



綜合試驗有限公司 SOILS & MATERIALS ENGINEERING CO., LTD.

香港新界葵涌永基路22-24號好爸爸創科大廈
Good Ba Ba Hitech Building, Nos. 22-24 Wing Kei Road, Kwai Chung, New Territories, Hong Kong
Tel: (852) 2873 6860 Fax: (852) 2555 7533 E-mail: smec@cigismec.com Website: www.cigismec.com



Test Report

On Compressive Strength of Concrete Cubes

Test Method CS1: 2010 Section 12

Test Report No.: 25CU012575 72

Page: 1 of 1

Date of Issue:

Sample Details as Supplied by Customer:

Customer : CEDD/NDO (Through PWL Contract No. GE/2025/04) PWL Reference No.: CMCUB2503336000-001
Contract No. : ND/2019/05 Your ref. No.: C5-6375
Address : -
Project / Site: Fanling North New Development Area, Phase 1: Fanling Bypass Eastern Section (Shung Him Tong to Kau Lung Hang)
Location in Works of : Type 1- 1080 to 1083, Type 5 - 098, Type 1A- L-2280<C4L><MJ>-01
Concrete Batch Sampled : -

Supplier : - Supply Plant : -
Source of Coarse Agg. : - Source of Fine Agg. : -
Cement Brand : - Admixture Brand : -
Concrete Mix I.D. No. : S1040D020 Dosage (l/m³) : -
Concrete Grade : 40 Designed / Measured Slump (mm): 100 / 110,115
Cement Content (kg/m³) : - W/C Ratio: - A/C Ratio: -
PFA/GGBS Content (kg/m³) : - PFA/GGBS Source : -
Date of Sampling / Casting : 18/01/2025 Time of Adding Water to Mix : 08:10
Time of Sampling : 08:20
Source of Sampling : - Place / Time of Making Cube : - / -
Method of Compaction : - Name of Person Making Cubes : Benny Wong
Site Curing Method : - Max. / Min. Curing Temperature at site (°C): -
No. of Cubes for the Same Sample : 2 Nominal Size (mm) : 100 Test at Age of (Days) : 28

Certificate of Sampling, Slump Test, Cube Making and Curing :

Certificate of Sampling, slump test, cube making and curing [] is available and a copy is attached [] is available but not attached [V] is not available

Laboratory Information and Test Results:

Date Received : 25/01/2025 Date / Time Tested : 15/02/2025 / 09:59,10:03 Cube Age at Test (Days) : 28
Curing Method : Water curing tank Max / Min. Curing Temp. (°C): 30/24 Testing Machine ID. : CO0382
Test Location : 1/F of Good Ba Ba Hitech Building Loading Rate : 0.4 MPa/s to 0.8 MPa/s.

RFID Tag No. / Security label no.	CA4798583	CA4798584	-	-	-	-
Identification no.	Cube mark	A	B	-	-	-
of cube	Lab Ref. No.	1	2	-	-	-
Mould no.	-	-	-	-	-	-
Condition on received*	W N	W N	-	-	-	-
Edges/corners damaged**	N	N	-	-	-	-
Dimension	W1 - width1	100.1	100.1	-	-	-
	W2 - height	100.1	99.7	-	-	-
	W3 - width2	100.2	100.2	-	-	-
Mass	as received	2.399	2.388	-	-	-
	saturated in air	2.403	2.391	-	-	-
	in water	-	-	-	-	-
Density***	by calculation	2390	2390	-	-	-
	by water-disp.	-	-	-	-	-
Maximum load at failure	kN	900.4	884.9	-	-	-
Compressive strength****	MPa	89.9	88.7	-	-	-
Type of fracture*****	S1	S1	-	-	-	-

Note: *

N - Normal, H - Honey Combing, P - Poor Compaction, I - Irregular Shape, O - Oversize

U - Undersize, D - Surface Dry, W - Surface Wet, M - Immersed in Water

** Y - for cubes having broken edges/corners with a dimension of 20mm or more in any direction

N - for cubes without broken edges/corners or having broken edges with a dimension less than 20mm in any direction

*** Determination of density is in accordance with CS1: 2010 Section 16


**** Compressive strength is based on measured loaded cross-sectional area (W1 x W2).

***** S-Satisfactory failure, U-Unsatisfactory failure (Please specify Pattern Number by referring Figure 13 in Section 12 of CS1:2010.

If the failure pattern cannot be found in Figure 13, the laboratory is required to record the unusual fracture.)

All test results relate only to the sample(s) tested.

Remark: -

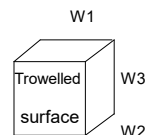

Checked by:

Approved signatory: