



香港試驗有限公司 HONG KONG TESTING CO., LTD.

Rm. G01 & G04, G/F., & Rm. 205, 2/F., Fuk Shing Comm. Bldg., 28 On Lok Mun St., On Lok Tsuen, Fanling, N.T. Hong Kong.
香港新界粉嶺安樂村安樂門街28號福成商業大廈地下G01 & G04室及二樓205室
Website : www.hktesting.com.hk Email : info@hktesting.com.hk Tel : (852) 2692 2171 Fax : (852) 2691 4874



Test Report

on Compressive Strength of Concrete Cubes

Test Method : CS1 : 2010 Section 12

Test Report No. : GE2406A006849

Page : 1 of 1

Date of Issue : 31 December 2024



Sample Details as Supplied by Customer :

Customer : North Development Office, CEDD (through PWL Cont. No. GE/2024/06)

Address : N/A

Contract No. : ND/2019/05

W.O. No. / Job No. : ND/2019/05

PWL Ref. No. : CMCUB24A0442000-001

Project / Site : Fanling North New Development Area, Phase 1: Fanling Bypass Eastern Section (Shung Him Tong to Kau Lung Hang)

Location in Works of : parapet skin type1-898 to 900,type1-SP1-1500<C3R>-01

Concrete Batch Sampled

Supplier : N/A

Source of Coarse Agg. : N/A

Cement Brand : N/A

Concrete Mix I.D. No : S1040D020

Concrete Grade : 40 (40/20D)

Cement Content : N/A

PFA/GGBS Content : N/A

Supply Plant : N/A

Source of Fine Agg. : N/A

Admixture Brand : N/A

Dosage : N/A

Designed / Measured Slump (mm) : 100 / 105, 100

W/C Ratio : N/A A/C Ratio : N/A

PFA/GGBS Source : N/A

Date of Sampling / Casting : 29 November 2024

Time of Sampling : 08:00

Source of Sampling : N/A

Method of Compaction : N/A

Site Curing Method : N/A

No. of Cubes for the Same Sample : N/A

Time of Adding Water to Mix : 07:53

Place / Time of Making Cube : N/A

Name of Person Making Cubes : N/A

Max. Min. Curing Temperature at Site : N/A

Nominal Size (mm) : 100

Test at Age of Customer : 28 Days

Certificate of Sampling, Slump Test, Cube Making and Curing :

Certificate of sampling, slump test, cube making and curing Is Not available

Laboratory Information and Test Results :

Date Received : 14 December 2024 Date / Time Tested : 27 December 2024 / 17:20, 17:25

Curing Method : Water curing tank Max. / Min. Curing Temp. : 30.0 / 24.0 °C

Test Location : Rm. G04, G/F., Fuk Shing Comm. Bldg., 28 On Lok Mun St., On Lok Tsuen, Fanling, N.T. Hong Kong.

Cube Age at Test : 28 Days

Testing Machine ID. : CON-COM-15

Loading rate : 0.4 - 0.8 MPa/s

Security label No.		CA4750846	CA4750847	-	-	-	-
Identification no. of cube	Cube mark	A	B	-	-	-	-
	Lab Ref. No.	2406D0033E141224054	2406D0033E141224055	-	-	-	-
Mould no.		N/A	N/A	-	-	-	-
Condition on received *		N.I.	N.I.	-	-	-	-
Edges/corners damaged **		N	N	-	-	-	-
Dimensions	W1 - width 1	mm	100.0	100.0	-	-	-
	W2 - height		100.5	100.0	-	-	-
	W3 - width 2		100.0	100.0	-	-	-
Mass	as received	kg	2.405	2.409	-	-	-
	saturated in air		2.408	2.412	-	-	-
	in water		-	-	-	-	-
Density ***	by calculation	kg/m ³	2400	2410	-	-	-
	by water-displacement		-	-	-	-	-
Maximum load at failure		kN	859.5	853.7	-	-	-
Compressive strength ****		MPa	85.5	85.4	-	-	-
Type of fracture *****			1	1	-	-	-

Note : * N - Normal, H - Honeycombing, P - Poor Compaction, I - Irregular Shape, O - Oversize, U - Undersize, D - Surface Dry, W - Surface Wet, M - Immersed in Water

** Y - for cubes having broken edges/corners with a dimension of 20mm or more in any direction

N - for cubes without broken edges/corners or having broken edges with a dimension less than 20mm in any direction

*** Determination of density is in accordance with CS1: 2010 Section 16.


**** Compressive strength is based on measured loaded cross-sectional area (W1 x W2).

***** S - Satisfactory failure, U - Unsatisfactory failure (Please specify Pattern Number by referring Figure 13 in Section 12 of CS1:2010.

If the failure pattern cannot be found in Figure 13, the laboratory is required to record the unusual fracture.)

All test results relate only to the sample(s) tested.

Remark : 1. N/A - no information provided by customer.
2. Customer Test Request Ref. No.: C5-6093

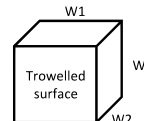

Checked By :

C.L. Fu

Independent Checker

Approved Signatory :

Digitally signed by TSUI
Pui Yuen
Date: 2024.12.31
17:26:55 +08:00

TSUI Pui-yuen
Asst. Lab. Manager

CON-PHY-HOK-0202/R1 - 24/01 - 27 September 2024

- END OF REPORT -

HKAS has accredited this laboratory (Reg. No. HOKLAS 012) under HOKLAS for specific laboratory/calibration activities as listed in the HOKLAS directory of accredited laboratories. The results for calibration report (or certificate, where appropriate) are traceable to the International System of Units (S.I.) or recognized measurement standards. The Copyright of this report is owned by the Hong Kong Testing Co., Ltd. It shall not be reproduced except in full and with prior written approval from Hong Kong Testing Co., Ltd.