

Infrastructure Committee Agenda

Date: Thursday, 18 September, 2025

Time: 11:30 am

Location: Civic Centre, Te Iwitahi, 9 Rust Avenue

Elected Members: Cr Simon Reid (Chairperson)
Cr Phil Halse (Deputy Chair Person)
His Worship the Mayor Vince Cocurullo
Cr Gavin Benney
Cr Nicholas Connop
Cr Ken Couper
Cr Jayne Golightly
Cr Deborah Harding
Cr Patrick Holmes
Cr Scott McKenzie
Cr Marie Olsen
Cr Carol Peters
Cr Phoenix Ruka
Cr Paul Yovich

For any queries regarding this meeting please contact
the Whangarei District Council on (09) 430-4200.

1. Declarations of Interest / Take Whaipānga	
2. Apologies / Kore Tae Mai	
3. Confirmation of Minutes of Previous Infrastructure Committee Meeting / Whakatau Meneti	
3.1 Minutes Infrastructure Committee meeting held 21 August 2025	6
4. Looking Forward	
4.1 Looking Forward - September 2025	10
5. Decision Reports / Whakatau Rīpoata	
5.1 Backflow Prevention Policy Review	15
6. Information Reports / Ngā Pūrongo Kōrero	
6.1 Contracts Approved Under Delegated Authority – July 2025	55
6.2 Transportation and Community Infrastructure Operations Report – September 2025.docx	66
6.3 Waters Operational Report - September 2025	137
7. Public Excluded Business / Rāhui Tangata	
7.1 Confidential Minutes Infrastructure Committee meeting held 21 August 2025	
8. Closure of Meeting / Te katinga o te Hui	

Recommendations contained in the agenda are not the decisions of the meeting.

Please refer to minutes for resolutions.

Infrastructure Committee – Terms of Reference

Membership

Chairperson Councillor Simon Reid

Deputy Chairperson Councillor Phil Halse

Members His Worship the Mayor Vince Cocurullo
 Councillors Gavin Benney, Nicholas Connop, Ken Couper, Jayne Golightly, Deborah Harding, Patrick Holmes, Marie Olsen, Scott McKenzie, Carol Peters Phoenix Ruka and Paul Yovich

Meetings Monthly

Quorum 7

Purpose

To oversee the management of council's infrastructural assets, utility services and public facilities.

Key responsibilities

- Oversight of services including:
 - Transportation
 - Three Waters
 - Wastewater
 - Stormwater
 - Flood Management
 - Drinking Water
 - Laboratory services
 - Solid waste, waste minimisation and recycling services
 - Parks and reserves
 - Cemetery
- Accountable for the development and implementation of the Infrastructure Strategy, Activity Management Plans (AMP's) and Development Contributions Policy.
- Operational accountability of performance including:
 - Health and Safety

- Regular reporting on service delivery
- Compliance
- Sustainability
- Finance

- Trends
- Benefits (positive outcomes achieved)
- Customer feedback
- Risk

- Accountability for the delivery of the Capital Programme.
 Committee will receive:
 - Capital Programme financial reporting over a three year horizon
 - Health and Safety reporting
 - Programme reporting
 - Procurement activities and strategies
 - Resourcing issues and requirements
 - Project Management Office gateway reviews and activities

- Procurement oversight - general procurement relating to the areas of business of this committee, within delegations.

- Shared Services – investigate opportunities for Shared Services for recommendation to council.

- Council Controlled Organisations (CCOs) – monitoring the financial and non-financial performance of CCOs whose functions would otherwise fall under the scope of this committee. Includes trading CCOs (CCTOs) and those CCOs exempted under the LGA. Responsibilities include:
 - advising on the content of annual Statement of Expectations to CCOs
 - agreement of the Statement of Intent
 - monitoring against the Statement of Intent
 - for exempted CCOs, monitoring and reporting as agreed between Council and the organisation
 - quarterly reporting on performance

CCOs accountable to this committee:

- Northland Regional Landfill Limited Partnership (NRLLP) – CCTO
- Whangarei Waste Limited (WWL) -exempted CCO

Delegations

- (i) All powers necessary to perform the committee's responsibilities, including, but not limited to:
 - a) the approval of expenditure of less than \$20 million plus GST.
 - b) approval of a submission to an external body.
 - c) establishment of working parties or steering groups.

- d) adoption of strategies and policies relating to the key responsibilities of this committee (except for those that cannot be delegated by Council under Clause 32(1)(f) of Schedule 7 of the LGA).
- e) the power to adopt the Special Consultative Procedure provided for in Section 83 to 88 of the LGA in respect of matters under its jurisdiction (this allows for setting of fees and bylaw making processes up to but not including adoption).
- f) the power to delegate any of its powers to any joint committee established for any relevant purpose under clause 32, Schedule 7 of the Local Government Act 2002.

The Committee does not have:

- i. The power to establish sub-committees.
- ii. The powers Council is expressly prohibited from delegating as outlined in Clause 32(1)(a)-(h) of Schedule 7 of the Local Government Act 2002; being:
 - the power to make a rate
 - the power to make a bylaw
 - the power to borrow money, or purchase or dispose of assets, other than in accordance with the long-term plan
 - the power to adopt a long-term plan, annual plan or annual report
 - the power to appoint a chief executive the power to adopt policies required to be adopted and consulted on under the Local Government 2002 in association with the long-term plan or developed for the purpose of the local governance statement
 - the power to adopt a remuneration and employment policy.

Infrastructure Committee Meeting Minutes

Date: Thursday, 21 August, 2025
Time: 11:30 a.m.
Location: Civic Centre, Te Iwitihi, 9 Rust Avenue

In Attendance	Cr Simon Reid (Chairperson) Cr Phil Halse (Deputy Chair Person) His Worship the Mayor Vince Cocurullo Cr Gavin Benney Cr Nicholas Connop Cr Ken Couper Cr Jayne Golightly Cr Patrick Holmes Cr Scott McKenzie Cr Marie Olsen Cr Carol Peters Cr Phoenix Ruka Cr Paul Yovich
----------------------	---

Not in Attendance	Cr Deborah Harding
--------------------------	--------------------

Scribe	V Kloet (Democracy Adviser)
---------------	-----------------------------

1. **Declarations of Interest / Take Whaipānga**

No interests were declared.

2. **Apologies / Kore Tae Mai**

Cr Deborah Harding.

Moved By Cr Marie Olsen

Seconded By Cr Scott McKenzie

That the apologies be sustained.

Carried

3. Confirmation of Minutes of Previous Infrastructure Committee Meeting / Whakatau Meneti

3.1 Minutes Infrastructure Committee meeting held 17 July 2025

Moved By Cr Carol Peters

Seconded By His Worship the Mayor

That the minutes of the Infrastructure Committee meeting held Thursday 17 July 2025, having been circulated, be taken as read and now confirmed and adopted as a true and correct record of proceedings of that meeting.

Carried

Secretarial Note: His Worship the Mayor was recorded as absent on Council Business for the Infrastructure Committee meeting held Thursday 17 July 2025.

4. Looking Forward

4.1 Looking Forward - August 2025

Moved By Cr Nicholas Connop

Seconded By Cr Simon Reid

That the Infrastructure Committee notes the Infrastructure Looking Forward Paper for August 2025.

Carried

Cr Nicholas Connop left the meeting at 11:45am during the discussion on 4.1

5. Decision Reports / Whakatau Rīpoata

5.1 Whangarei Urban Flooding Strategy Project Budget

Moved By Cr Simon Reid

Seconded By Cr Marie Olsen

That the Council:

1. Approves operational overspend of up to \$450,000 in the current financial year against the Coastal Systems and Flood Management Activity to complete the Whangārei Urban Flood Strategy technical phase, such overspend to be offset by a budget reduction of up to \$450,000 in year 3.

Carried**6. Information Reports / Ngā Pūrongo Kōrero****6.1 Contracts Approved Under Delegated Authority – June 2025****Moved By** Cr Carol Peters**Seconded By** Cr Marie Olsen

That the Infrastructure Committee note the Infrastructure contracts awarded under Chief Executive and General Manager delegated authority.

Carried**6.2 Transportation and Community Infrastructure Operations Report – August 2025.docx****Moved By** His Worship the Mayor**Seconded By** Cr Phil Halse

That the Infrastructure Committee notes the August 2025 Operational Report for:

- Transportation
- Community Infrastructure

Carried**6.3 Waters Operations Report – August 2025****Moved By** His Worship the Mayor**Seconded By** Cr Carol Peters

That the Infrastructure Committee notes the August 2025 Operational Report for:

- Waters

Carried**7. Public Excluded Business / Rāhui Tangata****Moved By** Cr Ken Couper**Seconded By** Cr Carol Peters

General subject of each matter to be considered	Reason for passing this resolution in relation to each matter	Ground(s) under Section 48(1) for passing this resolution

1.1 Litter Control and CBD Custodial Duties – Contract Extension	Good reason to withhold information exists under Section 7 Local Government Official Information and Meetings Act 1987	Section 48(1)(a)
--	--	------------------

This resolution is made in reliance on Section 48(1)(a) of the Local Government Official Information and Meetings Act 1987 and the particular interest or interests protected by Section 6 or Section 7 of that Act which would be prejudiced by the holding of the whole or the relevant part of the proceedings of the meeting in public, are as follows:

Item	Grounds	Section
1.1	To enable Council to carry on without prejudice or disadvantage commercial activities.	S7(2)(h)
	To enable Council to carry on without prejudice or disadvantage negotiations (including commercial and industrial negotiations).	S7(2)(i)

Carried

8. Closure of Meeting / Te katinga o te Hui

The meeting concluded at 12:16pm.

Confirmed this 18th day of September 2025

Councillor Simon Reid (Chairperson)

4.1 Looking Forward – September 2025

Meeting:	Infrastructure Committee
Date of meeting:	18 September 2025
Reporting officer:	Jim Sephton (General Manager – Transport and Community Infrastructure) Andrew Carvell (General Manager – Waters)

1 Purpose / Te Kaupapa

To provide Elected Members with visibility of upcoming approvals, events and gateways in Infrastructure. This includes approvals that will be completed under delegation.

2 Recommendation / Whakataunga

That the Infrastructure Committee notes the Infrastructure Looking Forward Paper for September 2025.

3 Council Papers

The following papers are being prepared

Briefings	Ruakaka Cemetery Update Glenbervie School Safety response – we are still awaiting MoE agreement Ruakaka Wastewater update
Council	Elected Member Capex Budget – Consideration of proposals Parua Bay Skatepark – approval of external funding
Information	Te Maika / Ngunguru Intersection Improvements

4 Business Case / Strategy

Business Cases are being completed which will provide clearer scope for the Long Term considerations. A key part of the Business Case (or Analyse Stage) is ensuring that we understand the scope, risks, capital and whole of life costs of the investment.

The following projects are at Analyse Stage

- Pohe Island Spine Path
- Whangarei Falls Viewing Platform
- Marine Hub
- New Ruakaka Cemetery

- Oakura Wetland and Sportspark
- Urban Flood Strategy
- Northern Growth Area Stormwater Attenuation
- Ruakaka Wastewater Upgrades

5 Engagement / Events

A report for the City Centre Parking Management Plan is being developed and this will be brought to the incoming Council as part of a Resolution to Adopt the City Centre Parking Plan.

Communications introducing the Urban Flood Strategy project to commence.

6 Procurement

The Procurement Pipeline is included at Appendix A.

There continues to be a significant increase in the volume of work that is getting out to the market. In transportation alone we are putting out over forty contracts before the end of the year.

Procurement and contract awards are underway for

- Quarry Gardens Lower Slip Wall and Stream Works
- Hikurangi Footpath Renewal
- Kopipi Cres Footpath
- New footpath and water station (Kiripaka Road)
- Seal extensions (Gray and Ormandy Roads)
- Springs Flat Roundabout
- Pavement rehabilitation works
- Onerahi watermain renewal

Field lighting at Onerahi and Otangarei has been awarded as a Design and Build Package of work. This is to achieve greater efficiencies in deliveries as we enable Contractors to manage risk that they are better placed to manage.

7 Delivery

Renewals across all our assets are underway. It's been good to see the influence of our Network Team in moving to the risk based approach to Traffic Management. Our contractors are getting more work done in a shorter time by closing streets and working longer hours.

We're looking forward to the first 44 additional on street car parks being in place by the end of September.

8 Significance and engagement / Te Hira me te Arawhiti

The decisions or matters of this Agenda do not trigger the significance criteria outlined in Council's Significance and Engagement Policy, and the public will be informed via Agenda publication on the website.

9 Attachments / Ngā Tāpiritanga

Attachment A – Procurement Pipeline



Project	Delivery Team	Physical Works Procurement Timing (estimated)	Budget	Description of Physical Works for Tender	Tender Status	Tender approach	Update
Parua Bay Skatepark	Community Infrastructure	Mar-25	\$100k-\$500k	New skatepark	Awarded	Closed tender	
Morningside Sportspark Drainage & Irrigation	Community Infrastructure	Jun-25	\$100k-\$500k	New Drainage & Irrigation	Awarded	Open tender on tenderlink	
Onerahi Domain Sportspark Field Lighting	Community Infrastructure	Aug-25	\$100k-\$500k	Rugby Field lighting	In progress	Open tender on tenderlink	Tender closed
Otangarei Fishbone Sportspark Field Lighting	Community Infrastructure	Aug-25	\$100k-\$500k	Rugby Field lighting	In progress	Open tender on tenderlink	Tender closed
Quarry Gardens Lower Slip Wall and Stream Works	Community Infrastructure	Sep-25	\$100k-\$500k	Construct precast concrete wall, stormwater culverts and rock revetment within the stream.	Tender	Open tender on tenderlink	The consents have been granted
Oakura Sports Fields and Wetlands Enhancement	Community Infrastructure	Nov-25	>\$1m	Earthworks, Playground, Hardcourts, lighting, drainage, Sportsfields and wetland enhancement.	Design	Open tender on tenderlink	Design & Consenting stage
Tikipunga Sport Field Upgrade (artificial turf)	Community Infrastructure	Nov-25	>\$1m	Artificail turf, lighting, drainage, earthworks, footpath, and fencing.	Design	Open tender on tenderlink	Current stage: Detailed Design and Consenting
Whangarei Falls viewing platforms upgrade	Community Infrastructure	Nov-25	\$100k-\$500k	Whangarei Falls viewing platforms upgrade	Investigation	Open tender on tenderlink	
Maunu Cemetery Extension	Community Infrastructure	Jan-26	\$100k-\$500k	Earthworks, forming roads, and relocating overhead powerlines.	Design	Open tender on tenderlink	
Northland Events Centre Roof Replacement	Community Infrastructure	Jan-26	>\$5m	Replacement of canvas roof on stadium to create permanent structure	Design	Open tender on tenderlink	Detailed Design
Lower Waiarohia Loop - Stage 1 Herekino Street	Community Infrastructure	Jul-27	\$1-5m	Waterfront shared path to connect the Hatea Loop and the City Centre	Design	Open tender on tenderlink	Detailed Design
Waterfront to City Centre Connection - John St	Community Infrastructure	Jul-27	>\$20m	Scope of the project is being reviewed by Council City Centre Committee.	Design	Open tender on tenderlink	Concept Design issued May 2025.
Pohe Island Spine Path	Community Infrastructure	TBA	\$100k-\$500k	New shared path between the bike park and the Pohe Island Carpark	Design	Open tender on tenderlink	Delayed due to remediation earthworks that will be done first.
Parihaka Transmission Mast Stabilisation Works	Community Infrastructure	TBA	\$500k-\$1m	Anchors and stays to stabilise mast, in a sensitive cultural, archaeological, and bush environment. Road access closed/restricted due to slips.	Design	Open tender on tenderlink	Tender date uncertain due to the road access uncertainty.
Albany Road Seawall	Community Infrastructure	TBA	\$100k-\$500k	Seawall renewal	Design	Open tender on tenderlink	
Hikurangi King Street Footpath	Transport	Aug-25	\$100k-\$500k	Replacement of chipseal footpath with concrete	In progress	Open tender on GETS	Procurement Plan to be approved.
Kopipi Cres footpath	Transport	Aug-25	\$750k	New footpaths	In progress	Open tender on GETS	Tender completed. Evaluation underway
New footpath and water station refill (Kiripaka Rd)	Transport	Aug-25	\$500 - \$1m		In progress	Open tender on GETS	Tender completed. Evaluation underway
Seal Extension	Transport	Aug-25	\$1 - \$1.5	Seal extensions - Gray and Ormandy Roads	In progress	Open tender on GETS	Out to Tender
Springs Flat Roundabout	Transport	Aug-25	\$7-9m	New roundabout construction on SH1	In progress	Open tender on GETS	Out to Tender
Bridge renewals works	Transport	Sep-25	\$5m	Several contracts covering bridge and structure component replacement works	Design	Open tender on GETS	Delayed. Likely to be Oct when works come to market
Kamo Village signal crossing	Transport	Sep-26	\$100k-\$500k	signalised crossing	Investigation	Open tender on GETS	Design only year 2
Kotata Rise safety improvement	Transport	Sep-25	\$100k-\$500k	Guard rails	Design	Open tender on GETS	
Parua Bay village safety improvements	Transport	Sep-25	\$500k-\$1m	Footpath and crossing improvements	Procurement	Open tender on GETS	
Pavement Rehabilitation works	Transport	Aug-25	\$6m	Works will be split into three contracts comprising of 2 to 3 sites	In progress	Open tender on GETS	Out to Tender
Scour protection - two year contract	Transport	Sep-25	\$1m	scour protection works	Design	Open tender on GETS	
Whangarei Heads guard rail	Transport	Sep-25	\$100k-\$500k	Guard rails	Design	Open tender on GETS	
General Bridge repairs y2 & y3	Transport	Oct-25	\$1m	minor structure repairs through the region on various bridges	Design	Open tender on GETS	
Resilience and emergency works repairs	Transport	Oct-25	\$5.5m	Various slip / resilience repairs	Panel	Through resilience panel	

Project	Delivery Team	Physical Works Procurement Timing (estimated)	Budget	Description of Physical Works for Tender	Tender Status	Tender approach	Update
Loop Road watermain renewal	Waters	Mar-25	\$100k-\$500k	Installation of new watermain	Awarded	Open tender on tenderlink	
Mair to Rurumoki Street Stormwater Upgrades	Waters	Mar-25	>\$1m	270m new concrete stormwater line from Mair St, through Hatea Dr to Rurumoki St. Watermain renewal on Rurumoki Street	Awarded	Open tender on tenderlink	
Miraka Road watermain renewal	Waters	Jul-25	\$100k-\$500k	Installation of new watermain	Awarded	Open tender on tenderlink	
Onerahi watermain renewal (Weir Cres)	Waters	Jul-25	\$500k-\$1m	Installation of new watermain	Closed	Open tender on tenderlink	Tender closed, recommendation for award in progress.
Whangarei WWTP Administration Building	Waters	Sep-25	\$2.5-\$3m	New administration building at Kioreroa Rd wastewater treatment plant.	Design	Open tender on tenderlink	Plan to go out to tender on a 3916 design and build contract, Concept design, & background Information being Investigated.
Pyle Rd East watermain upgrade	Waters	Oct-25	>\$1m	Installation of new watermain	Design	Open tender on tenderlink	
Station Rd trunkmain	Waters	Nov-25	>\$1m	Installation of trunkmain	Design	Open tender on tenderlink	
Decommission Gomez dam	Waters	Jan-26	\$100k-\$500k	Earthworks, demolition and reinstatement to decomission an earthen dam	Design	TBC	Design phase. Project requires Council approval prior to tender.
Whangarei WWTP Motor Control Room	Waters	Feb-26	\$500k-\$1m	New MCC room, building with significant electronic and electrical components. Associated with the new administration building at Kioreroa Rd wastewater treatment plant .	Design	TBC	Concept design and background information being Investigated. Procurement method TBC.
Demolition of existing Whangarei WWTP Administration Building (including asbestos disposal)	Waters	2026	\$100k-\$500k	Demolition of the existing administration building at Kioreroa Rd wastewater treatment plant, including asbestos removal.	Design	TBC	Budget approval required
Fairway Dr old WTP demo, new reservoir, Pump Station upgrade	Waters	2026	>\$5m	Demolition of old water treatment plant, construction of new reservoir, major upgrade of Fairway Drive pump station	Analysis	TBC	Early investigation stage, works not yet confirmed
Onerahi Trunkmain Renewal (Riverside Drive)	Waters	2026	>\$1m	Installation of trunkmain	Analysis	TBC	Early investigation stage
Ruakaka Wastewater Treatment Plant discharge fields	Waters	2026	\$100k-\$500k	Treated wastewater disposal fields.	Analysis	TBC	Early investigation stage
New Ruakaka Wastewater Treatment Plant	Waters	2027	>\$10m	New wastewater treatment plant.	Analysis	TBC	Early investigation stage
Poroti Water Treatment Plant Upgrade	Waters	TBC	>\$10m	Uncertain timing. Upgrade of Poroti WTP (value in the order of \$20 million plus pending design confirmation)	Consent	Open tender on tenderlink	Conditional on RC Approval, timing unsure, project not yet confirmed.

5.1 Backflow Prevention Policy Review

Meeting: Infrastructure Committee
Date of meeting: 18 September 2025
Reporting officer: Andrew Venmore (Water Services Manager)

1 Purpose / Te Kaupapa

To approve the review of the Backflow Prevention Policy – Policy 0020

2 Recommendation/s / Whakataunga

That the Infrastructure Committee:

1. Approves the attached Backflow Prevention Policy – Policy 0020.

3 Background / Horopaki

The backflow prevention policy, policy 0020, is due for review. The latest version of the policy was first adopted in 2015. Staff have undertaken a review of the policy and have suggested a few changes for clarification although the intent remains the same.

Backflow legislation in New Zealand dates back to the Water Supplies Protection regulation 1961 and Council have had backflow preventers, protecting our water supplies, since that time. The current primary legislation covering backflow prevention is the Water Services Act 2021. The relevant clause in the act is as follows.

27 Duty to protect against risk of backflow

(1) If a drinking water supply includes reticulation, the drinking water supplier must ensure that the supply arrangements protect against the risk of backflow.

(2) If there is a risk of backflow in a reticulated drinking water supply, the drinking water supplier may—

(a) install a backflow prevention device and require the owner of the premises to reimburse the supplier for the cost of installation, maintenance, and ongoing testing of the device; or

(b) require the owner of the premises to install, maintain, and test a backflow prevention device that incorporates a verifiable monitoring system in accordance with any requirements imposed by the supplier.

(3) A person who installs a backflow protection device must take all reasonable steps to ensure it operates in a way that does not compromise the operation of any fire extinguisher system connected to the drinking water supply.

In addition, the Drinking Water Quality Assurance Rules 2022 have a whole section on backflow prevention. The rules are as follows.

- D3.1 Drinking water suppliers must prepare and implement a backflow prevention programme to protect their distribution system against the risk of backflow
- D3.2 Periodic surveys of backflow risks to a distribution system to determine medium and high-risk sites must be undertaken by the drinking water supplier at least once every five years to assess the adequacy of backflow protection across the distribution system
- D3.3 Where backflow requirements at a point of supply are deemed inadequate, the drinking water supplier must notify the local authority with details of the situation and risk, determine the backflow device that should be installed at the point of supply and ensure that it is installed in a timeframe commensurate with the risk but as soon as reasonably practicable.
- D3.4 Testing of all testable backflow prevention devices installed at a point of supply specifically to protect the network (generally boundary devices) must be undertaken, at least annually.
- D3.5 A drinking water supplier must maintain a register of the location of all point of supply testable backflow protection devices, device types, assessed risk level and the results of testing of all devices.
- D3.6 Access to a water network through use of a standpipe is not permitted except by Fire and Emergency New Zealand, other emergency services, the drinking water supplier, or authorised contractors to the drinking water supplier where it is reasonably necessary to access the network for the operation of the drinking water supply.

The policy outlines how we will meet our legal requirements.

4 Discussion / Whakawhiti kōrero

Backflow prevention is one of the critical barriers required to protect the community drinking water supply. The policy clarifies how Council will implement the requirements of the legislation and the Water Supply Bylaw. Since the policy was last reviewed the legislation relating to backflow prevention has been updated as mentioned above. However, the policy does not require significant changes. The reviewed Backflow Prevention policy is at attachment A.

The policy has been moved into the new Council policy template. This template does not allow for code of practice or guideline documents. Consequently, the code of practice for backflow prevention has now been separated from the policy document. The code of practice is a guideline document that provides more details about the type of risks and the various backflow devices. The code of practice will also be reviewed and updated to reflect the new legislation. It will then be issued separately as a guideline document available to staff and customers. A copy of the old policy and code of practice document is at attachment B. A document showing the changes between the old and new policies, and reason for them, is at attachment C.

4.1 Financial/budget considerations

This policy is currently in place and the costs and income associated with it are balanced through the LTP and annual plan processes.

4.2 Policy and planning implications

The policy is being reviewed as it has been nearly five years since the last review and to ensure compliance with the new legislation.

4.3 Options

The policy covers how Council will comply with the legislative requirements of the Water Services Act 2021 and the Drinking Water Quality Assurance Rules 2022. It would be possible to just rely on the legislation and not have a policy. However, the policy provides clarity for both staff and customers as to how the legislation will be implemented. It is recommended the review policy be approved.

5 Significance and engagement / Te Hira me te Arawhiti

The decisions or matters of this Agenda do not trigger the significance criteria outlined in Council's Significance and Engagement Policy, and the public will be informed via agenda publication on the website.

6 Attachments / Ngā Tāpiritanga

- A – New Backflow Prevention Policy
- B – Old Backflow Policy and Code of Practice.
- C – Comparison between 2021 and 2025 policies

Whangarei District Council

Backflow Prevention Policy

***Policy
0020***

<i>Backflow Prevention Policy</i>			
Audience (Primary)	External	Business Owner (Dept)	Water Services
Policy Author	Marie-Katrin Richter	Review Date	August 2030

Backflow Prevention Policy			
Audience (Primary)	External	Business Owner (Dept)	Water Services
Policy Author	Marie-Katrin Richter	Review Date	August 2030

Table of contents

Contents

Table of contents	3
Legislative Requirement	4
Purpose.....	4
Policy.....	4
Procedures, Processes, Standards & Guidelines	5
Definitions	5
Relevant Legislation.....	5
Related Policies and Documents.....	5
Adopted	6
Policy Review	6

Backflow Prevention Policy			
Audience (Primary)	External	Business Owner (Dept)	Water Services
Policy Author	Marie-Katrin Richter	Review Date	August 2030

Legislative Requirement

This policy has been updated to comply with the requirement of the **Water Services Act 2021** clause 27 *duty to protect against risk of backflow*. This policy supports compliance with **Taumata Arowai's Drinking Water Quality Assurance Rules** and the **Council's Water Supply Bylaw**, ensuring that Whangarei District Council meets its duty to deliver safe and reliable drinking water.

Purpose

To minimise the risk of the drinking water network becoming contaminated, Whangarei District Council requires that all water connections include an appropriate level of backflow prevention.

This policy supports the delivery of safe and reliable drinking water to all consumers and contributes to Council's broader multi-barrier approach to water quality management.

Policy

Council will achieve its objective of protecting the drinking water supply by applying the following principles:

- All new water connections must include an appropriate boundary backflow prevention device, preferably installed at the point of supply.
- The type of backflow prevention device required will be determined by the potential risk to the public water supply *in the event of backflow*, based on the likelihood that a cross-connection could exist or be unintentionally created through on-site activities or installations.
- As a general guideline, boundary backflow prevention devices will align with the following water use categories:
 - Ordinary use (typically domestic) requires a non-testable dual check valve.
 - Extraordinary use (typically commercial or industrial) requires a testable backflow prevention device.
- Point of supply (boundary) devices are vested in Council and will be tested, maintained and replaced by Council as required. Customers may apply to Water Services to assume ownership by written agreement, provided an appropriate testing and maintenance regime is in place and approved.
- All testable boundary backflow prevention devices are inspected and tested at least annually by a suitably trained and qualified person. If a device is found to be faulty or non-compliant, it will be repaired or replaced immediately to maintain protection.
- Council will recover the cost of testing, maintaining and replacing of vested boundary devices through a targeted rate, included in the Annual and Long-Term Plans.
- Existing *ordinary-use* connections without backflow prevention will be upgraded with dual check valves when meters are replaced.
- Existing *extraordinary-use* connections that do not have appropriate backflow prevention will require an appropriate backflow prevention device to be installed.
- Where a change in use has increased the required level of backflow protection, the device will be upgraded.
- Periodic surveying of existing connections will be undertaken to identify changes in property use that may increase the risk posed to the public water supply in the event of backflow. Where necessary, backflow prevention devices will be upgraded accordingly.

Backflow Prevention Policy			
Audience (Primary)	External	Business Owner (Dept)	Water Services
Policy Author	Marie-Katrin Richter	Review Date	August 2030

- The cost of installing or upgrading boundary protection devices for extraordinary use will be met by the property owner.
- Where appropriate, enforcement action will be undertaken in accordance with the Council's Water Supply Bylaw.

Procedures, Processes, Standards & Guidelines

- Backflow Prevention Code of Practice
- Council Water Supply Bylaw
- Council Environmental Engineering Standards
- New Zealand Industry Standard: Field Testing of Backflow Prevention Devices and Verification of Air Gaps
- Taumata Arowai Drinking Water Quality Assurance Rules

Definitions

For the purposes of this policy, definitions are as set out in the following documents:

- Whangarei District Council Water Supply Bylaw, and
- Backflow Prevention Code of Practice.

Relevant Legislation

- Water Services Act 2021
- Drinking Water Quality Assurance Rules 2022
- Building Act 2004
- Health Act 1956
- Local Government Act 2002
- Whangarei District Council Water Supply Bylaw

Related Policies and Documents

- Water Quality Policy
- Fees and Charges Schedule (Annual and Long Term Plans)
- Backflow Prevention Code of Practice

Backflow Prevention Policy			
Audience (Primary)	External	Business Owner (Dept)	Water Services
Policy Author	Marie-Katrin Richter	Review Date	August 2030

Adopted

Date of Initial meeting: 10.06.2015

By: Infrastructure Committee

Policy Review

Document History			
Date	Author	Reviewed by	Status
2012	Diana Stavely	Andrew Venmore	Superseded
June 2015	Simon Charles	Andrew Venmore	Superseded
June 2020	Judith Ellensohn	Andrew Venmore	Adopted
June 2025	Marie-Katrin Richter	Andrew Venmore	Draft

This Policy was reviewed in 2025 and this revised Policy was updated as follows:

Date of meeting: DD-MM-YYYY

By: Infrastructure Committee

Policy Review

This policy is due for review in August 2030

Whangarei District Council

Backflow Prevention Policy and Code of Practice Policy 0020

Backflow Prevention Policy and Code of Practice			
Group	Infrastructure	Business owner	Water
Date adopted	25 February 2021	Adopted by	Council
Review Cycle	5 years (statutory)	Next Review date	June 2025

Document History			
Date	Author	Reviewed By	Status
2012	Diana Stavely	Andrew Venmore	Superseded
June 2015	Simon Charles	Andrew Venmore	Superseded
June 2020	Judith Ellensohn	Andrew Venmore	Adopted

Table of Content

Policy Statement.....	5
Code of Practice	6
1. Introduction	6
1.1. Definitions.....	6
2. Legislation.....	6
2.1. The Building Act 2004.....	6
2.2. Health Act 1956.....	7
2.3. Health (Drinking Water) Amendment Act 2007.....	7
2.4. Council's Water Supply Bylaw.....	7
2.5. Health and Safety at Work Act 2015.....	7
2.6. Local Government Act 2002.....	7
2.7. Other Legislation.....	7
2.8. Relevant Standards and Guidelines	8
3. Council's General Requirements.....	8
3.1. Ownership of Boundary Backflow Devices.....	9
3.2. Roles and Responsibilities.....	9
3.2.1. Water Services Department	9
3.2.2. Building Compliance Department.....	9
3.2.3. Customer Responsibility.....	9
4. Types of Hazards	10
4.1. Levels of Risk	11
5. Disconnection of Water Supply	11
5.1. Backflow Incidents	11
6. Types of Backflow Preventers	12
6.1. Backflow Manufacture.....	12
7. Installation of Backflow Preventers	12
7.1. Installation requirements	12
7.2. Installation Considerations.....	13
8. Testing	13
8.1. IQP's Responsibilities	13
8.2. Qualifications.....	14
8.3. Registration	14
8.4. Re-Registration	14
8.5. Removal of IQP Status.....	14
8.6. Company IQP Status.....	14

8.7. Insurance.....	14
8.8. Hygiene Requirements.....	15
8.9. Test Procedures.....	15
8.9.1. Test Equipment.....	15
8.9.2. Test Tags (for Boundary Devices only)	15
8.9.3. Backflow Registration Numbers (for Boundary Devices only).....	15
8.9.4. Test Certificate.....	15
9. Surveying	16
10. Acknowledgements	16
Appendix A Specific Hazards: Examples of Facilities and Hazard Ratings	17
Appendix B Hazard Levels: New Zealand Building Code G12/AS1	22
Appendix C Backflow Prevention Devices	24
Appendix D Backflow Testing Procedure	26
Appendix E WDC Backflow Prevention Device Test Certificate Form	27
Appendix F Requirements for Backflow Surveys	29

Whangarei District Council Water Quality Policy requires Water Services to maintain a multi barrier approach to water quality. One of the key barriers to contamination is backflow prevention. This backflow prevention policy outlines Whangarei District Council's (Council) commitment to the protection of the potable water.

The Health (Drinking Water) Amendment Act 2019 guides water suppliers in respect to the development of a backflow prevention policy to protect the water supply. Council will achieve this aim through effective and efficient enforcement of the Water Supply Bylaw, the following Backflow Prevention Code of Practice and public education.

Policy Statement

To minimise the risk that the water supply once treated, becomes contaminated, Council requires that an appropriate level of backflow prevention is provided on all water connections. When implementing this requirement Council shall consider the following:

- All new connections require a type of backflow prevention at the point of supply between the customer and the water supplier
- The type of backflow prevention device being dependant on the risk to the water supply posed by the customer
- Generally domestic/ordinary use connections will have a non-testable dual check device and commercial/extraordinary use customers will require a testable backflow prevention device at the point of supply.
- Point of supply or boundary backflow prevention devices are vested to Council and will be maintained and replaced as required, with the option given to the customer to retain ownership.
- Testing of boundary backflow prevention devices will be done at least annually and after maintenance.
- A schedule of targeted rates for backflow prevention devices of different sizes will be included in the Annual and Long Term Plans. The appropriate charge will be added to the customer's water account.
- Existing extraordinary, use as defined by the bylaw (generally commercial and industrial connections), without adequate backflow prevention are to be upgraded at the customers cost. These will be prioritised according to potential risk and customers will be given the option to install the device or have Council install and pass on the cost.
- Existing ordinary use as defined by the bylaw (domestic) connections without backflow prevention will be upgraded when the meters are replaced.
- Periodic surveying of existing connections will be undertaken to determine any change of use requiring upgrading of backflow prevention.
- Enforcement where necessary will be as set out in the Water Supply Bylaw.

Code of Practice

1. Introduction

Backflow can happen unintentionally when pressures change resulting in a reversal in the flow of the water supply which can then cause contamination to flow back into the supply system as a result of back pressure or back siphonage. To prevent this from occurring Council requires a mechanical backflow prevention device on all connections at the point of supply.

This document seeks to provide a guideline to achieving the aims of the Water Supply Bylaw 2012 and Backflow Policy in practical sense that is clear for both Council staff and customers.

Both Water Services and Building Control staff manage backflow prevention, and this document is intended to bring together all Council requirements.

The enforcement and monitoring of backflow prevention is an essential Water Services activity for ensuring the protection of public health.

1.1. Definitions

Auxiliary Water Supply	means any water supply on or available to any premises other than a public water supply.
Backflow	is the undesirable flow of a liquid or a contaminant back into the potable public water supply. There are two types of backflow: Back pressure and back siphonage.
Backflow Prevention Device	means a device designed to prevent backflow due to back pressure or back siphonage. For the purposes of this code of practice this refers to devices installed at the property boundary or point of supply.
Back Pressure	occurs when the pressure in the downstream plumbing is higher than the supply pressure, thus 'pushing' the water or other substances back into the supply line.
Back Siphonage	occurs when a temporary drop in water pressure occurs and water is siphoned into the drinking water pipeline.
Containment	means the prevention of backflow into the public system by the installation of backflow prevention device on the property boundary
Cross Connection	means an actual or potential connection between the potable water supply and an auxiliary supply or pipe work containing a contaminant.
Customer	means owner or occupier of a property who is responsible for the water reticulation within that property.
IQP	Independent Qualified Person under the Building Act 2004. Suitably qualified to test backflow prevention devices, assess hazards and provide written documentation. Wherever this is referenced in the document it shall also be interpreted to mean IQP as per the Boundary Backflow Prevention for Drinking Water Supplies Code of Practice 2012.
LBP	Licensed Building Practitioner as per Section 298-301 of Building Act 2004.
Potable Water	is water that is suitable for human consumption and as defined by the Drinking water Standard of New Zealand 2005 (revised 2018).

2. Legislation

The following are some of the principle acts and Regulations that are relevant to the area of backflow prevention and cross connection control.

2.1. The Building Act 2004

The Building Act requires that buildings are safe and sanitary and the occupants are safeguarded from possible illness.

The Act requires an annually renewable Building Warrant of Fitness (for non-residential buildings) to ensure the specified systems stated in the compliance schedule are operating correctly. The compliance schedule includes any backflow preventers installed at the source of possible contamination.

The Building Act calls upon the Building Code in the Building Regulations 1992, specifically, Schedule 1, G12 Water Supplies regarding backflow prevention. The code requires that water supply systems be installed in a manner that avoids the likelihood of contamination within both the system and the water main. It also identifies the level of risk for certain hazards and introduces the requirement for IQPs to test backflow prevention devices. This is the minimum acceptable standard to comply with the Building Act. However, Council requires additional measures to ensure effective protection of the water supply.

All property owners must take all necessary measures on their side of the point of supply to prevent water which has been drawn from the public water supply or from any other source returning to that supply.

2.2. Health Act 1956

The Health Act requires that adequate water supplies are provided to communities. Any buildings being built, sold or let must have an adequate and convenient supply of wholesome water.

The Act also provides for council “To make bylaws under and for the purposes of this Act or any other Act authorising the making of bylaws for the protection of public health”, refer section 23.

The Act further states that it is an offence to pollute a public drinking water supply under Section 60 and can incur a fine.

2.3. Health (Drinking Water) Amendment Act 2007

These require that a backflow preventer be fitted in situations where a network supplier (Water Services) considers a need to protect the distribution system from risks of pollution caused by water and other substances on properties connected to the system.

The regulations require:

- Water Services to install a suitable backflow prevention device on the council side of the point of supply; and the owner of the property to reimburse council for the cost of the backflow prevention device including installation, testing and ongoing maintenance. Or
- Water Services to allow the owner of the property to install a suitable backflow prevention device as close as practicable to the boundary of the property.
- Water Services to require the owner to repair or modify any faulty backflow prevention device.

They also require Water Services to ensure the backflow prevention device is tested at least once a year. The costs for conducting the annual test shall be met by the property owner.

2.4. Council’s Water Supply Bylaw

This requires that the public water supply be protected where a cross-connection may contaminate the public water supply. The bylaw requires a backflow prevention device on all connections in most cases this is a non testable dual check on ordinary use (domestic supply) and a testable device on extraordinary use (industrial and commercial connections). The bylaw contains typical layouts of different connection types and fittings details with the location of the point of supply.

2.5. Health and Safety at Work Act 2015

This Act provides for prevention of harm to employees at work. It makes the employer responsible for providing and maintaining a safe working environment for employees. The employer must ensure that hazards are identified and eliminated or minimized.

2.6. Local Government Act 2002

Under the Local Government Act Council may make bylaws as it thinks fit for the purposes of “protecting, promoting, and maintain public health and safety”, Section 145.

This Act also states that it is an offence to pollute the water supply of a Local Authority and also gives Council the power to stop the water supply in response to an event that may become a danger to public health.

2.7. Other Legislation

Other Acts and Regulations which may impact on the requirements for backflow prevention include:

- Camping Ground Regulations 1985

- Civil Defence Emergency Management Act 2002
- Consumer Guarantees Act 1993
- Crimes Act 1961
- Education (Early Childhood Centre) Regulations 2008
- Employment Contracts Act 1991
- Food (Safety) Regulations 2002
- Food Act 2014
- Food Hygiene Regulations 1974
- Game Regulations 1975
- Local Government Rating Act 2002
- Old People's Homes Regulations 1987
- Public Works Act 1981
- Resource Management Act 1991
- Soil Conservation and Rivers Control Act 1941.

2.8. Relevant Standards and Guidelines

- Backflow Prevention for Drinking Water Suppliers Code of Practice 2012, published by NZ Water
- New Zealand Drinking Water Standards 2005 (revised 2018)
- Public Health Risk Management Plan Guide 'Distribution System – Backflow Prevention', version 1, Ref D2.4 published by Ministry of Health
- Public Health Grading of Community Drinking-Water Supplies and Guidelines
- Council's Environmental Engineering Standards
- AS/NZS 2845.1:2010 Water supply - Backflow prevention devices - materials, design and Performance requirements
- AS/NZS 3500.1:2018 Plumbing and drainage - Standards - Water Services
- New Zealand Industry Standard: Field testing of backflow prevention devices and verification of air gaps.

3. Council's General Requirements

As a result of the above legislation, Council requires the following backflow prevention devices installed:

a Source (point of risk) protection

For buildings covered by the Building Act an appropriate backflow prevention device must be installed as close as possible to the source of potential contamination. The type of device used shall be in accordance with the Building Code Approved Document G12.

b Zone protection

Generally only applicable within large industrial or commercial complexes and is usually required to separate workshop areas from offices and communal areas.

c Boundary (containment) protection

In addition to the internal backflow prevention and in accordance with the Health (Drinking Water) Amendment Act 2007 an appropriate backflow prevention device must be installed on Council service pipe as close as practicable to the point of supply. The device shall be rated according to the highest risk on the site.

Where the water connection is an extra ordinary use or a specific risk is identified the boundary protection device installed shall be fully testable with the minimum standard being a double check valve. Extra

ordinary use as defined by the Water Supply Bylaw includes all commercial and industrial customers. For all other properties with ordinary use which is domestic use only a dual check valve device will suffice.

All costs associated with the installation, maintenance and testing of backflow preventers shall be met by the customer. However, Council may undertake these works and charge the customer in accordance with the Funding Policy and the Schedule of Fees and Charges.

3.1. Ownership of Boundary Backflow Devices

The point of supply is the location of change of ownership from Council to the property owner. The point of supply as defined by the Water Supply Bylaw 2012, being directly downstream of the water meter and/or backflow prevention device. Therefore, boundary backflow devices are in Council ownership. However, there is an option for the property owner to retain ownership if they wish by written agreement with Council.

3.2. Roles and Responsibilities

Various departments within Council as well as customers have responsibilities under the aforementioned acts and regulations. Council's requirements for backflow prevention and cross connection control fall into two distinct areas; Water Services requirements and the Building Compliance requirements.

3.2.1. Water Services Department

Water Services responsibilities are governed primarily by the Health (Drinking Water) Amendment Act. This gives Water Services a general responsibility for the safety of the public water supply system. The Act requires Water Services to ensure that containment devices are provided at the boundary of all properties with a potential risk of cross connection. This cross connection could be made either accidentally or deliberately and boundary protection is independent of any internal backflow prevention.

Water Services may need to inspect the property to determine the level of risk and re-assess the requirements upon being informed of a change of water use within the property. Water Services require that all costs associated with the installation, testing, maintenance and possible replacement or upgrading of boundary backflow prevention are borne by the property owner. This will also include provision of isolation valves and strainers.

Water Services are required to ensure that all boundary backflow preventers are tested annually. Water Services may undertake to do the testing and keep records of the test results. The cost of the testing may then be passed on to the property owners as a uniform annual charge on the water rates or invoiced separately.

3.2.2. Building Compliance Department

The Building Compliance Department is responsible for ensuring compliance with the Building Act and Building Code. Various Acts of Parliament are focused on protecting the building occupants and users from possible dangers, including cross connections and backflow. It is the customer's responsibility under these regulations to protect the occupants, and they must install and test backflow preventers where required under the Building Act.

Where a backflow has not been installed, has the wrong hazard rating or fails a test; the compliance department may issue a Notice to Fix under the Building Act 2004. Failure to comply with a Notice To Fix is an offence and has an infringement fee of \$1,000 or if taken to prosecution a maximum fine of \$200,000 and \$20,000 for every day that the offence continues.

If the backflow preventer forms part of the compliance schedule for the building, the Building Warrant of Fitness cannot be renewed until the annual test has been done and Form 12A had been completed by a Council approved IQP.

3.2.3. Customer Responsibility

The customer (building owner or employer) is responsible for the protection of all employees and visitors to the site as well as protecting the public supply. It is the customer's responsibility to install and maintain all backflow prevention devices as may be required by the relevant Acts, Regulations and Bylaws. The customer and their approved building certifiers shall ensure that on initial construction all necessary backflow preventers are installed and added to the Building Compliance Schedule and Water Services database for boundary devices. The customer shall ensure that the backflow devices installed meet the current standards. Should the standards be amended then it shall be the customer's responsibility to fully comply with the new standards.

The customer shall arrange for the internal backflow devices to be tested in accordance with the relevant regulations and the Building Compliance Schedule. The customer shall keep all test reports for a minimum

of two years. Also after any renovations requiring consent the customer shall ensure that cross connections are avoided or backflow preventers installed to conform to the Building Act and Health (Drinking Water) Amendment Act. The customer shall allow Council staff or appointed representatives access to the site by prior arrangement for the purpose of checking for cross connections and compliance with this document. They shall also provide a person knowledgeable in the water layout of the property to assist with the inspection. The customer shall also be responsible for obtaining the necessary permits and consents prior to any plumbing alterations or changes of building or water use.

The customer shall be responsible for the payment of all fees and costs associated with permits, installation, maintenance, testing or removal of devices as may be required in this document.

Failure to meet the requirements of this document may result in the disconnection of the customer's water supply (see section 5).

4. Types of Hazards

Details of specific types of hazards are included in Appendices A and B; however there are many common installations which require backflow protection, regardless of the nature of the activities conducted on the premises. The hazard rating supplied in brackets is a general assessment and the specific hazard for an installation may differ when in doubt use to the hazard definitions in section 4.1 below.

These types of installations include:

Air conditioning units, heat exchangers and other water cooled equipment (Medium)

This equipment may be contaminated with algae or bacterial slime.

If potentially connected to the sewage system or treated with chemicals. **(High)**

Agricultural (Medium)

Stock water can be contaminated with bacterial slime

Supplies to cow sheds that could be contaminated with stock effluent or stock water with direct injection of chemicals **(High)**

Boilers (High)

Chemicals are often added and water made non potable.

Public toilets and urinals (Medium)

These are usually connected to the sewage system and often contain cleaning agents in the water stored for flushing.

Hose connections (Medium)

When hoses are connected they can easily become submerged in a contaminated non-potable liquid.

Common hazard areas are wash down areas and hose taps close to grease traps.

Swimming pools, spa pools and fish ponds (Medium)

May be contaminated with algae or bacterial slime or treated with chemicals. They are typically filled either by fixed piping or hose which may be left running below water level.

Irrigation and sprinkler systems (Medium)

Any below ground or pop up system would constitute a risk.

Chemicals added to the water or applied to the ground. **(High)**

Auxiliary sources (Medium)

Water pumped with a booster pump and held in a storage reservoir for use (i.e. on upper floors of multi-storied buildings) which could backflow into the potable system with a loss in pressure in the distribution main. The quality of auxiliary water supplies will typically not comply with relevant standards of potable for consumption.

Alternate Supply (Medium)

Alternate supplies such as rainwater tanks or springs are unlikely to comply with drinking water standards and may become contaminated.

Fire protection systems (Medium)

The water in these systems is often poor quality as no usage occurs for months on end.

If toxic chemicals are added to these systems. **(High)**

4.1. Levels of Risk

The levels of risk to public health identified relates to a hazard rating as defined in G12 of the Building Code are:

Hazard Rating	Description
High Hazard	Any condition, device or practice which, in connection with the potable water supply system, has the potential to cause death.
Medium Hazard	Any condition, device or practice which, in connection with the potable water supply system, has the potential to injure or endanger health.
Low Hazard	Any condition, device or practice which, in connection with the potable water supply system, would constitute a nuisance, by colour, odour or taste, but not injure or endanger health.

A full list of hazards and their classifications of table 1 from G12 is included in Appendix B.

Unless otherwise exempted, Water Services require that an appropriate and testable boundary protection device be provided as close as practicable to the boundary on Council's service pipe of any property containing either a high hazard or a medium hazard.

Exemptions may be granted at the discretion of Water Services where it is agreed that there is no significant potential for a cross connection to be made either accidentally or intentionally that could result in contamination of the public water supply. Examples of situations where exemption may be granted include:

- Situations where the point of supply is at an elevation 10.5 metres or more higher than the identified hazard. (For back siphonage hazards only).
- Spa pools, fish ponds or rainwater tanks of total volume less than 1000L.
- Interior spa pools where the method of filling is unlikely to result in cross connection.

Should a dispute arise over the level of risk, or the backflow prevention device required at the boundary, the Water Services Manager shall nominate the device. Where it is unclear as to the level of risk or for reasons the water usage is unknown a Reduced Pressure Zone backflow preventer shall be installed.

All other properties shall have dual check valves incorporated within the water meter installation.

5. Disconnection of Water Supply

Where a hazard or potential hazard to the water supply exists and is not remedied within a reasonable period of time (as specified by Water Services but not longer than 30 days from the date of notification) Water Services may disconnect the water supply to the customer. Other instances where a disconnection of the water supply would be considered include but are not limited to:

- Unprotected, direct or indirect connection between a contaminant and the public water supply
- Removal or bypassing of a boundary backflow preventer.

Disconnection of the water supply may be undertaken in accordance with the following legislation; The Local Government Act 2002 , the Council's Water Supply Bylaw 2012 and the current versions of the Water Services Act.

Water Service will make every effort to inform customers in advance of disconnection. However, in the event that a potentially serious hazard to the public water supply exists the connection to that property may be disconnected immediately. Reconnection of the supply shall not be undertaken until the appropriate action has been undertaken to the satisfaction of the Water Services Manager. The cost of the disconnection, and reconnection if applicable, shall be met by the consumer. Failure to provide sufficient backflow prevention inside a premises or building as required under the Building Act or other regulations shall be deemed an offence under those regulations. Any penalties or actions to be taken shall be in accordance with the relevant legislation and at the discretion of the Building Control Department and/or the Drinking Water Regulator.

5.1. Backflow Incidents

Notwithstanding any legal action that may result from a backflow incident the cost of rectifying contamination of the public water supply shall be the responsibility of those allowing the backflow to occur.

6. Types of Backflow Preventers

The types of backflow preventers are categorised in accordance with the level of risk, low, medium or high (See Appendix B). However, certain devices may not be suitable in all situations even if they have the correct hazard rating. For example an air gap would often be impractical as a boundary device. The types of devices depending on location are shown below:

Hazard	Boundary (Containment) Device	Source (Point of Risk) Device
Low Hazard	Dual check valve	Dual check valve Dual check valve with atmospheric port Hose connection vacuum breaker
Medium Hazard	Double check valve Double check detector	Double check valve Atmospheric vacuum breaker Pressure vacuum breaker Spill proof vacuum breaker
High Hazard	Reduced pressure zone Reduced pressure zone detector	Reduced pressure zone Registered air gap

A brief description of each device is in Appendix C.

6.1. Backflow Manufacture

All backflow prevention devices shall be manufactured in accordance with AS/NZS 2845.1 Water supply Backflow prevention devices Materials, design and performance requirements. For Boundary devices on the property boundary, only top entry backflow preventers complying with AS 2845.1 shall be used. See Water Services Approved Materials List for approved models.

It is important to ensure that the correct device is chosen for the potential hazard. It is also essential that the installer and tester are fully aware of the installation requirements and operating characteristic of all devices. If in doubt a higher level of protection should be used.

7. Installation of Backflow Preventers

7.1. Installation requirements

Before a boundary backflow preventer can be installed or removed consent must be obtained from Water Services. Water Services may request the owner to undertake a comprehensive survey of the site by a qualified IQP. Installation of a backflow prevention device may be required following any of the following events:

- Building Consent for construction of a new building or alteration of an existing building
- Public Utility Application
- Change of Use Application
- Property inspection by Council's backflow contractor

For new buildings with a new water connection the consent will come with the approval for the water connection in the form of an approved drawing stating the type of device required. When a change in the use of the building occurs a "Change of Use Application" must be made to Water Services who will inform the customer if any change to the boundary backflow prevention is required. Where the applicant is unsure of the final use of the water supply Water Services may allow a double check valve to be installed. However, should the water subsequently be used for high hazard activities the backflow preventer shall be upgraded at the customer's expense. For internal backflow preventers as required by the Building Act a building consent will also be required.

All source (point of risk) devices shall be installed as near as practicable to the potential source of contamination (appliance) while still in an easily accessible position for maintenance and testing.

All backflow preventers must be installed with isolating valves and a line strainer upstream. The only exception being on fire sprinkler lines when strainers shall not be used unless the make and model is approved by the Insurance Council. The isolating valves must be ball valves or resilient seated gate valves

for large (greater than 40mm) devices and shall be installed adjacent to the backflow preventer. All high hazard devices shall be installed above ground in a securely fenced / housed or caged area with a lockable access to protect from physical damage. The installation of high hazard devices shall be such that discharge from the relief valve can drain and does not cause damage.

No device shall be bypassed unless the bypass is also fitted with a device appropriate for the same hazard rating.

New source (point of risk) protection devices will be added to that buildings compliance schedule. All boundary (containment) protection devices will be added to Council's property database.

The installation of internal backflow prevention devices shall only be undertaken by a craftsman plumber or by a licensed plumber working under the direction of a craftsman plumber. For boundary devices Council only Licensed Contractors or contractors specifically approved by Water Services shall be allowed to install the backflow preventer.

All devices shall be installed in accordance with Council's Environmental Engineering Standards, this document, and the manufacturer's recommendations. The device shall be tested immediately following installation to prove compliance with all requirements. This shall be carried out by a registered IQP.

7.2. Installation Considerations

When installing a backflow prevention device the following criteria need to be considered:

- Level of risk
- Appropriate backflow prevention device for level of risk
- Location of backflow prevention device (at source or boundary)
- Appropriate backflow prevention device for type of water use downstream - consideration must be given to the head losses through the device and appropriate size of connection to meet anticipated flow rates
- Ease of access for testing, maintenance and replacement
- Manufacturer's recommendations
- Pressure loss across device
- Safety of testing for maintenance personnel
- Continuity of supply while testing. A bypass line may be required, also with a backflow preventer
- Installation above ground level or with adequate functioning drainage where no part of the device can become submerged
- Protection, from vandalism, traffic, hazardous environments
- Approved brand (a copy of the latest list of Approved Materials shall be obtained from Water Services)

8. Testing

It is a requirement under the Building Act 2004 that all internal backflow preventers are tested within the required time frame by an IQP. This will normally be part of the building's Compliance Schedule. An IQP is defined within the building act as being "a person who:

- a Has no financial interest in the building, other than as a qualified person; and
- b Is accepted by the territorial authority as being appropriately qualified to undertake the inspection and maintenance of the feature or system concerned."

Boundary devices that are not part of the building compliance schedule shall be tested annually by an IQP or as directed by the Water Services Manager. Water Services may undertake the testing of boundary devices and recover the cost from the consumer. Alternatively Water Services may allow the consumer to organise the test and forward the test certificate to Water Services.

8.1. IQP's Responsibilities

The IQP shall inform both the customer and Council if the level of protection offered by the backflow device is at any time found to be insufficient for the highest hazard on the property.

The IQP shall report any unsanitary plumbing practices and report any unprotected backflow risks to Council.

The individual who holds the IQP status shall inform Council if he leaves a company, and/or joins a new company and wishes to continue to operate as an IQP.

8.2. Qualifications

Council requires that all approved IQPs have a thorough knowledge of backflow prevention and cross connection control. They must be able to recognise potential backflow hazards as well as testing devices. An IQP must be able to advise property owners on backflow requirements and be familiar with all acts and regulations pertaining to backflow and cross connection issues. In addition, they shall have attended and passed an approved course of not less than 40 hours duration or obtained competency in unit standards US23847 and US23848. For qualified plumbers have obtained competency in unit standard US2117.

In order to keep up to date with changes in regulations, equipment and procedures, each IQP must also attend a recognised refresher course at least every three years.

8.3. Registration

Persons wishing to become registered as an IQP, as specified in the Building Regulations, for Section G – “Any automatic backflow preventer connected to a potable water supply” with the Whangarei District shall complete the relevant application form. They shall enclose with their application a copy of the qualification certification (or refresher certificate if applicable), medical certificate signed by their doctor (Water Services Hygiene Code, WSMQ1 form), their test kit serial number with a copy of current calibration verification along with the appropriate application fee. If the applicant has the correct qualifications and is deemed suitable Council will notify the applicant and include their name to the IQP register.

8.4. Re-Registration

Every year all IQPs shall re-register with Council in order to maintain their approved status. The IQP will be contacted by Council and asked to reapply before a certain date. The applicant shall apply in writing enclosing the appropriate fee, a copy of their test kit annual calibration report and their refresher course certification if due. If all details are in order then approved status will be granted for a further year.

8.5. Removal of IQP Status

If in the opinion of the Water Services Manager or Building Control Manager, an IQP has not undertaken their obligations to a satisfactory level then Council may immediately withdraw their IQP status. Reasons approved status might be withdrawn are:

- Failure to adequately test backflow preventers
- Failure to comply with this policy
- Failure to comply with the relevant acts and regulations
- Breaches of OSH regulations
- Poor, unsafe or unhygienic work practices.

For minor offences Council may first issue a written warning, but reserves the right to immediately remove IQP status for serious breaches. Council may ask an IQP to re-sit the 40 hour course before reapplication for approved status. However, Council shall be under no obligation to reinstate any IQP who has been removed from the register.

8.6. Company IQP Status

Only individuals are eligible for IQP status. Companies with IQP on their staff may advertise as such but the status is attached to the individual only. Council will keep a record of companies who have IQP on their staff and the companies will be listed in Council's IQP register. Should the individual leave the company the company will immediately be removed from the register. Only IQP employed or contracted by the company shall be allowed to test backflow preventers and sign report forms.

8.7. Insurance

All IQPs must hold current public liability and/or professional indemnity insurance suitable for the type of areas in which they will be working.

8.8. Hygiene Requirements

Every IQP shall be familiar with the requirements of the Water Services Hygiene Code of Practice for persons working on potable water mains. IQPs shall obtain a blue card by getting medical clearance from their doctor in accordance with the requirements of the hygiene code. The blue card (medical clearance) shall be kept up to date. Failure to do so may result in the removal of IQP status.

8.9. Test Procedures

Testing procedures for backflow preventers shall be in accordance with the New Zealand Industry Standard: Field testing of backflow prevention devices and verification of air gaps and/or the American EPA Cross Connection Control Manual. In addition, visual checks will also be required for registered break pressure tanks and atmospheric vacuum breakers. Testing shall be done at the following times:

- Immediately after installation
- Annually
- On completion of any maintenance work
- After a backflow or suspected backflow incident
- At the request of the Drinking Water Regulator, Building Control Officer, Dangerous Goods Inspector or Water Services Manager.

The test procedures shall be as per the New Zealand Industry Standard. The test forms for backflow prevention devices shall be as shown in Appendix M of that document or Appendix E of this document.

Note For boundary backflow prevention devices the registration number of the device and the meter number to which it is attached must be included.

Prior to the annual test of a backflow preventer the line strainer must first be cleaned.

8.9.1. Test Equipment

The test equipment used shall be the correct type for the device being tested. The equipment shall be a recognised make and model and not a “homemade” device. The test kit shall have a maximum working pressure of at least 1200kPa, and shall have colour coded hoses for ease of use. It is recommended that each hose should contain an in-line filter which should be cleaned out regularly.

Calibration tests shall be done annually by an International Accreditation New Zealand (IANZ) registered testing laboratory, or Water Services approved laboratory. The calibration frequency should be those set out in The New Zealand Industry Standard: Field testing of backflow prevention devices and verification of air gaps. Current calibration test certificates must be forward at the time of re-registration.

8.9.2. Test Tags (for Boundary Devices only)

The “test completed” tag shall be attached to the boundary backflow device on completion of a successful test. The tags shall be durable with a 5 year date grid. The IQP shall drill a hole in the date grid corresponding to the date of the successful test. The tag shall be securely fastened to the backflow, clearly visible and legible. Test tags shall only be obtained through the Whangarei District Council.

8.9.3. Backflow Registration Numbers (for Boundary Devices only)

Each boundary backflow shall have a unique registration number. This registration number shall be stamped on the front of the test tag. The test tags with the number must be obtained from Water Services prior to the installation test for a new backflow.

If a device requires a new tag (i.e. if testing date on tag has expired), then a new tag shall be securely fastened to the backflow. Both the old and the new registration numbers must be written on the report forms, and all other correspondence to Water Services regarding individual backflow prevention devices.

8.9.4. Test Certificate

The backflow prevention test form is to be completed for every test (as per Appendix E), and returned to Whangarei District Council within five (5) working days. The form shall have the following information:

- Type of test (initial, annual etc.)
- Owner details (name, address)
- IQP details (name, IQP number)

- Device details (location, make, model, size, serial number)
- Unique backflow registration number (if tag requires replacement then both old and new number shall be recorded)
- Associated water meter number (for boundary devices only)
- Type of hazard (for internal backflow preventers only)
- Strainer cleaning
- Test results
- Maintenance work undertaken
- Pass / Fail result
- Test kit information (make, serial number, calibration date)
- Additional information if required
- IQP signature and date of test

9. Surveying

The surveying of properties for cross connections and potential backflow problems shall be undertaken by persons experienced in this field. They shall have attended a recognised backflow survey course of not less than 3 days duration. The surveyor shall have a survey accreditation ID card that shall be carried at all times when undertaking surveys. The surveyor shall have the necessary public liability and professional indemnity insurances as required by Council.

Two types of survey may be undertaken:

- A highest hazard survey only determines the highest hazard on a property and is used to determine the level of boundary backflow prevention required.
- A full survey should determine all risks and possible cross connections which may prove hazardous to the occupants.

On completion of a survey, a report should be submitted to the relevant Council department and a copy should be kept by the surveyor. Further descriptions of survey requirements are at Appendix F.

10. Acknowledgements

Much of the information for this policy came from the following sources:

- Water New Zealand, Backflow Prevention Code of Practice for Water Supplier
- Department of Housing, New Zealand Building Code Acceptable Solutions G12/AS1
- The Master Plumbers, Gasfitters and Drainlayers NZ and Water New Zealand, New Zealand Industry Standard: Field testing of backflow prevention devices and verification of air gaps
- USEPA Cross-Connection Control Manual
- Unitec Backflow Survey Course Notes

Appendix A Ratings

Specific Hazards: Examples of Facilities and Hazard

This Appendix gives examples and guidance for the overall hazard when determining the boundary backflow required in the types of premises described. The hazard rating supplied in brackets is a general assessment and the overall hazard for the specific site may differ when in doubt use to the hazard definitions in section 4.1.

Sewage Plants, Pump Stations and Water Reduction Facilities (High)

The hazards normally found in plants of this type include cross connections between the public water supply and:

- a) Sewage pumps for priming, cleaning, flushing or unclogging purposes.
- b) Water operated sewage sump ejectors.
- c) Chlorinators using potable water when disinfecting wastewater.
- d) Sewer lines for purpose of disposing of filter or softener backwash water or water from cooling systems.

Plating and Chemical Companies (High)

The hazards normally found in plants of this type include cross connections between the public water supply and:

- a) Plating facilities involving the use of highly toxic cyanides, heavy metals in solution, acids and caustic solutions.
- b) Plating solution filtering equipment with pumps and circulating lines.
- c) Tanks, vats or other vessels used in painting, de-scaling, anodizing, cleaning, stripping, oxidizing, etc for the preparation or finishing of productions.
- d) Steam generating facilities and lines which may be contaminated with boiler compounds.
- e) Water cooled equipment which may be sewer connected such as compressors, heat exchangers, and air conditioning equipment.

Hospitals (High)

The hazards normally found in facilities of this type include cross connections between the public supply and:

- a) Contaminated or sewer connected equipment such as bedpans, washers, flush valve toilets and urinals, autoclaves, specimen tanks, sterilizers, aspirators, autopsy and mortuary equipment laboratories.
- b) Sewer lines for the purpose of disposing of filter or softener backwash water.
- c) Water cooled equipment such as compressors, heat exchangers, air conditioning equipment, etc.
- d) High pressured coil system.
- e) Cooling towers which may be heavily contaminated with bird droppings, vermin, algae, etc., or with toxic water treatment compounds.
- f) Steam generating facilities and lines.
- g) Kitchen and food processing equipment including dishwashers, icemakers, carbonated beverage machines.
- h) Haemodialysis units.
- i) Auxiliary emergency water supplies.

Convalescent and Nursing Homes (High)

The hazards normally found in facilities of this type include cross connections between the public water supply and:

- a) Contaminated or sewer connected equipment such as bedpan washers, flush valve toilets, urinals and whirlpool baths.

- b) Kitchen and food processing equipment including dishwashers, ice-makers, carbonated beverage machines.
- c) Auxiliary emergency water supplies.

Funeral Homes and Mortuaries (High)

The hazards normally found in this type of facility include cross connection between the public water supply and:

- a) Prep room equipment such as hose connections and aspirators.
- b) Boilers with chemicals added.

Schools and Universities (High)

The hazards normally to be found in a facility of this type include cross connections between the public water system and:

- a) Contaminated and/or sewer connected facilities such as inadequately protected flush valve toilets, urinals, aspirators, retorts, pipette tube washers, etc.
- b) Laboratory equipment which may be chemically or bacteriologically contaminated.
- c) Steam sterilizers, autoclaves, specimen tanks, autopsy and morgue equipment.
- d) Sewer connected plumbing fixtures such as flush valve toilets and urinals.
- e) Steam generating facilities and lines, which may be contaminated with boiler compounds.
- f) Water cooled equipment which may be sewer connected such as compressors, heat exchangers, air conditioning equipment, etc.
- g) High pressured coil systems.
- h) Irrigation systems which may be equipped with pumps, injectors, or other facilities for injecting chemicals or subject to contamination from submerged inlets, auxiliary water supplies, or polluted or contaminated waters.
- i) Tanks, automatic film processing machines or facilities.
- j) Auxiliary water supplies.
- k) Lab sinks and other hose connections.

Medical Laboratories (High)

The hazards normally found in this type of facility are cross connections between the public water supply and:

- a) Lab sinks and hose connections.
- b) Pipette washers, sterilizers, autoclaves, etc.
- c) Sewer lines for the purpose of disposing of samples.
- d) Filter equipment, deionizers, membrane filters and distillers.

Car Wash Facilities (High)

The hazard normally found with this type of facility would be a cross connection between the public water supply and:

- a) The scrubber and rinser plumbing, which would enable a re-circulating pump to force recycled water back into the public water supply.

Veterinary Hospitals, Grooming Establishments (High)

The hazards normally found in this type of facility would be a cross connection between the public water supply and:

- a) Bath tubs where animals are washed with chemicals for treatment of fleas, skin disorders, etc.
- b) Hoses used to wash wastes from pens and run areas.
- c) Medical equipment such as x-ray development.

Marinas, Yacht Clubs and Docks (High)

The hazards normally found in water front facilities include cross connection between the public water supply and:

- a) Outlets available for supplying water to docks using common garden hoses.
- b) Large supply lines used to supply drinking water for larger seagoing vessels.
- c) Kitchen/restaurant facilities such as dishwashers, ice machines, carbonated beverage machines.
- d) Gas tanks which hydraulically raise gas levels.
- e) Cooling towers.
- f) Fire protection systems.
- g) High pressure washing systems.
- h) Motor testing tank with bottom feeds.

Swimming Pools (Medium)

The hazards normally found at swimming pools are cross connections between public water supply and:

- a) Below rim inlets.
- b) Hoses left running and dropped into the pools.
- c) Direct connections at the chlorination equipment.
- d) Steam generating facilities and lines which may be contaminated with boiler compounds.

Greenhouses (Medium)

The hazards normally found at greenhouses are cross connections between the public water supply and:

- a) Irrigation systems.
- b) Hoses left running on the floor or in planters where there is a possibility of back siphonage.

However **(High)** if facility includes

- c) Chemical injectors.
- d) Steam generating facilities which may be contaminated with boiler compounds.

Farms and Agricultural Facilities (Medium)

The hazards normally found with farms and agricultural facilities are a cross connection between the public water supply and:

- a) Stock troughs
- b) Chillers
- c) Dams and other auxiliary supplies

However **(High)** if facility includes

- d) Cowsheds and slurry pits
- e) Irrigation systems with chemigation/fertigation.

Tank Trucks and Sprayers (High)

The hazards normally found with tank trucks and sprayers are a cross connection between the public water supply and:

- a) A fill pipe which becomes submerged in the tank during filling.
- b) Hydroseeders, sweepers, sewer vacuums, sewer rodders or lawn maintenance equipment which may be subject to back siphonage during use.

Automobile Repair and Related Industries (High)

The hazards normally found with these types of facilities are cross connections between the public water supply and:

- a) Submerged inlets into testing tanks where chemicals are present.
- b) Rinse hoses lying on the floor stuck into tanks.
- c) Steam generating lines which may be contaminated with boiler compounds.

Laundries, Dry Cleaners and Dye Works (High)

The hazards normally found in this type of facility are a cross connection between the public water and:

- a) Laundry machines having under rim inlets.
- b) Steam generating facilities which may be contaminated with boiler compounds.
- c) Water storage tanks equipped with re-circulating pumps
- d) Dye vats using chemicals.
- e) High pressure coil heat exchangers.
- f) Sewer connected compressors.
- g) Dry cleaning equipment with solvents and heat exchangers.

Solar Heating Systems (Medium)

The hazards normally found with solar heating and/or cooling systems include cross connections between the public water supply and:

- a) Single wall heat exchangers between the consumer's water and non-potable water.
- b) Negative pressure zones created by circulation pumps.

However **(High)** if facility includes

- c) Reservoirs and/or solar collector fluids which may have antifreeze, toxic corrosion inhibitors, or non-potable water.

Food Processing such as Bottling Companies, Canneries and Meat Packing (Medium)

The hazards normally found in this type of facility would be cross connections between the public water supply and:

- a) Steam connected facilities such as pressure cookers, autoclaves, retorts etc.
- b) Equipment used for washing, cooking, cleaning, blanching, flushing, or fluming or for transmission of foods.

However **(High)** if facility includes

- c) Fertilizers or wastes.
- d) Can and bottle washing machines and lines where caustics, acids, detergents and other compounds are used in cleaning, sterilising etc.
- e) Cooling towers and circulating systems which may be contaminated with bird droppings, vermin, algae, bacterial slimes or with toxic water treatment compounds.
- f) Steam generating facilities and lines which may be contaminated with boiler compounds.

Beauty Salons - Barber Shops - Beauty Schools (Medium)

The hazards normally found in these facilities are cross connections between the public water supply and:

- a) Hair wash sinks that have hoses for rinsing hair during washing, dying or other chemical treatments.

Doctors' and Dentists' Offices (High)

The hazards normally found in these facilities are cross connections between the public water supply and:

- a) Autoclaves.
- b) Specimen tanks.
- c) Sterilisers.
- d) Aspirators.

- e) Laboratory sinks.
- f) Dental suction hoses.
- g) X-ray equipment.
- h) Air compressor lines.
- i) Water cooled equipment such as air conditioning equipment which may be connected to sewers.

Restaurants and Cafes (Medium)

The hazards normally found in these types of facilities would be cross connections between public water supplies and:

- a) Dishwashing sinks particularly with detergent injectors.
- b) Deep sinks with aspirators with soap, detergents etc.
- c) Cleaner's sinks.
- d) Toilets and urinals.
- e) Air conditioning units piped directly to sewers.
- f) Steam generating facilities which may be contaminated with boiler compounds.
- g) Water cooled equipment such as air conditioners, which may be connected to the sewers.
- h) Garbage can washers.
- i) Garbage disposal units.
- j) Soda equipment, espresso boilers with salt filters.
- k) Lawn sprinklers.

Alternate Water Supplies

The hazards normally found at properties with private water supplies would be cross connections between public water supplies and:

- a) Rainwater tanks
- b) Spring sources
- c) Bores
- d) Rivers and Streams
- e) Small dams

Appendix B Hazard Levels: New Zealand Building Code G12/AS1

Below the type of hazard is taken from G12/AS1 of the Building Code and gives a good indication of the devices required for particular situations.

Note The final decision as to which device is required shall be made by the Water Services Manager.

Type of Hazard	Acceptable Devices
High may include but not necessarily be limited to: - a Autoclaves and sterilizers - b Systems containing chemicals such as anti-freeze, anti-corrosion, biocides or fungicides - c Beauty salon and hairdresser's sinks - d Boiler, chiller and cooling tower make-up water - e Car and factory washing facilities - f Chemical dispensers - g Chemical injectors - h Chlorinators - i Dental equipment - j Direct heat exchangers - k Fire sprinkler systems and fire hydrant systems that use toxic or hazardous water - l Hose taps associated with High hazard situations like mixing of pesticides - m Irrigation systems with chemicals - n Laboratories - o Mortuaries - p Pest control equipment - q Photography and X-ray machines - r Piers and docks - s Sewage pumps and sump ejectors - t Sluice sinks and bed pan washers - u Livestock water supply with added chemicals - v Veterinary equipment	• Registered air gap • Reduced pressure backflow prevention device
Medium may include but not necessarily be limited to: - a Appliances, vehicles or equipment - b Auxiliary water supplies such as pumped and non-pumped fire sprinkler secondary water - c Deionised water, reverse osmosis units and equipment cooling without chemicals - d Fire sprinkler systems and building hydrant systems - e Hose taps and fire hose reels associated with Medium hazard - f Irrigation systems with underground controllers - g Irrigation without chemicals - h Livestock water supply without added chemicals - i Untreated water storage tanks - j Water and steam cleaning - k Water for equipment cooling - l Drink dispensers with carbonates - m Swimming pools, spas and fountains	• Registered air gap • Reduced pressure backflow prevention device • Double check valve

Low may include but not necessarily be limited to: a Drink dispensers (except carbonators)	As above plus • Hose connection vacuum break • Dual check valve
--	--

Note The examples given are not an exhaustive list. Where there is doubt comparison must be made to the hazard definitions.

Appendix C Backflow Prevention Devices

Hose Connection Vacuum Breakers

This device can be attached to the outlet of any standard hose bib tap and prevents back siphonage only. It will not work under back pressure or continuous pressure conditions. A similar device is also available for laboratory outlets.

Dual Check Valves

These are in line non testable devices which are suitable for continuous pressure applications in low hazard applications.

Dual Check Valves with Atmospheric Port

As above, but with an atmospheric vent. This allows water to discharge to atmosphere if the second check valve does not close correctly.

Double Check Valve

These are fully testable and can be used for back siphonage and back pressure conditions. They may only be used to protect against a contaminant that could at worst cause illness, hence they are classified as medium hazard devices.

Double Check Detector Assembly

This is specifically designed for fire sprinkler lines where backflow prevention is combined with the need to detect unauthorised water usage or leakage. It incorporates a large and a small double check valve in parallel with a meter on the smaller line. It provides the same level of protection as a double check valve however it will detect small flows. Large flows, such as in the event of a fire, will go through the large line and hence not be recorded. This assembly has carefully matched components and cannot be field assembled from stock double check valves.

Atmospheric Vacuum Breaker

These devices are used to protect against back siphonage of a pollutant only. They should not be subject to back pressure and are therefore only to be used on open ended pipeline such as irrigation systems or garden hoses with no downstream valves. They are not suitable as boundary devices and should be installed a minimum of 150mm above all downstream piping. They may also only be used for a maximum of 12 hours out of any 24 hour period as long usage may cause the seat to stick. Whilst atmospheric vacuum breakers cannot be tested, they can be opened and checked to ensure they are working correctly. This should be done on an annual basis.

Pressure Vacuum Breaker

These devices are similar to the atmospheric vacuum breaker and are only suitable for back siphonage conditions. They can however be used under constant pressure conditions and can be tested in line. They must be installed at least 300mm above all downstream outlets.

Spill Proof Vacuum Breakers

Similar to the pressure vacuum breaker but can be installed in areas where spillage of water from the device is not wanted. They are testable and only suitable for protection against back siphonage. They must be installed in accordance with the manufacturer's recommendations and are not suitable as boundary devices.

Reduced Pressure Zone

These devices are acceptable for contaminants that can cause illness or death as they are rated for high hazards. They will protect against both back pressure and back siphonage and are fully testable. They must be installed above ground in a free draining area.

Reduced Pressure Zone Detector Assembly

This is specifically designed for fire sprinkler lines which use chemical additives and where backflow prevention is combined with the need to detect unauthorised water usage or leakage. It incorporates a large and a small reduced pressure zone backflow preventer in parallel with a meter on the smaller line. It provides the same level of protection as a reduced pressure zone device, however it will detect small flows. Large flows, such as in the event of a fire, will go through the large line and hence not be recorded. This

assembly has carefully matched components and cannot be field assembled from stock reduced pressure zone valves. This device must be assembled above ground in a free draining area.

Registered Air Gap or Break Tank

Air gaps are non mechanical devices which when installed correctly offer high hazard protection against both back siphonage and back pressure. The air gap should be at least two times the diameter of the inlet pipe and not less than 25mm. Air gaps are usually used at the end of a service for a reservoir or storage tank. The resultant loss of pressure may mean that a booster pump is required. At an air gap, the potable water is in contact with the surrounding air, so it must not be installed in a toxic environment. Air gaps should be registered and inspected annually to ensure that they have not been bypassed and the overflow capacity is sufficient.

Appendix D Backflow Testing Procedure

Fully Testable Devices

The following procedure shall be followed when testing backflow prevention devices using a recognised test kit:

- Determine appropriate date and time with property owner
- Confirm model and size of backflow preventers to be tested and ensure correct test kit (calibrated) is available
- Check with building occupants prior to shutting of water to building, area or equipment
- **Note** If testing fire line or sprinkler backflow preventer, the Fire Service or monitoring company will also need to be notified
- Check installation is correct, including correct level of protection, and all test ports accessible. If not owner should be notified and test delayed until problem fixed
- Check no health and safety risks at test site. See Appendix A of the New Zealand Industry Standard: Field testing of backflow prevention devices and verification of air gaps
- Prior to testing the line strainer must be cleaned
- Undertake test in accordance with correct procedure (New Zealand Industry Standard: Field testing of backflow prevention devices and verification of air gaps; or USEPA Manual)
- Complete test certificate form Appendix E or appropriate form from New Zealand Industry Standard: Field testing of backflow prevention devices and verification of air gaps
- Should the device fail, the owner's permission must be sought before undertaking any maintenance work
- Mark test complete tag, or attach new tag to backflow device and mark
- Report to building occupiers when test is complete and water restored
- Submit test report forms to correct authority.

Boundary Devices – Water Services

Internal Devices – Building Control Authority

- The tester should give a copy to the Council and keep a copy of the report form themselves for a period of not less than two years.

Atmospheric Vacuum Breakers

The procedure for atmospheric vacuum breakers is similar to that for fully testable devices. The only difference is the test itself. As there are no test ports the device has to be dismantled to visually inspect the disk seating for sticking or damage. The test procedure is Appendix K of New Zealand Industry Standard: Field testing of backflow prevention devices and verification of air gaps with a report form in appendix M that can be used.

Registered Air Gaps

A registered air gap or break tank requires no physical testing as such. However they do require examination at intervals the same as fully testable devices. The test procedure is obtained by following the checklist and verifying the air gap as detailed in Appendix C of New Zealand Industry Standard: Field testing of backflow prevention devices with a report form in appendix M that can be used.

Appendix E WDC Backflow Prevention Device Test Certificate Form

A Copy of the test form is overleaf.

Inspection and Maintenance Form for Backflow Prevention Devices

☐ Initial test ☐ Retest ☐ Annual test ☐ Other

Owner/Occupier _____

Address _____

IQP Name _____ WDC IQP No _____

Device Details

☐ Containment backflow ☐ Internal backflow

Backflow Registration No _____ Hazard _____

Associated Meter No _____ ☐ High risk ☐ Medium risk

Device location _____

Make _____ Model _____

Size _____ Serial No _____

☐ Strainer cleaned

	Reduced Pressure Zone Devices			Pressure Vacuum Breaker	
	Double Check Devices		Relief valve	Air inlet	Check valve
	First check	Second check			
Initial test	☐ DC closed tight RP _____ kpa ☐ Leaked	☐ Closed tight ☐ Leaked	Opened at _____ kpa	Opened at _____ kpa ☐ Did not open	_____ kpa ☐ Leaked
Maintenance undertaken, parts & materials used					
Test after maintenance	☐ Closed tight RP _____ kpa	☐ Closed tight	Opened at: _____ kpa	Opened at _____ kpa	_____ kpa

☐ Pass ☐ Fail

Test kit make _____ Serial No _____

Date test kit last verified _____

Remarks (correct hazard rating, suitable location, recommended course of action, etc)

IQP Signature

Date of test

Appendix F Requirements for Backflow Surveys

The procedures to be followed when conducting a full backflow survey are as follows:

- A letter of intent should be sent to the water customer at least one week prior to the inspection
- Whenever possible the customer or their agent should accompany the surveyor on the inspection. A copy of the drawings of the water layout should also be requested
- The surveyor must carry ID and wear the correct safety gear for the property
- The survey should start at the property boundary and continue to the last free flowing outlet
- The report should be collated during the survey. Notes and sketches (if possible photographs) should be made of all areas requiring backflow protection
- Any existing or potential cross connections should be noted on the report
- Recommendations for corrective actions should also be documented and discussed with the owner
- The report should be signed by the inspector and countersigned by the owner who also keeps a copy
- A follow up inspection date should also be in the report
- If the surveyor discovers a situation where contaminants are in the process of or suspected of entering the distribution system they shall inform the utility immediately

The highest hazard survey should include as many of the above items as are required to determine the hazard rating of the property.

Comparison between 2021 and 2025 backflow prevention policies

2021 Policy	2025 Draft	Reason
All new connections require a type of backflow prevention at the point of supply between the customer and the water supplier	All new water connections must include an appropriate boundary backflow prevention device, preferably installed at the point of supply.	Minor wording change for clarity
The type of backflow prevention device being dependant on the risk to the water supply posed by the customer	The type of backflow prevention device required will be determined by the potential risk to the public water supply... based on likelihood of cross-connection existing or be unintentionally created.	Expanded wording and clarify could be unintentional
Generally domestic/ordinary use... dual check device... commercial/extraordinary use... testable device	As a general guideline... Ordinary use (typically domestic) requires a non-testable dual check valve. Extraordinary use... requires a testable device.	Re-formatted, same meaning
Point of supply or boundary... vested to Council... maintained and replaced... option to retain ownership	Point of supply (boundary) devices are vested in Council and will be tested, maintained and replaced... Customers may apply to own... by written agreement with approved regime.	Expanded wording and outline requirements for private ownership
Testing of boundary... at least annually and after maintenance	All testable boundary... inspected and tested at least annually... faulty/non-compliant devices repaired/replaced immediately.	Expanded wording including training requirement, confirming fault rectification.
A schedule of targeted rates... included in the Annual and Long	Council will recover the cost... through a targeted	Reworded to simplify

2021 Policy	2025 Draft	Reason
Term Plans... charge added to customer's account	rate, included in the Annual and Long-Term Plans.	
Existing extraordinary... without adequate backflow prevention are to be upgraded at the customers cost... prioritised according to potential risk... option for Council to install and pass on cost	Existing extraordinary-use connections... will require an appropriate device...	Minor rewording, and move cost info to other bullet point.
Existing ordinary use... without backflow prevention will be upgraded when meters are replaced	Existing ordinary-use connections... will be upgraded with dual check valves when meters are replaced.	Minor rewording
	Increase in risk level following change in use will require device upgrade	New clause to reflect a change in use
Periodic surveying... to determine any change of use requiring upgrading of backflow prevention	Periodic surveying... to identify changes... Where necessary, devices will be upgraded accordingly.	Expand and confirm potential upgrade requirement.
	Cost of installing backflow preventer to be met by property owner.	Standalone bullet point confirming cost liability. Moved from previous bullet point.
Enforcement where necessary will be as set out in the Water Supply Bylaw	Where appropriate, enforcement action will be undertaken in accordance with the Council's Water Supply Bylaw.	Minor rewording

6.1 Contracts Approved Under Delegated Authority – July 2025

Meeting: Infrastructure Committee

Date of meeting: 18 September 2025

Reporting officer: Jim Sephton (General Manager – Transport and Community Infrastructure)
 Andrew Carvell (General Manager – Waters)

1 Purpose / Te Kaupapa

For the Infrastructure Committee to note Infrastructure contracts awarded under Chief Executive and General Manager delegated authority.

2 Recommendation / Whakataunga

That the Infrastructure Committee note the Infrastructure contracts awarded under Chief Executive and General Manager delegated authority.

3 Background / Horopaki

Table 1 (below) records Infrastructure contracts awarded under Chief Executive and General Manager delegated authority.

Attachment 1 provides a summary of the award process for each contract and a brief description of the works being undertaken.

1. Transportation		Summary
CON25023	Contract Award: Wairahi Road Surface Drainage Improvement	Contract for CON25023 - Wairahi Road Surface Drainage Improvement be awarded to Asset Construction Ltd for \$155,784.75 excluding GST. This tender is to improve the existing road surface drainage and repair vehicle crossing levels. Eight tenders were received with a range of prices from \$155,784.75 to 327,045.61. Engineers Estimate was \$121,764.

2. Parks and Recreation		
CON25024	Contract Award: Morningside Sports Park Drainage	Contract for Morningside Sports park drainage CON25024 awarded to Green By Nature Ltd for the tendered sum of \$334,371.14 excluding GST plus a risk management fund of \$35,000.00 excluding GST. Maximum contract value of \$369,371.14 excluding GST. An Open Tender process was followed with two tenders received. The Contract price is 71% of the Engineers Estimate \$470,841.00
3. Waters		
CON24022	Contract Award: Mair Street to Rurumoki Street Stormwater Renewal	Contract for Mair Street to Rurumoki Street Stormwater Renewal (CON24022) awarded to Fulton Hogan, based on their submitted schedule of rates, with an estimated contract value of \$1,649,514.26 + GST. Final payment will be based on actual measured quantities in accordance with the measure and value contract terms. The scope of this contract is flood mitigation at Mair Street and neighbouring private properties, particularly 1/85 Hatea Drive, Regent, Whangarei. Registration of Interest resulted in six tenders with three suppliers shortlisted for the Request for Proposal. The Engineer's Estimate was \$2,109,271.74
N/A	Contract Award: Project Management Resource	Contract for Project Management Resource be awarded to Hoskin Civil for \$274,000 excluding GST, for the services of secondment from Hoskin Civil during the 2025/26 financial year. This project manager from Hoskin Civil has been working as a Council-embedded resource since June 2023. They have managed multiple projects, including the alternative discharge workstream of the Ruakaka Wastewater Treatment Plant, the Northern Growth Flood Resilience Stormwater Attenuation project, and the Kioreroa Road wastewater rising main project. Their contribution has been essential in progressing these projects, and they have also supported the team with specific tasks on other projects during periods of high workload.

4 Discussion / Whakawhiti kōrero

Report is for noting only – no decision is required from the Infrastructure Committee.

4.1 Financial/budget considerations

Financial considerations are applied at contract award stage.

5 Significance and engagement / Te Hira me te Arawhiti

The decisions or matters of this Agenda do not trigger the significance criteria outlined in Council's Significance and Engagement Policy, and the public will be informed via agenda publication on the website.

6 Attachments / Ngā Tāpiritanga

1. Summary of Contracts Approved Under Delegated Authority – July 2025

Summary of Contracts Approved Under Delegated Authority

This attachment provides a summary of the award process and works being undertaken for Infrastructure contracts awarded under Chief Executive and General Manager delegated authority.

1 Transportation

CON25023
Contract Award: Wairahi Road Surface Drainage Improvement

General Manager Approval

It is recommended that the contract for CON25023 - Wairahi Road Surface Drainage Improvement be awarded to Asset Construction Ltd for \$155,784.75 excluding GST.

Background

WDC has received recurring flooding complaints from 15,17 and 23 Wairahi Road. The properties are affected by surface water runoff spilling from Wairahi Road due to the unfavourable road geometry.

Procurement Process

This tender is to improve the existing road surface drainage and repair vehicle crossing levels.

Scope of Procurement

This procurement is for the installation of a section of Kerb & Channel, catchpits and associated connecting pipes and regrading vehicle crossings for 15, 17 and 23 Wairahi Road to contain road drainage within road corridor, reduce flood frequency and intensity of primary stormwater flows.

Procurement Method

Lowest Price Conforming method was used. This was as open tender advertised on GETS.

Tenders Received and Evaluated

The Lowest Price Conforming (LPC) method is considered suitable for this project. The works are generally simple to construct and are considered relatively low risk.

Attributes to be evaluated are;

- Relevant Experience (Pass/Fail),
- Relevant Skills (Pass/Fail),
- Methodology (Pass/Fail),
- Programme (Pass/Fail).

The price shall be 100%.

Tenders Received

Eight submissions were received from the following tenderers:

- Asset Construction Ltd
- Red Dell Ltd
- Donovans Drainage and Earthmoving Ltd
- WM Construction Ltd

- Robinson Asphalts
- Ventia NZ Operations Ltd
- Clements Contractors
- Downer NZ Ltd

Asset Construction Ltd offered the lowest tender price of \$155,784.75 and Downer NZ Ltd offered the highest tender price of 327,045.61.

The Engineer's Estimate was for \$121,764.00.

Evaluation Method

The tender was evaluated using the Lowest Price Conforming method.

The lowest price was from Asset Construction Ltd.

Their price was checked and found to be complete and accurate.

The submission contained tags which were evaluated, and one tag was removed via Tender Clarification 01.

No price adjustments were made.

Financial Details

This is a shared activity between the roading and stormwater team. The cost of this project is to be split between the available budgets - stormwater budget for road catchpits and pipes (approximately 34% contract value) and roading budget for kerb & channel installation and vehicle crossing adjustments (approximately 66% contract value).

	Stormwater	Roading
Available Budget:	\$288,120.00	\$308,700.00

2 Parks and Recreation

CON25024

Contract Award: Morningside Sports Park Drainage

Chief Executive Approval

That the contract for Morningside Sports park drainage CON25024 be awarded to Green By Nature Ltd for the tendered sum of \$334,371.14 excluding GST plus a risk management fund of \$35,000.00 excluding GST. Maximum contract value of \$369,371.14 excluding GST.

Background

In February 2021 Council adopted the Active Recreation & Sport strategy (the Strategy) to provide a high-level direction for WDC on how to meet current and future active recreation and sports facility needs for the District.

The 2022 Sports Field Supply and Demand study determined a critical shortage of sports fields with the options to meet the shortfall in field capacity by increasing the capacity of existing fields. This is identified as improving the drainage in an un-drained field.

Morningside Sports park drainage improvement is aligned with this strategy and was included in the 2024 Long Term Plan.

Procurement Process

An Open Tender process was followed which. opened on 30th May 2025 and closed on 4th July 2025.

Tenders Received and Evaluated

2 tenders were received from the following companies:

- Green By Nature Ltd
- TIC Contracting Limited Ltd

The tenders were evaluated using the weighted attributes methodology.

The tender evaluation took place on 14th July 2025 and consisted of the following panel members.

- Harsheel Patel (WDC)
- Sarah Snowden (WDC)
- Darren James (Hoskin Civil Ltd)

Both tenders conformed to the prerequisites of the tender.

TIC offered an Alternative Price for the use of non-specified sand (Tomarata sand).

Green By Nature were contacted during evaluation to confirm sand specification met the technical specification requirement. Green By Nature confirmed the price was for the use of a non-specified sand (Hansen washed sand).

SSDM (Designers) were contacted post evaluation to provide a comparison between the sands and confirmed that the properties of the Hansen washed sand for drainage was superior to Tomarata sand.

The evaluators concluded that Green By Nature Ltd were the successful supplier.

Tenderer	Non Price attributes score	Score with Price included	Tendered Price	Position post Evaluation (ex GST)
Green By Nature Ltd	369	709	\$334,371.14	1
TIC Contracting Ltd	410	650	\$492,119.52 (Alt \$420,158.28)	2
Engineer's Estimate	N/A	N/A	\$470,841.00	N/A

The Contract Price is comparable to the Engineers estimate undertaken in May 2025.

The main difference in price between the two contractors is attributed to the value associated with supply of sand. TIC Ltd sand rate equated to \$191 per m³ (Alt \$105 per m³) whereas Green By Nature sand rate equalled \$73.38 per m³.

The Contract price is 71% of the May 2025 Engineers Estimate \$470,841.00 and is indicative of today's market values.

A contingency of \$35,000.00 excluding GST will be allowed for in the Contract. This will only be used at the direction of the Engineer for unforeseen circumstances and payments warranted within the Contract.

Financial Details

The budget for Morningside Sports Park Drainage is sufficient to award the contract for the tendered amount:

Account	Amount (excl. GST)
PJ-00994-CX-6480	\$476,558.00

3 Waters

CON24022

Contract Award: Mair Street to Rurumoki Street Stormwater Renewal

Chief Executive Approval

It is recommended that the contract for Mair Street to Rurumoki Street Stormwater Renewal (CON24022) be awarded to Fulton Hogan, based on their submitted schedule of rates, with an estimated contract value of \$1,649,514.26 + GST. Final payment will be based on actual measured quantities in accordance with the measure and value contract terms.

Background

Stormwater:

Whangarei District Council (WDC) has received complaints of habitable floor flooding from properties at 1/85 Hatea Drive and 85 Hatea Drive, Regent, Whangarei. An investigation into the flood mechanism revealed that the affected properties are within a major overland flow path. The flow path activates when runoff exceeds the capacity of the local catchpits and pipe network or when blockages occur.

Metis Consultants have designed a solution; to divert the majority of flows through an upgraded stormwater network from Mair Street to Rurumoki Street, including along Hatea Drive. The network along shall be upsized for a 10% AEP + climate change event, including high-capacity catchpits to meet primary and secondary flow levels of service.

Water Supply:

The cast iron public water main on the north side of Rurumoki Street is nearing the end of its design life. To make efficient use of local traffic management and contractor resources, the renewal has been brought forward to coordinate with the stormwater main upgrade, enabling shared trenching and cost efficiency.

Procurement Process

A two-stage tender process (EOI followed by RFP) was undertaken. Of the six suppliers who registered interest at the EOI stage, three were shortlisted and invited to submit proposals. All three submitted pricing, these have been assessed against the lowest conforming criteria.

Scope of Procurement

Flood mitigation at Mair Street and neighboring private properties, particularly 1/85 Hatea Drive, Regent, Whangarei. The scope of work includes the construction of approximately 290 meters of new concrete pipeline, ranging from DN300 to DN825 at the outlet. The pipeline will run parallel to the traffic lanes of Mair Street, Hatea Drive, and Rurumoki Street. The works include installation of new catchpits and manholes, connections into the existing line, and cut, cap and grout filling of abandoned lines. The contract includes the renewal of the Rurumoki Street watermain.

Procurement Method

Two step EOI/RFP open tender.

Tenders Received and Evaluated

Stage one EOI:

No.	Attribute	Weighting
1.	Health & Safety	Pass/Fail
2.	Financial Viability	Pass/Fail
3.	Track record/relevant experience	40%
4.	Methodology (managing key risks, quality and programme)	40%
5.	Key personnel and equipment	20%
6.	Price	Lowest Price Conforming

Stage two RFP:

Lowest price conforming.

Tenders Received

The registration of interest received these six tenders:

- Asset Construction limited
- Donovan Drainage Earthmoving
- Fulton Hogan Corporate
- Mako Civil Contracting
- Robinson Asphalts
- United Civil Construction limited

The evaluation team shortlisted three suppliers to take through to the RFP. The following suppliers were shortlisted:

- Fulton Hogan
- Robinson Asphalts 1992 Limited
- United Civil Construction Limited

In the request for price three completed tenders were received. The evaluation found Fulton Hogan to be the preferred tenderer, as they provided the lowest conforming price.

The following tendered prices were received:

Tenderer	Tendered price (ex GST)
Fulton Hogan	\$1,649,514.26
Robinson Asphalts	\$2,061,177.57
United Civil Construction	\$1,837,560.90

The Engineer's Estimate was \$2,109,271.74 + GST.

Within this tendered price the value of the Stormwater portion of the works is \$1,523,659.56, the value of the Water portion of the works is \$125,854.70.

Contract Risk Analysis

Risks and mitigation are outlined below.

Project Risk	Risk Description and Mitigation
Services Clash	- The pipe is a relatively large diameter and will need to be constructed to avoid existing services in the road corridor or could require expensive service relocation. - Mitigation: GPR and topographic survey completed to locate majority of services.
Works on major road	- Part of the works are located on a main road (Hatea Drive) and will result in disruption. - Mitigation: Ensure traffic management plan in accordance with the provisions of NZGTTM and where appropriate the Local Roads Supplement is followed to minimise disruption to road users. Advance public communication shall be undertaken for road closure. Timing considerations are included in the contractor's construction programme
Programme and adverse weather	- Project includes excavation works that may be affected by weather. - Weather conditions may impact programme. - The quality of some work, such as road reinstatement, may be compromised by weather. - Adverse weather may cause environmental issues, such a poor water quality. - Mitigation: Consider programme flexibility to enable final reinstatement in good weather. Consider whether construction methodology can reduce the impact of adverse weather (e.g., material selection, task prioritisation, effort and resourcing). Use of sediment and silt controls at inlets to stormwater drains.

Financial Details

A budget of \$1,740,640 is allocated to this stormwater projects in the 2024/25 Financial Year. This is more than what is required for the \$1,523,659.56 stormwater portion of this contract.

This budget is currently allocated across multiple PJ accounts, upon contract award approval the budget shall be moved to the Mari/Rurumoki PJ account.

The \$125,854.70 water renewal component of this project will be funded through the Water reticulation renewals budget, PJ01066.

Contract Award: Project Management Resource

Chief Executive Approval

It is recommended that the contract for the Project Management Resource be awarded to Hoskin Civil for \$274,000 excluding GST, for the services of secondment from Hoskin Civil during the 2025/26 financial year.

Background

In recent years Council has had consultant project managers take on a portion of Council's major projects, acting as internal project managers. This is to help manage workloads and cover gaps in internal resourcing.

The Waters Projects and Administration Department is currently managing 24 active projects, with an additional six projects awaiting assignment. The department is allocated four Project Managers and a Department Manager, of this one Project Manager role and the Department Manager role are vacant. Two consultants are assisting the three Council Project Managers, but the workload still exceeds the team's capacity. Approval is being sought to extend the contracts for these existing project managers, this procurement plan is for the secondment.

This project manager from Hoskin Civil, has been working as a Council embedded consultant project manager since June 2023, usually working 30 to 35 hours per week. They have managed multiple projects, including the alternative discharge workstream of the Ruakaka Wastewater Treatment plant, the Northern Growth Flood Resilience Stormwater Attenuation project, and the Kioreroa Road wastewater rising main project. Their work has been essential in progressing these projects and she has also supported the team with specific tasks on other projects during high workload times.

Previous procurement approvals for Hoskin Civil have included a \$500,000 two-year contract for project management consultants. That contract started in May 2023 and was extended for an additional 12 months in June 2024 to June 2025.

A procurement plan and variation to the procurement policy have approved an additional year of project management, through Hoskin Civil, to address the ongoing resourcing shortfall. An additional year will ensure continuity in project management and help manage the projects workload across the Waters Group.

This recommendation to award requests approval of a \$274,000 purchase order and agreement, to allow for an average of 117 hours worked per month, the average hours worked for Council in the 24/25FY. If additional work hours are requested to cover resourcing shortfalls a recommendation to increase this contract value shall be made, an approved procurement plan allows a contract value of up to \$333,450.

Procurement Process

Direct Source, this method was approved in the procurement plan and variation to the procurement policy signed on 1/7/25.

Scope of Procurement

Experienced Project Manager with knowledge of Council systems and project background, existing relationships and suitable skills.

Contract Risk Analysis

Perceived conflict of interest:

Direct sourcing an existing Consultant Project Manager could be perceived as a conflict of interest. When this resource was originally sourced available local resources were reviewed and the consultant from Hoskin Civil was chosen for their appropriate skills and suitability for the role, at the time they had not worked with the team members that were involved in this procurement. They remain well suited and skilled for this role and are now also integrated into Council and have a knowledge of Council's systems and processes.

Dependency Risk:

Over-reliance on a single consultant can create a bottleneck if they become unavailable or leave the project unexpectedly. Project documentation is saved to Kete to mitigate this risk. This risk exists for any team member that may choose to leave.

Perception from stakeholders that Council is not fully represented by a consultant.

Integrated consultants provided with Council email address. Support from Council staff and management is available as required.

Financial Details

Individual projects shall fund project management costs. Project management hours shall be capitalised against projects, where allowed for within the Capitalisation Policy.

Work shall be charged at an hourly rate of \$195 per hour.

A maximum value is set at \$274,000, this allows for approximately 117 hours of chargeable work per calendar month. On average, in the past year, they have worked 117 hours month on Council projects. It is expected that an increase to this awarded value shall be requested later in the financial year, if required additional budget shall be allocated at that stage.

Three main projects are allocated to the secondment for the 25/26 financial year. Any additional time that the secondment has available would be used on other projects that require additional resourcing, each project budget would be used for any hours worked on each particular project.

Project	PJ	25/26 FY Budget – Purchase Order for Approval
Ruakaka wastewater treatment plant upgrade	01070-CX-6480 01075-CX-6480	\$169,650.00
Northern Growth Stormwater Attenuation	00957-CX-6480	\$81,900.00
Kioreroa Road Wastewater rising main renewal (stage 2)	Wastewater renewals budget, project specific PJ to be allocated.	\$22,450.00
Total:		\$274,000.00

6.2 Transportation and Community Infrastructure Operations Report – September 2025

Meeting: Infrastructure Committee
Date of meeting: 18 September 2025
Reporting officer: Jim Sephton (General Manager - Transport & Community Infrastructure)

1 Purpose / Te Kaupapa

To provide an overview of Operations that the Infrastructure Committee is responsible for.

2 Recommendation / Whakataunga

That the Infrastructure Committee notes the September 2025 Operational Report for:

- Transportation
- Community Infrastructure

3 Background / Horopaki

In November 2022, the Council adopted committee terms of reference 2022-2025 triennium, with the purpose of the Infrastructure Committee being to 'oversee the management of the council's infrastructural assets, utility services and public facilities. These reports provide the Committee with a summary of Infrastructure operations during September 2025.

3.1 Financial/budget considerations

Financial information is included in the Capital Programme Finances which is presented at the Finance Committee.

Financial information at a project level will be provided through the Project Lifecycle Management system.

4 Significance and engagement / Te Hira me te Arawhiti

The decision or matters of this Agenda do not trigger the significance criteria outlined in Councils Significance and Engagement Policy, and the public will be informed via Agenda publication on the website.

5 Attachments / Ngā Tāpiritanga

Attachment 1 – Transportation Monthly Report (statistics for July 2025)
 Attachment 2 – Community Infrastructure Monthly Report (statistics for July 2025)

Monthly Report

Transport

September 2025
(statistics to 31 July 2025)

Transport and Community Infrastructure – Monthly Report

Reporting Officer: Jeff Devine (Department Manager - Transportation)

Meeting Date: 18th September 2025

Contents

1	Executive Summary	3
2	Health and Safety	4
3	Customer requests and feedback	6
4	Strategy and Planning	7
5	Performance	8
5.1	<i>Performance Measures</i>	8
5.2	<i>Network Performance</i>	9
5.2.1	<i>Road Safety</i>	9
5.2.2	<i>Active Modes</i>	9
5.2.3	<i>Locky Docks</i>	10
6	Key Activities	11
6.1	<i>Network Coordination Team</i>	11
6.2	<i>Road Maintenance & Renewals Contracts</i>	13
6.3	<i>Active Transport</i>	21
6.4	<i>Road Safety</i>	24
6.4.1	<i>Speed Management</i>	24
6.4.2	<i>Te Maika Road / Ngunguru Road Intersection</i>	24
6.4.3	<i>Road Safety Promotion activities</i>	24
7	Contractor Performance	29
7.1	<i>Maintenance & Renewal Contracts</i>	29
7.2	<i>Monthly Performance Management</i>	29
8	Significant Risks and issues	30
9	Capital Work	31

1 **Executive Summary**

This report covers the operational and capital works for the month of July 2025

Planning

Focus has been on the public consultation phase of the Parking Strategy and Draft City Centre Parking Plan. The consultation Phase has now closed.

Maintenance

This month marked the successful commencement of the new district-wide road maintenance contracts. A primary focus has been the critical setup and mobilisation phase, with significant effort dedicated to aligning expectations with our contracting partners for maintenance patrols across the network.

A total of **3036** dispatches (individual works items) were completed across the network between 30 June 2025 and 31 July 2025 (cf **3366** for June). Totalling **\$1,569,867.27**

Capital Programme delivery

Resealing works planning and programming is well underway. Start dates for works expected in September pending weather.

Pavement rehabilitation design is well underway. Tender packages have started to be released to the market.

Rose Street Bus is on schedule to opened 8th of August.

The Springs Flat Project is a significant portion of the upcoming work, and the construction phases are progressing well. Phase 2 of Springs flat roundabout has been tendered.

2 Health and Safety

Statistics for the Transportation Department – July 2025

No Significant incidents recorded for the month of July. All 3 injuries were minor in nature.

<i>Type of incident</i>	<i>Employee reported incidents</i>	<i>Contractor reported incidents</i>	<i>Member of the public reported incidents in our workplaces</i>	<i>Totals</i>
WorkSafe notifiable incident	0	0	0	0
Lost time injury (LTI)	0	0	0	0
Medical treatment injury (MTI)	1	0	0	1
Minor injury	1	1	0	2
Pain and discomfort report	0	0	0	0
Stress and fatigue	0	0	0	0
Incident – Occupational health exposure	0	0	0	0
Near miss incidents	0	5	0	5
Incident - Security	1	0	0	1
Incident – Vehicle related	1	4	0	5
Incident – Property damage	0	4	0	4
Incident – non work medical condition affecting the worker or person	0	0	0	0
Totals	4	14	0	18

Employee reported incidents

One minor office-related cut and a slightly more serious finger injury from a falling clegg hammer. Also, a Council vehicle backed into by a member of the public and a Council staff member being verbally accosted at Bascule carpark.

Public incidents

No member of the public incidents recorded for the month.

Safety observations

Type	Employees	Contractors
New Hazard	0	3
H&S Concern	0	0
H&S Success	0	4
H&S Suggestion	0	0
Total	0	7


Physical inspections

There is an internal requirement for physical health and safety inspections of sites to be undertaken at least monthly. Below is a table of inspections done by Transportation.

Type of monitoring	
HS016 – Full site inspection	1
HS102 – Be safe engagement	2
HS030 – Site spot check	20
HS140 – TTM site	20
Total	43

3 Customer requests and feedback

In July 2025, the Transport Team received a massive 663 requests. Our contractors and staff closed off 618 of these requests which is a huge effort.

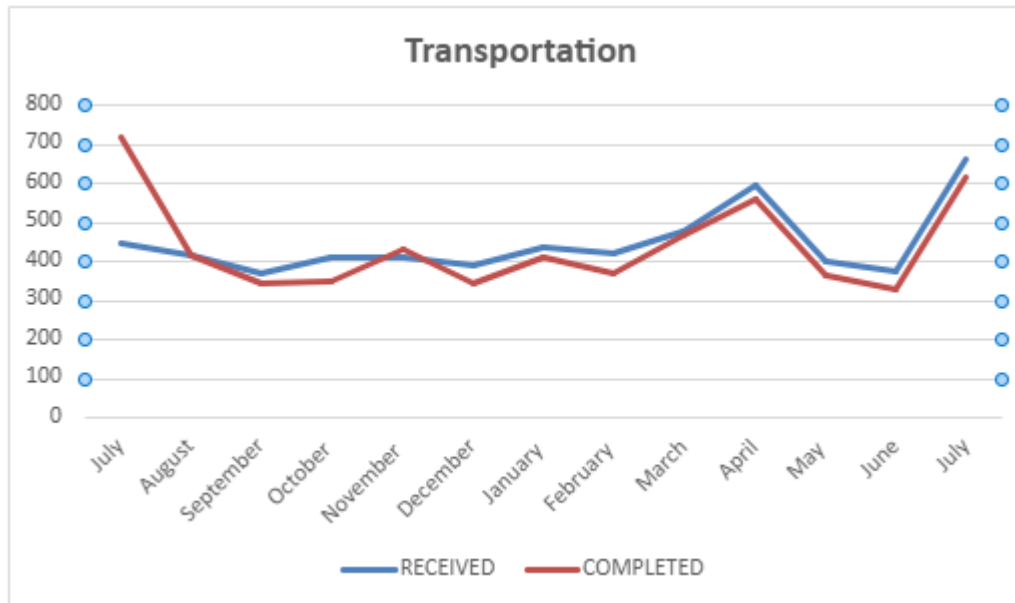

Road surface damage and maintenance	278
Clear blocked drain and culverts	52
General Roding	50
Tree Maintenance requests and enquires	48
Road structures damage and maintenance request	39
Road Lighting and other electronic roading systems	36

Compliments

RDG2524437 – Marsden Bay Drive	5 out of 5 stars!! - Ventia
RDG2523976 – Pipiwai Road	5 out of 5 stars!! - Traffic Safety Team
RDG2523936 – Dundas Road	Thank you all!!! - Traffic Safety Team
RDG2523901 – Crow's Nest Road	Quick appropriate action taken – Fulton Hogan

4 Strategy and Planning

Transport Infrastructure strategy and planning actions for July 2025

- Point of Entry (PoE) for Whangarei City and Bream Bay Programme Business Case (PBC) submitted to NZTA for formal review. Next steps to develop the Whangarei City and Bream Bay PBC which will inform the 2027-37 LTP and RLTP.
- Updating the Whangarei Walking and Cycling Strategy (adopted 2015) to incorporate recent business cases (Walking and Cycling, Public Transport) and other recently adopted strategies (such as FDS)
- Develop business case for Parking as a Service (PaaS) 10-year contract to manage both parking fees and parking enforcement.
- Drafting parking supply feasibility report
- Investigation phase of joint WDC / NRC park and ride feasibility report
- Drafting 2027-30 Activity Management Plan

5 Performance

5.1 Performance Measures

Our District's roading network will be maintained in a satisfactory condition and in accordance with national safety and engineering standards.

Performance Measure	2025 – 26 targets	Compliance
The change from the previous financial year in the number of fatalities and serious injury crashes on local road network, expressed as a number. (*does not include roads administered by Waka Kotahi/NZTA)	≤0	N/A Results due in September *Measured annually
The average quality of a ride on a sealed local road network, measured by smooth travel exposure.	≥84%	Last Yrs result 80% * Not Achieved Trend worsening due to impacts of flood damage over recent years
The percentage of the sealed local road network that is resurfaced.	≥9%	Last Yrs result 7.3% * Not Achieved Trend worsening due to reduced funding from NZTA
The percentage of the sealed local road network that is rehabilitated.	≥0.7%	Last Yrs result 0.51% * Not achieved Trend worsening due to reduced funding from NZTA
The percentage of customer service requests relating to roads and footpaths to which the territorial authority responds within the time frame specified in the LTP.	≥65%	Last Yrs result 91.3% Achieved Improved result due to process improvements

We will support alternative transport methods.

The percentage of footpaths within a territorial authority district that fall within the level of service or service standard for the condition of footpaths that is set out in the territorial authority's relevant document (such as its Annual Plan, Activity Management Plan, Asset Management Plan, annual works programme or LTP).	≥ 98% in fair or better condition	Last Yrs result 98% * Achieved Measured by annual condition survey
Total length of footpath network provided compared to requirements of Council Engineering Standards.	≥ 56% of network provided	Last Yrs result 59% * Achieved Standards require footpath 2 sides of urban sealed roads.

*Note This year's Annual Results not available yet.

5.2 Network Performance

5.2.1 Road Safety

Year to date fatal injuries – 2021 to 2025

Year	2021		2022		2023		2024		2025	
Road Type	SH	LR	SH	LR	SH	LR	SH	LR	SH	LR
Number of Fatal's	3	2	3	6	6	6	7	5	2	2

SH – State Highway, LR – Local Road


No fatal crashes for the month of July

5.2.2 Active Modes

Cycling, walking, scooting and other mobility (mobility scooters and other active modes of transport) counts continue to be monitored across the shared path network.

July 2025 saw a net zero increase in movements across the network compared to July 2024. Pedestrian movements saw a small increase of 8% on the year prior.

Shared Path Use

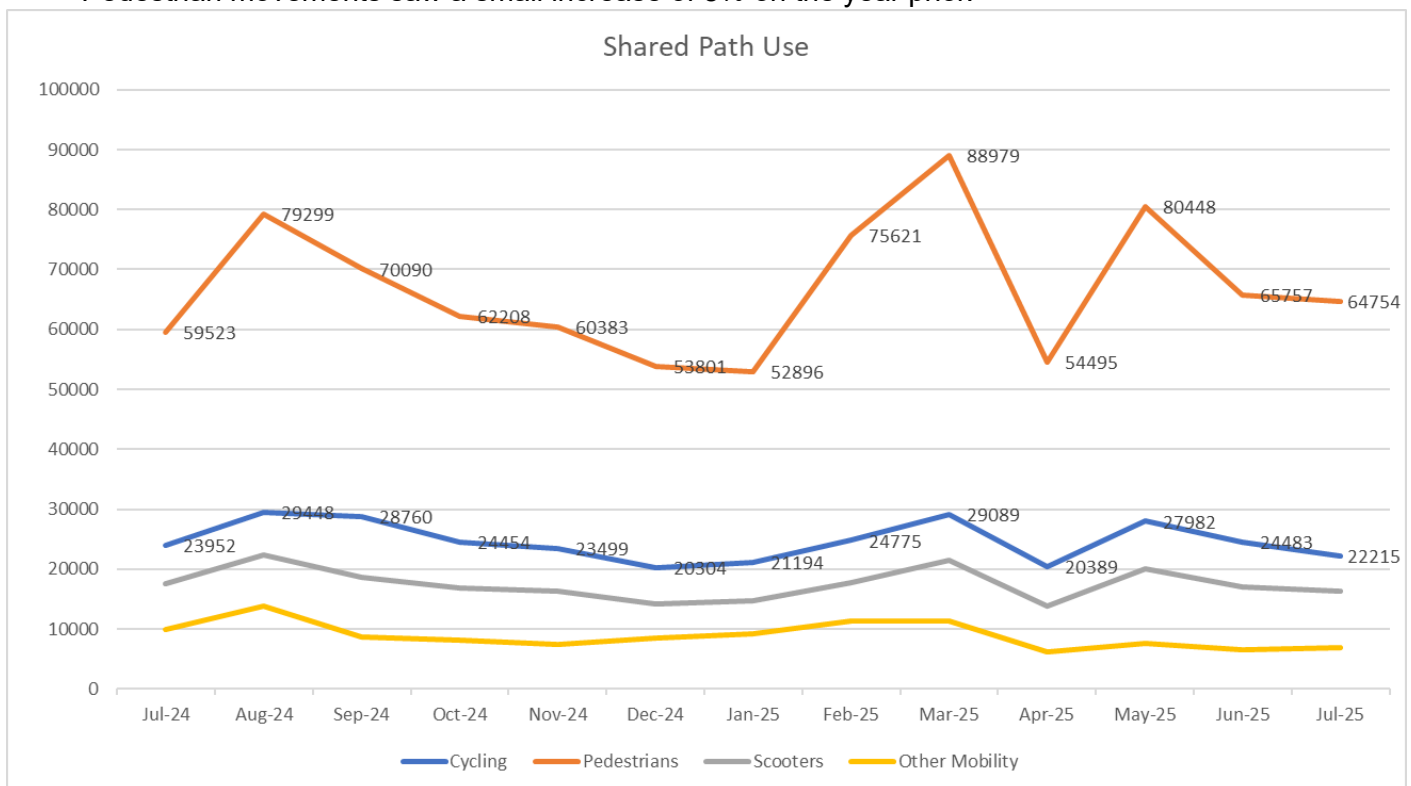


5.2.3 Locky Docks

There is currently a total of 89 individual bike parks across ten Locky Dock secure bike parking sites. Usage across the network continues to increase and soon there will be enough data to start building an annual comparison. Note the decrease in April, where there was over 400ml of rain, four times the usual April average.

Locky Dock Usage

Total parking sessions by month

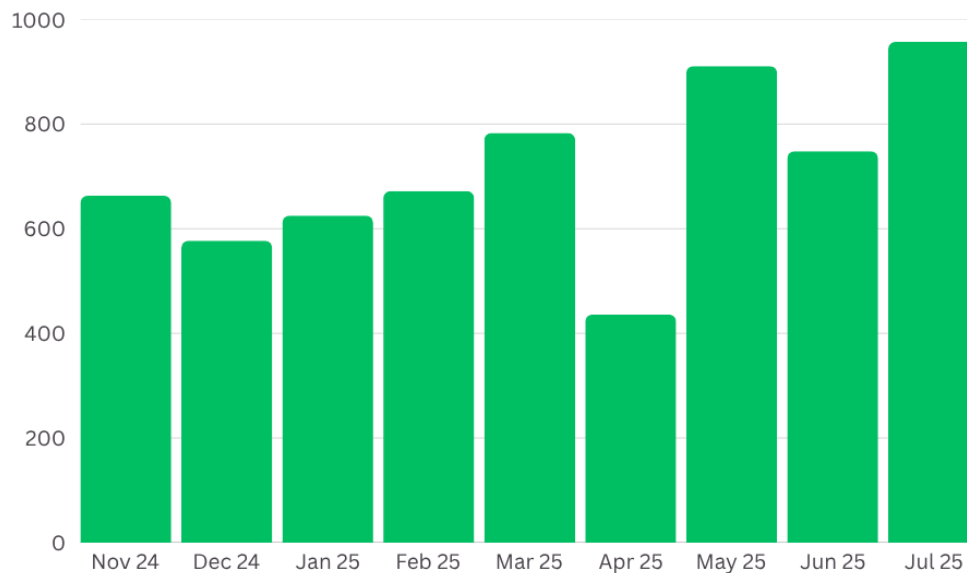

Total of 7412 bikes parked to date

6 Key Activities

6.1 Network Coordination Team

General

A couple of major projects concluded with lessons / **experiences to be shared**.

Pipe replacement between the Parua Bay Golf Club and Parua Bay Tavern. With the rapid adoption of NZGTTM, WDC pioneered how an impactful project can be successful engaging early consultation with interested parties, collaborating and coordinating (referred to as the 3 Cs in the NZGTTM). It provided the ability to be flexible and adopt TTM practices that under CoPTTM would not have been considered.

Conversely the T2 Transit (Bank / Kamo Rd) differed from the Parua Bay project. There were inefficiencies about consultation, collaboration and coordination which lead to congestion issues in the carriageway or footpath. The project may have profited by adopting the 3Cs early with all interested parties rather than an ad hoc approach. This is a tight piece of corridor network that impacted businesses, buses, pedestrians and approx. 16,000 vehicle movements per day.

Assurance Checks

Twenty site visits / assurance checks completed in July; coaching / mentoring for those checks included:



- Safe TTM reduction remains challenging; 25 years of measured auditing where TTM practicality was not an option will take time to change
- A dictatorial approach under NZGTTM may place risk on WDC; our engagement will remain consultative
- Several CARs from one TTM supplier (national presence based in the 'Tron) are being placed on hold to encourage them to adopt simpler NZGTTM aligned TTM designs and including a simpler TTM proforma
- In general, we are noting from the majority of TTM design suppliers a concise move to risk assess and design for a safe and practical solution
- The 20 sites visited confirmed that to get change we need to visit as many sites as possible; the submitted plan on the ground is often "busy" with TTM. Once the site is physically established, we are encouraging a TTM risk assessment to ensure that it safe, practical and what is deployed is necessary.
- We are engaging with TTM staff; we recognise that some contractors will do what they want to do anyway which frustrates the TTM crews, so we are encouraging them to call us for intervention

Road Cone Hotline

Five reports in July; 50% reduction from previous month:

- Cones thrown into the sea @ Ngunguru which have been retrieved
- Two referred to NZTA as a State Highway
- One emergency overnight water job; reviewed with the traffic management company and agreed that the three-way manual control option was required based on where the fault was
- Waters job; one week prior to the MOP reporting this we identified this site to the contractor. We requested that they risk assess the necessity of the TTM. The site was reduced
- Telco job: again, approximately a week earlier we raised this with the contractor, and again once we advised it had been reported into the Cone Hotline they risk assessed and removed

This confirms that we are advising TTM companies and contractors sound practical advice; directing them to remove TTM is a risk to WDC, so we will continue our consultative approach.

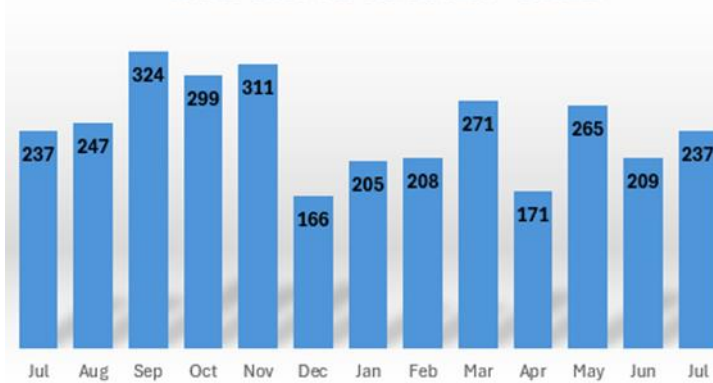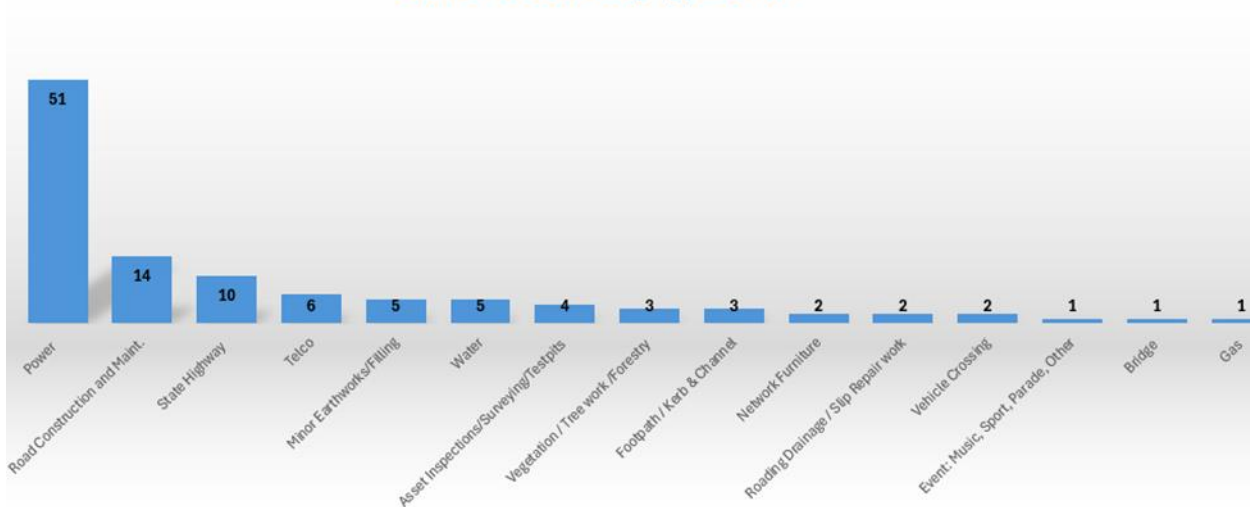CARs Received Jul 24 - Jul 25

CARs Processed by Type Jul 25


Work Type Status

Compliance is improving consistently with a reduction across the measurables; this is a reflection of the relationship and compliance management that the CAR Specialist has with the various companies.

	Sep	Oct	Nov	Dec	Jan	Feb	Mar	Apr	May	Jun	Jul
WIP	1388	1564	1659	1790	1843	1370	1404	938	928	827	668
Awaiting Completion Sign Off	29	83	121	181	188	110	33	15	38	16	7
Works in Warranty	2255	2252	2265	2251	2251	1571	957	540	481	452	417

6.2 Road Maintenance & Renewals Contracts

Key Achievements

This month marked the successful commencement of the new district-wide road maintenance contracts, 24053 and 24054. A primary focus has been the critical setup and mobilisation phase, with significant effort dedicated to aligning expectations with our contracting partners for maintenance patrols across the network.

To ensure a smooth transition and a shared understanding of service levels, a series of collaborative workshops were held (photo below of the presentation slides). These sessions brought Council and contractor teams together to review changes in the new contract and critically assess the first two weeks of patrol operations. This provided a valuable forum to discuss early successes and identify areas for improvement, covering key details such as 'find and fix' criteria, patrol frequencies, and the scope of maintenance activities. A strong emphasis was placed on the shared responsibility of all parties in the successful delivery of the contract and the overall health of our roading network.

In a practical application of this collaborative approach, Council's roading team conducted a hands-on alignment session with Ventia, focusing on best-practice techniques for sealed pothole repairs. This included a demonstration of a high-quality repair by a Council Network Supervisor to clearly establish the expected standard of workmanship.

Looking forward, collaborative programming sessions have commenced with both contractors to develop ongoing work programmes. These programmes are being informed by joint network inspections of future reseal and unsealed road rehabilitation sites, a process designed to foster joint ownership of network outcomes and ensure we are delivering the right treatments at the right time.

- A total of **3036** dispatches (individual works items) were completed across the network between 30 June 2025 and 31 July 2025 (cf **3366** for June). ○ Totalling **\$1,569,867.27**
- **16** individual work items audited in July, of which **2** were found to not be up to standard, resulting in held claims, and rework ordered.
- Audit outputs for the month were below target due to a necessary reprioritisation of resources. The transition to new contracts required a significant focus from our inspection team on establishing work programmes and clarifying new roles and responsibilities with contractors. This, along with unavoidable staff absences, meant that available resources were directed to these functional tasks over routine audits during this transitional period.
- Works delivered across 734 out of 1498 local roads giving 49% network coverage by road count, **or 72% network coverage by road length for July**

Duty of Care

The primary aspects of this staff's work will be to ensure that the road is safe for the public. It is the duty of care to ensure that the road is safe for the public.

Within the scope of the Council's Duty of Care, it is the responsibility of the staff to ensure that the road is safe for the public.

- **Other Council Assets (Public Domain Assets):** The staff will ensure that the road is safe for the public by ensuring that the road is safe for the public.
- **Utility Assets (Power, Water, etc.):** The staff will ensure that the road is safe for the public by ensuring that the road is safe for the public.
- **Third Party Assets (e.g. Motor Vehicles, etc.):** The staff will ensure that the road is safe for the public by ensuring that the road is safe for the public.

It is the responsibility of the staff to ensure that the road is safe for the public.

- **All Staff:** All staff will ensure that the road is safe for the public by ensuring that the road is safe for the public.

It is the responsibility of the staff to ensure that the road is safe for the public.

- **Unacceptable Safety/Environmental Issues:** If a safety or environmental issue is identified, the staff will ensure that the road is safe for the public by ensuring that the road is safe for the public.

It is the responsibility of the staff to ensure that the road is safe for the public.

If not you, then who?



Review of recent patrols



What is Maintenance Patrol (MP01)?

Primary Purpose:

- Day-to-day activities for safety, maintenance, and maintenance of existing assets.
- Checked for safety, correct acceptable service levels and high customer responsiveness.
- This is the first and last part of the day for the state of the network.

"First and Last" Operations:

- **Initiation:** Staff will ensure that the road is safe for the public by ensuring that the road is safe for the public.

Proactive & Responsive:

- Operates on a "first and last" basis.
- After consideration of the safety and environmental issues, the staff will ensure that the road is safe for the public by ensuring that the road is safe for the public.

Performance Criteria & Expectations

Expectations:

- The time taken to complete the work is sufficient to meet the specified time.
- The work is completed in a safe and secure manner.
- All work is completed in a safe and secure manner.
- The work is completed in a safe and secure manner.

Key Performance Indicators:


- Subject to regular audits by WDC staff to ensure compliance.
- Work completion is in a safe and secure manner.



Edge Markers

Table 1: Edge Marker Specifications for the Roadside Safety System (RSS) (WDC 10)

Marker Type	Height	Weight
Standard	1000	1000g
Standard	1000	1000g
Standard	1000	1000g
Standard	1000	1000g

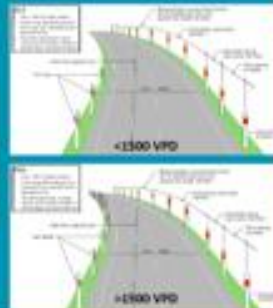

General Rules:

- The staff will ensure that the road is safe for the public by ensuring that the road is safe for the public.
- The staff will ensure that the road is safe for the public by ensuring that the road is safe for the public.
- The staff will ensure that the road is safe for the public by ensuring that the road is safe for the public.



Potholes

1. The immediate area surrounding the pothole must be excavated to completely remove all damaged material.
2. The rate of the excavation must be monitored at all times to ensure that the excavation is completed in a safe and secure manner.



3. The excavation process must be completed in a way that preserves the integrity of the adjacent pavement, structurally sound sections of the pavement.
4. A light touch of excavation must be applied to all surfaces that will be in contact with the pothole material to ensure proper bonding with the surrounding pavement.



Setting you up for success



Vegetation Envelope

WDC Maintenance Patrol
Initial Alignment Session



WDC Maintenance Patrol
Initial Alignment Session















July 2025 – All Works completion overview Works delivered across 734 out of 1498 local roads giving 49% network coverage by road count, or 72% coverage by road length for July

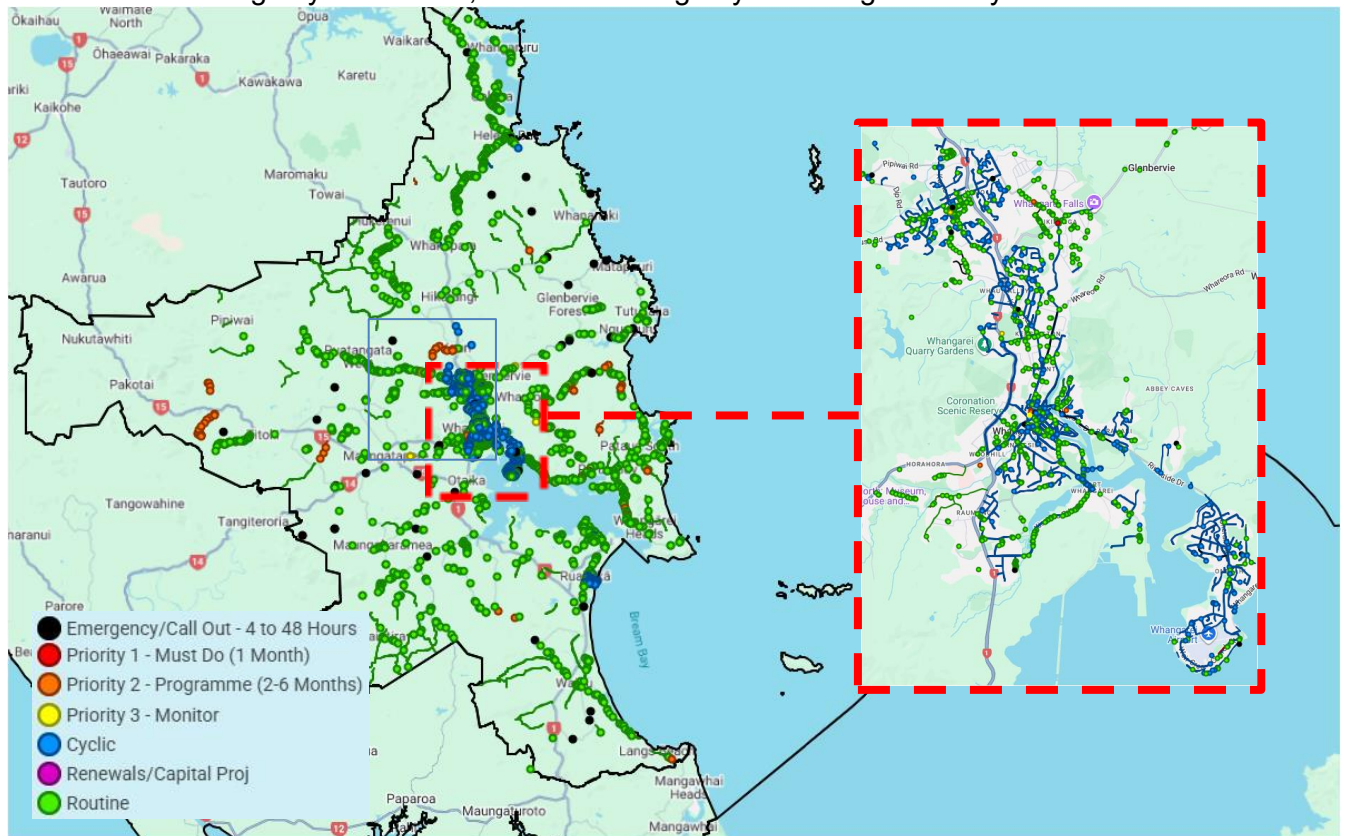

WDC Central routine works comparison between June 2025, and July 2025 indicating a strong start to the 'find and fix' Maintenance Patrol format.

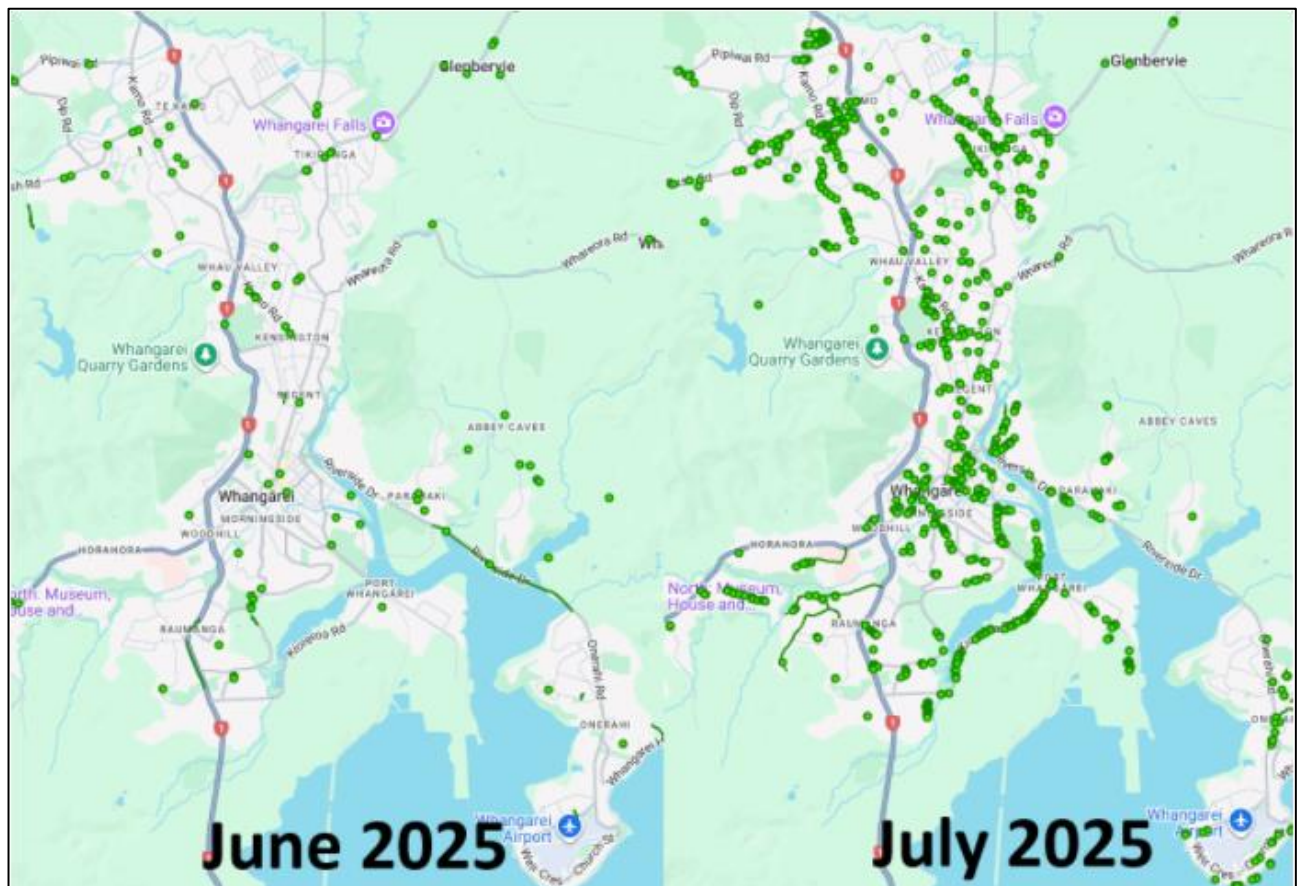

6.3 Active Transport

Bike Skills Training

Bike Northland Contract 24009 – delivering Cycle Skills in school and supporting the Bikes in School's program. Bike Northland also offer adult cycle skills which are covered in the Grade 1.5/2 category:

2025/26 Whangarei District Council		
Course	Contracted	YTD
Grade 1 (beginners)	1240	225
Grade 1.5 / 2 / Adults (intermediate)	500	71

A total of 296 students participated in Cycle Skills during July 2025.

- Grade 1 – 225 students (Morningside & Whangarei Intermediate)
- Blomfield School opportunities – one session at Bike Park.
- Hip hop holiday programme.
- Get2Go Challenge.

Bikes in Schools

- Bike fleet maintenance is being organised for schools with bikes for Term 4. This will be subsidised by Bike Northland.
- Early interest shows demand already exceeds the available resources in terms of Bike mechanic availability and funds, with 9 schools indicating they would like support.
- Teacher in charge of bikes at Onerahi School, Jade Grant, is moving to Hikurangi. Meeting first week in August with new teacher. Hikurangi School does have bikes so potential opportunity to increase the biking there.
- Bike Northland supported Morningside School Whanau Engagement evening by overseeing bike activity. This was very popular despite the limited space and the rain.
- Note Morningside bike parking equipment has arrived and will be installed by contractors onsite completing significant capital works.
- Blomfield School is interested in putting in a Bike Track at their Manu school. Site visit showed space is very limited, but there is an opportunity for a small track. Discussed the option to continue the school visits to Bike Park currently piloted. May need to look for some additional funding particularly to cover cost of use of Parafed Northland time and equipment.

Community Events

- Hillary Outdoors Get 2 Go – annual event for Year 9 and 10 students. This is a regional event offering students an opportunity to try adventure racing. The day includes biking, water activity and orienteering with the winning school gaining the opportunity to compete in the National event. Bike Northland run the bike challenge. Due to logistics and track challenges at Parihaka MTB Park this year the course was Cyclecross style and run at the Pohe Island Bike Park.
- Wheels Day – planning underway with a meeting held at the Bike Park with More FM and Pou Herenga Tai Twin Coast marketing manager.
- Silver Festival Group Ride – registration complete. At this stage planning similar route to last year but open for discussion. Comments from a previous participant was that they would like to go somewhere different. This is challenging given limited network.
- Design a Helmet competition – prizes for Highly Commended students distributed. Helmets have been completed by the artist and presentations started to winning students. Feedback has been extremely positive.



Whangarei Intermediate – Grade 1



Winning helmets

School Travel Planning

Following a pilot project in 2024, school travel planning is underway with further schools in the district. School travel planning seeks to alleviate safety and congestion challenges associated with students traveling to and from school.

Following the May school travel audit at Whangarei Primary, draft travel plans have been developed in collaboration with the school. These, along with some small infrastructure improvements, are with the school's senior leadership team for review.

Suggested routes to Whangarei Primary School

We can all work together to make it safer around our school.

- The school gates do not open before 8am.
- For student safety, we ask parents and caregivers to ensure children arrive at school after 8.30 am and leave the school grounds by 3.15 pm (unless enrolled in after-school care or supervised activities).
- Please only use the school gates on Bank Street and Cross Street. The gate on Apirana Ave is for staff and students with special needs only, and the shared path gate is kept locked at all times.



Private Bag 9033, Te Mai, Whangarei 0143, New Zealand

Te Iwitihi (civic centre)
Rust Avenue, Whangarei

Ruakākā Service Centre
Takutai Place, Ruakākā

P +64 9 430 4200 | 0800 932 463
 mailroom@wdc.govt.nz | www.wdc.govt.nz
 Facebook.com/WhangareiDC





SUGGESTED ROUTES TO SCHOOL



Here are some ways you can help make school travel safer:

- Plan your travel routes with your child/children.
- Park safely during drop off and pick up, even if you're in a rush. Parking illegally (eg on yellow dotted lines) endangers our tamariki.
- Lead by example – children learn by watching what we do. Try to be patient with other drivers, always cross at designated points and follow the road code.

Let's work together to make it easier at drop off and pick up times!

Most of our students arrive at school by car, which makes it very busy on the roads around our school.

If your child is in year 5 or 6, consider park and walk, which helps reduce congestion at the school gates. This is where you park a small distance from school and let your child walk the rest of the way using a safe route. We've marked out park and walk locations on our map with blue stars.

Please don't park on double yellows, across driveways or anywhere that makes it less safe for other people and children around you.

Please do not call your child across the road, instead encourage them to cross in the appropriate place. If needed, meet them at the school gate and walk with them to your car.

Need to turn around? Please use one of the side streets rather than u-turning in front of the school or turning into a driveway and backing into the street.




Legend

- Entry gates
- No entry gates
- Park and walk
- Kamo Shared Path
- Signalised crossing
- Zebra crossing
- Rail crossing – take care!



Draft brochure under review by school SLT

The travel audit for Whangarei Heads School has been completed, in response to several children cycling to school in an unsafe manner. Travel planning is on hold until the extent of the nearby footpath renewal / pipeline repairs are known as this is likely to impact any safe route choices.

Community led Cycle Trails

Waipu Trail – Staff are progressing an alternative design option that does not require land take. Construction planned for early mid-2025.

Bream Bay Trail – Letter of intent signed by Council and Bream Bay Shared Path Incorporated (BBSPI). Next steps are to formalise an MoU between Council and BBSPI and engage a Contractor to build the portion that Council is funding.

6.4 Road Safety

6.4.1 Speed Management

School Speed Limits – a Speed Management Plan for all category 1 and 2 schools is being developed in accordance with the Ministry of Transport Rule: Setting of Speed limits 2024. Consultation with schools to commence and NZTA where shared RCA frontages occur.

Ngunguru Catchment Speed Limits – Council will formally consult with community in 2026 on potential speed limit reviews of roads within the Ngunguru Catchment. Pending the outcome of consultation, any agreed changes will be implemented in 2026-27. The wider Tutukaka Catchment was previously consulted under previous version of the Setting Speed Limit Rule.

6.4.2 Te Maika Road / Ngunguru Road Intersection

Due to intersection insufficiencies with the existing right turn bay from Ngunguru Road into Te Maika Road, localised road widening will be undertaken to improve road safety by providing adequate space for all road users. This will include traffic calming on Te Maika Road outside Ngunguru Primary School. As part of the future speed limit review of Ngunguru Road the rural/urban speed threshold will be improved to manage crash risk from westbound vehicles traveling above the speed limit through Te Maika Road Intersection

6.4.3 Road Safety Promotion activities

Over 55 local freight operators and drivers turned up to the National Road Carriers and Northland Road Safety “Brake and Banter” road safety event on the 25th July 2025. Feedback was very positive as the participants found the presenters very informative and took away tools to help them while on our roads.

Lance Burdett from Warn International spoke on how our brain works and what to do when we feel anxious, distracted, and fatigued amongst other things. The NZ Police impairment unit and Commercial Vehicle Safety Team (CVST) gave an update on the oral fluid tested that is set to be implemented once it has received the final sign off. St John gave a reminder on first aid if you were to happen upon a car crash and how best to manage the scene.



Some of the comments received:

- "That was really informative I enjoyed learning the breathing techniques to help me chill out more as I get frustrated from some of the crazy drivers out there"
- "Going to try the sleep breathing exercise as am struggling"
- "That first aid lady was good made me rethink what I need to do as have come across a few nasties on the road".
- "Geez we are going to unfortunately see a few vehicles parked up when that roadside drug testing kicks off, but it's a good thing"
- "Lance was great found him good"
- "Great meeting, great presenters, when's the next?"
- "Shame should have brought others to this was good thanks!"

Early Childhood Road Safety Education

Following the Safe and Sustainable Transport Association conference in May, the road safety team was given the opportunity to emulate a road safety education book specifically for early childhood audiences. The original resource was developed by Rotorua Lakes Council. Working with the communications team, a road safety Pekapeka character was created for the road safety book. The Māori Outcomes team advised on the appropriateness of this choice and translated some messaging into Te Reo.

The team will look to test-drive the book in coming weeks, once child seat technician training has been completed. This means we can offer kindergartens and early childhood centres a wraparound road safety session with a story, road safety exercises (especially carpark and driveway safety for this age group), and also provide child seat checks for whanau. This work will proceed in partnership with Plunket and Northland Road Safety Trust.

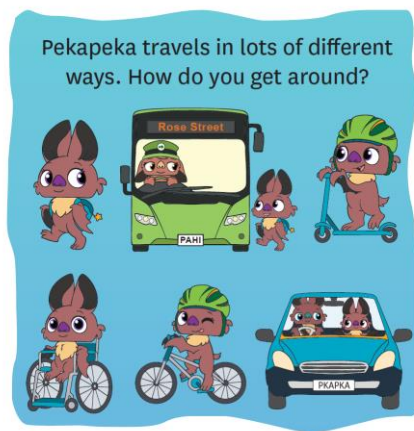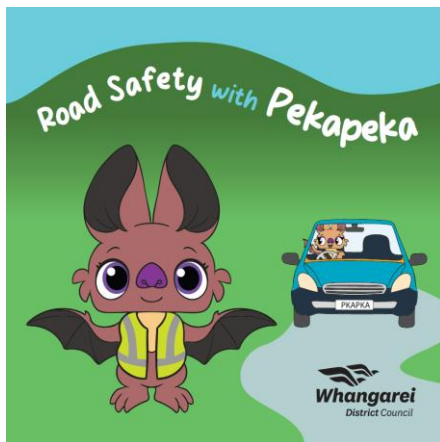

Example pages from the early childhood road safety book

Northland Road Safety Trust (Contract 21034) is contracted to deliver on road safety promotions activity and below is a summary of the Road Safety Promotion activities during the month.



Northland Rugby and Northland Road Safety Team Up to Tackle Drink Driving

NORTHLAND RUGBY IS PROUD TO ANNOUNCE OUR CONTINUED PARTNERSHIP WITH NORTHLAND ROAD SAFETY IN 2025, WORKING TOGETHER TO DELIVER A CLEAR AND CONSISTENT MESSAGE: TACKLE DRINK DRIVING.

THIS CAMPAIGN AIMS TO REDUCE ALCOHOL-RELATED HARM ON OUR ROADS BY PROMOTING SAFER CHOICES AND ENCOURAGING FANS TO PLAN AHEAD AND LOOK AFTER EACH OTHER. BY USING THE POWER OF SPORT TO SPARK IMPORTANT CONVERSATIONS, THE TACKLE DRINK DRIVING INITIATIVE IS BUILDING A CULTURE OF RESPONSIBILITY AND CARE, BOTH ON AND OFF THE FIELD.

WITH ALCOHOL-FREE ZONES AT ALL HOME GAMES, THE MESSAGE IS ALREADY EMBEDDED IN THE MATCHDAY EXPERIENCE. BUT WE'RE TAKING IT EVEN FURTHER THIS SEASON. THE TACKLE DRINK DRIVING MESSAGE IS NOW FRONT AND CENTRE ON-FIELD, ON A PLAYER'S SHIRT, ACROSS NORTHLAND RUGBY'S SOCIAL MEDIA, IN FAR NORTH CINEMAS, THROUGH PA ANNOUNCEMENTS AT GAMES, AND AT DEDICATED FAN ENGAGEMENT ZONES.

THROUGHOUT THE SEASON, THE NORTHLAND ROAD SAFETY TEAM WILL BE ON-SITE AT EVERY HOME GAME IN THE FAMILY ZONE. FANS ARE INVITED TO STOP BY, TRY ON THE IMPAIRMENT GOGGLES, PLAY A ROUND OF CORN HOLE, AND CHAT WITH THE TEAM ABOUT GETTING HOME SAFELY. THE GOAL IS TO CREATE MEMORABLE, FAMILY-FRIENDLY MOMENTS THAT DRIVE HOME THE IMPORTANCE OF HAVING A SOBER DRIVER AND LOOKING OUT FOR YOUR MATES.



THE FIRST GAME AT SEMENOFF STADIUM WAS A RESOUNDING SUCCESS, ENGAGING HUNDREDS OF MEMBERS OF THE PUBLIC AND DELIVERING POSITIVE ROAD SAFETY MESSAGES HIGHLIGHTING THE DANGERS OF IMPAIRED DRIVING ON OUR ROADS.

THE TEAM THAT ATTENDED THIS GAME WAS:

- NICOLE KORACH (WHANGAREI DISTRICT COUNCIL)
- ASHLEY JOHNSTON (NORTHLAND ROAD SAFETY TRUST)
- CALEY MCGILLVARY (WHANGAREI DISTRICT COUNCIL)
- PAT SUGRUE (WHANGAREI DISTRICT COUNCIL)

WE WILL BE ATTENDING ALL OF THE NORTHLAND GAMES THIS SEASON!




RIDE FOREVER MOTORCYCLE SAFETY PROGRAMME - JULY 2025

Motorcycle Safety Programme	Participants Attended
Bronze License Programme	3 out of 3 completed
Silver License Programme	N/A
Gold License Programme	10 out of 10 completed
Total YTD 24-25	163 completed



NGATIWAI EDUCATION DRIVER LICENSING PROGRAMME SNAPSHOT

July 2025

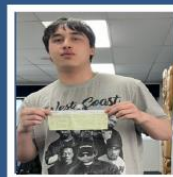

SAID (Stop Alcohol Impaired Driving) July 2025 Evaluations

Evaluation of the SAID course

1. What have you learnt in this course that you did not know about ALCOHOL?
How long it takes to process through your liver.

2. What have you learnt in this course that you did not know about ALCOHOL impairment?
How impaired you actually are at driving of alcohol.

3. What have you learnt in this course that will help you to NOT DRINK AND DRIVE again?
How to plan.

4. Did you find this course useful to help you stop drink driving?
No useful Moderately Useful Useful Very Useful

5. What in particular did you find most useful to help you stop drink driving?
Planning before you drink & always having more than one plan.

On a NINE (9) Scale Yes / No (circle one)

Evaluation of the SAID course

1. What have you learnt in this course that you did not know about ALCOHOL?
The amount of alcohol you consume - no one length of time it takes to leave your bloodstream - long per hour.

2. What have you learnt in this course that you did not know about ALCOHOL impairment?
How bad 800mg in a can impair & your judgement.

3. What have you learnt in this course that will help you to NOT DRINK AND DRIVE again?
How to make plans and take the consequences of drink driving 'on the spot'.

4. Did you find this course useful to help you stop drink driving?
No useful Moderately Useful Useful Very Useful

5. What in particular did you find most useful to help you stop drink driving?
The most useful is how long it takes for alcohol to leave your system and the consequences of drink driving.

On a NINE (9) Scale Yes / No (circle one)

Evaluation of the SAID course

1. What have you learnt in this course that you did not know about ALCOHOL?
The time alcohol takes to leave the body & the perspective of others in group.

2. What have you learnt in this course that you did not know about ALCOHOL impairment?
The vision/slower movements sometimes don't notice when you are impaired.

3. What have you learnt in this course that will help you to NOT DRINK AND DRIVE again?
Consequences!!!

4. Did you find this course useful to help you stop drink driving?
No useful Moderately Useful Useful Very Useful

5. What in particular did you find most useful to help you stop drink driving?
N/A

On a NINE (9) Scale Yes / No (circle one)

Evaluation of the SAID course

1. What have you learnt in this course that you did not know about ALCOHOL?
That 40g alcohol (one) takes it time to leave your system.


2. What have you learnt in this course that you did not know about ALCOHOL impairment?
Your vision is really worse than I thought.

3. What have you learnt in this course that will help you to NOT DRINK AND DRIVE again?
Be conscious, try to really not drink it.

4. Did you find this course useful to help you stop drink driving?
No useful Moderately Useful Useful Very Useful

5. What in particular did you find most useful to help you stop drink driving?
What not to bring off don't know.

On a NINE (9) Scale Yes / No (circle one)



DRIVER LICENSING PROGRAMMES - JULY 2025

		Passed	Active (getting Mentored)	YTD 24-25	# Of Mentors
People Potential Whangarei	Learners:	2 out of 2	N/A	70	N/A
	Restricted/Full:	3 out of 3	12	40	3
Howard League	Special License Endorsements:	5 out of 5 Class 2 9 out of 9 Class 6	55	93	3
Ngatiwai Trust:	Learners:	16 out of 16	N/A	87	N/A
	Restricted/Full:	26 out of 26	25	262	2
Kamo High School:	Learners/ Restricted:	5 out of 5 L+R + Defensive Driving	60 gateway students	48	2
Northern Health School:	NZQA Licensing Programme:	15 Learner Licenses	N/A	26	3

6.5 Maintenance & Renewal Contracts

Monthly Contractor Performance

Contract	Supplier	Performance	Comment
Road Maintenance (North)	Fulton Hogan	Meets Expectations	Both new maintenance contractors are meeting expectations, showing strong commitment through active engagement in mobilisation workshops and joint planning sessions. This collaborative start has established a positive foundation for the new contract term
Road Maintenance (South)	Ventia	Meets Expectations	Both new maintenance contractors are meeting expectations, showing strong commitment through active engagement in mobilisation workshops and joint planning sessions. This collaborative start has established a positive foundation for the new contract term
Parking Meter Maintenance	Mobicom	Good	No issues
LHBr Hydraulics	LC Hydraulics	Good	Bridge operations are being managed well & as expected.
LHBr Electrics	McKay Electrical	Good	Contractor working electrical maintenance as expected.
LHBr Operations	Northern District Security	Good	Bridge operations are being managed well & as expected.
LHBr routine cleaning and minor works	Whangarei Construction	Good	Contractor is always innovative and proactive; has done a great and timely job dealing with graffiti on site and managing tricky concrete works
Streetlight Maintenance	Currie Electrical Ltd (CSLi)	Good	Successful performance review with consistent quality and reliability.
Traffic Signal Maintenance	CSLi	Meets Expectations	CSLi are continuing to be proactive and innovative; difficult construction conditions are stretching their capacity.

6.6 Monthly Performance Management

A new Monthly Performance Management System is being introduced to the new maintenance contracts and new KPI's and performance requirements are being negotiated with the Contractors. The reports are being developed and will be completed to cover the first 3 months of the contract and will be reported back in October.

7 Significant Risks and issues

Risk event	Cause & Consequence	Controls and Mitigation
Cost increases result in reduction of maintenance and operation activities	Funding for M&O was reduced by Waka Kotahi at the start of the LTP. Cost escalations of circa 12% have further exacerbated these issues.	Reprioritise works Consider alternative investment paths – e.g., improved treatment of unsealed roads rather than unsubsidised seal extensions.

8 Capital Work

Delivery against Capital Programme

The Rose Street Bus Hub was opened on the opened 8th of August.

The Kamo Priority Lane roadworks & signalised crossings are complete and functioning. The enforcement cameras implementation is dependant on reaching an agreement with Auckland Transport (AT) delivery of the service agreement. A Business Case is being developed which will consider alternative options.

The Springs Flat Project is a significant portion of the upcoming work, and the construction phases are progressing. Phase 2 of Springs flat roundabout has been tendered.

Waipu Caves Road Bridge – Deck replacement completed

Kaiikanui Slip repair completed

Project updates

Transport Capital Projects	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
Port / Kioreroa Intersection Upgrade (CIP)	Deliver - Construction	Jul-22	Sept-25	
Roundabout pedestrian crossings and Kiwirail infrastructure is complete, a final completion certificate has been issued. RAG is Amber as the coordination of the software between pedestrian signals and Kiwirail signals has been further delayed by Kiwirail. The works to coordinate the signals is currently being undertaken by Kiwirail and is expected to be completed in August. Stockpiles on site are also likely to be respread in late August/early September. Contractor/Consultant: United Civil Construction / WSP				
Waterfront to City Centre Connection (John Street)	Deliver - Design	TBC	TBC	
The project has been put on hold pending the creation of the City Centre Committee and adoption of the Parking Strategy. Consultants: Isthmus/ Flow/ Chester/ Bluewater				

Ratepayer subsidised seal extensions	Deliver - Design	March-25	May-26	
Gray Road RP 25 – 1325 (1.3km) Investigation and design stage - McLean Road – RP 400 – 1910 (1.5km) delivered through FH Maintenance Contract to expedite delivery this construction season. Works completed up to basecourse aggregate and put on hold. Expected stabilising and sealing date September 25. Delay due to weather. Ormandy Road – RP 4791-6791 (2.0km). Investigation and design stage - Will be tendered for construction 25/26				
New Footpath – Kopipi Cres Ngunguru	Design	Sept 25	Dec 25	
Council approved the allocation of \$750k to undertake stages 1 to 3. Allowance will be made in the tender documents for tenderers to price stages 4 and 5 as separable portions. Works have been Tendered and we can confirm pricing in mid September 2025.				
Future Footpaths	Investigation	TBC	TBC	
King Street Hikurangi – Investigation stage. Procurement plan approved via council meeting 17th July 2025. Works assigned to PM and design / Tender documents being prepared. Marsh Road – Ruakaka – Investigation stage.				

Low-Cost Low Risk Programme

Brief Title	Description	Delivery year
Mains / Cainfield Int	Intersection improvement - remove slip lane. Contractors will establish in August to complete works.	25/26
Footpath upgrades	- Central Ave – (from SH1 to Fifth Ave) works now Completed. - Kiripaka Rd / Ngunguru Rd - (Tikipunga falls area) has been tendered due to start mid-October 2025 following tender award. - Corks Rd – (from Wairau Drive to Tiaki Rise) has been tendered due to start March 2026 following tender award. - Weir Cres – design Stage 26/27	24/25 - 26/27
Kotata Rise safety improvement	Guard rail on the bend at the bottom of hill including line marking changes and other safety improvements to reduce vehicle speeds. Designs underway.	25/26
Whangarei Heads guard rail	Wharf Road guard rail proposed on both sides of intersection pending design (underway) and available budget	25/26
Millers Lane	Concept design to be developed and funding reprioritised to enable guard rail to be constructed	25/26
Te Maika intersection improvements	Safety improvements to reduce speed and improve intersection treatment - awaiting formal brief.	25/26
Whau Valley pedestrian crossing	New signalised pedestrian crossing at Whau Valley Primary School to replace existing zebra crossing. Design underway.	25/26
Old Onerahi Road safety improvements	Intersection improvements for pedestrian and cyclist safety at Old Onerahi Rd/Riverside Dr. Project has been tendered due to start January 2026.	25/26
Moody Ave Safety Improvements	Alter Moody Ave/Weaver St intersection for speed reduction, construct ped crossing. Design Stage	25/26
Riverside Drive Pedestrian Crossing	Relocate existing pedestrian crossing to a safer location (likely new signalised crossing). Design options being considered.	26/27
Kamo Village signal crossing	New signalised pedestrian crossing at / near McDonalds car park entrance / Grant Street in Kamo Township. Design options being considered.	26/27
Ngunguru / Sands Road RAB	Sands Road and Ngunguru Road roundabout - design only (underway).	26/27

Ngunguru Rd safety improvements	Series of safety improvements along the route to reduce death and serious injuries occurring. Safety recommendations provided and awaiting formal brief to be provided.	26/27
---------------------------------	---	-------

Transport Choices Programme

Key Progress

Raumanga Shared Path Stage 4 lighting is complete.

The new Rose Street Bus Terminal will be opened on the 8th of August.

The Kamo Priority Lane roadworks & signalised crossings are complete; the enforcement cameras implementation is dependent on reaching agreement with Auckland Transport (AT) delivery of the service agreement.

Transport Choices Programme	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
Kamo Active Modes - WHGR02	Close Out	Oct-23	Dec-24	
Kamo Shared Path Stage 5 – Village Works is complete. Kamo Slow Streets / Clark Road is complete				
Raumanga Active Modes - WHGR03	Close Out	Oct-23	June-25	
Complete - Raumanga South Slow Streets; Raumanga Reserve playground safety links; Cafler Park Boardwalk; First Ave Alleyways Raumanga Shared Path Stage 4 (lighting and minor footpath works) is commissioned and open to the public.				
Public Transport - WHGR04	Construction	Oct-23	July-25	
The Kamo Priority Lane is operational, and the clearway is being enforced. The implementation of the special vehicle lane enforcement cameras element is being delayed due to reaching agreement with Auckland Transport on the delivery of the Service Agreement. This programme risk results in the RAG status currently being Red. A Business Case considering alternative options is being developed. As a result, we expect a go-live date for the enforcement cameras no earlier than 1 November. We may commence with a warning notice period of 1-2 weeks before issuing infringements or not depending on when the go live date falls in relation to school term / holiday periods. The Rose Street Bus Terminal opened on the 8 August. These project works have been paid for via 100% Waka Kotahi funding, with an additional 500k approved by the Council, which is paying for works being completed post 1 July 2025. We successfully claimed the full \$14M Transport Choices funding in the June 2025 claim.				

Infrastructure Acceleration Fund

Funding for the Springs Flat project has been approved by Kainga Ora. This project is broken into three separate projects as detailed in the table below.


Infrastructure Acceleration Fund Programme	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
Springs Flat Roundabout & Approach Roads	Consent/ Construction	March-25	Feb-27	
The detailed design is approximately 98% complete and a concept design for an additional left turn lane on the northbound approach to the roundabout is currently being developed for consideration. The consents for the roundabout have now both been granted. With the granting of the consents, the Stage 1 enabling works are well underway. Work this month has included the installation and backfilling of 75m (70%) of the 110m long box culvert. The realignment of residential sewer connections is also underway. The Springs Flat Road extension awarded through the Springs Flat Ltd infrastructure agreement is also underway. A guardrail has been installed along the state highway to enable works to proceed in the highway corridor. Work behind the guardrail will commence in August. The tender for the Stage 2 contract for the main roundabout construction was released to the market in late July and is expected to be recommended for award in October. Delegation to the Chief Executive will be sought for the award of this contract in the September Council meeting because this will occur during the election period. The consent for the Alcoba to Beacondale link road has been approved and engineering plan approval will be sought in August. Construction of the link road is likely to commence in October. Two houses are being relocated onto residual Council owned land at the site (6 Pearce Dr) and a subdivision consent for this surplus land has been approved. This house removal work has been paused while the Stage 1 works are underway. The purchase of all of the property purchases has been completed. Consultant: Northern Civil Consulting Engineers. Contractor: Stage 1 – DCGroup/BDX				
Gillingham Road Bridge Replacement	Construction	Apr-25	Feb-26	
Construction of the bridge is well underway with works this month including the piling for the new bridge at both abutments. Rock rip rap is also being placed at both abutments. Drainage works are nearing completion and road construction on the south side is commencing. Consultant: WSP Contractor: United Civil Construction				

Photo Wall – Transport

	
Springs Flat Roundabout – 75m of the 110m long box culvert installed	Springs Flat Roundabout – View inside box culvert
	
Springs Flat Roundabout – Realignment of sewer connections	Gillingham Road Bridge – Piling on southern abutment
	
Gillingham Road Bridge – Piling at northern abutment	Gillingham Road Bridge – Rock rip rap underway both sides.



Waipu Caves Road Bridge Looking North

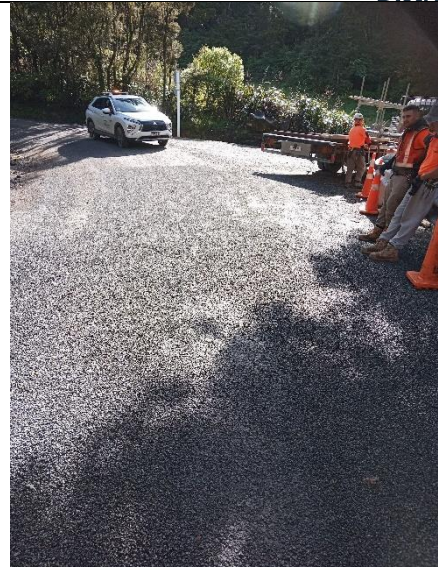

Waipu Caves Road Bridge Looking South




Nova Scotia Drive – McLeans Bridge – Piles all cleaned – initial inspection



Kaiikanui – Anchor nails complete, site rail installed



CON24045 - Public Transport Improvements (City) - completion of bus bay at 124 Morningside Road and continuing with footpath renewals

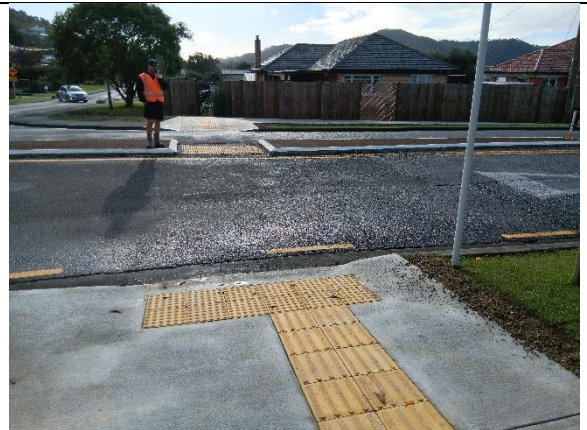

CON25021 – Central Ave Footpath – completion of project showing completed tactiles at pram crossing

Monthly Report
Community Infrastructure

September 2025
(statistics to 31 July 2025)

Community Infrastructure – Monthly Report

Reporting Officer: Ross Flanagan Acting Manager – Parks & Recreation Manager

Ross Flanagan – Waste Management & Minimisation Manager

Meeting Date: 18th September 2025

1	Executive Summary	3
2	Health and Safety	4
3	Strategy and Planning	6
4	Customer requests and feedback	7
4.1	Parks and recreation	7
4.2	Waste management and minimisation	8
5	Performance	9
5.1	Performance Measures	9
5.2	Network Performance	10
6	Key activities in the last period	12
6.1	Public Tree Maintenance	12
6.2	Walking Tracks	13
6.3	Coastal Structures:	13
6.4	Sports Parks and Facilities	15
6.5	Cemetery	17
6.6	Parks and Gardens	17
6.7	Playgrounds	18
6.8	Public Toilets	19
6.9	Litter and Illegal Dumping	20
6.10	Graffiti	21
6.11	Waste Minimisation	22
6.12	Transfer Stations	23
6.13	Kerbside Waste and Recycle	24
7	Contractor Performance	25
8	Significant Risks & Issues	26
9	Capital Work	28

1 *Executive Summary*

This report covers the Operational and Capital works for the month of July 2025

Parks & Recreation

The team has performed extremely well under interim leadership, whilst the hunt for a full-time replacement continues.

July was a busy and weather-challenged month across Council's infrastructure services, with 252mm of rainfall impacting ground conditions and operations.

Public Tree Maintenance began the new contract year strongly, with high volumes of pruning and removals. Recruitment is underway to support powerline clearance work, and stump grinding is expected to resume shortly.

Walking Tracks progressed with approvals for the Drummond Track realignment, with construction planned for Spring 2025.

Coastal Structures progressed with procurement underway for a contract, to cover routine inspections and maintenance of coastal assets, is underway with the ROI phase closing August 1st.

Sports Parks remained operational despite wet conditions. Parks and Gardens completed winter planting and responded to vandalism and homelessness-related issues.

Aquatic Centre renewal works are progressing well, with Stage 1 nearly complete and Stage 2 commencing in August, focusing on competition and learn to swim pool areas, changing rooms, and infrastructure upgrades.

Cemeteries experienced double the usual burial volume, compounded by staff shortages and wet ground conditions, which limited maintenance capacity.

Playgrounds saw the completion of the Beach Rd renewal and urgent repairs at Pohe Island due to borer damage. Budget reviews may lead to reduced service levels in maintenance.

Waste Management and Minimisation

Vandalism and illegal dumping continue to an almost daily occurrence; public toilets were targeted 22 times in July. Illegal dumping is increasing, one item, a boat, cost almost \$1k to uplift, overall, \$4.7k was spent cleaning up these sites in July. Expenditure at this level isn't sustainable, a campaign to promote a behavioural change is required.

Key contracts are performing well; no justified complaints were received in July.

Waste Minimisation Milestone: Matarau School becoming the first in Whangārei to achieve *Waste Wise* standards — that's a real benchmark for the district.

There is still one vacancy within the team for a Sustainability Coordinator, work will begin shortly on shaping the role to ensure it delivers the requirements of Council.

2 Health and Safety

Statistics for the Infrastructure Community Group July 2025

<i>Type of incident</i>	<i>Employee reported incidents</i>	<i>Contractor reported incidents</i>	<i>Member of the public reported incidents in our workplaces</i>	<i>Totals</i>
WorkSafe notifiable incident	0	0	0	0
Lost time injury (LTI)	0	0	0	0
Medical treatment injury (MTI)	0	1	0	1
Minor injury	0	2	0	2
Pain and discomfort report	0	1	0	1
Stress and fatigue	0	0	0	0
Incident – Occupational health exposure	0	0	0	0
Near miss incidents	0	3	0	3
Incident - Security	1	1	0	2
Incident – Vehicle related	0	1	0	1
Incident – non work medical condition affecting the worker or person	0	0	0	0
Totals	1	9	0	10

Employee incidents

- The security incident was related to the situation at Old Boys Club Rooms

Contractor incidents

- One security incident was a rough sleeper hassling a cleaning contractor at a public bathroom
- Two minor injuries – one from a log shifting while feeding a chipper, one from a slight finger jam in rubbish truck doors
- Medical Treatment injury from a phoenix palm frond puncture to the thigh
- Two vehicle-related near misses

Safety observations

Type	Employees	Contractors
H&S Concern	1	0
New Hazard	0	0
H&S Success	0	1
H&S Suggestion	0	0
Total	1	1

Physical inspections of contractor worksites

There is an internal requirement for physical health and safety inspections of contractor worksites to be undertaken monthly. The table below shows those done in July 2025.

Type of monitoring	Community Infrastructure
HS016 – Full site inspection	2
HS102 – Be safe engagement	0
HS030 – Site spot check	3
HS140 – TTMP site	0
Total	5

3 **Strategy and Planning**

Community Infrastructure strategy and planning actions for July 2025

- New Strategic Infrastructure Planner started July 2025 to focus on the Future Development Plan Implementation Plan and preparing for 2027
- Draft Water Sports Feasibility Study report received and briefing paper being prepared for September Council Briefing.
- Working on two Coastal Protection Works Policy applications – Whangaumu Bay and Headland Farm Park.

4 Customer requests and feedback

4.1 Parks and recreation

Customer requests and feedback

In July 2025, the Parks and Recreation team received 162 **requests**. Our contractors and staff closed off 120 **requests**.



Tree Maintenance requests and enquiries	41
Park reserves and street garden maintenance	40
Contact us - general enquiries	28
Homeless	7
Cemetery and Botanica enquiries and maintenance	6
Sportsgrounds maintenance	5

Compliments


TRE243081

5 Stars - The workers who came to do the job were very professional and keen to do a good job.
 Very appreciated

4.2 Waste management and minimisation

In July 2025, the Waste management and minimization Team received 296 requests.

Our contractors and staff closed off 288 requests.

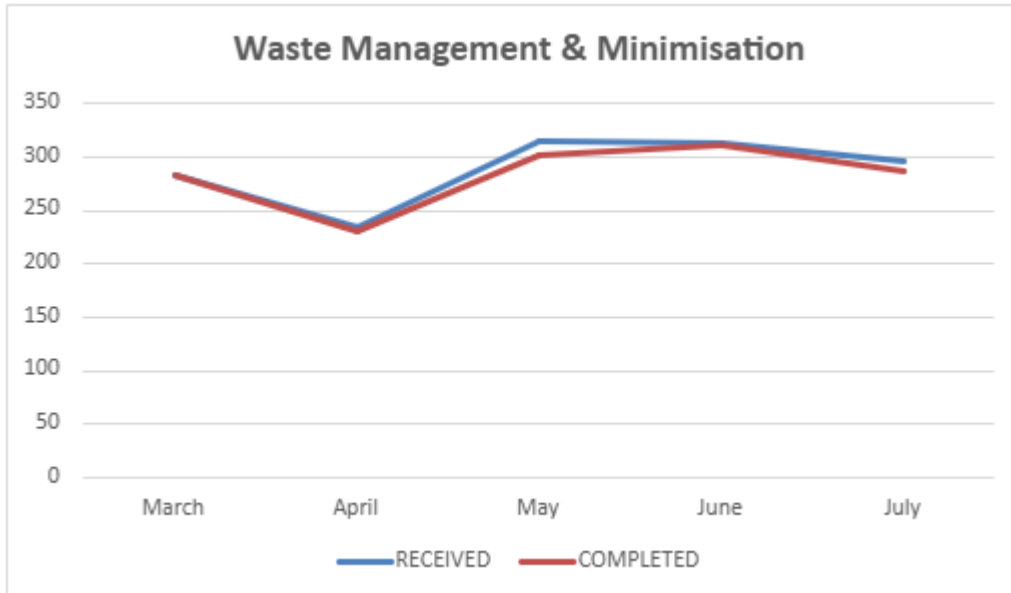

Public toilets issues and enquiries	85
Rubbish in the environment (public litter bins and dumping)	83
Graffiti notification	52
Household rubbish and recycling collection issues and enquiries	31
Other rubbish and recycling issues and enquiries	15
Contact us - general enquiries	7

5 Performance

5.1 Performance Measures

Council will provide and maintain recreational facilities to support and promote active recreation of the community through participation in both organised and informal recreational activities aligned with Active Recreation and Sports Strategy.

The results for last year are very positive with only one Performance Indicator being missed by a small margin.

Performance Measure	2025 – 26 target	Compliance
Sports parks will be provided to meet the community's needs by providing minimum hours available at a sports park per 10,000 people during the winter season.	≥180hrs	177.56hrs

Council will provide and maintain a range of parks, reserves and playgrounds to meet the needs of the community as well as protecting and enhancing the natural environment.

Performance Measure	2025 – 26 target	Compliance
Residents' satisfaction with the range and quality of public spaces, including parks, playgrounds and reserves. (Recorded through the Residents Survey.)	≥90%	94.5%
Residents have adequate access to local recreational opportunities.	0.9Ha / 1000 Residents	0.97 HA/1000 Residents
Playground and or Skate Park provision	4 / 10,000 Residents	4.15/10,000 Residents
Walking Track provision	5.93km / 10,000 Residents	6.04km / 10,000 Residents

Council will provide and maintain cemeteries and a crematorium in a satisfactory manner.

Performance Measure	2025 – 26 target	Compliance
Residents' satisfaction with cemeteries. (Recorded through the Residents Survey).	≥90%	98%

Council will provide well maintained and accessible public toilets in high use areas.

Performance Measure	2025 – 26 target	Compliance
Residents' satisfaction with public toilets (Recorded through the Residents Survey).	≥65%	65%

5.2 Network Performance

Vandalism along with large value unbudgeted items are main negative impacts on the network.


Area	Issue	Action/Status
Pohe Island Playground	Borer in structures	Work has begun to replace all affected play items using the playground supplier and local contractors.
Drummond Track	Taken out during cyclone Gabriele	Consent application lodged. Work to commence in Spring
AH Reed Canopy Walkway	Design flaws identified which weaken the structure	Currently limiting numbers on structure whilst design and costings prepared. No Change.
Urquarts Bay Wharf	Wharf piles deteriorating	Investigating options for repair
Town basin wharves	Wharves due for renewal	Engineer engaged to assess and report on required works. Permit to work underway.
Pataua North Boat Ramp	Pile has snapped	Repair work complete.
William Fraser floodlights	Some of the lighting poles are starting to lean. Foundation bolts for the lighting poles corroding and at risk of failing	Leaning poles pose no immediate risk so ongoing monitoring required. Methodology and pricing for bolt replacements received. Working through funding options.
Maunu Cemetery	Current developed site nearing capacity.	Budget brought forward being sought to undertake works in 2025/26. Initial works underway.
One Tree Point esplanade reserve encroachments	Residents adjoining One Tree Point reserve have encroached into the reserve with plantings and built structures making the reserve unsafe for community and limiting community access	Reserve boundaries have been surveyed and Parks working with local Councillor and residents to remove a portion of the encroachments to make public access possible.
Pohe Island Stormwater & Leachate	Stormwater isn't draining away, as a result, leachate drainage systems are overrun with stormwater, resulting in leachate finding it was into stormwater discharge points.	3 options being considered. 1. 150,000m³ of clay cap to recontour. 2. Geotech membrane placed over the existing cap and covered with soil. 3. Capture leachate and treat on side before discharge into the harbour. We continue to work through draft conditions with NRC.

Area	Issue	Action/Status
Transfer Stations	Hikurangi RTS entry road has deteriorated to a point that urgent repairs are required Ngunguru RTS. A local resident is refusing to pay for waste disposal, claiming they own the land.	Requested a scope of works to repair. Establish the site is within the roading corridor, with nothing to suggest there is a dispute around ownership.
Pohe Island (Bike Northland)	Landfill cap was penetrated via drainage works	Quotes to rectify damage have been received.

6 Key activities in the last period

6.1 Public Tree Maintenance

First Month of the new contract year! Good tree numbers in both scheduled street tree pruning and removals, Good CRM closing numbers as well. Couple of minor incidents but good reporting. Budget confirmed and a little overspend in the first month due to higher Traffic Control costs and higher tree removals. Northpower approached to expedite access for Cut or Trim Notice works ongoing. Looking at hiring new fully qualified level 4 Arborist and level 3 Utility Arborist to the team by end of August which will enable faster CTN1 powerline pruning works. still processing the SOP's for stump Grinding should be resolved by Monthly meeting in August, and will start stump grinding again once sorted

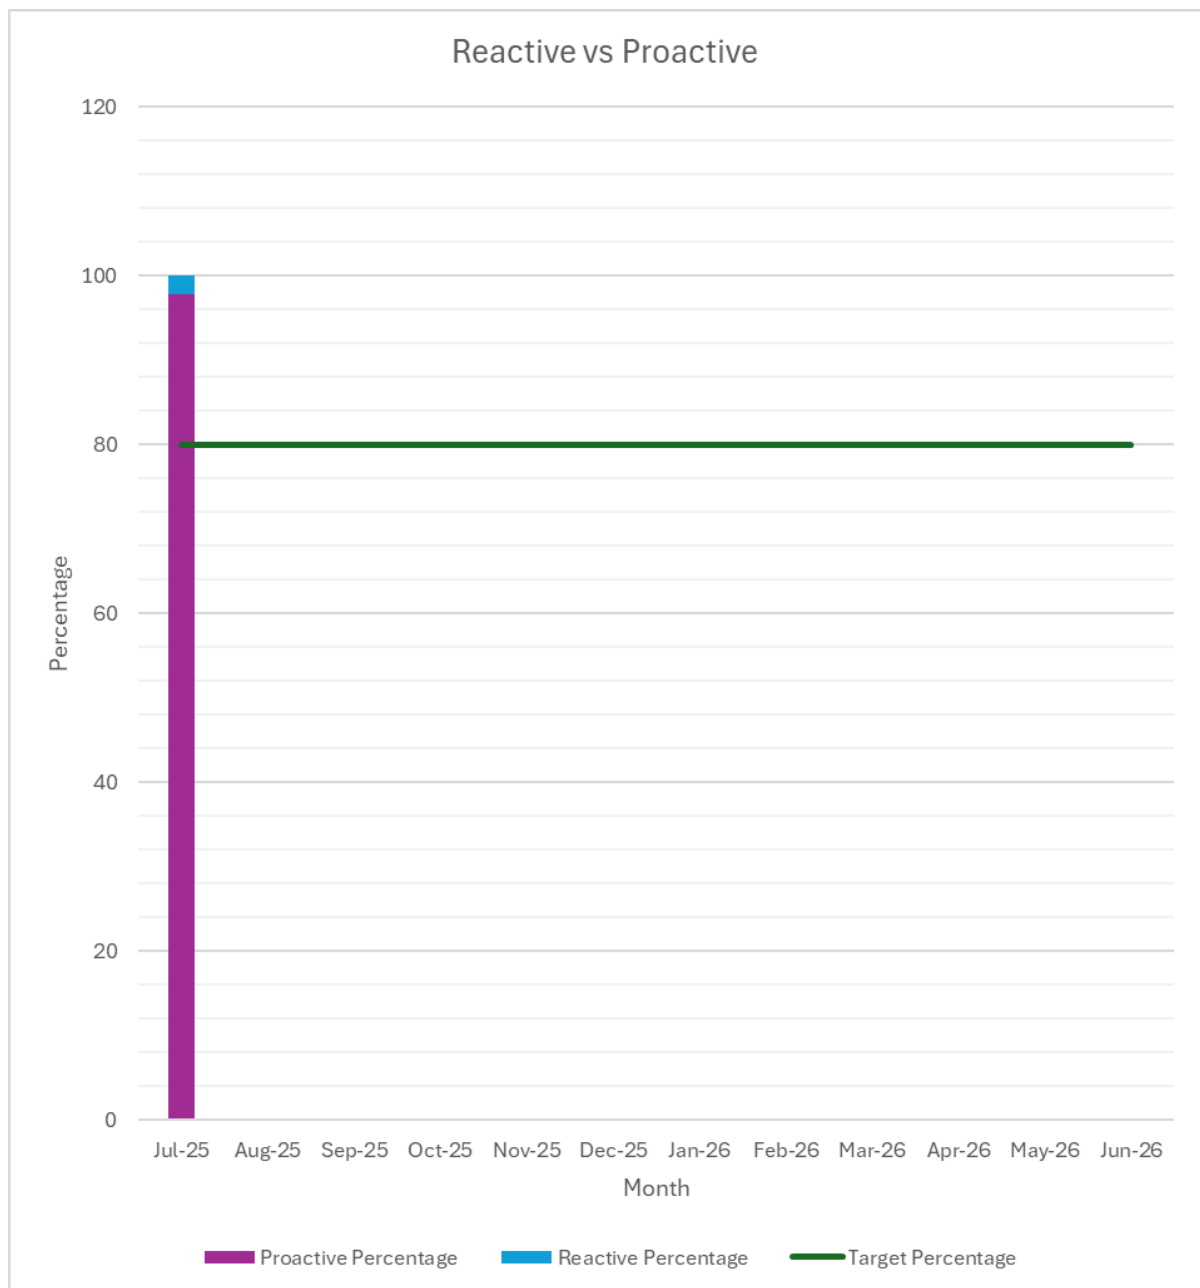

6.2 Walking Tracks

Nothing major occurred in July on the Tracks and Walkways contract.

Council received the archaeological authority from Heritage NZ to proceed with the track realignment of Drummond track after completing archaeological assessments. Building consent, for the staircase that is required to get up a steep bank, has been obtained. Resource consent was originally thought not to be required however is required. Consent application was lodged in May and work to be scheduled in Spring 2025.

6.3 Coastal Structures:

The procurement process for CON24018 which will outsource routine inspections, and scheduled maintenance of WDC's coastal assets is underway. The ROI phase is set to close on August 1st.

Urquhart's Bay Wharf: Major decay (wood worm) has been found in the piles of this wharf below the low tide mark. Steve Bowling Contractors have undertaken a basic inspection and have advised there is no immediate risk, but urgent action is required to ensure it doesn't become dangerous. RS Eng have been engaged to produce designs and estimates for two options; Option 1 – Design and estimate to repair/protect the existing structure. Option 2 – Design and estimate to rebuild the structure.



Albany Rd Sea Wall update – Design and engineers estimate for a timber retaining wall has been received. Next steps are to assess the long-term impacts of a timber wall to help inform upcoming consultation with hapu and residents.

Pataua North Boat Ramp – The third pole from the end of the timber wall is broken at ground level. Asset Construction have completed repairs.



Matapouri Stairs – An engineer's report from Grit identified structural issues caused by erosion on a set of stairs at Matapouri. Asset Construction has undertaken repairs and extended the upper landing to mitigate further erosion issues. Before and after photos below.



6.4 Sports Parks and Facilities

July was notably wet, with 251mm of rainfall creating challenging conditions for our mowing and line marking teams. Despite this, the Green by Nature team continued to maintain service delivery, without disruption.

Cricket block preparations are progressing well ahead of the summer season, with mowing scheduled to begin in August. Rugby union and league club seasons are concluding, leaving club football as the primary winter code continuing alongside representative rugby and league for the next couple of months.

Renovation works have commenced at Cobham Oval, with scarifying and topdressing of the outfield underway. Attention will shift to rugby, league and football fields from next month, marking the start of a busy renovation period. Balancing field usage with renovation needs remains a priority, and ongoing communication with clubs and user groups is essential.

In July, we became aware of individuals occupying the old Old Boys Clubrooms at Okara Park. A coordinated response team has been established to manage the situation and facilitate a safe and structured exit.

The upcoming renewals programme will focus heavily on bollard replacements across multiple sites. This is a timely initiative, as many vehicle barriers and bollards are reaching the end of their service life.



Vehicle barriers at Onerahi Sport Park due for renewal, and access created by persons living at Old Boys/Okara Park to bypass our padlocked forestry gate.

It was great to read some positive feedback in the Bream Bay News on 24 July regarding the fields at Ruakaka Recreation Reserve:


Here's something the Whangārei District Council needs to be given credit for. After all the rain over the past few weeks the fields in Ruakākā were able to be used for a junior football tournament last Saturday. Fourteen under 12 years teams and 20 under 10 years teams came to Ruakākā from all over Northland. Bream Bay United ended up hosting the under 10s as well as the under 12s because the fields in Whangārei were too waterlogged. Our fields were fine with no puddles or

mud anywhere. Visitors from other clubs were impressed. Many came wearing gumboots, which they found when they arrived, were not needed.

“It’s a good showcase for Ruakākā”, commented Ruakaka’s Pharmacist Warren Green who was hard at work for Bream Bay United collecting up line markers and flags.

The carpark alongside the library was full and there were cars lined up all along the eastern side of the park. Congratulations to the Bream Bay United club and its committee members who had the foresight to lobby the Council for the upgrade and expansion of the sports park. It was lovely to see all those children out in the winter sunshine showing off their tricky football skills. I look forward to watching many more games – both junior and senior on this park.

July Field usage hours

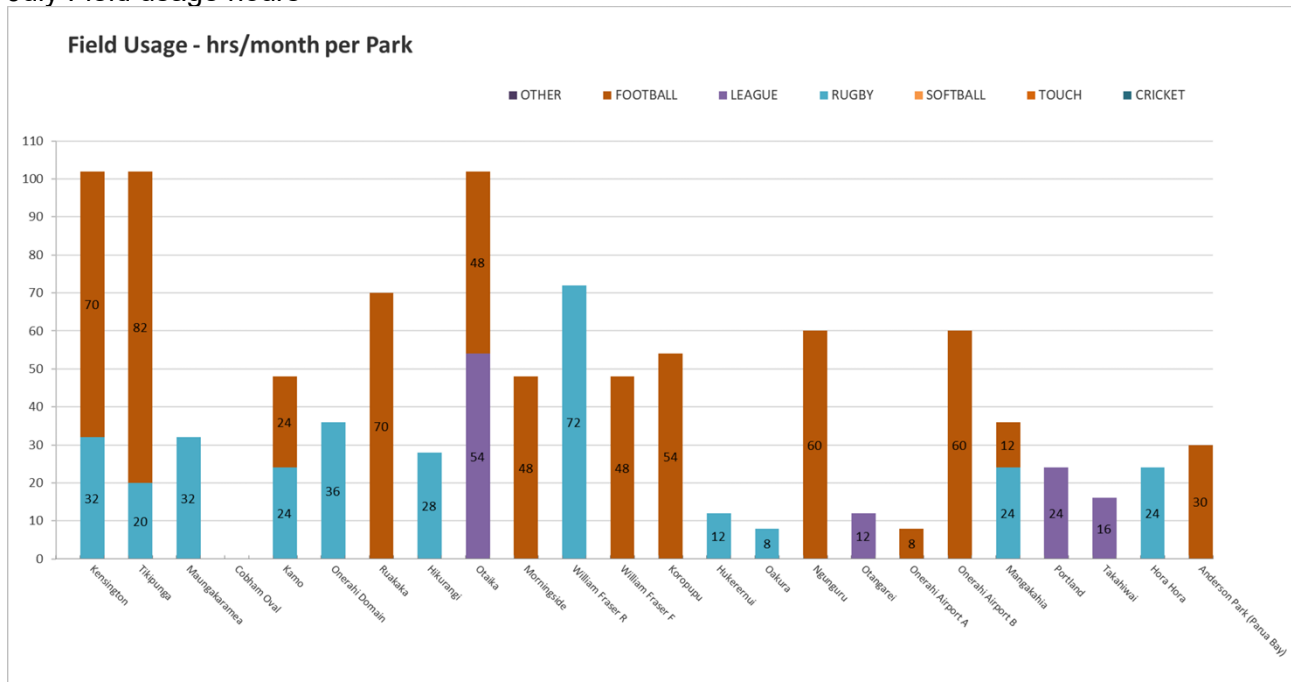

Whangarei Aquatic Centre

Stage 1 of the renewal works at the Whangarei Aquatic Centre is nearing completion. The Wave Pool, Spa Pool, Tots Pool, and Hydrotherapy Pool are now fully operational. The final component awaiting completion is the replacement of the stairs and supporting structure for the Hydrosides, which is scheduled to be finished by early September.

Stage 2 of the renewal works is set to commence in August. The initial focus will be on the changing rooms, which will be temporarily relocated to the BBQ grassed area. During this phase, alternative access to the facility will be provided via the Café. Clear and consistent communication will be essential to ensure a smooth experience for both the general public and regular user groups throughout the upgrade process.

Stage 2 Key Areas of Focus: 25m Competition Pool, Learn to Swim Pool and Changing Spaces

- **Water Quality:** Upgrading filtration and treatment systems to maintain consistently high standards of water cleanliness
- **Switchboard Upgrade:** Replacement of the main electrical switchboard which powers pool circulation pumps, filtration, heating and air handling for the older half of the building
- **Flooring:** Poolside flooring to be upgraded to non-slip flooring, in-keeping with upgrades in the Stage 1 Wave Pool upgrades
- **Pool Areas:** Competition & Learners Pool halls to be re-painted

- **Changing Spaces:** General refurbishment, improved drainage, and additional toilets in two Family Changing Rooms

During closure of the Competition Pool, CLM are endeavouring to make use of all lane space available in the Wave Pool to ensure lap-swimming options for regular hirers, including swim clubs, and public.

6.5 Cemetery

July Burials: 16, Cremains interments: 10, Scatterings: 3, cremations: 97

A busy month for burial in July and made especially hard with staff away and sick. 3 of these burials were particularly time consuming, with one at Kamo cemetery, a Natural Burial, and 1 at the Hukerenui Cemetery.

This was roughly double an average month for burials and the crematorium was also busier with around 20 more cremations than normal.

This didn't leave much time for much ground's maintenance, which is a good thing since the lawns are not growing too fast presently, but using tractors and excavators on the wet grounds did make the grounds messy and created more work with each burial.

6.6 Parks and Gardens

July saw 252mm of rain fall, another wet month this winter. Ground conditions are wet and very soft which is influencing what our contractor can mow. However, considering these challenges, there are very few sites that are a long way out of specification.

This winter's infill planting has been completed, with good feedback from the public about the planting along the northern areas of the Kamo Shared Path. The rose garden in Cafler Park has had all the irrigation repaired, after sustaining multiple occurrences of vandalism. The rose beds have also been composted.

We are currently getting a lot of complaints about a homeless lady who has been living in the reserve at the end of Cheviot St. The lady has made quite a mess of the reserve, excavating areas of ground and is throwing all her rubbish onto the neighbouring private property.



This winter the Pohutukawa Coast programme celebrated giving away its 100,000th plant, with a community planting day in Raumanga. This coincided with the retirement of Alan and Rona Mahy – Willis, who have been volunteering since the start of the programme, 35 years ago. A morning tea was held at Te Iwitahi to thank Alan and Rona for their services, in which Simon Weston presented them with a certificate of achievement and a gift.

6.7 Playgrounds

The Beach Rd Playground Renewal is complete. The removed play equipment will be donated to the Pakotai Hall.




Borer was discovered in a number of timber structures at the Pohe Island playground which caused concern over the structural integrity and safety of the equipment. The timber supplied was a non-treated exotic hardwood and was supposed to be resistant to rot and borer. In response Parks and Recreation closed the concerning equipment whilst we worked with the supplier on a solution. It has been confirmed the supplier will replace the wooden structures at their own cost with treated pine timber. Replacement work has begun.

The Playground Maintenance operational budget is currently being reviewed in an effort to find realistic savings. This may result in a reduction in level of service such as shade sails staying up year-round, stolen/vandalised equipment not being replaced, and non-vulgar graffiti not being removed.

6.8 Public Toilets

- On 22 occasions during July, our public toilets were the target of mindless damage or left in a disgusting state.
- Parua Bay: MOE approval granted, Toilet block is at fabrication stage, expected delivery Aug 25
- Pipiwai: Works underway for services, expected completion Sept 25
- Pataua South: Quotations are being sort to replace the holding tank and soak fields.
- Matapouri: Toilet block is under fabrication, expected delivery is Oct 25

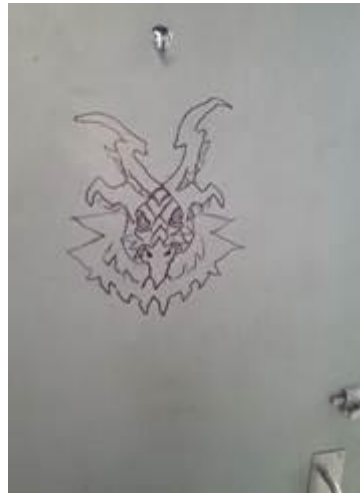

6.9 Litter and Illegal Dumping



Whananaki Moloks issues continue

- Boundary Rd Hikurangi




Roadside litter and fly tipping continues to feature for all the wrong reasons, \$4.7k was spent in July cleaning up these sites.

There is repeated illegal dumping around the Whananaki Molok's, we met with locals and suggested if we can't find a solution, removal might be our only option.

6.10 Graffiti

Like illegal dumping of waste, graffiti is unsightly and unwanted across our district.

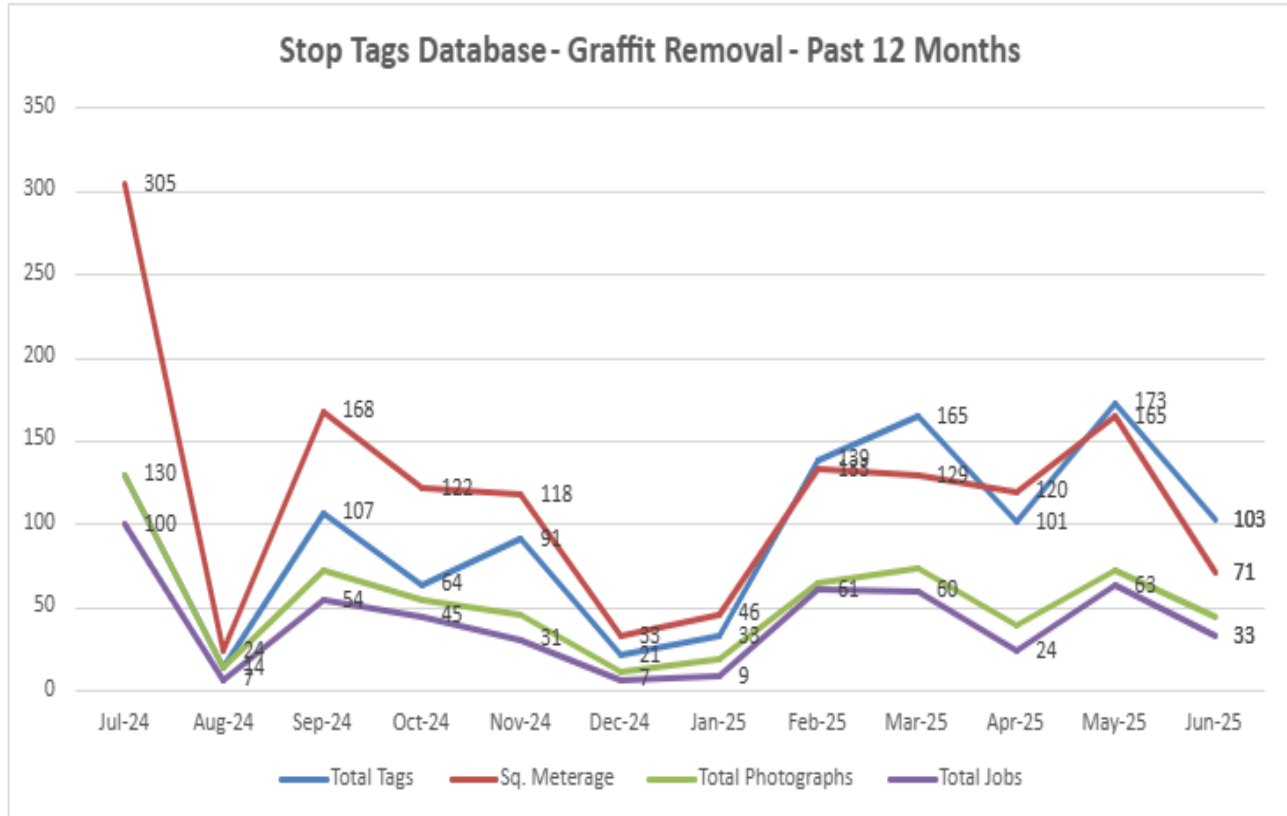

6.11 Waste Minimisation

- Recycling brochures printed and regularly given out. These are available at libraries, customer service centres; downloadable online; given out at various events. This is in line with the national standards.
- Follow up of various projects at various stages ongoing throughout the year with Para Kore; THRIFT; Woodhill Gardens; Waste-Ed with Kate; Eco Solutions; 155 Whakaora Kai; as mentioned previously.
- Rubbish & Recycling page changes.
- Contract and procurement paperwork.
- Two internal audit meetings.
- H & S Waste Minimisation update.
- KDC/WDC Waste Minimisation hui; so, we have consistency across Northland.
- Prepare for LFHW NZ 'Beat the Bin' national campaign.
- Regular monthly meeting to plan upcoming events for schools/community with Eco Solutions.
- Highlights from what we have planned and funded for the month: School holidays for two weeks, so more kindergartens were on this month. School holidays, good opportunity for the kindergartens. Fourteen schools - 312 students and 36 teachers worked with this month. Lessons: Three x Reuse; Eight x Rot lesson; Three x Recycle lesson; One x Waste Audit and the first Rākau award presented.
- Three Community Events - 78 people reached.
- Matarau School presentation for whole school assembly – first waste wise school in Whangarei to reach this.




- Top 5 most used clicks on the WDC Rubbish & Recycling pages in 6 months to July.


Page path and screen class	Views	Active users	Views per active user	Average engagement time per active user (min:sec)	Event count
/Services/Rubbish/Rubbish-Collection	6587	2339	2.82	1:26	18,895
/Services/Rubbish/Disposal-guide	6159	1072	5.75	2:29	17,843
/Services/Rubbish/Rubbish-Stations	3670	1499	2.45	0:53	10,399
/Services/Rubbish	3258	1375	2.37	0:31	8,859
/Services/Rubbish/Cut-waste/Recycle	274	135	2.03	0:54	826

6.12 Transfer Stations


Diversion Rates per Transfer Station YTD

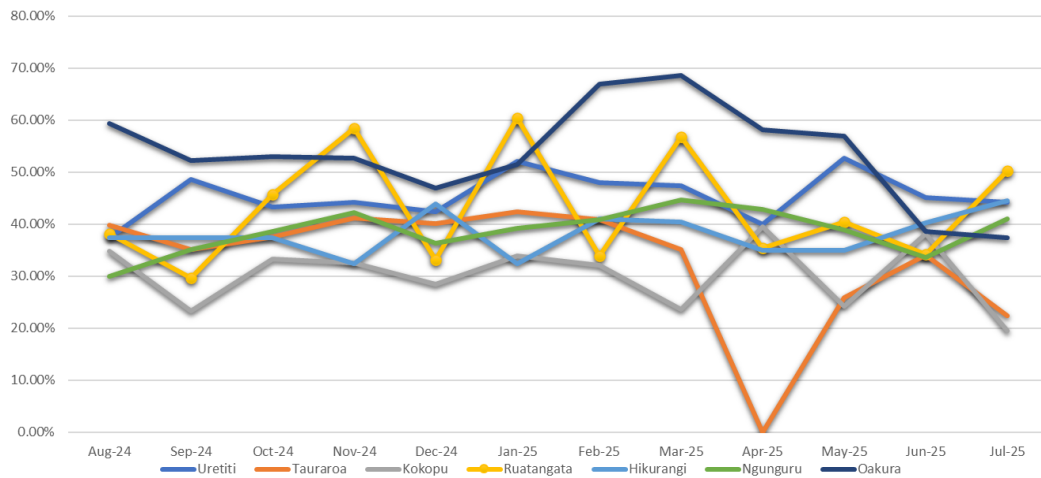

Refuse vs Recycling Trend YTD

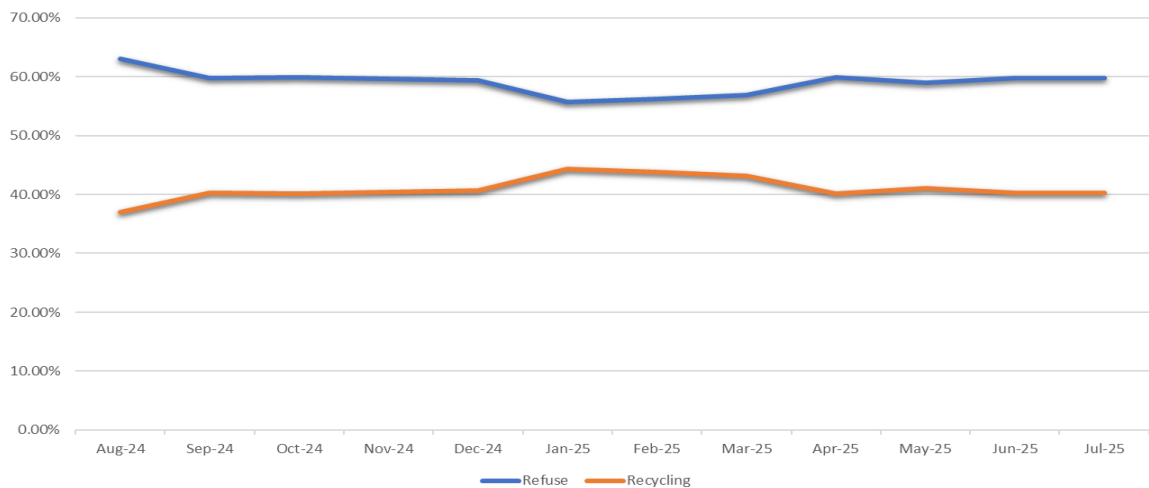

TOTALS BY PERCENTAGE

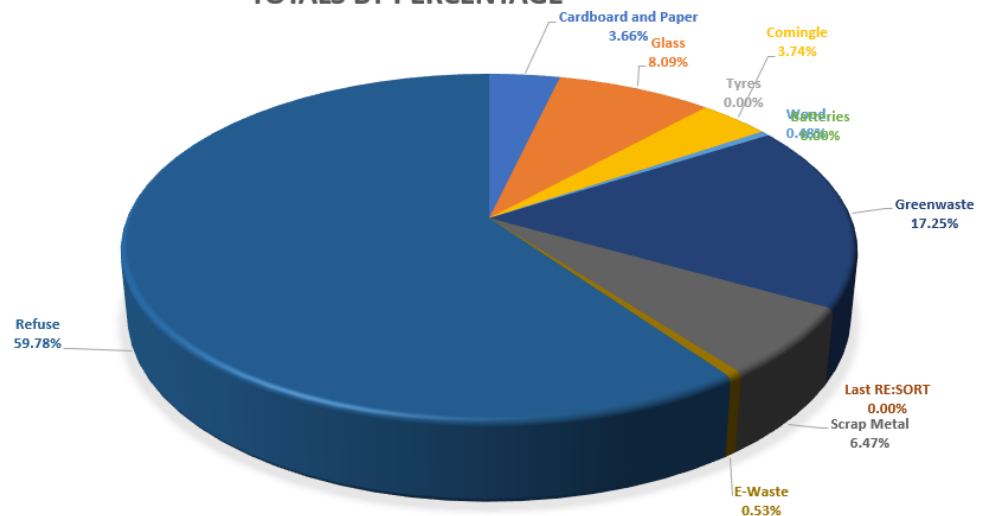

6.13 Kerbside Waste and Recycle

Kerbside services are currently performing well. We have received a few questions about extending collection routes as the city spreads out, we are working with the contractor to see what is viable without increased charges.

7 Contractor Performance

Contract	Supplier	Performance	Comment
Public tree maintenance	Treescape	Good	Exceptional progress made on closing out their requests backlog but are receiving requests faster than they can close them. No negative behaviour in the month.
Tracks and Walkways	Northland Park Care	Excellent	Solid performance again this month
Coastal Structures	None – covering with internal	-	Monitoring coastal structures and conducting procurement of CON24018.
Playground and skatepark maintenance	Northland Park Care	Good	Maintenance under control. No notable complaints.
Parks & Gardens	City Care Ltd	Good	Maintenance under control. No notable complaints.
Sportsground maintenance	Green by Nature	Excellent	Winter club season nearing completion with excellent field delivery
Pest Plant	Green by Nature	Excellent	Good knowledgeable team that efficiently carry out good quality work.
Kerbside Rubbish and Recycling	Northland Waste	Very Good	Performed very well, CRM have been well managed with a 97% close out rate. No new complaints of recycling escaping collection vehicles.
Maintenance of Public Toilets	PPCS	Strong Improvement	No justified complaints received re toilet cleanliness

8 Significant Risks & Issues

Risk / Issue	Mitigation	Comment
Homeless on parks. Community putting pressure to resolve homeless issues on parks. Parks does not have the capacity or capability to resolve homeless issues.	Homeless managed via the Rough Sleeper Framework. Parks only responds if there is a threat to parks assets or people use of the asset.	Park's purpose is to provide places and spaces for people to play sport, keep fit, have fun and enjoy nature. Council is looking at a centralised resource to facilitate land occupancy issues.
Motorbikes on Parks	Consider a public campaign for the public to photograph, record motorbikes on parks land.	There is very little Parks can do to prevent motorbikes being ridden on public spaces as prevention devices also prevent wheelchairs prams etc from accessing spaces. A public campaign can be considered however this does come at risk to the public as often the motorbike riders are aggressive and threatening if observed.
Theft and Vandalism Public Toilets	Difficult, closing certain facilities in high abuse areas may become the only viable option.	There were 22 reported events of either vandalism or theft across the 78 public toilets in July, this level of abuse on public facilities is unsustainable. Suggest a targeted social media campaign to increase public awareness of this issue, and the potential consequence of WDC having no option except to close the affected toilet blocks.
Whangarei Aquatic Centre Maintenance	Working group established to consider partnership solutions including potential changes to ownership structure.	Council officers meeting regularly with Sport Northland on Aquatics issues
Community encroachment of esplanade reserves	Develop an encroachment guideline document	Legal review of draft document completed, with changes incorporated.
Sport Parks budget inadequate to maintain facilities	Prioritise work programme to meet budget	Budget increased in line with fee and charges to deliver required programme of works.

Risk / Issue	Mitigation	Comment
Pohe Island Leachate	Ponding of stormwater is the biggest issue at Pohe Island	Continue to work through proposals and form scope of work.
NRC have advised they no longer want to operate the hazardous chemical drop off at Resort;	NRLLP have expressed interest in doing this work	Expecting a proposal from NRLLP on 29 August.

9 Capital Work

Delivery of Capital Programme

Project Progress Update

The new Parua Bay Toilets at the football field have been installed. The new Pipiwai Toilets adjacent to the school have been installed. Both toilets will be open to the public in September. Parua Bay progress photo:



The Parua Bay Skatepark foundation is complete. The concrete skatepark features are being built individually, following that the two concrete slabs will be poured on two different levels. Progress photo:



The Wharf Road Wharf Safety Improvements have been completed. The accessible ramp has been built, and the wharf is now open to the public. Photo of the completed wharf and accessible ramp with bollards to exclude vehicles:



The Ngunguru Seawall project is almost complete. The fifth and final precast concrete staircase will be installed early September. Testing has been completed and confirmed non-slip surface finishing meets the specification. Algae that formed below the high tide level has been removed (water blasting) and will continue to be monitored. The photo below shows the testing on the stairs:



Project Name	Dept./ Activity	RAG Status	RAG Exception	Current Stage	Stage % Complete	Expected Construction Start	Expected Construction Completion
Albany Road Seawall	Coastal		Need to confirm preferred option and funding options for the community.	4 - Deliver - Design	90%	TBC	TBC
Lower Waiarohia Loop	Parks			4 - Deliver - Design	75%	Jul-27	Nov-28
Maunu Cemetery Extension	Parks			4 - Deliver - Construction	20%	Mar-26	Jun-26
Morningside Sports Park Drainage & Irrigation	Parks			4 - Deliver - Construction	5%	Oct-25	Feb-26
New Ruakaka Cemetery	Parks		There is a gap between LTP funding and the construction cost of Stage 1 (Bulk EW, wetland restoration, some burial capacity, roading, public toilet).	2 - Analyse	80%	TBC	TBC

Project Name	Dept./ Activity	RAG Status	RAG Exception	Current Stage	Stage % Complete	Expected Construction Start	Expected Construction Completion
Ngunguru Seawall	Parks			5 - Deliver - Construction	90%	Feb-25	Sep-25
Oakura Sport Field & Wetland Upgrade	Parks			4 - Deliver - Design	60%	Jan-26	Jul-26
Onerahi Domain Sports Park Field Lighting	Parks			4 - Deliver - Construction	0%	Dec-25	Mar-26
Otangarei Fishbone Sports Park Field Lighting	Parks			4 - Deliver - Construction	0%	Jan-26	Apr-26
Parua Bay Skatepark	Parks			5 - Deliver - Construction	25%	Jul-25	Oct-25
Pohe Island Spine Path	Parks		The construction of this project has been put on hold until earthworks are completed to fix the Pohe Island leachate issues.	2 - Analyse	75%	TBA	TBA
Quarry Gardens Slip Management	Parks			4 - Deliver - Design	95%	Oct-25	Feb-26

Project Name	Dept./ Activity	RAG Status	RAG Exception	Current Stage	Stage % Complete	Expected Construction Start	Expected Construction Completion
Tikipunga Sport Field Artificial Turf & Lighting	Parks			4 - Deliver - Design	80%	Jan-26	Jun-26
Whangarei Falls Viewing Platform Renewal	Parks			2 - Analyse	50%	Mar-26	Jul-26
Matapouri Toilet No. 2	Parks			3 - Plan	70%	Oct-25	Dec-25
Parua Bay Toilets	Parks			5 - Deliver - Construction	50%	Aug-25	Oct-25
Pipiwai Toilets	Parks			5 - Deliver - Construction	60%	Aug-25	Oct-25

6.3 Waters Operations Report – September 2025

Meeting: Infrastructure Committee
Date of meeting: 18 September 2025
Reporting officer: Andrew Carvell (General Manger – Waters Group)

1 Purpose / Te Kaupapa

To provide an overview of Operations that the Infrastructure Committee is responsible for.

2 Recommendation Whakataunga

That the Infrastructure Committee notes the September 2025 Operational Report for:

- Waters

3 Background / Horopaki

In November 2022, Council adopted committee terms of reference 2022-2025 triennium, with the purpose of the Infrastructure Committee being to ‘oversee the management of council’s infrastructural assets, utility services and public facilities. These reports provide the Committee with a summary of Infrastructure operations during July 2025.

3.1 Financial/budget considerations

Financial information is included in the Capital Programme Finances which is presented at the Finance Committee.

Financial information at a project level will be provided through the Project Lifecycle Management system.

4 Significance and engagement / Te Hira me te Arawhiti

The decision or matters of this Agenda do not trigger the significance criteria outlined in Councils Significance and Engagement Policy, and the public will be informed via Agenda publication on the website.

5 Attachments / Ngā Tāpiritanga

Attachment 1 – Waters Operations Report – September 2025 (Statistics for July 2025)



Waters Group

September Monthly Report (Statistics for July 2025)

Waters Group Monthly Report

Reporting Officer: Andrew Carvell (General Manager – Waters Group)

Meeting Date: 18 September 2025

Contents

1	Executive Summary	4
2	Health and Safety	5
3	Strategy and Planning	7
4	Operational Activities	8
4.1	Customer requests and feedback	8
	Potable water	8
	Wastewater	10
	Stormwater	11
4.2	Overall Performance	12
	Potable Water Department	12
	Wastewater Department	14
	Laboratory	15
	Stormwater and Flooding Department	15
4.3	Reticulation	16
	Potable Water	16
	Wastewater	17
4.4	Treatment Plants	20
	Potable Water	20
	Wastewater	21
	Stormwater and Flooding	23
4.5	Significant Risks and issues	24
	Potable water	24
	Wastewater	24
	Stormwater and Flooding	24
	Laboratory	24
5	Performance Measures and compliance	25
	Potable Water	25
	Wastewater	27
	Stormwater and Flooding	28
6	Capital Work (Statistics from July 2025)	30
	Potable Water	30
	Wastewater	34
	Stormwater and Flooding	37

6.1	Project details – Specific projects	39
	Fluoridation Programme	39
	Ruakaka Wastewater Treatment Plant	40

1 Executive Summary

This report covers the following activities in the Waters Group;

- Strategy and Planning Activities during July 2025
- Operational Activities during July 2025
- Capital Activities during July 2025

Strategy and planning

- Whangarei Urban Flood Strategy – Currently at Stage 3 - Technical Assessment (April 2025 – July 2026)
- Local Waters Done Service Delivery Plan submitted and 30-year forecasts underway in conjunction with the Local Waters Done well delivery model decision.
- Future Development Plan – Implementation Plan development underway

Operations

- Council received 242 potable water, 131 wastewater and 86 stormwater customer requests; responded to and closed off 208, 118 and 58 respectively.
- Dam levels remain at 100%. There are no water availability issues likely before Summer.
- All potable water treatment plants were fully compliant.
- Five out of nine wastewater treatment plants were fully compliant.
- Potable water leak figures back to average for this time of the year
- Attendance and restore times for sewage overflow requests in July 2025 were again within target times.
- The fluoride levels were consistent across the 4 potable water treatment plants during June

Capital - Potable water

- Three Mile Bush Road is complete and in operation although there are still some tidy up works to do. Demolition of the obsolete timber tanks and the Tuatara Drive pump station is complete.
- Poroti treatment plant upgrade on hold. However, it is programmed to restart at the end of September following agreement with local hapu. The Poroti Water Treatment Plant still needs to upgrade to meet the current directive date of 30 June 2026. A letter has been sent request to the Director General of Health requesting an extension.

Capital - Stormwater

- Morningside flood relief project Stage 1 completed. Stage 2, Eastern arm of the interceptor is progressing well.
- Mair St and Rurumoki St stormwater renewal underway.
- Whangārei Urban Flood Strategy: Selected manhole survey will be conducted in town to address the data gaps in asset data to inform Hydraulic Modelling by Beca in end August/early September 2025.

Capital- Wastewater

- Ruakākā WWTP upgrades: preliminary Design expected to be completed early Sep 2025. Preferred Site location identified (Rama Rd)
- Ruakākā coastal outfall: Constructability options are expected to be completed mid Aug 2025
- Ruakākā WW alternative discharge options: Short list and MCA Assessment completed, and in review with the list of preferred options to be taken to concept design by end of July 2025.
- The design for the replacement motor caravan dump station has been complete, located adjacent to Ngunguru Road on the Tikipunga reserve. Construction of the dump station is planned to start in September.
- The construction of the new clarifying basin at Hikurangi WWTP has been completed.

2 Health and Safety

Statistics for the Waters Group – July 2025

Type of incident	Employee reported incidents	Contractor reported incidents	Member of the public reported incidents in our workplaces	Totals
WorkSafe notifiable incident	0	0	0	0
Lost time injury (LTI)	0	0	0	0
Medical treatment injury (MTI)	0	0	0	0
Minor injury	2	0	1	3
Pain and discomfort report	0	1	0	1
Stress and fatigue	0	0	0	0
Incident – Occupational health exposure	0	0	0	0
Near miss incidents	1	6	0	7
Incident - Security	0	1	0	1
Incident – Vehicle related	2	1	0	3
Incident – Property damage	0	1	0	1
Incident – non work medical condition affecting the worker or person	0	0	0	0
Totals	5	10	1	16

Employee Incidents

- One vehicle-related near miss
- A white-tail spider bite
- A twisted ankle descending stairs at Te Iwitahi

Contractor Incidents

- Sub-contractor was concrete cutting in a manhole without adequate confined space controls in place.
- Material slippage on excavation but trench was protected with shoring.
- A number of excavation-related issues identified at a contractor's worksite (fall from height risks, housekeeping, rescue method) were raised by Council and rectified on request.
- Aggregate truck reversing downhill, slipped off the driveway and impacted a fence.

Member of the Public Incidents

- Member of the public fell off their bike outside Forum North

Safety observations

Type	Employees	Contractors
H&S Concern	2	5
New Hazard	1	1
H&S Success	0	0
H&S Suggestion	0	0
Whiria walk (HS and Wellbeing check)	4	NA
Totals	7	6

Physical inspections

There is an internal requirement for physical health and safety (H&S) inspections of sites to be undertaken monthly. Below is a table of contractor on site monitoring undertaken by Waters teams through July 2025.

Type of contractor monitoring	Water
HS016 – Full site inspection	0
HS102 – Be safe engagement	3
HS030 – Site spot check	8
HS140 – TTM site	0
HS169 – Water reticulation specific	5
Totals	16

3 **Strategy and Planning**

Strategy and planning actions are undertaken in conjunction with Infrastructure Planning in Transport and Community Infrastructure.


- Whangarei Urban Flood Strategy – Whangarei District Council (WDC) and Northland Regional Council (NRC) are developing a flood strategy with the aim of building the technical understanding required to underpin strategic and adaptive planning for the management of flood risk in Whangārei's urban areas. Currently at Stage 3 - Technical Assessment (April 2025 – July 2026)
- Local Waters Done Service Delivery Plan delivered on time and 30-year forecasts underway in conjunction with the Local Waters Done well delivery model decision.
- Future Development Plan – Implementation Plan development underway

4 Operational Activities

4.1 Customer requests and feedback

Potable water

In July 2025 the Potable water team received **242** requests. Our contractors and staff closed off **208** requests.

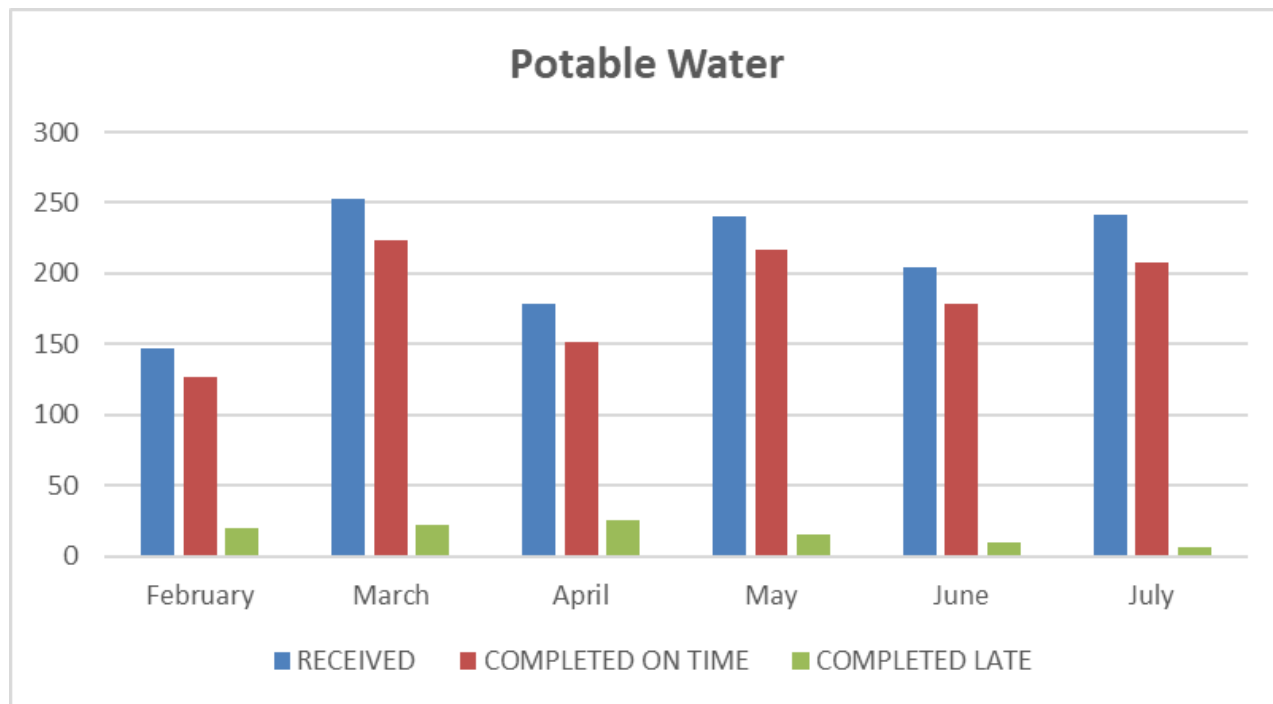

Top Request Categories	
Request Type	Number of Requests
Report a water leak	113
Report an issue with water meter and boxes	40
No water coming out of tap	19
Fast Track water meter installation (Internal Only)	12
Other drinking water requests and issues	8

Compliments**CC251539 - Kamo - Downer Water**


Many thanks for sending the fellow back to tidy up the alignment and resetting of the water meter casing and the mess left behind previously. He also spread some grass seed around to speed up the recovery. We are very happy

Current Status of requests as of 20 August 2025

Open Requests	Requests Past Deadline	Acceptance Overdue
102	56	0

Wastewater

In July 2025, the Wastewater Team received **132** requests, and our contractors and staff closed off **124** requests.

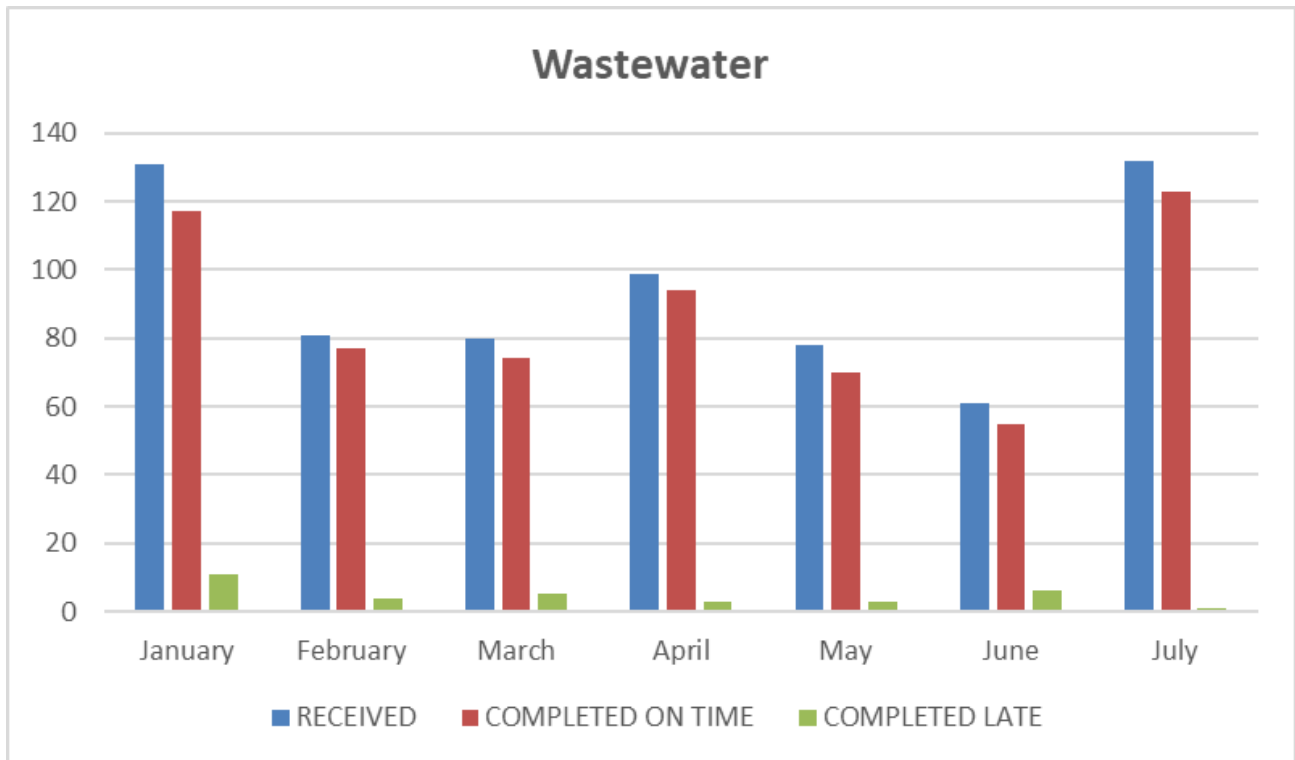

Top Request Types	
Request Categories	Number of Requests
Other council-maintained sewage/wastewater network issues	94
Sewage overflow or spill from wastewater network	15
Request for information regarding sewage/wastewater	8
Public utility applications (Internal Only)	4
Missing, damaged or displaced manhole covers and drains	3

Compliments

WW253646 - 5 Star Review - Wastewater Department


Customer comments: Scored well as you responded where some do not where we have sort information.

Current Status of requests as of 13 August 2025

Total	Past Deadline	Acceptance Overdue
13	3	1

Stormwater

In July 2025, the Stormwater Flooding & Coastal Team received **88** requests. Our contractors and staff closed off **71** requests.

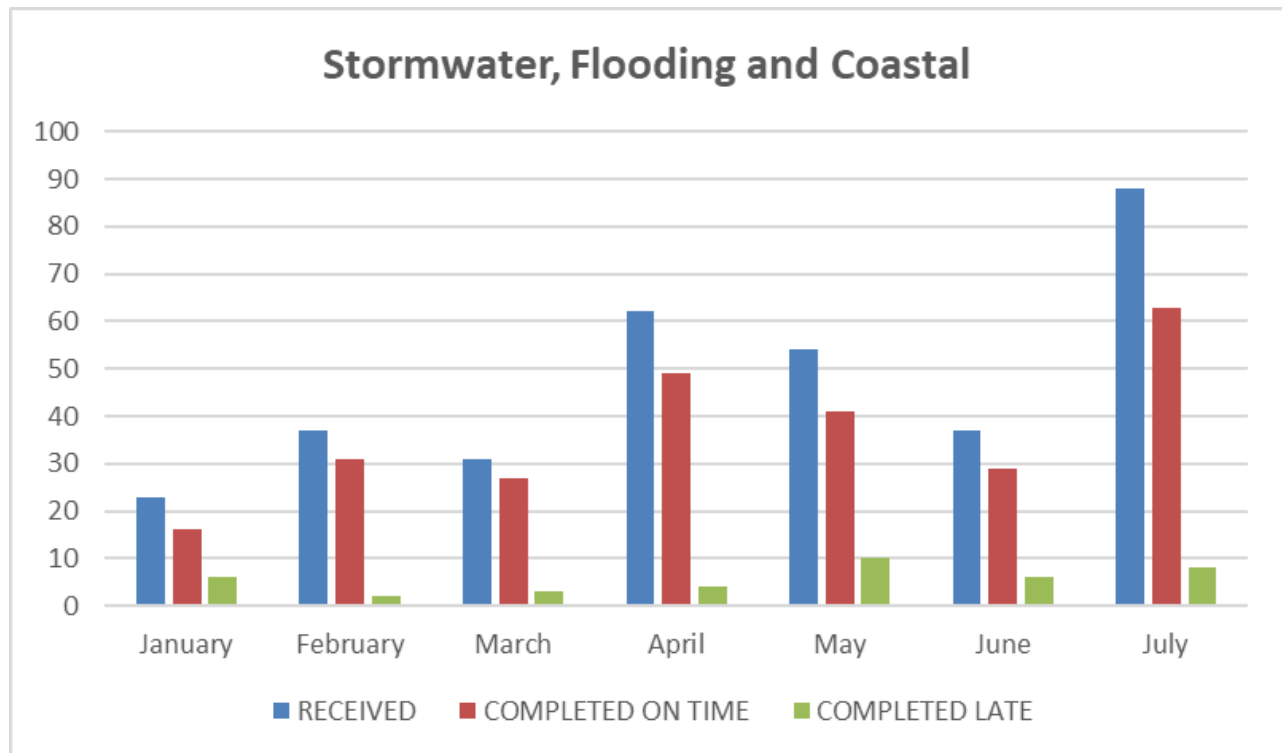

Top Request Types	
Request Categories	Number of Requests
Report other issues with Council's stormwater network	22
Clear blocked drains and culverts	14
Contact us - general enquiries	10
Request for information regarding Stormwater	9
Missing, damaged or displaced manhole covers and drain grates	8

Compliments

No compliments for July 2025

Current Status of requests as of 13 August 2025


Total	Past Deadline	Acceptance Overdue
65	34	0

4.2 Overall Performance

Potable Water Department


Rainfall and Dam Levels

Rainfall in July again exceeded historical averages with 274mm falling at Whau Valley Dam compared to 199mm normally expected. A total of 1343mm of rain has fallen so far this year, which is well in excess of the total rainfall for the whole of last year. The long-range forecast is for above average rainfall for the next three months, with the possibility of heavy rainfall events occurring. There are no water availability issues likely before Summer.

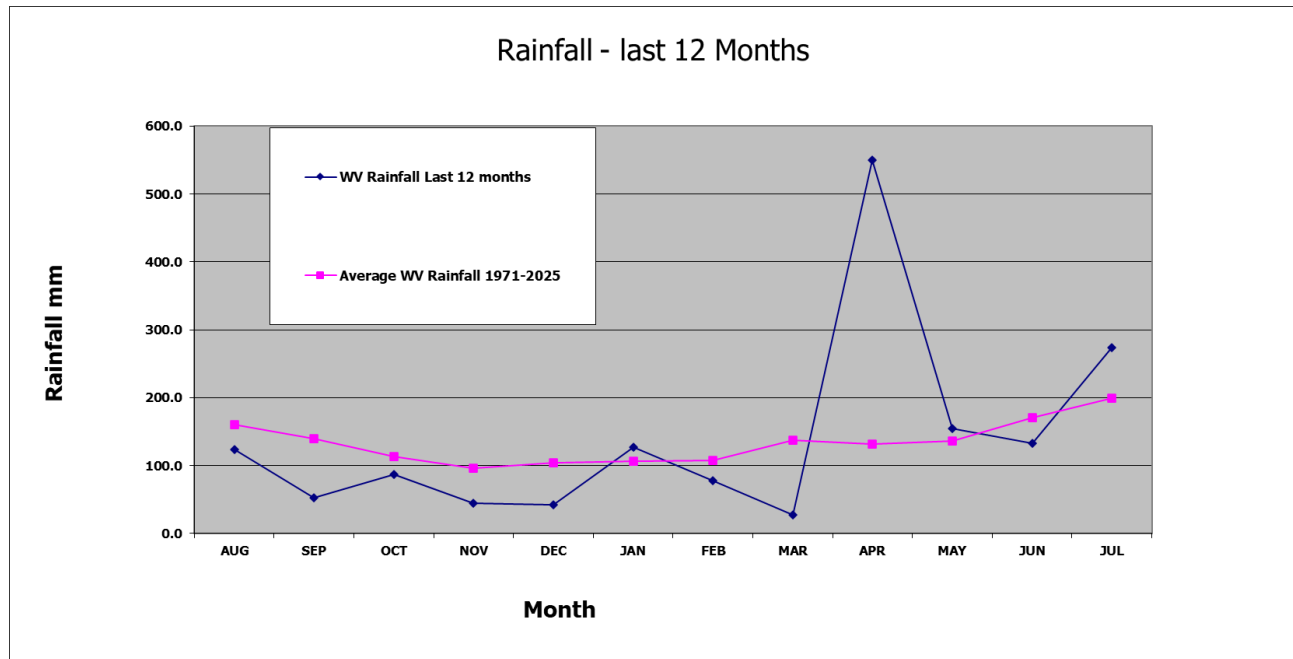

Dam Levels

The dam levels recovered quickly with the heavy rain in April and both dams have remained 100% full since. River and spring sources are also flowing well, and groundwater levels have recovered. If the long-range forecast is correct, it is unlikely that dam levels will drop below 100% over Winter and well into Spring.

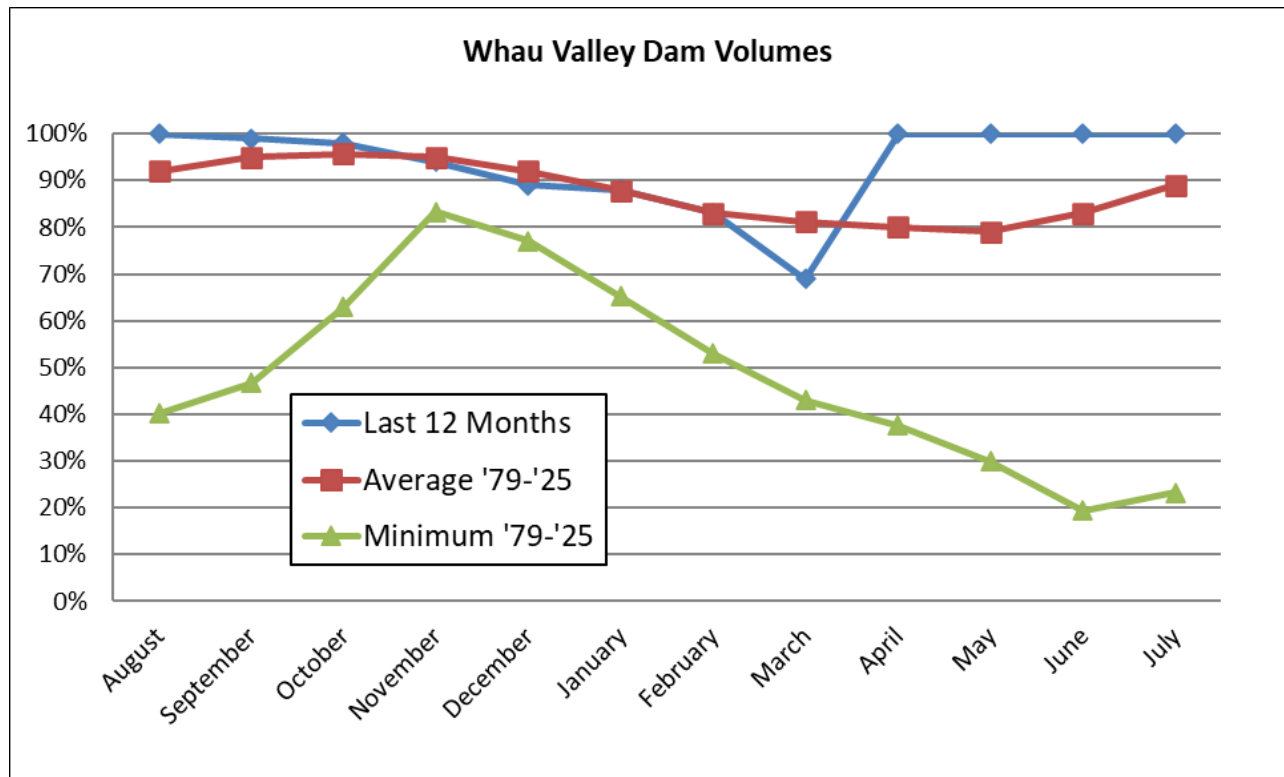


Wastewater Department

Wastewater Treatment Plant (WWTP) consent compliance

Name	RAG Status	Compliance comments
Kioreroa Rd WWTP (Whangarei)		Total Suspended Solids (TSS) has increased above the consent limit. The plant performed well in terms of biological removal. However, a filter upgrade is required and planned.
Hikurangi WWTP		TSS and Biochemical Oxygen Demand (BOD) are meeting the consent requirements. E. coli showed a slight increase.
Ngunguru WWTP		Fully compliant
Oakura WWTP		Low risk non- compliance, E.coli elevated above 95% limit, though land discharge.
Portland WWTP		Fully compliant
Ruakaka WWTP		Low risk non-compliance. BOD at the wetland reduced below 40mg/L. However, ammonia elevated - only at bore no 2
Tutukaka WWTP		Fully compliant
Waipu WWTP		Fully compliant
Waiotira WWTP		Fully compliant

Laboratory

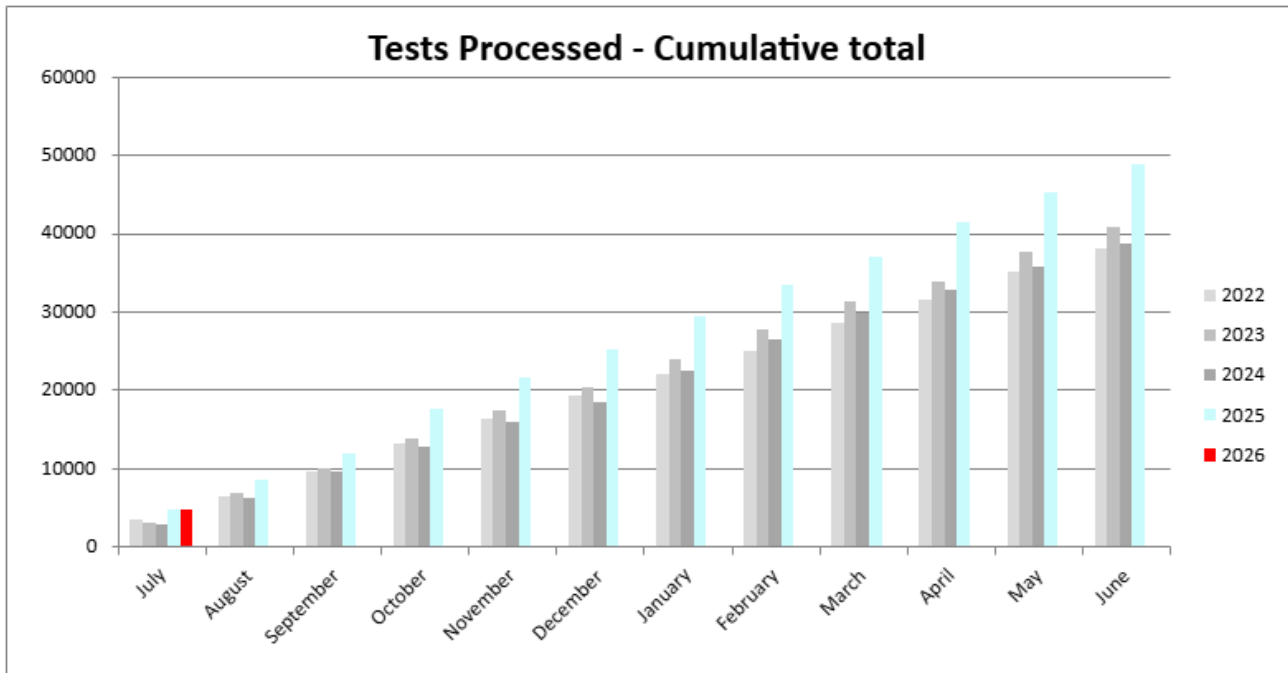

For July 2025, 1084 samples were analysed for 4713 tests. 69.7% of these tests were completed in house, while the remainder were subcontracted. 50% of testing was completed and reported within five days.

Laboratory team is back to 7.2FTE.

Stormwater and Flooding Department

No significant issues to report during this period.

4.3 Reticulation


Potable Water

Distribution compliance

Network	Chlorine Sampling			Microbiological sampling		
	Quantity of Samples	Sample Interval	Quality	Quantity	Interval	Quality
Whangārei	Pass	Pass	Pass	Pass	Pass	Pass
Whangārei Heads	Pass	Pass	Pass	Pass	Pass	Pass
Hikurangi	Pass	Pass	Pass	Pass	Pass	Pass
<u>Bream Bay</u>	Pass	Pass	Pass	Pass	Pass	Pass
<u>Maungakaramea</u>	Pass	Pass	Pass	Pass	Pass	Pass
<u>Mangapai</u>	Pass	Pass	Pass	Pass	Pass	Pass

Network Maintenance

The graph below shows the number of leaks fixed in the network over the last 12 months. The drop during April was due to the extremely wet weather which hid a number of leaks. The rebound in May was due to the backlog of leaks not identified in April that we found and fixed in May. The June and July figures are back to a more normal level for the time of year.

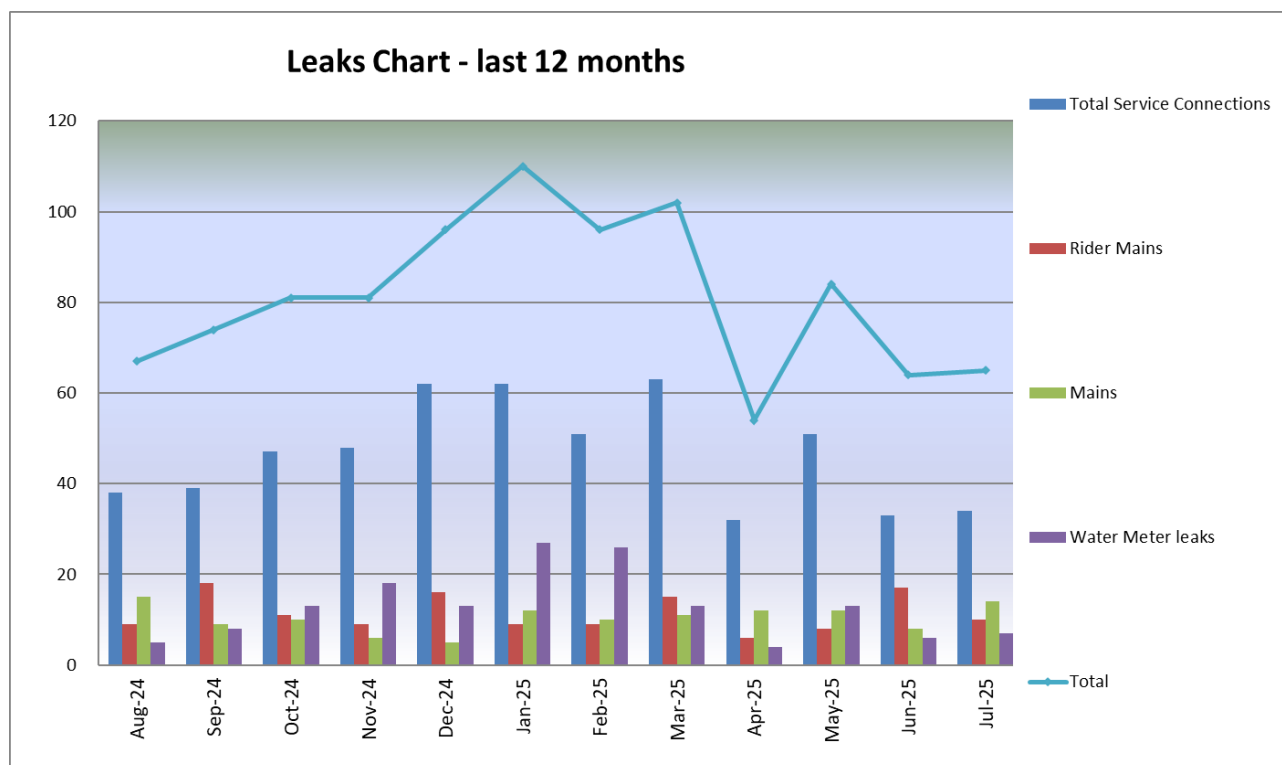

Wastewater

Parua Bay Inflow into Wastewater Investigations

On property investigations are completed at Parua Bay. Defects are being followed up on a case-by-case basis by the inspection team. Operations will engage our maintenance contractor for CCTV inspections of the sewer pipes. This will help us identify its condition and make any needed repairs. This job is estimated to take 2-3 months, as it's weather dependent.

New level sensors, flow meters and pressure sensors were installed to capture level, pressure and flow from the Parua Bay system. This was done to gain a better understanding of its behavior. The data was recorded in both the Historian server and WaterOutlook for trending.


Wastewater Network Modelling

Wastewater capacity assessments are ongoing. Mott MacDonald are progressing with the system performance for the wider WDC wastewater network. This is dependent on ongoing model updates.

WaterOutlook is now able to generate data which shall be used for model calibration and understanding of wet/dry weather overflow.


Reactive Maintenance

A total of 69 Sewer requests of varying nature were received, including 13 x E1 pumps received for July.

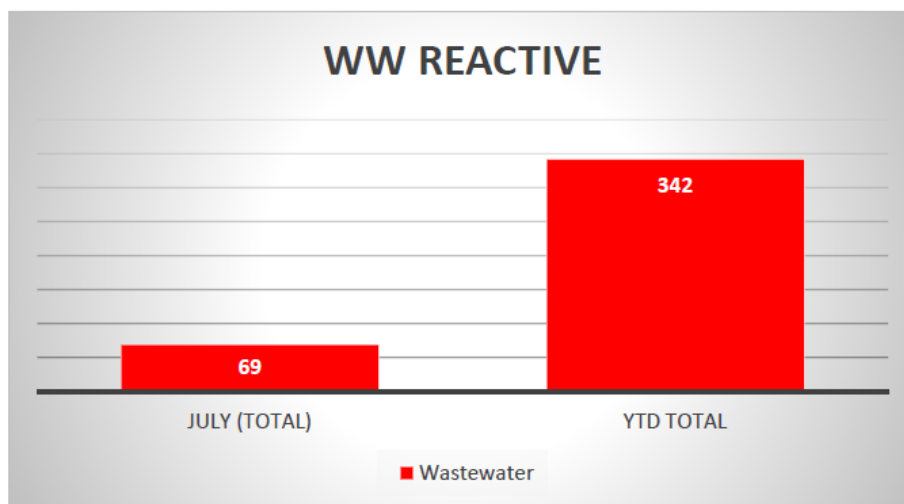


Proactive Maintenance

TDG, our maintenance contractor, have produced a monthly schedule for these, which is a combination for twice weekly, weekly, fortnightly monthly and yearly inspections.

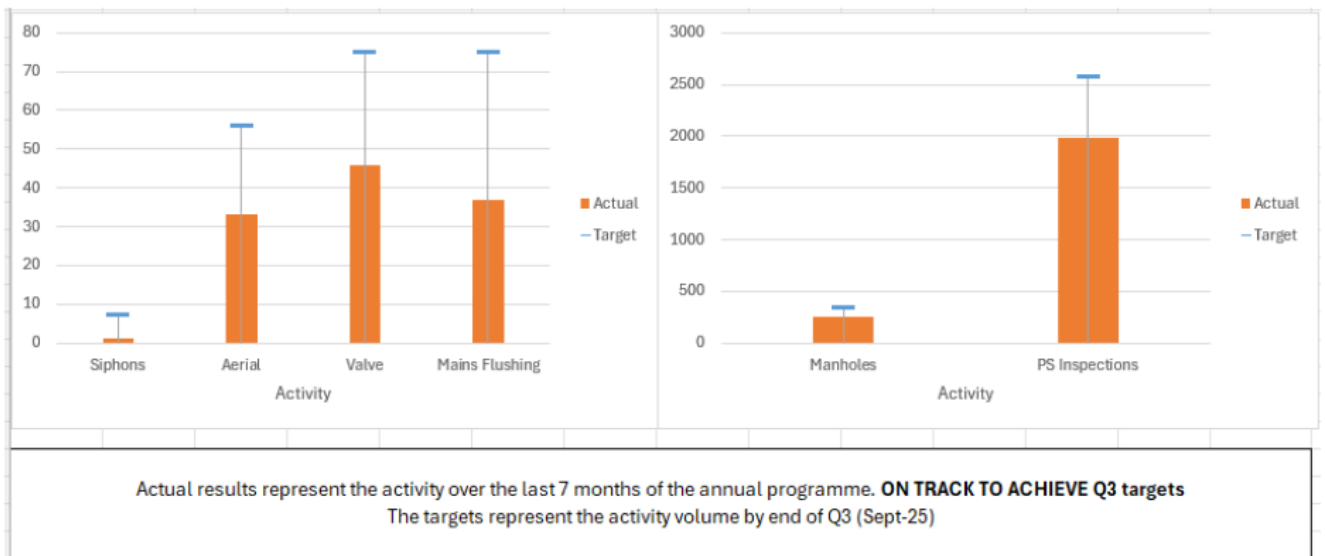


Delivery Performance

1. Restore/Response Performance

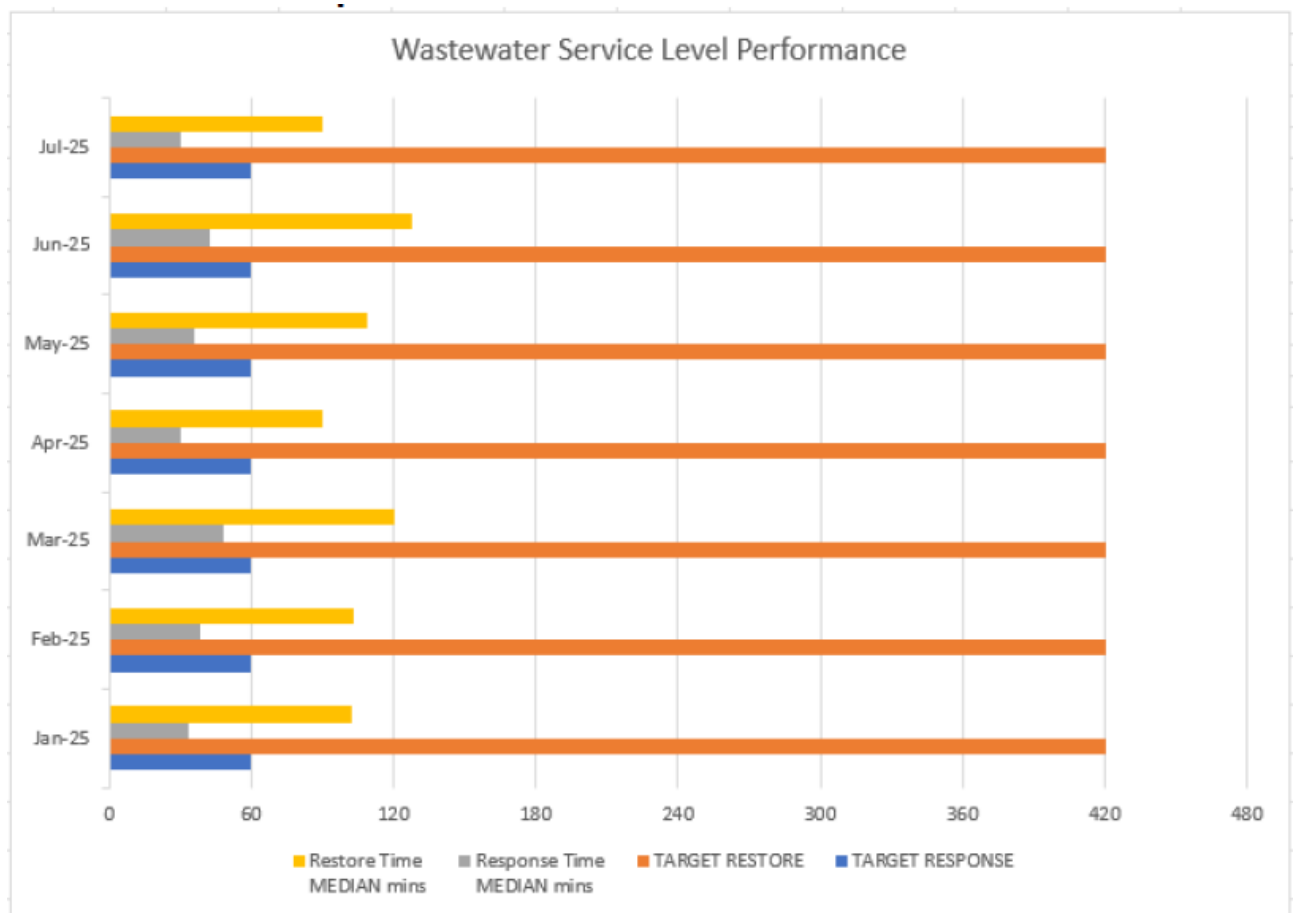

Response and restore times for July 2025 were again excellent this month and comfortably within the target times of 60-mins for response and 360-mins for restore. This has a *positive* impact on both customer service and environmental impacts.

2. Contractor KPI Performance

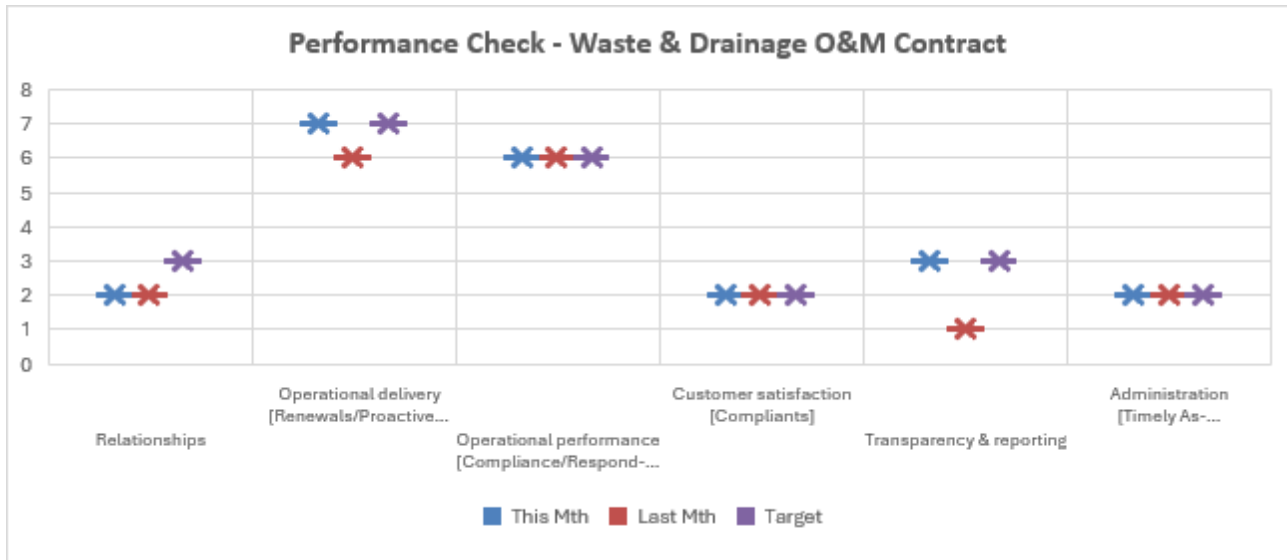

An overall performance of **22 out of 23** across the set of KPIs for July 2025 resulted in a **pass, with requirements fully met**. Although this result was a fully met pass, it showed an improvement of 3 points when compared to the prior month (19) due to the timely furnishing of monthly reports.

Performance	Total KPI score
Requirements fully met	≥18
Performance requires attention	≥12 - ≤17
Poor performance	≤11

4.4 Treatment Plants

Potable Water

Compliance

All treatment plants were compliant over the month

Treatment Plant Compliance

Water Treatment Plant	Bacterial Compliance	Protozoa Compliance	Overall Compliance (Pass/Fail)
Maungakaramea	Pass	Pass	Pass
Mangapai	Pass	Pass	Pass
Ruakaka	Pass	Pass	Pass
Ahuroa	Pass	Pass	Pass
Whau Valley	Pass	Pass	Pass
Ruddells	Pass	Pass	Pass
Poroti	Pass	Pass	Pass

Fluoridation

The fluoride levels were consistent across the 4 treatment plants during July. The average concentrations of fluoride measured at each of the plants is shown in the table below. These are the figures that are reported monthly to the Ministry of Health.

Fluoride levels for June 2025


Treatment Plant	Ahuroa	Ruakaka	Ruddells	Whau Valley
Average Fluoride mg/l	0.72	0.71	0.73	0.72

Wastewater

Whangārei wastewater treatment plant:

Based on the data for July 2025, the Whangarei wastewater plant's flow rate fluctuated significantly. The daily flow generally ranged from approximately 15,123 to 44,322 m³/day, with an average daily flow of about 25,499 m³/day. The month started with moderate flows which increased during the first week of July, corresponding to high rainfall events.

On July 29, the Whangarei wastewater plant received the month's highest rainfall of 88.2 mm. While wastewater flow immediately increased, it did not reach its peak until the following day, July 30, when it hit 44,322 m³/d. This one-day delay between the peak rainfall and peak flow is unusual for our system, as historically, the highest flows have occurred on the same day as the heaviest rain events. This suggests that the intense rainfall on July 29 likely occurred late in the evening, causing stormwater to infiltrate the network and travel to the plant overnight, delaying the peak flow. This highlights a strong correlation between high rainfall and elevated wastewater flow.

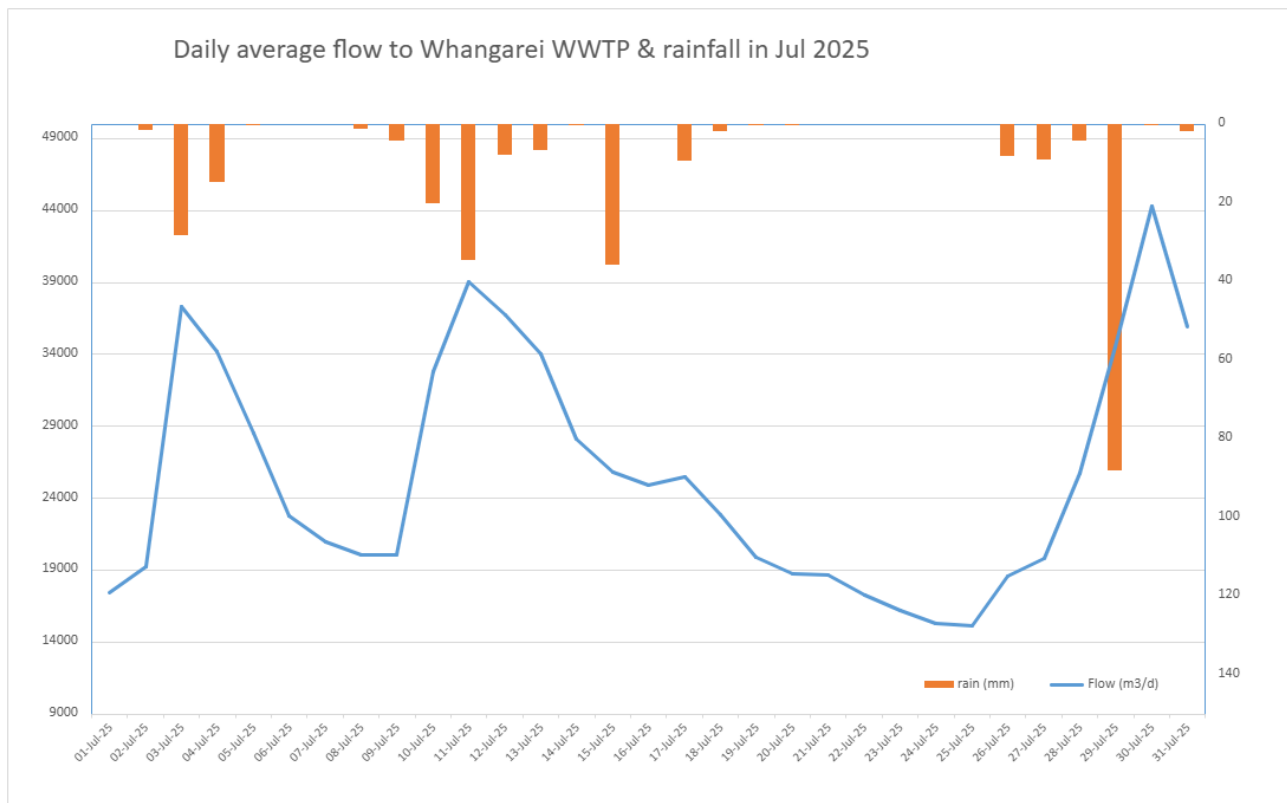

Main maintenance activities:

- The hydraulic wiper rams of the low-flow UV system are being replaced because their magnets have deteriorated with age. Our specialist service provider Filtec will also be replacing the sleeves and wiper rings.
- After three weeks of extensive data collection, the first draft of the Whāngarei Treatment Plant Operations and Maintenance Management Plan (OMMP) has been issued for review and comments. The target submission date to the NRC is August 25.
- Receiving Environment Management Plan (REMP) and Odour Management plan (OdMP) shall be submitted at the same time. GHD has been appointed as a technical advisor to assist the operations team in preparing the aforementioned plans.
- Boiler no 2 was tested and back online.
- Our contractor, Horizon, has added the totals for both the low-flow and high-flow UV systems. This will help us calculate the totals required under **Condition 25** of the plants' new consent.
- Backup generator was serviced.

Hikurangi

- Plant upgrading completed. TSS, BOD now can meet the existing consent conditions < 10mg/L
- The operations team has been running the plant at twice its design capacity to lower the primary pond's water level, which has caused E. coli levels (30-45 per 100 ml) to be slightly higher than the consent limit. However, the treated effluent is still much better compared to both the upstream and downstream water

Ruakaka:

- Ruakaka desludge consent granted.
- Still waiting for CE to approve the recommendation to award the Contract for physical works. A shortfall in the operational budgets needs to be overcome.

Portland:

- The inaugural Kaitiaki Advisory Rōpū meeting has been scheduled for August. This is in keeping with our new consent requirements.
- Te Parawhau hapū have indicated that they may not have the resources to participate in the wetland planting enhancement project
- WDC will appoint a contractor to do this work alone.

Tutukaka:


- There shall be a meeting setting up with key stakeholders, including hapū, as per the new consent requirements.
- Meeting agenda to be circulated in August 2025
- A draft wetland enhancement plan has been submitted to NRC for review and comment. It will be likely that this project shall commence after the completion of similar work at the Portland WWTP.

WaterOutlook Software progress to track consent compliance

- Automated regular reporting for **nine** wastewater treatment plants has been developed.
- We are awaiting feedback from NRC on the reports that have been developed.
- Tradewaste results from our Quality Laboratory Information Management system (QLIM) was successfully received in WaterOutlook, which has the potential to automate the generation of all invoices.
- A new dashboard has been created for Parua Bay flow monitoring reporting.

Stormwater and Flooding

A total of 52 Storm Water jobs were received for the month of July. Most of the requests were weather-related.

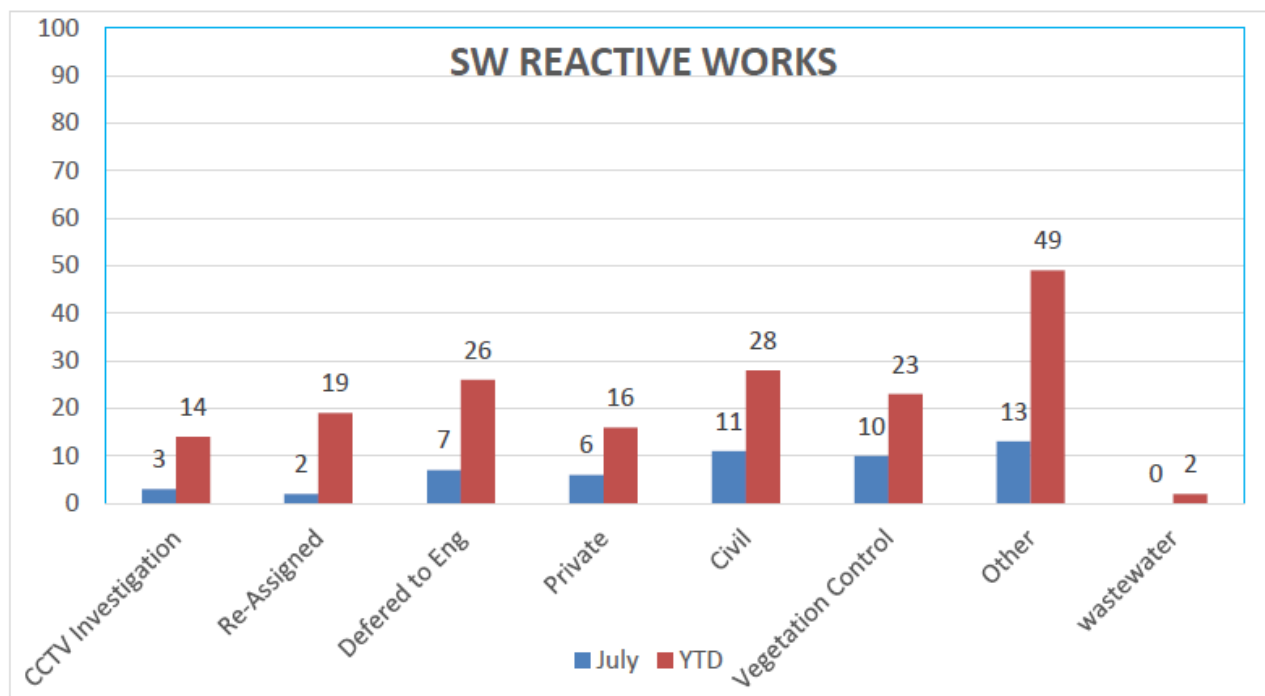

TDG carried out post-storm inspections at the Hikurangi flood scheme to remove weeds. A lot of weeds were washed down during the flooding, which blocked the pump intake. The photos below show that TDG removed the weeds after the storm event.



4.5 Significant Risks and issues

Potable water

Risk event	Cause & Consequence	Controls and Mitigation
Old Fairway Drive Reservoir Leaking	Concrete is degraded and cracks are appearing. Risks to water supply to northern parts of City and Hikurangi	Initial repair undertaken but further investigation required over the next few months. Also investigating a new reservoir on the old Water Treatment Plant site at Whau Valley.
Increased water losses	Increases in leakage coupled with reduced demand and more meter inaccuracy.	Ensure main replacements are undertaken in timely manner, leak detection is completed, and meter renewals are prioritised. Look at possibility of Smart Meters to be rolled out in future.

Wastewater

Whangārei Wastewater treatment plant:

- Median value of TSS is 32 mg/L (from 1 Dec 2024 to 26 March 2025) the consent limit is 15mg/L for flow below 21,000 m³/d
- GHD issued a review for our main plant, it was reported that Total Nitrogen (TN) has been near reaching the limit for the flow within 15,000 m³/d to 100,000 m³/d in condition 25 of the new consent. This suggesting more samples to be collected.

Discharge Triggers (30-day rolling average)	Flows <15,000m ³ /d	Flows >15,000 ≤100,000 m ³ /d
Total nitrogen	280 kg/d	605 kg/d
Total phosphorus	100 kg/d	100 kg/d

- The Wastewater department met with GHD to discuss initiating the filter augmentation work and the Receiving Environmental Monitoring program.

Stormwater and Flooding

Land acquisition has been proposed for Northern Growth Storm Water Attenuation Project. WDC has initiated the process. WSP will start ecological investigations and have planned geotechnical investigation for option 1 in August 2025. In case the land acquisition does not progress well, we will be reverting to other options. Proposed developments on the land in discussion, and Hapu cultural value input might impact on the proposed stop bank option.

Laboratory

No issues to report

5 Performance Measures and compliance

Potable Water

We provide continuous safe, high-quality drinking water to all our customers.

Performance Measure	2024 – 25 targets	Result 24-25
The extent to which the local authority's drinking water supply complies with table 1 of the Water Services (Drinking Water Standards for New Zealand) Regulations 2022 and the Drinking Water Quality Assurance Rules (a) Determinand – Escherichia coli (b) Determinand – Total Pathogenic Protozoa	Fully complies	Fully complies
Residents' satisfaction with the water quality provided by Council (Recorded through the Residents Survey).	≥90%	82%
The total number of complaints received by the local authority about any of the following: (a) drinking water clarity (b) drinking water taste (c) drinking water odour (d) drinking water pressure or flow (e) continuity of supply; and (f) the LA's response to any of these issues expressed per 1000 connections to the LA's networked reticulation system.	≤17	13.0

Adequate water supply available at all times, including in time of emergency.

Performance Measure	2024 – 25 targets	Result Last Month
Where the local authority (LA) attends a callout in response to a fault or unplanned interruption to its networked reticulation system, the following median response times measured:		
(a) attendance for urgent callouts: from the time the LA received notification to the time service personnel reach the site	≤ less than 1hr	0.40
(b) resolution of urgent callouts: from the time the LA received notification to the time that service personnel confirm resolution of the fault or interruption	≤ less than 4hrs	2.00
(c) attendance for non-urgent callouts: from the time that the LA receives notification to the time that the LA receives notification to the time that service personnel reach the site; and	≤ less than 12hrs	3.40
(d) resolution of non-urgent callouts: from the time that the LA receives notification to the time that service personnel confirm resolution of the fault or interruption.	≤ less than 24 hrs	8.27
Total number of water leaks (expressed as No per 100km of mains, including service connections)	≤ 120	89.65
Water Restriction Days (NEPM D-R19)	0	0

We manage the water supply system in a sustainable way that also caters for growth.

Performance Measure	2024 – 25 targets	Results 23 - 24
The percentage of real water loss from the local authority's networked reticulation system (including a description of the methodology used to calculate this). WaterNZ Benchloss	≤ Less than 25%	29.67%
Network Leakage index score (Infrastructure leakage index for whole district) (NEPM D-RE3)	< 3	3.52
Median Residential Water Consumption (litres/connection/day) (NEPM D RE4)	≤ 600	440.87
The average consumption of drinking water (litres/resident/day) within the territorial authority district	≤ 600	330
Residents in our District annually adopt water conservation techniques in their homes and/or businesses (Recorded through the Residents Survey).	≥65%	52%

Wastewater

In defined areas, Council will collect, treat, and dispose of wastewater through a reliable wastewater network which is managed to ensure blockages, breaks or spillages are kept to a minimum.

Performance Measure	2024 – 25 targets	Compliance
Compliance with Territorial Authority (TA) resource consents for discharge from its sewerage system measured by the number of: (a) abatement notices (b) infringement notices (c) enforcement orders, and (d) convictions received by the territorial authority in relation those resource consents.	1	One abatement notice issued by NRC due to Non-compliance at Hikurangi WWTP
The number of dry weather sewerage overflows from the TA's sewerage system, expressed per 1000 sewerage connections to that sewerage system.	≤1.35	On target
Residents' satisfaction with the wastewater network and treatment (Recorded through the Residents Survey).	>70%	On target
4.1.4 The total number of complaints received by the TA about any of the following: (a) sewage odour (b) sewerage system faults (c) sewerage system blockages; and (d) the TA's response to issues with its sewerage system expressed per 1000 connections to the TA's sewerage system.	≤20	On target
4.1.5 Where the TA attends to sewerage overflows resulting from a blockage or other fault in the TA's sewerage system, the following median response times measured:		
(a) attendance time: from the time that the TA receives notification to the time that service personnel reach the site; and	≤1 hr	Within the target Refer to contractor performance for more details
(b) resolution time: from the time that the TA receives notification to the time that service personnel confirm resolution of the blockage or other fault.	≤7 hr	On target

Stormwater and Flooding

Performance Measure	2024 – 25 target	Compliance
Compliance with the territorial authority's (TA) resource consents for discharge from its stormwater system, measured by the number of: (a) abatement notices (b) infringement notices (c) enforcement orders; and (d) convictions received by the TA in relation to those resource consents.	0	On target
Residents' satisfaction with stormwater drainage service (Recorded through the Residents Survey).	≥70%	On target
The number of complaints received by a TA about the performance of its stormwater system, expressed per 1000 properties connected to the TA's stormwater system. (c.)	≤16	On target
(a) The number of flooding events (a.) that occur in a TA district; and (b) for each flooding event (a.) the number of habitable floors affected (b.) expressed per 1000 properties connected to the TA's stormwater system.	0	On target
The median response time to attend a flooding event, measured from the time that the TA receives notification to the time service personnel reach the site.	≤1 hr	On target

Notes:

- A flooding event means an overflow of stormwater from a territorial authority's stormwater system that enters a habitable floor (Department of Internal Affairs, 2014). It does not therefore apply outside declared stormwater service areas, or to non-habitable structures such as garages and sheds, or to flooding of yards.
- While all flooding events will be recorded as per DIA requirements, the target is immunity from storm events with an annual exceedance probability (AEP) of more than 2% (one in 50-year ARI). This is consistent with District Plan rules for minimum floor level.
- This target expresses per 1000 properties rather than a total, which would have resulted in a target of 15.7 per 1000 properties. In 2017-18 Annual Plan this was expressed as per 400 properties across the district.

Council will provide a reliable and sustainable flood protection scheme, which is managed to mitigate flooding within the Hikurangi Swamp Scheme area to an acceptable level.

Performance Measure	2024 – 25 target	Compliance
The major flood protection and control works that are maintained, repaired and renewed to the key standards defined in the local authority's relevant planning documents (such as its Activity Management Plan, Asset Management Plan, annual works programme or Long-Term Plan).	Yes	On target
The number of infringement or abatement notices issued by Northland Regional Council in relation to the scheme consent.	0	On target

6 Capital Work (Statistics from July 2025)

Potable Water

* RAG = Red / Amber / Green – **Red**, some issues to **Green**, going to plan

Major Projects	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
Three Mile Bush Reservoir	Construction	Jun-24	Sept-25	

The two new timber tanks on Woodlea Lane, along with the associated pump station on Dip Road, the pumping main, gravity main, and pressure reducing valve, were commissioned in May. Some residents will now receive slightly higher water pressure due to the higher elevation of the new reservoirs compared to the old reservoirs on Three Mile Bush Road. Communications were in place ahead of this change, and all affected residents had been informed. The pressure reducing valve on Three Mile Bush Road is scheduled to be completed in August. Pipework at the existing reservoir site needs to be remediated and will be completed in September. Demolition of the obsolete timber tanks and the Tuatara Drive pump station is finished.



Consultant: Vecta, Contractor: Ventia NZ Operations.

Kamo Reservoir (Dip Road)	Construction	Aug-24	Oct-25	
---------------------------	--------------	--------	--------	--

Construction is progressing well. Post tensioning of the walls is complete and roof construction is currently underway.

Completion is still on track for October 2025

Major Projects	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
				
Consultant: Tonkin & Taylor, Vecta, Contractor: Steve Bowling Contracting				
Porotī Water Treatment Plant	On Hold	TBC	30 Nov 2028	
Detailed design draft complete. RAG status is RED, however, now an agreement in principle has been agreed with Whatitiri Māori Reserves Trust the project can be restarted. A new timeline will be developed, and it is estimated that completion is now likely to be late in 2028. The Ministry of Health has been informed and we have asked for the fluoride directive to be extended until this date. Consultant: Beca				
Whangarei Heads Pipeline Replacement	Construction	Nov-24	Jun-25	
Construction has been completed. Commissioning of the newly installed pipes was completed on 15 July 2025. Practical completion inspection has been completed as well.				

Major Projects	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
				
Consultant: Hawthorne Geddes Engineers		Contractor: Northern Pipe and Civil		
Poroti Trunkmain Renewal	Construction	April-25	September-25	
Works commenced mid-May and are expected to be completed by early September 2025. Access agreements are in place with the private landowners. Ground condition is worse than anticipated and an extension of time has been granted due to this.				

Major Projects	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
				
Consultant: Hawthorn Geddes Engineers		Contractor: Fulton Hogan		
Onerahi Watermain Upgrade	Procurement	April-25	June-26	
Tender evaluation has been completed. Recommendation for award of contract has been submitted for approval. Consultant: Vecta Contractor: TBC				
Miraka Road Watermain Upgrade	Deliver	June-25	Sept-25	
Construction has commenced in late June. No major issues encountered aside from line strikes due to inaccurate as-builts. A section of the works is also located within the shoulder of SH1 which required nightworks as directed by NZTA. Consultant: Weir Consulting Contractor: North Drill Ltd.				

Wastewater

Capacity increases is the current focus.

Major Projects	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
Whangārei WWTP New Admin / Workshop Building	Analyse	Early 2026	TBA	
The Business case has been completed. Due to a high engineer's estimate, the Procurement Plan, including project budget shortfall details, are to be submitted to Council in August for approval, before going to tender. The project remains separated into three subprojects to manage complexity and streamline delivery: • The new administration building and workshop • The new motor control room (MCC) • The demolition of the old administration building Next steps: • The design of the new MCC room is currently out to tender, with submissions due back at the start of September. • The relocation plan for the transformer is being developed in coordination with Northpower. • The tender for the design and build contract for the new administration building and workshop is being prepared for release in September, pending Council budget approval. Contractor: TBA				
Whangārei WWTP Augmentation	Analyse	June 2025	June 2026	
• The Wastewater department met with GHD to discuss initiating the filter augmentation work and the Receiving Environmental Monitoring program • The Wastewater department has been working with the Waters Project team to find a suitable project manager to develop the upgrade works. This will include the tertiary filtration and preparing scope of works for Civil component. • Filtec have been asked to provide a revised offer for the supply and install of tertiary filters and it is expected that this will go ahead. Early indications suggest that there will be a 26 month lead in period for the delivery of the filter units. • The upgrading of the UV facility at the WWTP that was initially included in the overall scope of the augmentation works will be put on hold until after the tertiary filtration has been completed. The effectiveness of the filtration may have a direct bearing on the efficacy of the UV disinfection. If this eventuates, then this upgrade may not be required.				
Whangārei WWTP Odour Control	Construction	Mar-23	Nov-25	
Construction underway and going well. Completion expected in November 2025. During the concrete rehabilitation in preparation for the new GRP covers, it has become apparent that the concrete damage to the splitter chamber downstream of the headworks is much more substantial than anticipated, requiring immediate repair. BECA and United Civil are currently				

Major Projects	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
working through the implications (design and cost) together with WDC staff. WDC staff will report back to Council once the full extent is understood. Design and Cost for the Splitter Chamber have been confirmed, and an increase of the contract value has been requested Consultant: Beca Contractor: United Civil				
WW Emergency Overflow Tank – Parua Bay	On Hold	TBA	TBA	
The project is to construct a larger tank to reduce the frequency and volume of spills. Further modelling investigation, Inflow investigations, gap analysis and stream quality monitoring is underway to understand the problem; once complete the project will be rescoped. Budget has been removed from current LTP – decision required whether to cancel this project. Outside of this project actions are being taken by the Operations team on sewer overflows. Consultant: Mott MacDonald				
WW Rising Main Renewal Kioreroa Road	Construction	Feb-24	Mar-25	
Construction is complete, Consultant: Hoskin Civil; Contractor: United Civil Construction.				
Hikurangi WWTP – Modular Plant & Inlet Screen	Construction	Early 21	July 2025	
Upgrade completed. Consultant: Aquaero. Contractor: Northern Drainage				
Sewer Capacity Increase Growth Areas	Business Case		Jun-26	
Updating of network model ongoing. Gap analysis has been completed and road map for collecting missing information has been developed. Ongoing.				
Tutukaka Dump Station	Business Case	Oct 24	July 25	
The motor caravan dump station design is completed. Construction of the dump station is planned to start in September – to be located adjacent to Ngunguru Road on the Tikipunga reserve.				
Kepa Road	Construction	Sep 24	July 25	
The pipeline and manhole construction works are now completed. Manhole coatings have been applied. The contractor is closing out minor snagging items. Draft As-built drawings have been provided for review. Consultant: JAS Civil; Contractor: TDG				

Consenting Projects - Wastewater	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
Whangārei WW Network Discharge Consents	Deliver	N/A	Jun-25	
Network discharge consents (NDC) covering the wastewater pump stations and piped reticulation network for the WDC's Whangārei Wastewater Scheme including the Whangārei Heads network (excludes the Whangārei Wastewater Treatment Plant) as required by the NRC's Proposed Regional Plan for Northland. The Whangārei Wastewater network model (separate project) which will help to quantify the extent of the wet weather overflows, and to inform the assessment of environmental effects required to support the NDC consent application is being updated and validated. Specialist consultants to undertake the necessary ecological and public health risk assessments to inform the assessments of environmental effects required to support the consent applications have been engaged. Stage 1 of the Ecological assessment has been completed which has informed the scope of the public health risk assessment. The Coast and Catchment - Whangarei WW Network Stage 1 Water Quality and Ecological Assessment (Final) has been submitted. The delivery timeframe for the Stage 2 assessment report (assessment of the effects of overflows from the Whāngārei wastewater network on stream and coastal environments) is expected to be 28 February 2026. A project Working Group/Rōpū has been established for hapū to provide advice on matters relating to the consent application. A meeting with hapu was held in July as part of the consent requirements for the Whangārei City and Whangārei Heads Wastewater Network Discharges Consent Project - Working Group-Rōpū. The next meeting is scheduled for late August. RAG status is amber due to the longer than expected timeframes to undertake and receive the ecological and public health risk reports required to inform the consent application. Consultant: Mott MacDonald & Coast and Catchment Ltd.				
Oakura/Hikurangi WWTP Resource Consent Renewal	Deliver	N/A	Mid-25	
Existing NRC consents authorising the discharge of treated effluent for the Oakura and Hikurangi wastewater treatment plants are due to expire on the 31 May 2025 and 30 June 2025 respectively (note that Council may continue to operate under the existing consents until the new consents have been granted and all appeals, if any, are determined). The consent application for the renewal of the Oakura WWTP discharge consents has been lodged. Ngati Wai has provided a cultural impact assessment to inform the consent application. The consent application for the renewal of the Hikurangi WWTP discharge consents has been lodged and it has been agreed with the NRC to extend the timeframe to process the application pending receipt of input from hapū. Council has engaged with Ngati Kahu regarding input to the application and have undertaken a joint site visit. Consultant: GHD				

Stormwater and Flooding

Major Projects	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
Morningside Flood Relief Upgrade	Detail Design, procurement	Jan-24	Nov-25	

Stage 1 (Pump Station):

Stage 1: Complete, apart from handrails and the mesh protection on top of the Pump Station

Stage 2 (Interceptor)

Works are underway, with the Eastern Interceptor to be completed first, followed by the western pipeline across the sports field and towards Morningside School.

Eastern Interceptor construction in August/September 2025

Installation across sports field: September 2025

Western interceptor along Morningside Rd.

and in front of School: September/October 2025

Completion in November 2025

Consultant: Weir consultants

Contractor: United Civil Construction Ltd



Citywide Stormwater Consent	Consenting	N/A	Jul-25	
------------------------------------	-------------------	------------	---------------	--

CVA: Draft ToR version 1.1 has been circulated. Two separate Hui (online) have been arranged with hapu due to coordination issues to discuss on ToR Version 1.1 and develop CVA scope, process, timeline and remuneration.

ITA: Industrial Trade Audit of 41 sites is required, quote has been received from previous contractor, works to start in end August/September.

Maintenance Activities: Consultant is reviewing the feasibility of including general maintenance activities into the application.

Consultant: GHD, Landform Consulting

Major Projects	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
Hikurangi Repo Flood Scheme – Business Case	Analyse	May-23	Jul-25	
Hydraulic modelling complete. Ewater will issue a draft report for WDC to review and comment. Review to finalise report will happen in August.				
Mair Street to Rurumoki Street Stormwater Renewal	Deliver - Design	Aug-25	Nov-25	
The construction contract has been awarded to Fulton Hogan. Hydrovac and site investigations will start in August 2025. Consultant: Metis Consultants Contractor: Fulton Hogan				
Whangarei Urban Flood Strategy	Strategic case Technical Assessment	N/A	July 2026	
Phase 1: Project Planning: Complete Phase 2: - Strategic case is in progress. Undertook internal meetings to brainstorm Investment Objectives. Feedback was collated and a draft “WUFS Investment objective” Report has been prepared. - Roles & Responsibility Report has been received that sets out the legislative and strategic context, and roles and responsibilities of key stakeholders involved in managing compound flood risk (including coastal flooding) in urban Whangārei. Consultants : Adapterra Ltd & Coastal Management Collective Ltd Phase 3: - Methodology to deliver technical assessment includes 4 stages – Stage 1: Understand the problem, Stage 2: Identify potential solution, Stage 3: Bundle & test against different futures, Stage 4: Prepare business cases. - Deliverable for Stage 1 has been received. The project team has identified pilot studies for which to progress development of adaptation strategies, based on a set of predetermined criteria. - Asset data survey was required to inform the flood model. Local surveyors are engaged to capture the data. To be delivered on 28th August. - Technical Advisory Group (TAG) is formed. Meeting has been arranged to discuss reporting on Stage 1 deliverable-Understanding the problem. Consultants: - Technical Assessments: Beca, Urban Intelligence and NIWA - Project Leadership: Adapterra Ltd - Asset Data survey: Simpson & Shaw Peer reviewers: BellAdapt & Metis Consulting				

Major Projects	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
Northern Growth Flood Resilience SW Attenuation	Analyse	2026/2027	2028	

Professional services RFP for Stage 1 (Separable Portion 2) has been awarded to WSP.

The second portion of work for Stage 1 Feasibility includes civil concept design, consenting strategy, ecology, cultural values, archaeology, land acquisition and construction cost estimation. Consent application & Detailed Design will follow (26/27 FY) and then Construction is planned for 26/27 FY.

Land acquisition has been initiated by WDC. Ecological and more detailed geotechnical investigations will be done in August for the second phase of Feasibility by the consultants.

Consultants: Hoskin Civil, WSP New Zealand Ltd.

Blue Green Network Programme	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
Raumanga Stream Restoration	Deliver	Feb-24	Jul-27	

Flood mitigation and environmental restoration. Weeding and revegetation on section from Bernard St footbridge upstream to SH1 in Otaika. Work is to be staged over time and includes establishment period for planting. Hapū engaged early and ongoing. Initial areas of work will be the path-side of the stream, and non-path side between SH1 and the reserve. A large area has been weeded and close to 3,000 plants were planted in July 2025. Weed clearance and re-planting in the winter 2025 along the bank is programmed for this year and on-going. SP1 is completed now and SP2 will continue from September 2025.

Contractor/Consultant: Wildlands Consultants

6.1 Project details – Specific projects

Fluoridation Programme

As directed by the Director General of Health this fluoridation programme involves the installation of fluoride dosing equipment to meet deadlines between July 2024 and 2026. Whau Valley, Ruddells, Ruakaka and Ahuroa Water Treatment Plants are completed and have met the directive date. The Poroti Water Treatment Plant still needs to upgrade to meet the current directive date of 30 June 2026.

Fluoridation Programme	Current Phase	Estimated Construction Start Date	Estimated Completion Date	RAG Status
Poroti Water Treatment Plant	Analyse	2026	Nov-28	

A letter has been drafted to the Director General of Health requesting an extension of the deadline for the Poroti Water Treatment plant until 30 November 2028.

Ruakaka Wastewater Treatment Plant

The Project is for a major upgrade of the Ruakākā Wastewater Treatment Plant (WWTP) and disposal system (land disposal and/or ocean outfall), in order to increase the capacity allowing for growth both residential and commercial. The Project has been in the Analyse Phase of the IMF engaging the necessary resources to investigate and develop concepts, optimization, preliminary designs, suitable locations, and estimates to produce a comprehensive Business Case by end Nov 2025.

Ruakaka WWTP & Effluent Disposal Systems Upgrade Programme	Current Phase	Estimated	Programme	Current Phase
Ruakākā WWTP Upgrade	Analyse	End-25	2029-30	
Preliminary Design for both WWTP and Biosolids is approx. 40% through the process, which will include a list of outcomes required to feed into the Business Case. This is expected to be completed early Oct 2025. Design Consultant: PDP.				
Ruakākā WW Coastal Outfall	Analyse	End-25	2029-30	
All investigations and data complete, the phase is 30% through Concept design, and construction specifications, which will also include a list of outcomes required to feed into the Business Case. This is expected to be completed early Oct 2025. This is expected to be completed early Oct 2025. Design Consultant: AECOM.				
Ruakākā WW Alternative Discharge Options	Analyse	End-25	2029-30	
Preferred options have been confirmed; concept design is being completed including next stage programme and requirements together with estimated costs. This is expected to be completed by end of Sep 2025, with the information to be feed into the Business Case. The investigations and community consultation will not be fully complete for the Business Case, assessments and assumptions will be necessary to complete the Business Case. Design Consultant: WSP.				
Ruakākā WW Interim Discharge	Analyse/Plan	Aug25	Jul 26	
Completion of the Hydrogeology modelling has been delayed, which has delayed the necessary information to complete the other assessment. This is now expected to be completed early Sep 2025. Lizard Surveys are now required with the Concession application as a result of process changes in DOC. All of this has delayed Application Submissions of the Resource Consent and Concession by six weeks with the new submission date 22 Sep 2025 Design Consultant: Beca				

RESOLUTION TO EXCLUDE THE PUBLIC**Move/Second**

That the public be excluded from the following parts of proceedings of this meeting.

The general subject of each matter to be considered while the public is excluded, the reason for passing this resolution in relation to each matter, and the specific grounds under Section 48(1) of the Local Government Official Information and Meetings Act 1987 for the passing of this resolution are as follows:

General subject of each matter to be considered	Reason for passing this resolution in relation to each matter	Ground(s) under Section 48(1) for passing this resolution
1.1 Confidential Minutes Infrastructure Committee meeting held 21 August 2025	Good reason to withhold information exists under Section 7 Local Government Official Information and Meetings Act 1987	Section 48(1)(a)

This resolution is made in reliance on Section 48(1)(a) of the Local Government Official Information and Meetings Act 1987 and the particular interest or interests protected by Section 6 or Section 7 of that Act which would be prejudiced by the holding of the whole or the relevant part of the proceedings of the meeting in public, are as follows:

Item	Grounds	Section
1.1	For the reasons as stated in the open minutes.	

Resolution to allow members of the public to remain

If the committee wishes members of the public to remain during discussion of confidential items the following additional recommendation will need to be passed:

Move/Second

“That _____ be permitted to remain at this meeting, after the public has been excluded, because of his/her/their knowledge of Item _____.

This knowledge, which will be of assistance in relation to the matter to be discussed, is relevant to that matter because _____.