Development of the Technology City in Dhahran

تطوير المناطق التقنية - الظهران

CLIENT	CONTRACTOR	CONSULTANT	MODON PM	SITE HANDOVER	CONTRACT COMPLETION
MODON	ANSAB Contracting	EGIS	Eng. Afat Elanzey	06-Jan-2026	05-Mar-2027

Scope: collector and local roads; potable water, sewage, storm drainage, irrigation, TSE, medium-voltage, street lighting and telecom networks; a sewage pump station and storm drainage ponds; boundary fence, guard room and utility buildings.

Status at a glance

Progress is measured as physical % complete, weighted by budgeted man-hours. At the 02-Nov-2026 data date the project is 21.1% complete against 36.4% planned in the baseline (SPI 0.58), and against 34.8% in the contractor's recovery plan (SPI 0.61). This week added 0.31%, all in roads and sewage, against 2.78% planned in the recovery plan.

PHYSICAL % COMPLETE

21.1% / 36.4% plan

▼ SPI 0.58 −15.2%

PROGRESS THIS WEEK

+0.31% / +2.78% plan

▼ 2.47% below the weekly plan

CONTRACT TIME ELAPSED

70.9% · day 300 of 423

▼ P6 finish 22-Jul-2027

INVOICED TO DATE (GROSS)

11.3% · 10.5M SAR


4 invoices, last period ends 15-Oct-2026

The schedule update now finishes the project four and a half months late.

The P6 update with data date 02-Nov-2026 schedules project completion on 22-Jul-2027, 139 days after the contract completion date of 05-Mar-2027 and 7 days later than last week's update. The weekly report still forecasts 05-Mar-2027 with no change to any milestone. Finishing on time needs about 4.6% physical progress a week for the 17 weeks left, against 0.31% this week.

Site photos this week

Four photos from this week's upload: one photo file and three photos embedded in the 02-Nov-2026 weekly report workbook. Only the prime-coat photo carries a stamp (02-Nov-2026, 15:20, Adh Dhahran Industrial District). Select a photo to view it larger, then use the arrows to move between photos.

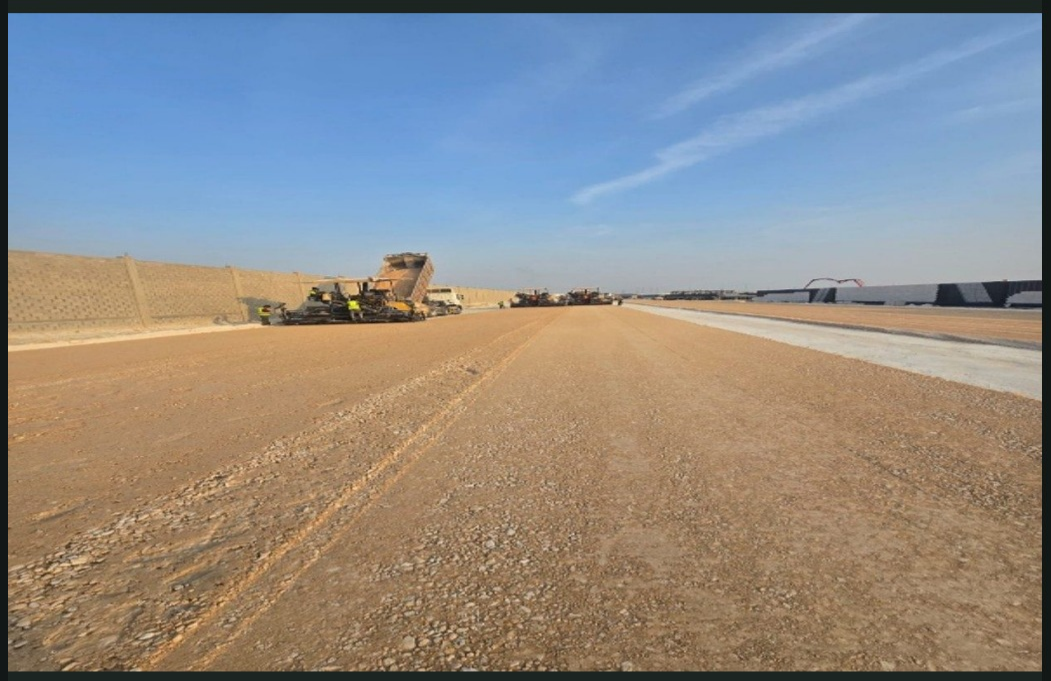


Road base course

Aggregate base course laid, with a paver and trucks working ahead.



Storm pipe trench

Levelling survey along a storm pipe trench, with pipes laid out and an excavator behind.

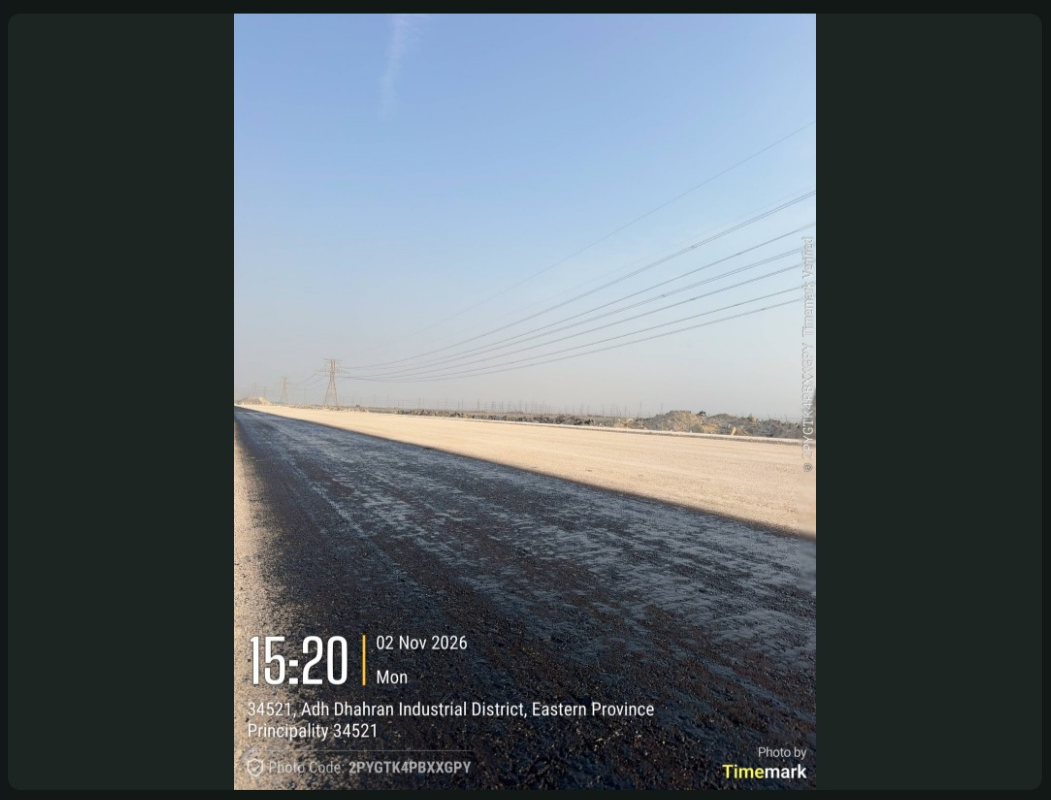

Prime coat

MC1 prime coat sprayed on the base course. Stamped 02-Nov-2026, 15:20.




Roof slab formwork

Shoring and timber formwork for a building roof slab between concrete columns.

Progress S-curve

Cumulative physical progress (man-hour weighted), monthly. Source: Physical-Chart Data sheet.

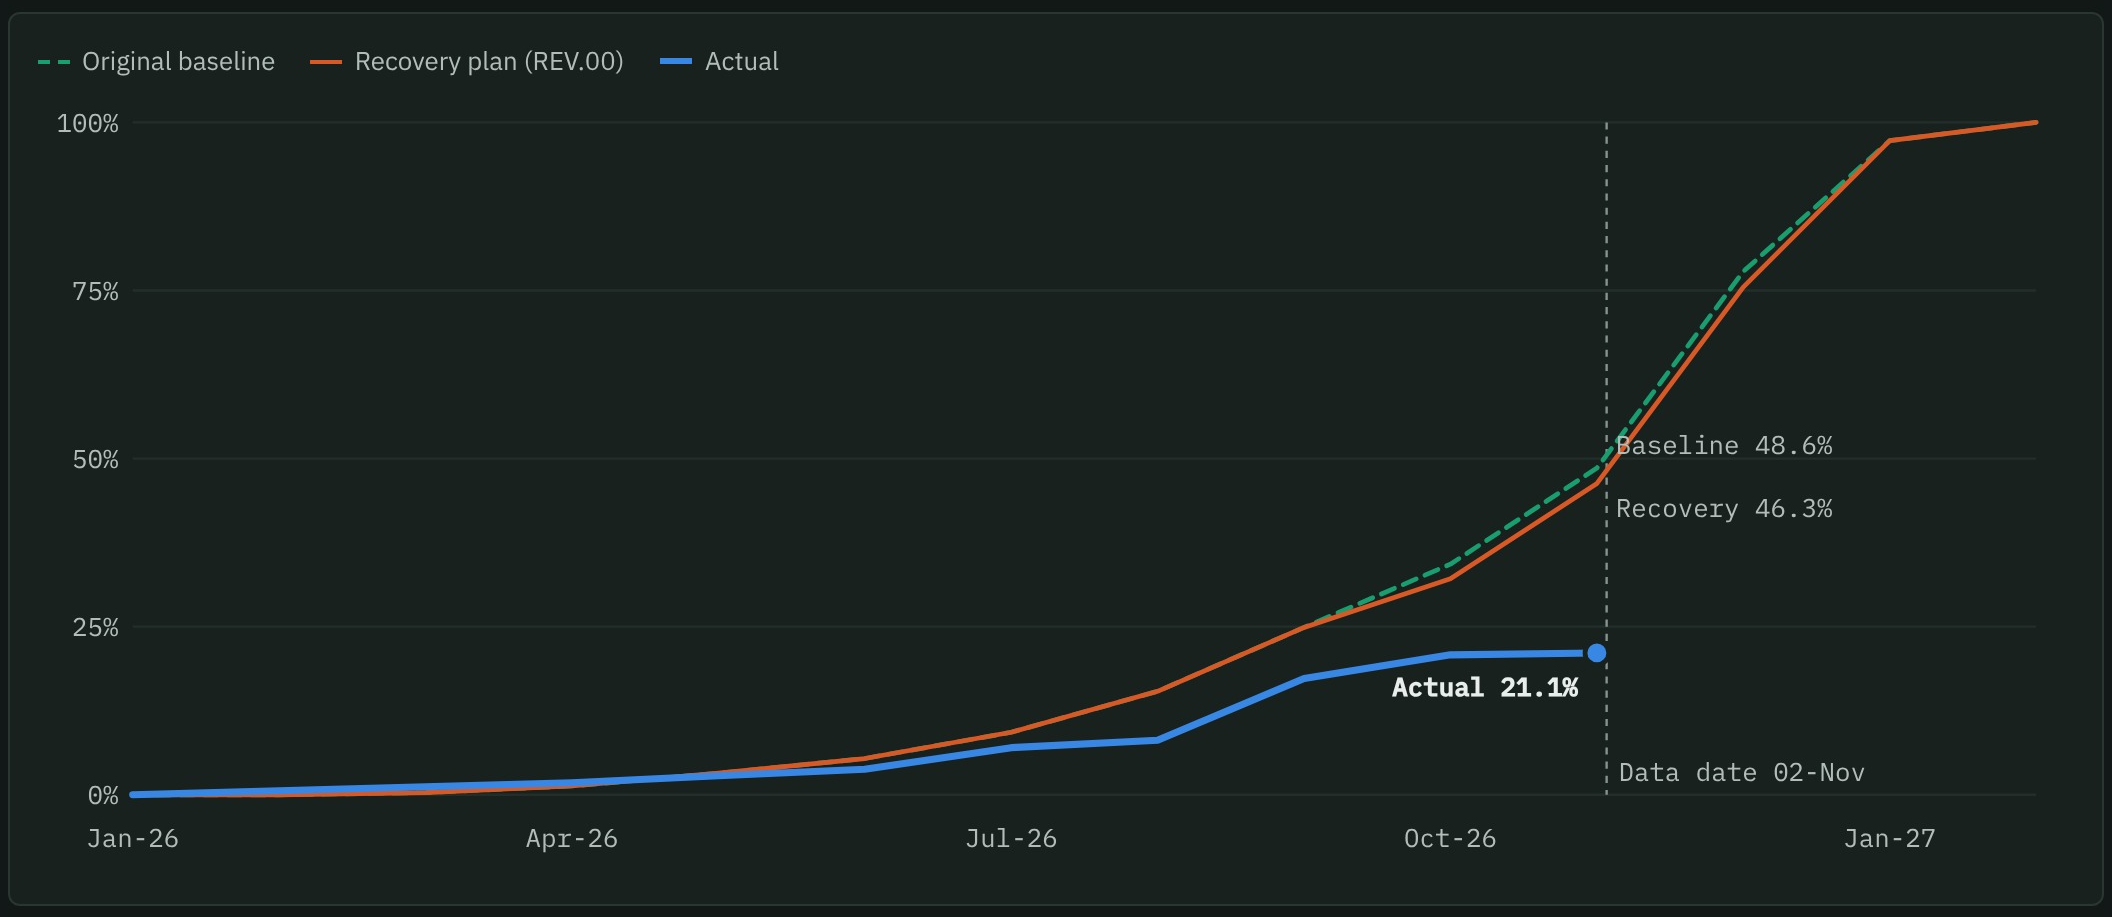

PERIOD ENDING	PLANNED %	ACTUAL %	VARIANCE	GAINED IN PERIOD	SPI
Jun-2026	5.4	3.8	−1.6%	+1.0%	0.70
Jul-2026	9.3	7.0	−2.3%	+3.2%	0.75
Aug-2026	15.4	8.1	−7.3%	+1.1%	0.52
Sep-2026	24.9	17.3	−7.5%	+9.2%	0.70
26-Oct-2026	36.4*	20.8	−15.6%	+3.5%	0.57
02-Nov-2026	**36.4***	**21.1**	**−15.2%**	**+0.31%**	**0.58**

Planned values are the original baseline; monthly rows are month-end values from the chart data, and the last two rows are the weekly reports of 26-Oct and 02-Nov-2026. * The progress summary gives 36.4% planned to date in both weeks, so the baseline plan did not advance this week; the monthly chart data gives 34.3% for the end of October and 48.6% for the end of November. The recovery plan rose from 32.1% to 34.8% this week.

Progress by phase

Physical progress to date by WBS, weighted by budgeted man-hours (131,328 in total). All man-hours sit under construction; engineering, procurement and testing carry none.


PHASE	WEIGHT	PLANNED	ACTUAL	VARIANCE	SPI	STATUS
Boundary fence and guard room	28.5%	56.3%	51.1%	−5.2%	0.91	▼ Slightly behind
Roads network	17.2%	0.0%	1.9%	+1.9%	–	▲ Started early
Utility buildings	14.1%	59.6%	28.8%	−30.8%	0.48	▼ Behind
Storm drainage network	10.6%	80.4%	19.3%	−61.0%	0.24	▼ Behind
Softscape	5.3%	0.0%	0.0%	0.0%	–	● Not yet due
Low-voltage network	5.0%	0.0%	0.0%	0.0%	–	● Not yet due
Potable water network	4.1%	10.4%	0.0%	−10.4%	0.00	▼ Not started
Sewage network	3.1%	65.4%	3.6%	−61.9%	0.05	▼ Behind

PHASE	WEIGHT	PLANNED	ACTUAL	VARIANCE	SPI	STATUS
Street lighting network	3.0%	0.0%	0.0%	0.0%	–	Not yet due
TSE network	2.6%	19.7%	0.0%	-19.7%	0.00	Not started
Irrigation network	2.2%	4.2%	0.0%	-4.2%	0.00	Not started
CCTV	1.6%	0.0%	0.0%	0.0%	–	Not yet due
Medium-voltage network	1.3%	23.9%	0.0%	-23.9%	0.00	Not started
Telecom network	1.2%	0.0%	0.0%	0.0%	–	Not yet due
Furnishing	0.2%	0.0%	0.0%	0.0%	–	Not yet due
Total	100%	**36.4%**	**21.1%**	**-15.2%**	**0.58**	Behind

Planned is the original baseline. Against the recovery plan (34.8% to date) the SPI is 0.61. This week's 406 earned man-hours came from roads (+260) and sewage (+146); fence, utility buildings and storm drainage did not move. The P6 update (data date 02-Nov-2026) has 1,065 activities: 302 completed, 28 in progress and 735 not started.

Scope of work: quantities

Total quantity, quantity finished and quantity remaining for the main items, from the Major Quantities sheet of the 02-Nov-2026 weekly report. "This week" compares it with the 26-Oct-2026 report: the sheet was not updated, so every item shows 0.

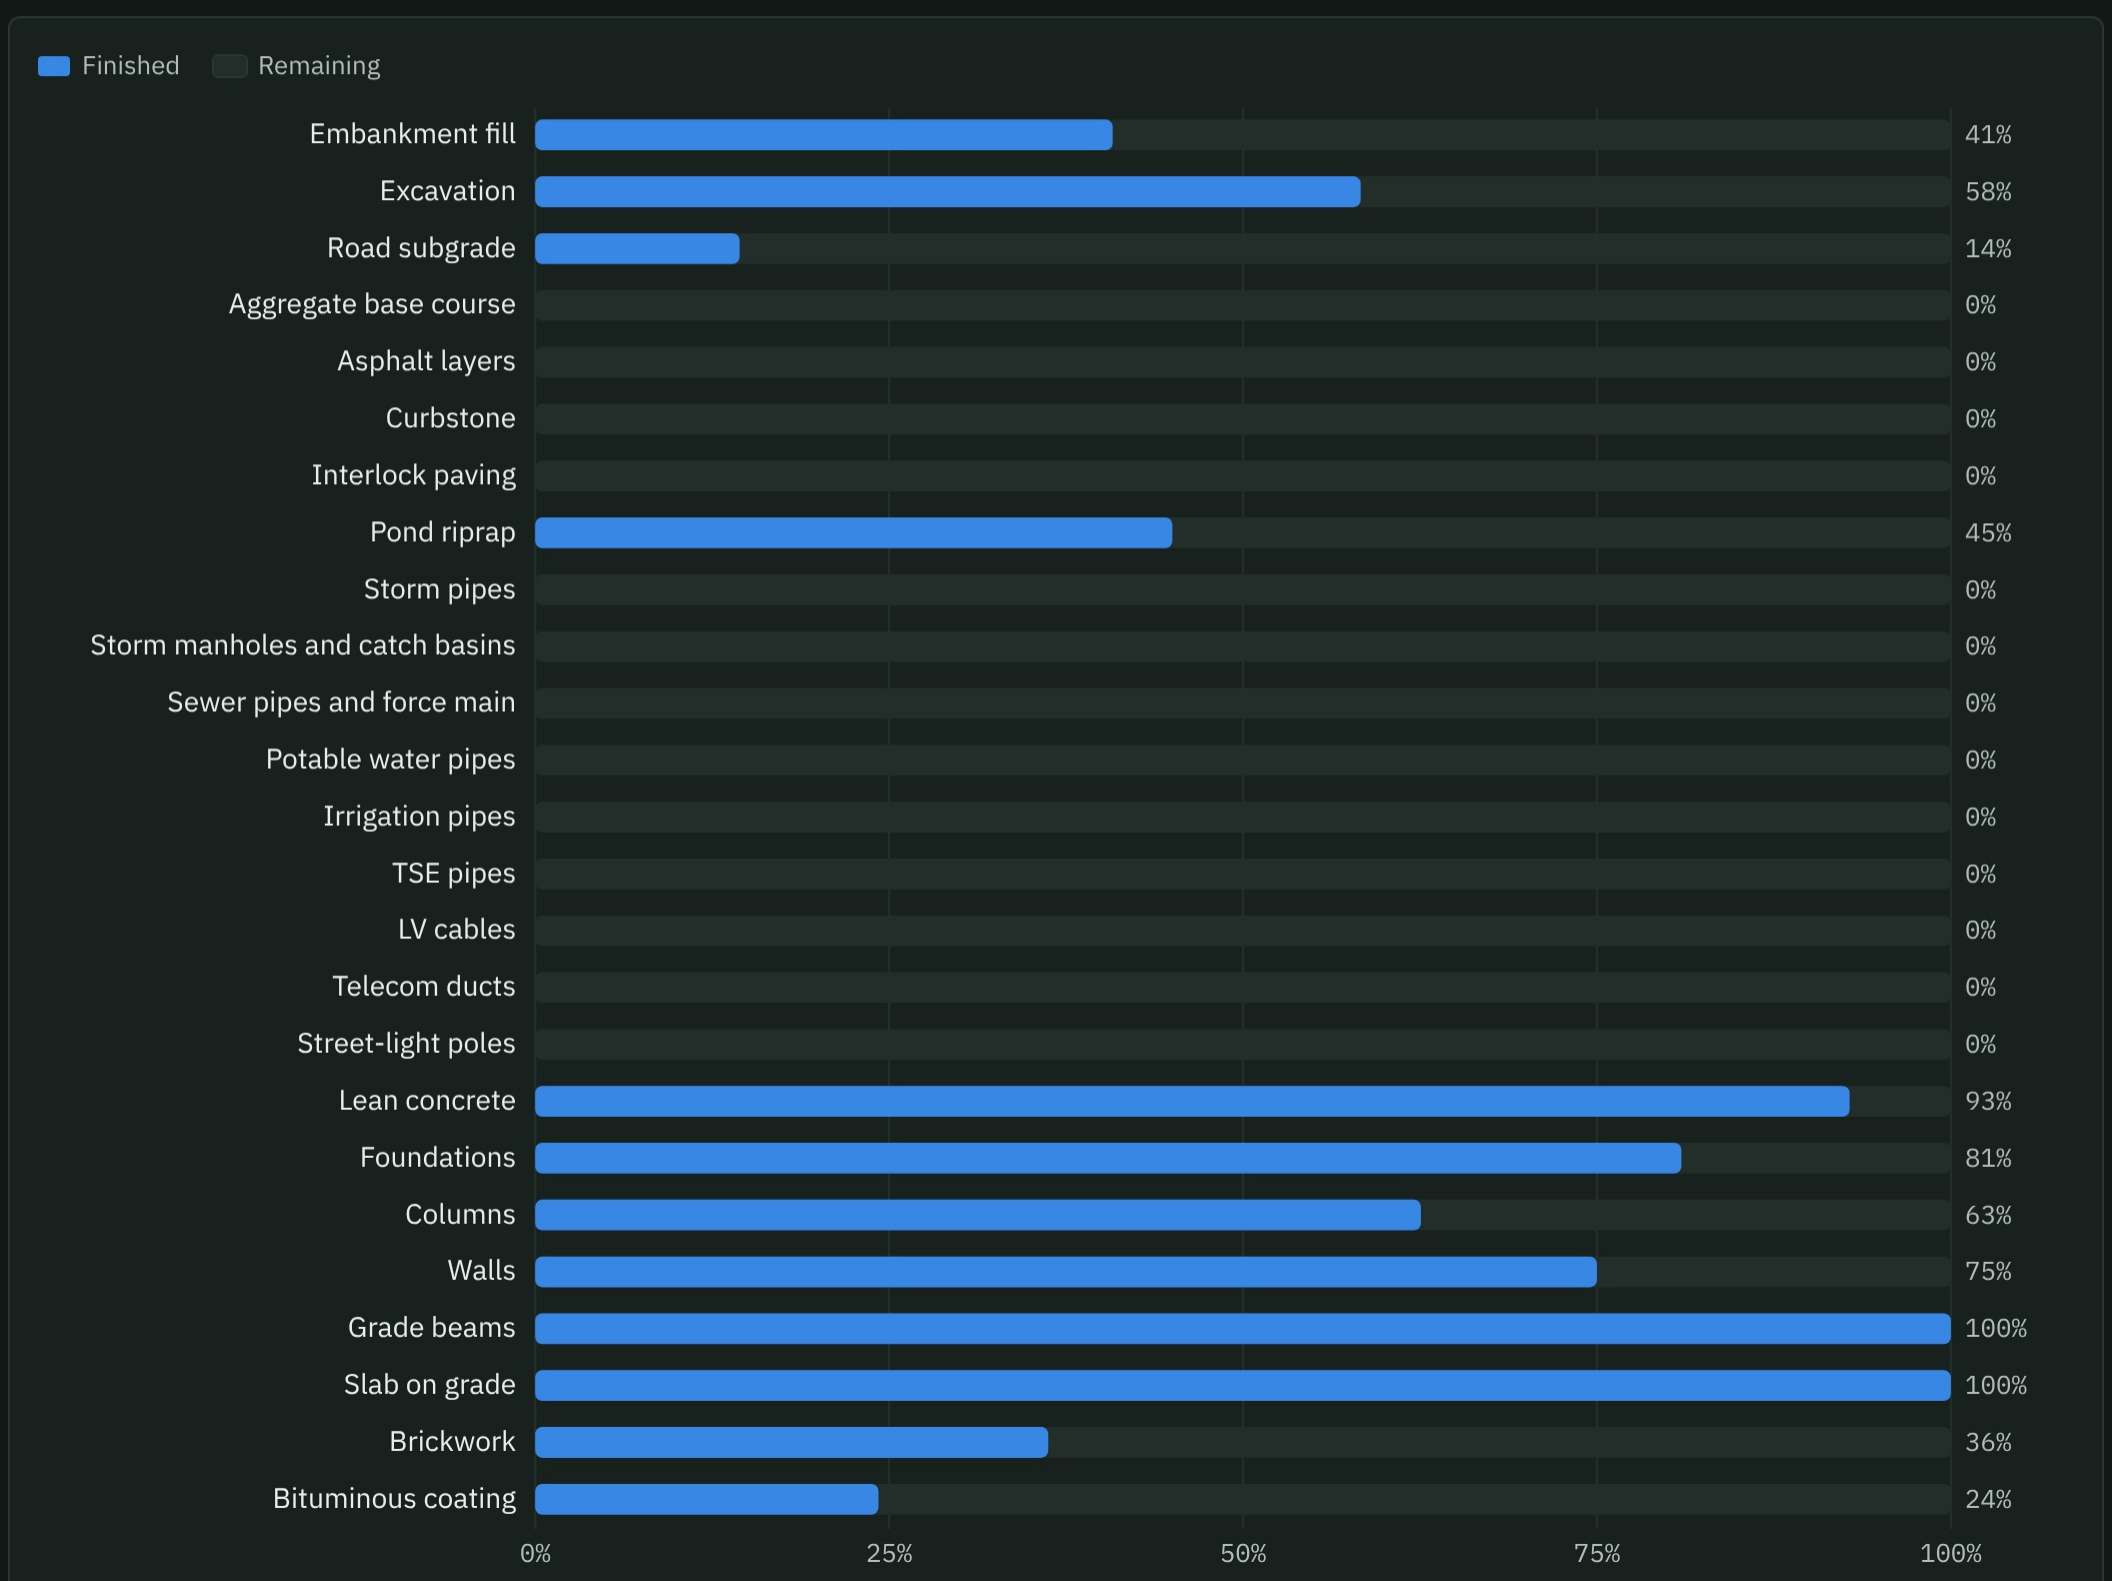

SCOPE ITEM	AREA	UNIT	TOTAL	FINISHED	THIS WEEK	REMAINING	% FINISHED
Embankment fill	Site	m³	1,050,000	428,344	0	621,656	40.8%
Excavation	Site	m³	61,715	35,987	0	25,728	58.3%
Road subgrade	Roads	m³	45,731	6,605	0	39,126	14.4%
Aggregate base course	Roads	m³	22,866	0	0	22,866	0.0%
Asphalt layers	Roads	m³	15,254	0	0	15,254	0.0%
Curbstone	Roads	LM	46,423	0	0	46,423	0.0%
Interlock paving	Roads	m²	90,979	0	0	90,979	0.0%
Pond riprap	Storm ponds	m²	7,985	3,594	0	4,391	45.0%
Storm pipes	Networks	LM	7,221	0	0	7,221	0.0%
Storm manholes and catch basins	Networks	EA	283	0	0	283	0.0%
Sewer pipes and force main	Networks	LM	3,897	0	0	3,897	0.0%
Potable water pipes	Networks	LM	4,183	0	0	4,183	0.0%
Irrigation pipes	Networks	LM	8,954	0	0	8,954	0.0%
TSE pipes	Networks	LM	5,421	0	0	5,421	0.0%
LV cables	Networks	LM	13,353	0	0	13,353	0.0%
Telecom ducts	Networks	LM	5,770	0	0	5,770	0.0%
Street-light poles	Networks	EA	139	0	0	139	0.0%
Lean concrete	Fence and guard room	m³	1,933	1,914	0	19	99.0%
	Utility buildings	m³	248	111	0	137	44.8%
	Total	m³	**2,181**	**2,025**	**0**	**156**	**92.8%**
Foundations	Fence and guard room	m³	2,119	2,102	0	17	99.2%
	Utility buildings	m³	781	246	0	535	31.5%
	Total	m³	**2,900**	**2,348**	**0**	**552**	**81.0%**
Columns	Fence and guard room	m³	440	328	0	112	74.5%
	Utility buildings	m³	137	33	0	104	24.1%
	Total	m³	**577**	**361**	**0**	**216**	**62.6%**
Walls	Fence and guard room	m³	1,328	996	0	332	75.0%
Grade beams	Utility buildings	m³	460	460	0	0	100.0%
Slab on grade	Utility buildings	m³	119	119	0	0	100.0%
Brickwork	Fence and guard room	m²	11,754	4,260	0	7,494	36.2%
Bituminous coating	Fence and guard room	m²	51,678	12,532	0	39,146	24.3%

Buildings and earthworks

Fence and guard room foundations are almost complete and walls are at 75%. Utility building grade beams and slabs are complete, but their columns are at 24%. Embankment fill is at 41% and road subgrade at 14%; the storm pond riprap is at 45%.

Networks barely started

The Major Quantities sheet still records no pipes, manholes, cables or ducts installed, against 5,698 m of storm pipes and 1,768 m of sewer pipes planned by this date. The inspection log for this week does record storm pipe backfilling between manholes MH-10 and MH-06, 6 storm manholes, 7 catch basins, base course and prime coat on external roads 2 and 3, and the Conclusion sheet reports 102 m of storm network executed.

Milestones

The weekly report keeps every milestone on its baseline date, while the P6 update moves most of them by one and a half to nine and a half months. Both are shown so the difference can be resolved with the contractor.

MILESTONE	BASELINE	WEEKLY REPORT FORECAST	P6 UPDATE FORECAST	P6 VS BASELINE (DAYS)	STATUS
Site handover	06-Jan-2026	06-Jan-2026	06-Jan-2026 (actual)	0	✓ Done
Execution plan and baseline schedule	05-Feb-2026	05-Feb-2026	05-Feb-2026 (actual)	0	✓ Done
Shop drawing and material approval	16-Feb-2026	16-Feb-2026	29-Nov-2026	+286	▼ Late
Mobilisation	08-Mar-2026	08-Mar-2026	07-Mar-2026 (actual)	−1	✓ Done
Potable water network	14-Dec-2026	14-Dec-2026	25-May-2027	+162	▼ Late
Irrigation network	27-Dec-2026	27-Dec-2026	25-May-2027	+149	▼ Late
Medium-voltage network	07-Jan-2027	07-Jan-2027	24-Apr-2027	+107	▼ Late
Telecom network	11-Jan-2027	11-Jan-2027	25-May-2027	+134	▼ Late
Storm drainage network	13-Jan-2027	13-Jan-2027	24-May-2027	+131	▼ Late
Sewage network	26-Jan-2027	26-Jan-2027	15-Mar-2027	+48	▼ Late
TSE network	26-Jan-2027	26-Jan-2027	12-Jun-2027	+137	▼ Late
Street lighting network	09-Feb-2027	09-Feb-2027	24-May-2027	+104	▼ Late
Road works	–	–	25-May-2027	–	▼ After contract date
Storm drainage ponds	–	–	12-May-2027	–	▼ After contract date
Sewage and water pump stations	–	–	30-Jun-2027	–	▼ After contract date
Control room	–	–	19-Jul-2027	–	▼ After contract date
Project completion	05-Mar-2027	05-Mar-2027	22-Jul-2027	+139	▼ Late

The weekly report and the P6 update disagree on every open milestone.

The weekly report shows all milestones on their baseline dates with zero days of change, including shop drawing and material approval (16-Feb-2026), which is still open. The P6 update moves every network past its baseline and the project finish to 22-Jul-2027, one to two weeks later than last week for every open milestone. The P6 file gives no total float values, so float is not shown.

Procurement of key materials

Share of total quantity supplied. Source: the supply tracking file uploaded with the 02-Nov-2026 report.



Electrical, mechanical and building systems: nothing supplied yet


Street lighting poles, fixtures and cables, CCTV, pumps, GLS tanks and SCADA are all at 0%. Supply is scheduled between 25-Nov and 25-Dec-2026; street lighting, CCTV and SCADA are recorded as unpaid.

Two sources disagree

Storm manholes (50 of 59) and catch basins (90 of 144) are listed as still in manufacturing, with supply starting next week. The weekly report's own Procurement sheet is unchanged since 26-Oct and shows far lower deliveries, for example storm pipes 634 of 4,672 m and sewage pipes 0 of 2,977 m.

Manpower

Monthly head count on site (manual and non-manual), planned vs actual. Source: Manpower sheet.

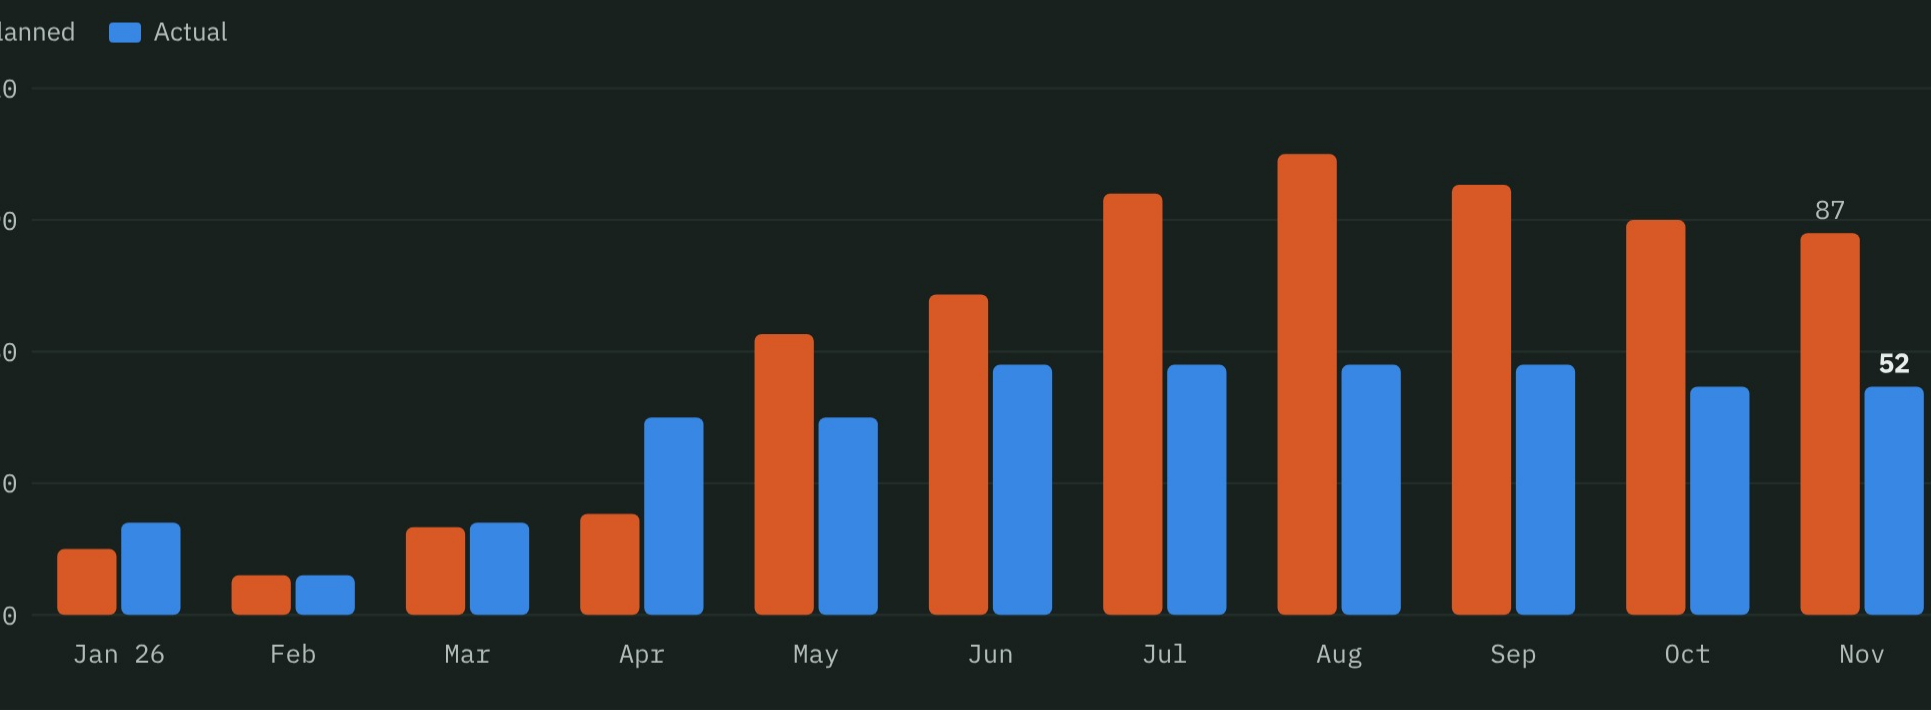

November head count is 52 against 87 planned (−40%): 30 manual workers against 78 planned, and 22 staff against 9 planned. The November actuals repeat October's.

Cost and invoicing

Contract value

Original contract value	93,388,079
Change orders	0
Potential changes	0
Advance payment (10%)	9,338,808

All values in SAR. The contract summary in the same workbook gives 93,388,697 including VAT.

Invoices

Invoices submitted	4
Gross value	10,524,342
Retention	0
Deductions and penalties	165,500
Net amount	10,358,842
PM-approved / paid	0 / 0

Invoicing is 11.3% of the contract value against 20.8% physical progress. None of the four invoices is recorded as approved by the PM or paid.

Health, safety and quality

Safety Score 0.89

Safe man-hours (cumulative)	123,930
Man-hours this week	4,800
Lost-time injuries	0
Fatalities	0
First-aid cases	0
Near misses	0
Property damage	0
Inductions / toolbox talks	10 / 29

Quality Score 0.84

NCRs issued / open	4 / 4
Site instructions open	5
FIRs issued / closed	3 / 3
MIRs issued	0
Shop drawings submitted	53
Material submittals	19
Material submittals with consultant	5

Three NCRs have been open for 31–60 days. The scores come from a QC checklist dated 14-Apr-2026 and an HSE inspection covering 27-Jan to 03-Feb-2026.

Open issues and risks

ISSUE	OWNER	DETAIL
Advance payment and invoices	Client	Risk score 25 of 25. The P6 update still shows receipt of the advance payment as not started (now forecast 02-Nov-2026), and none of the four invoices is approved or paid.
Testing of executed works	Contractor	Risk score 20. Delays in testing, or failed tests, could lead to rework and delay handover.
Tie-in to existing networks	Client / Consultant	Risk score 16. The existing infrastructure may not be ready for connection, delaying commissioning.
Groundwater	Contractor	Risk score 16. Excavations may need continuous dewatering, which would slow trench and foundation works.
Material supply	Contractor	Risk score 15. Most network materials are still undelivered while installation is planned to be well advanced.

Source: Risk Log sheet. Both items in the issue log (site debris and the advance payment) are marked closed. The risk log also lists an opportunity: possible BOQ savings after re-measurement of quantities.

Data notes

- This-week values compare the 02-Nov-2026 weekly report (WPR-37) with the 26-Oct-2026 report (WPR-36) in the W05 folder.
- The Milestones sheet states contract week 43 of 60, used as the report week. Whole weeks from site handover to the data date give 42.
- The baseline planned progress to date is 36.4% in both weeks' summaries, so the baseline plan did not advance; the monthly chart data gives 34.3% at the end of October and 48.6% at the end of November.
- The weekly physical columns repeat last week's values (708 planned and 445 earned man-hours, fence only). The actual gain this week (406 man-hours, +0.31%) was taken from the change in cumulative earned man-hours.
- The Major Quantities and Procurement sheets are unchanged from 26-Oct-2026, while the inspection log records storm pipe, manhole, catch basin, base course and prime coat works this week and the Conclusion sheet reports 102 m of storm network executed.
- The supply tracking file gives much higher supplied quantities than the Procurement sheet, uses project ID DHRT-02-01 and names a different project manager ("م/ نواف"). It lists supplied quantities for storm manholes and catch basins that it also marks as still in manufacturing.
- The weekly report forecasts completion on 05-Mar-2027 with zero variance, while the P6 update finishes on 22-Jul-2027 (15-Jul-2027 last week).
- In the dashboard's progress overview, the Roads and CCTV rows have their names swapped; the Progress sheet was used instead.
- The Conclusion sheet and the dashboard label cost-based progress as "actual" progress; it is not used in this report.
- The Conclusion sheet is headed "Dammam", reports 260,000 m³ of earthworks against 428,344 m³ in the Major Quantities sheet, and gives network lengths that differ from the Procurement sheet (for example storm pipes 4,838 m against 4,672 m).
- The invoice summary says 3 invoices were submitted, but the invoice log lists 4 with a total of 10,524,342 SAR. The log also shows a revised contract value of 21,100,000 and an EAC of 20,900,000, which do not match this contract.
- Several sheets carry other projects' identifiers or old dates: the QC checklist and the FIR log use project DHRT-02-001, the risk register uses DAMT-01-002 (Dammam), and the HSE inspection covers 27-Jan to 03-Feb-2026.
- The issue log closes the advance payment issue, but the P6 update and the risk log both show it as still open.
- The November manpower actuals (30 manual, 22 staff) repeat October's, and the dashboard's resources panel still shows January head counts.
- The Schedule sheet still counts 1,271 activities with the same statistics as last week; the uploaded P6 file has 1,065.
- The uploaded PowerPoint is the MODON report guide; it still states contract week 35 of 60 and was not used for figures.

Compiled 05-Nov-2026 from the weekly reports of 26-Oct and 02-Nov-2026 and the P6 update of 02-Nov-2026.