Development of the Technology City in Dammam

تطوير المناطق التقنية - الدمام

CLIENT	CONTRACTOR	CONSULTANT	MODON PM	SITE HANDOVER	CONTRACT COMPLETION
MODON	Ansab Contracting	EGIS	Engr. Afat Elanzey	23-Dec-2025	22-Feb-2027

Scope: collector and local roads, potable water, sewage, storm drainage, irrigation, TSE, medium voltage, street lighting and telecom networks, a sewage pump station, storm drainage ponds, the boundary fence and guard room, and utility buildings, in the 2nd Industrial City in Dammam.

Status at a glance

Progress is measured as physical % complete, weighted by budgeted man-hours. The weekly report (WPR-38) gives 32.47% actual against 68.43% planned in the original baseline and 50.23% in the revised plan. This week added 2.66% against 3.68% planned.

PHYSICAL % COMPLETE

32.47% / 68.43%

plan

▼ SPI 0.47 −35.96% · revised plan 50.23%, SPI 0.65

PROGRESS THIS WEEK

+2.66% / +3.68%

plan

▼ 1.02% below the weekly plan

CONTRACT TIME ELAPSED

72.8% · day 310 of 426

▼ Forecast finish 08-Jun-2027

INVOICED TO DATE (GROSS)

11.2% · 7.6M SAR

Last invoice period ends 05-Oct-2026

The project is forecast to finish 106 days late.

The weekly report and the P6 update both forecast completion on 08-Jun-2027 against the contract date of 22-Feb-2027, and the completion milestone has −80 days of float in P6. Most networks have barely started: sewage is at 0.6%, potable water 5.5% and storm drainage 23.4% of their man-hours, while work is concentrated on the fence and guard room and the utility buildings. To finish on 22-Feb-2027 the remaining 67.53% must be done in 16 weeks, about 4.22% a week, against 2.66% this week.

Site photos this week

Six photos from the WPR-38 upload. The photos carry no date or GPS stamp. Select a photo to view it larger, then use the arrows to move between photos.



Boundary fence wall

Block wall with its bituminous coating, along the site boundary.



Concrete columns in formwork

Crew working on scaffolding around tall reinforced concrete columns.



Utility building frame

Concrete frame with roof formwork, a mobile crane and an excavator alongside.



Foundation slab reinforcement

Reinforcement fixed inside braced formwork, ready for concrete.



Storm drainage pond

Grouted riprap on the pond slopes, with an inlet structure.



Road capping layer

Compacted road formation between sand stockpiles.

Progress S-curve

Cumulative physical progress (man-hour weighted), monthly. Source: Physical-Chart Data sheet of WPR-38.



MONTH	PLANNED %	ACTUAL %	VARIANCE	GAINED IN MONTH	SPI
May-2026	10.9	3.1	−7.8%	+1.2%	0.28
Jun-2026	17.6	4.2	−13.5%	+1.1%	0.24
Jul-2026	29.7	14.3	−15.4%	+10.1%	0.48
Aug-2026	43.3	21.1	−22.2%	+6.8%	0.49
Sep-2026	56.9	29.0	−27.9%	+7.9%	0.51
Oct-2026	**73.8**	**31.6**	**−42.3%**	**+2.6%**	**0.43**

Planned is the original baseline at month end. The chart sheet uses the full P6 budget of 151,920 man-hours, so its October actual (31.59%) is lower than the 32.47% on the cover sheet; see Data notes. The revised plan reaches 41.0% in October and the contractor's forecast reaches 100% in February 2027. Weekly values for earlier weeks are not available, because this is the first week uploaded for the project.

Progress by phase


Physical progress to date by WBS, weighted by budgeted man-hours. Planned is the revised (P6) plan to date. Source: P6 extract on the Progress sheet of WPR-38.

PHASE	WEIGHT	PLANNED	ACTUAL	VARIANCE	SPI	STATUS
Engineering	3.0%	100.0%	100.0%	0.0%	1.00	✓ Complete
Procurement	20.0%	86.2%	55.1%	−31.1%	0.64	▼ Behind
Sewage network	2.7%	85.1%	0.6%	−84.5%	0.01	▼ Behind
Storm drainage network	6.4%	61.0%	23.4%	−37.6%	0.38	▼ Behind
Potable water network	3.1%	52.0%	5.5%	−46.5%	0.10	▼ Behind
Irrigation network	2.3%	5.8%	0.0%	−5.8%	0.00	▼ Not started
TSE network	1.2%	5.2%	0.0%	−5.2%	0.00	▼ Not started
Medium voltage network	0.6%	0.0%	0.0%	0.0%	–	● Not yet due
Telecom network	1.8%	0.0%	0.0%	0.0%	–	● Not yet due
Street lighting network	2.2%	0.0%	0.0%	0.0%	–	● Not yet due
Roads network	4.8%	66.7%	64.6%	−2.1%	0.97	▼ Slightly behind
Fence and guard room	30.2%	50.6%	31.9%	−18.7%	0.63	▼ Behind
Utility buildings	11.7%	17.9%	26.7%	+8.8%	1.49	▲ Ahead
Testing & commissioning	10.0%	0.0%	0.0%	0.0%	–	● Not yet due
Total	100%	**48.9%**	**31.6%**	**−17.3%**	**0.65**	▼ Behind

Weights are each phase's share of the 18,990 budgeted man-days in P6. The P6 update (MOD3-3147-BL0-R0-6, data date 27-Oct-2026) has 873 activities: 331 completed, 50 in progress and 492 not started. Failed-start activities rose from 60 to 77 this week.

Scope of work: quantities

Total, finished and remaining quantity for the items with recorded progress, from the Major Quantities sheet of WPR-38. "This week" cannot be calculated, because no earlier week has been uploaded for this project.

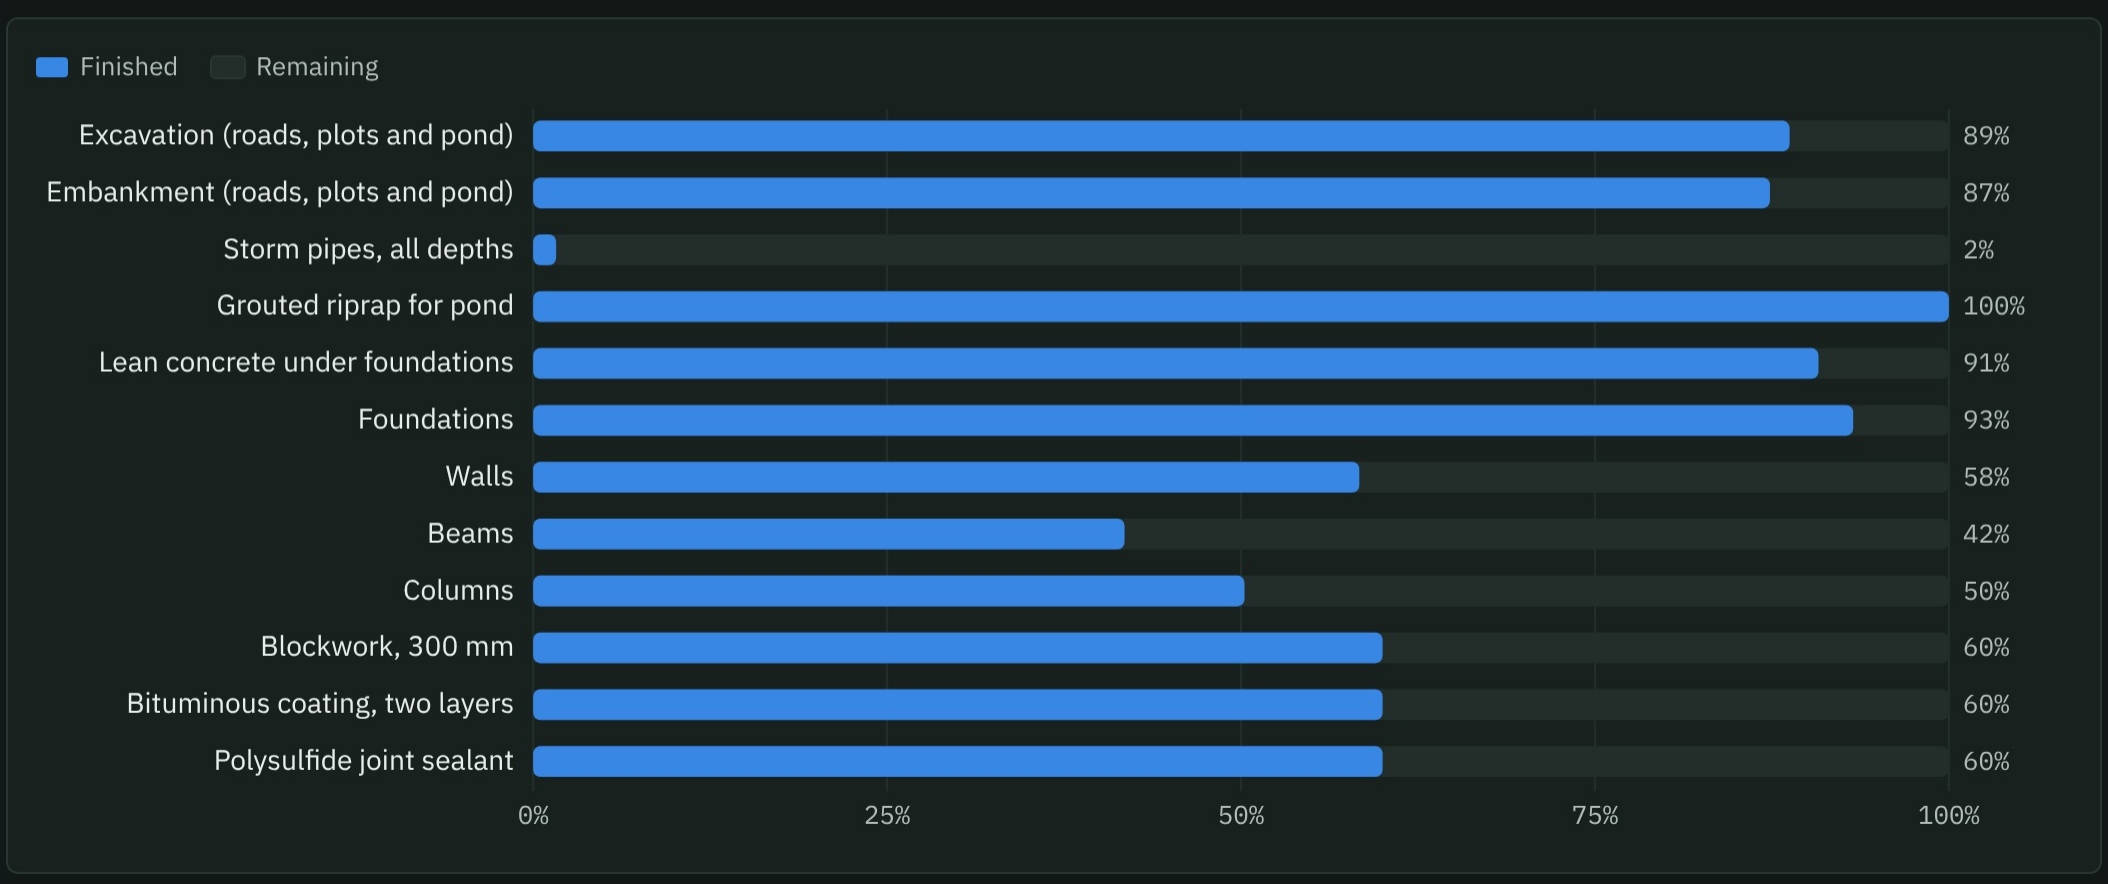

SCOPE ITEM	NETWORK	UNIT	TOTAL	FINISHED	THIS WEEK	REMAINING	% FINISHED	BACKFILLED

SCOPE ITEM	NETWORK	UNIT	TOTAL	FINISHED	THIS WEEK	REMAINING	% FINISHED	BACKFILLED
Excavation (roads, plots and pond)	Roads	m³	502,417	445,886	–	56,531	88.7%	–
Embankment (roads, plots and pond)	Roads	m³	314,650	274,878	–	39,772	87.4%	–
Storm pipes, all depths	Storm drainage	LM	5,560	90.2	–	5,470	1.6%	–
Grouted riprap for pond	Storm drainage	m²	3,720	3,720	–	0	100.0%	–
Lean concrete under foundations	Fence and guard room	m³	1,500	1,362	–	138.2	90.8%	–
Foundations	Fence and guard room	m³	7,310	6,816	–	494	93.2%	–
Walls	Fence and guard room	m³	1,960	1,144	–	816.3	58.4%	–
Beams	Fence and guard room	m³	288	120.3	–	167.7	41.8%	–
Columns	Fence and guard room	m³	372	186.9	–	185.1	50.2%	–
Blockwork, 300 mm	Fence and guard room	m²	8,775	5,265	–	3,510	60.0%	–
Bituminous coating, two layers	Fence and guard room	m²	39,170	23,502	–	15,668	60.0%	–
Polysulfide joint sealant	Fence and guard room	LM	415	249	–	166	60.0%	–

Fence, guard room and earthworks lead

Fence foundations are 93% done and the pond riprap is complete. Excavation is at 88.7% and embankment at 87.4%. Walls, beams and columns of the fence and guard room are between 42% and 58%.

Networks: no measured installation yet

Sewage, potable water, irrigation, TSE, medium voltage, street lighting and telecom show 0 installed. Storm pipes show 1.6%, but every storm line carries the same percentage, so the figure is pro-rated rather than measured.

Milestones

Baseline and forecast dates from the weekly report; forecast dates and float from the P6 update (data date 27-Oct-2026).

MILESTONE	BASELINE	WEEKLY REPORT FORECAST	P6 UPDATE FORECAST	P6 FLOAT (DAYS)	STATUS
Site handover	23-Dec-2025	23-Dec-2025	23-Dec-2025 (actual)	–	✓ Done
Execution plan and baseline schedule	17-Mar-2026	17-Mar-2026	18-Jan-2026 (actual)	–	✓ Done
Shop drawing and material approvals	13-Apr-2026	13-Apr-2026	21-Aug-2026 (actual)	–	✓ Done late
Mobilisation and site preparation	19-May-2026	19-May-2026	18-Jan-2026 (actual)	–	✓ Done
Storm drainage network	06-Jan-2027	27-Apr-2027 (+111 d)	05-Apr-2027	−66.5	▼ Late
Sewage network	06-Jan-2027	01-May-2027 (+115 d)	28-Apr-2027	−77.2	▼ Late
Medium voltage network	07-Mar-2027	23-May-2027 (+77 d)	26-Apr-2027	−74	▼ Late
Street lighting network	18-Mar-2027	26-May-2027 (+69 d)	29-Apr-2027	−64	▼ Late
Telecom network	18-Mar-2027	04-May-2027 (+47 d)	03-May-2027	−80	▼ Late
Road works	18-Mar-2027	02-Jun-2027 (+76 d)	26-May-2027	−68.5	▼ Late
Potable water network	22-Mar-2027	20-May-2027 (+59 d)	08-May-2027	−64.5	▼ Late
Irrigation network	22-Mar-2027	13-May-2027 (+52 d)	12-Apr-2027	−43	▼ Late
TSE network	22-Mar-2027	05-Jun-2027 (+75 d)	26-Apr-2027	−54.5	▼ Late
Project completion	22-Feb-2027	08-Jun-2027 (+106 d)	08-Jun-2027	−80	▼ Late

The weekly report's network forecasts are 1 to 40 days later than the P6 update.

Both give 08-Jun-2027 for completion, but the weekly report places the network milestones later than P6, most of all for TSE (05-Jun-2027 against 26-Apr-2027), irrigation (13-May-2027 against 12-Apr-2027) and medium voltage and street lighting (27 days each). The weekly report still marks milestones 2 to 4 as forecast, although P6 records them as complete.

Procurement of key materials

Share of total quantity delivered to site. Source: procurement tracker updated 27-Oct-2026, item summary sheet.



Electrical, telecom, water and irrigation materials: 0% delivered


Purchase orders for MV cables and telecom ducts and manholes are not yet issued; the contractor will raise an RFI for MV and links the telecom orders to payment of the invoice. All 41 tracked items are behind their baseline delivery dates, by 1 to 217 days.

Sewage pipes and covers complete; fence concrete at 66%

Sewage pipes (1,944 m) and manhole covers (42) and storm catch-basin pipes (2,686 m) are fully delivered. Fence concrete is 8,300 of 12,500 m³, with delivery expected to finish by the end of December 2026.

Manpower

Manual head count on site this week by trade, planned vs actual. Source: Manpower sheet of WPR-38.

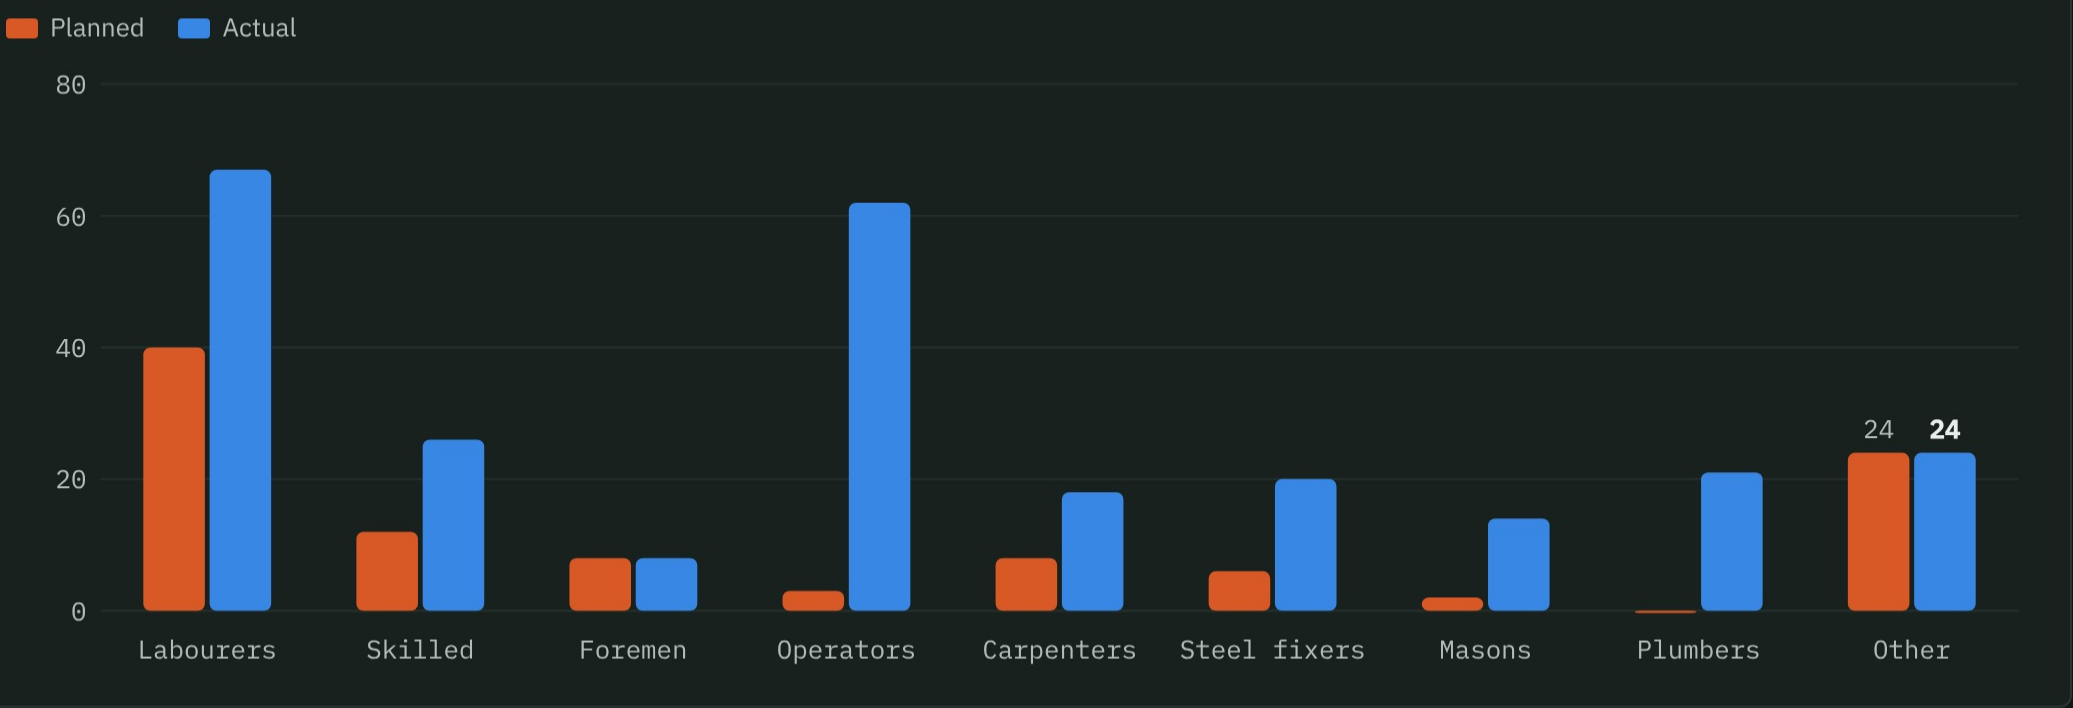

260 manual workers against 103 planned, plus 19 staff against 9 planned: 279 in total against 112. Equipment on site: 145 against 120 planned, none idle.

Cost and invoicing

Contract value

Original contract value (excl. VAT)	**67,768,369.77**
Contract value incl. 15% VAT	77,933,625.23
Change orders	0
Advance payment (10%)	6,776,836.98

All values in SAR. The value including VAT is from the Conclusion sheet. The change order log is empty.

Invoices

Invoices submitted (invoice log / cover sheet)	3 / 2
Gross value submitted	7,617,509.90
Approved by MODON PM	7,617,509.90
Paid (invoice log / cover sheet)	3,596,613.90 / 0
Retention	0
Deductions and penalties	0

Invoicing is 11.2% of the contract value against 32.47% physical progress. The cover sheet and the invoice log disagree on the number of invoices and on payments.

Health, safety and quality

Safety Score 0.82

Safe man-hours (cumulative)	204,884
Man-hours this week	15,600
Lost-time injuries	0
Fatalities	0
First-aid cases	0
Near misses	0
Property damage	1
Toolbox talks (sessions / attendees)	164 / 2,429

Quality Score 0.90

FIRs issued / closed / pending	394 / 336 / 58
MIRs issued / closed / pending	15 / 8 / 7
NCRs issued / closed / open	16 / 15 / 1
Site instructions	0
Method statements approved	8 of 20

QC inspection 28-Oct-2026.

Open issues and risks

ISSUE	OWNER	DETAIL
Land ownership dispute	MODON	A citizen disputes ownership of the project land. Open since 01-Jan-2026; the police advised the dispute is outside their jurisdiction, and the target date of 20-Apr-2026 has passed.
Late purchase orders	Contractor	Purchase orders are still outstanding (open since 10-Apr-2026), including MV cables, joints and telecom materials.
Late start of the networks	Contractor	Risk 07, score 20. The networks started late and progress slowly while resources focus on the fence; network activities carry about −75 to −84 days of float.
MV consultant and subcontractor	Contractor / Consultant	Risk 08, score 16. MV procurement and works cannot proceed until the specialised MV consultant and subcontractor are approved.
Groundwater	Contractor	Risk 05, score 16. Excavations need continuous dewatering.
Material supply	Contractor	Risk 01, score 15. Late material supply can stop or delay activities.

Other open risks in the register: delays in advance and invoice payments, delay or failure of tests, and readiness of existing infrastructure for tie-ins.

Data notes

- Data date: the cover sheet of WPR-38 states 29-Oct-2026; the P6 update, the procurement tracker and the failed-start list are dated 27-Oct-2026, and the look-ahead file is named 20-10-2026 but titled Update 27-10-2026.
- Man-hour total: on the cover and Progress sheets the budgeted man-days of the construction WBS are shifted up one row. Sewage's 516 man-days are dropped and testing & commissioning's 1,899 appear against Utility Building, so the total is 18,474 instead of the 18,990 in P6 (151,920 man-hours). With the full budget, physical progress is 31.59%, as on the Physical-Chart Data sheet and in the P6 update. The headline uses the reported 32.47%.
- Because of the shift, the per-phase percentages on the cover sheet are wrong (Storm Drainage shows 126.8% planned). The phase table uses the P6 extract on the Progress sheet instead. The cover also gives every phase the same original-plan figure (68.43%), so it has no real per-phase baseline.
- Revised plan to date: 50.23% on the cover sheet against 41.04% for October on the Physical-Chart Data sheet.
- The "last week earned" column on the Progress sheet counts the construction phases twice (total 8,245 man-days instead of 5,402). Its implied gain this week (597 man-days) also differs from the cover sheet's weekly figure (492 man-days, 2.66%).
- This is the only week with files for this project, so the quantity "this week" column shows "—".
- Contract duration: the cover gives 426 days to 22-Feb-2027, while the Milestones sheet says "Contract Weeks 44 of 65" and lists the completion baseline as 22-May-2027. P6 has a must-finish date of 23-Feb-2027.
- Activity counts: the weekly report gives 310 completed, 47 in progress and 516 not started; the P6 update gives 331, 50 and 492.
- The Conclusion sheet labels cost-based progress as "actual"; it is not used in this report. It also reports roads earthworks of 637,536 m³ against 720,764 m³ (excavation plus embankment) on the Major Quantities sheet.
- Quantities: storm pipes show the same 1.62% finished on every line, and storm manholes fractional counts (0.198 of 20), so these values are pro-rated, not measured. The storm manholes are left out of the table.
- Invoices: the cover sheet shows 2 invoices and 0 paid; the invoice log lists 3 invoices with the first two paid (3,596,613.90 SAR). The invoice log references DAMT-02-001 and gives a revised contract value of 21,100,000. The HSE inspection sheet also carries project ID DAMT-02-001 and the period 30-Sep to 06-Oct-2026.

- Procurement tracker: the item summary and the quantity details disagree. Storm main-line pipes show 0 of 18 m against about 4,523 m delivered in the details; storm manholes 0 of 55 against 50 of 54; TSE pipes 0 against 1,200 m; sewage manholes 1,200 of 2,489.6 against 42 of 42. The chart uses the item summary and leaves out the storm main-line pipes, TSE pipes and sewage manholes.
- The weekly manpower sheet's "actual" manual row repeats the planned cumulative values, so only this week's head count is shown.
- The photos have no date or GPS stamp, and two uploaded photo files are identical.

Compiled 01-Nov-2026 from weekly report WPR-38 (data date 29-Oct-2026), the P6 update and the procurement tracker of 27-Oct-2026.