


INSPECTION AND TEST PLAN FOR BUILDING CONSTRUCTION WORKS

RA APARTMENTS AND VISITOR'S CENTRE RENOVATION WORKS

CONTRACT NO: B250180ESD

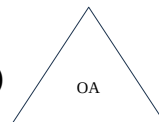

						
A	18NOV26	F. KPAKUE	A. OKOSUN	O. ESIEVO	APPROVED FOR CONSTRUCTION	
OA	27NOV25	F. KPAKUE	A. OKOSUN	O. ESIEVO	ISSUED FOR REVIEW	
O	04NOV25	F. KPAKUE	A. OKOSUN	O. ESIEVO	ISSUED FOR REVIEW	
ISSUE	DATE	BY	CHKD	APPD	DESCRIPTION	
WHEN REVISION HAVE BEEN MADE TO THIS DOCUMENT THE INDEX OF ISSUE SHALL BE INDICATED IN A TRIANGLE NEAR THE PART(S) CONCERNED						
CLASSIFICATION: MOST CONFIDENTIAL ☐ CONFIDENTIAL ☐ RESTRICTED ☒ UNRESTRICTED ☐						
This document is confidential. The copyright therein is vested in Nigeria LNG Ltd. Recipients must obtain the written authority of the said company before wholly or partly duplicating these contents or disclosing the same to others. All rights reserved.				 RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS		
DISCIPLINE: QUALITY				Contract No: B250180ESD		
LOCATION: BONNY ISLAND, NIGERIA			AREA: RA			
				PAGE 1 OF 27		
UNIT: 0000	NIGERIA LNG LTD INSPECTION AND TEST PLAN FOR BUILDING CONSTRUCTION WORKS			DOC NO:		REV
				CONTR. DOC. NO: EGSL-NLNG-RAVCP-ITP-8001		

REVISION LOG

<u>REVISION</u>	<u>DATE</u>	<u>PAGES</u>	<u>REMARKS</u>
O	04NOV25	NIL	ISSUED FOR REVIEW
OA	27NOV25	8 - 40	ISSUED FOR REVIEW
A	16MAR26	NIL	APPROVED FOR CONSTRUCTION

APPROVAL TABLE			
<u>Key For Inspection Levels:</u>		All QC Activities are complete and Item ready for operation	
H=Mandatory Hold Point W= Witness (Mandatory Notification)		EGSL- Executor	Fortune Kpakue
S= Sample Inspection T= Test R= Review Records V= Visual M= Monitor		Name	Signature:  Date: 3/18/2026 348149CE7BF5412...
		NLNG	Ekeneme.Patrick
		Name	Signature:  Date: 16/3/2026 A0CC664047924B8...


RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS				
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA		
		CONTRACT NO: B250180ESD		
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 2 of 42	
			DOC NO: _____ Rev OA	
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

TABLE OF CONTENT

1.0	INTRODUCTION	4
1.2	PROJECT OVERVIEW	4
1.3	SCOPE SUMMARY	5
1.4	PURPOSE.....	5
2.0	DEFINITIONS AND ABBREVIATIONS	6
3.0	NORMATIVE REFERENCE.....	7
4.0	INSPECTION AND TEST PLAN NOTIFICATION	9
4.1	INSPECTION POINTS.....	9
5.0	LIST OF QC FORMS	10
6.0	INSPECTION & TEST PLAN.....	12

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS				
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD	
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 3 of 42	
			DOC NO: Rev OA	
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

1.0 INTRODUCTION

1.1 PROJECT OVERVIEW

The Residential Area (RA) houses form a critical part of Nigeria LNG's staff accommodation infrastructure in Bonny Island. Over the years, these houses have experienced natural wear and tear due to prolonged use, environmental exposure, and evolving residential standards. As part of NLNG's commitment to the welfare of its personnel and the continuous improvement of living conditions, the company has initiated a comprehensive renovation project for selected RA houses.

This project aligns with NLNG's broader strategic goals of asset sustainability, operational excellence, and employee well-being.

1.2 PROJECT OBJECTIVE

The main objective of the **Renovation of NLNG RA Houses Project** is to upgrade, modernize, and restore existing residential buildings to a safe, functional, and contemporary standard that enhances occupant comfort, safety, and satisfaction.

The renovation will include both external and internal works such as structural repairs, plumbing and electrical upgrades, finishes replacement, roofing, tiling, and sanitary fittings, among others.

Key reasons necessitating the renovation include:

- **Aging Infrastructure:** Several RA houses have surpassed their original design life in terms of finishes and fittings.
- **Maintenance Challenges:** Increased maintenance frequency and cost due to degraded building elements.
- **Safety & Compliance:** Need to align with modern building safety codes, fire protection standards, and accessibility requirements.
- **Improved Living Standards:** Demand for improved interior designs, better space utilization, and energy-efficient systems.
- **Corporate Image:** Maintaining a high standard of staff housing reflects NLNG's

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 4 of 42
			DOC NO: Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001

commitment to quality and care.

1.3 SCOPE SUMMARY

The scope of work includes

- **Structural Repair Works** (walls, roofs, concrete elements)
- **MEP Upgrades** (plumbing, electrical wiring, lighting, HVAC systems)
- **Interior Finishes** (floor and wall tiles, ceilings, painting, doors, and fittings)
- **Kitchen and Bathroom Refurbishment**
- **External Works** (painting, drainage improvements, window and door replacements)
- **Health & Safety Improvements** (smoke detectors, fire exits, non-slip floors, etc.)

The scope of work for the RA TYPE 2 &4, GE APARTMENTS & RA VISITORS' CENTER includes

S/N	Activity	Description
1	Strip-Out/Demolition	Removal of partitions, tiles, ceiling boards, electrical fittings, etc.
2	Structural Alterations	Beam/wall removals, slab openings, new lintels, reinforcements
3	Internal Wall Construction	Provision for external walls and tiling should be provided. The Gabion wall will be made of blocked, pitched with cracked stone tiles and countertop wrapped with granite slab Blockwork or wall partitions will be used such as HDPE, Glazed and solid board.
4	Floor Screeding	Leveling of subfloor, tiling, vinyl, or timber floor finish
5	Plumbing First Fix	Rerouting or replacing concealed water supply & drainpipes
6	Electrical First Fix	Running new conduits, wires, socket & switch boxes
7	HVAC Installations	Installation or upgrade of refrigerant and condensate pipework, split AC units, ventilation
8	Ceiling Works	Installation of gypsum, PVC, or acoustic ceiling, fibre cement board ceiling, WPC wooden slate ceiling
9	Tiling & Wall Finishes	Floor tiling, wall tiles in wet areas, skirtings
10	Painting & Decoration	Wall surface prep, primer, emulsion or enamel painting, vinyl and silk paint, painting and vases

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA	AREA: RA	CONTRACT NO: B250180ESD	OA
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	Page: 5 of 42	
		DOC NO:	Rev OA
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

11	Joinery & Carpentry	Installation of doors, wardrobes, kitchen cabinets, shelves, bed, tables, chairs, tempered glass and aluminum frames
12	Window & Door Fittings	Installation of locks, hinges, handles, louvres or grills
13	Plumbing Second Fix	Installation of WCs, taps, basins, showers, water heaters
14	Electrical Second Fix	Installation of light fixtures, switches, sockets, DBs
15	Testing & Commissioning	Power testing, water leak test, HVAC commissioning
16	Cleaning & Final Touch-Ups	Removal of debris, final surface polishing, paint touch-ups
17	Handover & Snag Rectification	Client inspection, punch list correction, final sign-off

Table1: Scope of work

1.4 PURPOSE

The purpose of this Inspection and Test Plan is to set out requirements for inspection and testing of building renovation activities, and all other activities as reference in table 1, for RA apartment and Visitor's center renovation works.

2.0 DEFINITIONS AND ABBREVIATIONS

- **Contractor:** Evomec Global Services Limited
- **Company/Client:** Nigeria LNG Limited (NLNG)
- **Project:** RA Apartment and Visitor's Centre Renovation works
- **Record:** Document stating results achieved or providing evidence of activities performed
- **Site:** The site locations where WORK is to be performed
- **Third party:** Independent body besides the contractor and client.
- **ITP:** Inspection and Test Plan
- **PMT:** Project Management Team

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 6 of 42
			DOC NO: Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001

- **HSE** Health Safety and Environment
- **LNG** Liquefied Natural Gas
- **QMS** Quality Management System
- **RFI** Request for Inspection
- **ISO** International organization for standardization
- **AFC** Approved for Construction
- **EPC** Engineering, Procurement, and Construction
- **NLNG** Nigeria Liquefied Natural Gas
- **QA/QC** Quality Assurance & Quality Control
- **EN** European Standards (Eurocode)
- **DEP** Design and Engineering Practice

3.0 NORMATIVE REFERENCE

- EGSL-NLNG-RAVC-QUA-PLN-001 Quality Control Plan
- B230196NTP Contract Number
- ISO 9001:2015 Quality Management Systems Requirements
- EGSL-NLNG-RAVC-HSE-PLN-XXXXX HSE Plan
- EGSL-NLNG-AAR-CIV-MST-XXXXX Method Statement for Civil works
- EGSL-NLNG-AAR-CIV-MST-XXXXX Method Statement for Survey Works
- BS 1377-2 Method of Test for Soils for Civil Engineering purpose
- ACI 305R-99 Guide to Hot Weather Concreting
- BS 4449:2005 Steel for the reinforcement of concrete
- DEP 34.19.20.31Gen Reinforced Concrete Structures.
- BS EN 1991-1-6:2005 Eurocode1.Actions on structures. General actions during execution.
- BS 7671 Guide to IET Wiring Regulations
- BS 6755 Testing of valves
- ASTM D3359 Adhesion Test by Tape Method

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 7 of 42
			DOC NO: Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001

- BS EN 60598 Luminaires – safety and performance.
- BS EN 61439 Low-voltage switchgear and assemblies.
- BS EN 14604 Smoke alarm devices.
- BS EN 60669/60947 Switches and isolators.
- BS EN 60335 Series Safety of household and similar electrical appliances.
- ASTM E283/ E1354 / F2285 Air leakage, fire testing, and appliance performance
- BS EN 14604 Smoke alarm devices.
- BS 5262 Code of practice for external rendering
- BS 5492 Code of practice for internal plastering
- ASTM D3359 Adhesion Test by Tape Method
- DEP 34.17.10.32 Design of Blast Resistant Onshore Buildings, Control rooms and Field Auxiliary Rooms
- BS 5385 Code of practice for the design and installation of external ceramic wall tiling and mosaics
- ASTM D714 Evaluating Blistering of Paints
- BS 6150 Code of practice for painting of buildings
- BS EN ISO 12944 Protective paint systems (corrosion & durability)
- BS EN 771-5:2011 Specification for masonry units. Aggregate concrete masonry units (dense and light-weight aggregates)

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 8 of 42
			DOC NO: Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001


- BS EN 772-1:2011 Methods of test for masonry units – Determination of compressive strength.
- BS EN 206 Concrete — Specification, production, and conformity
- ASTM C305 Standard Practice for Mechanical Mixing of Hydraulic Cement Pastes and Mortars of Plastic Consistency.
- ASTM C140 Standard Test Methods for Sampling and Testing Concrete Masonry Units and Related Units.

4.0 INSPECTION AND TEST PLAN NOTIFICATION

The NLNG Representative shall be given 24 hours' inspection notice for weekdays and 48 hours' notice for weekends and public holidays via email, attaching the RFI form. If the Client is unavailable after notification, work can progress for random inspection. For Hold point inspections, the Client shall witness or provide instruction and evidence such as pictures may be sent to the respective Client representative.

4.1 INSPECTION POINTS

- **HOLD POINT (H):** This is a mandatory notification to NLNG. All activities at this level must not proceed without the approval of NLNG inspection team. Notification shall be a minimum of 24hrs. prior to carrying out the activity.
- **WITNESS (W):** A prior notification to NLNG is mandatory. All activities at this level may proceed by Evomec Global Services Limited if NLNG is not present at the stipulated time, provided there is no rescheduling or cancellation from

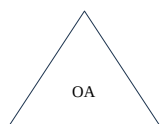

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA	AREA: RA	CONTRACT NO: B250180ESD	
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	Page: 9 of 42	
		DOC NO:	Rev OA
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

NLNG. Notification shall be a minimum of 24hrs. prior to carry out activity.

- **REVIEW (R):** This point is used for review of documents, drawings, or records for the works being performed and/or carried out. Notification is not required.
- **INSPECTION (I):** An inspection where Evomec Global.
- Services Limited and NLNG plan to audit, monitor, or witness the activity in process at random or periodic basis. Notification is not required.
- **PERFORM (P):** Evomec Global Services Limited will execute the works and, upon request, prepare inspections and submit Inspection Notices/Requests for Inspection (IN/RFI) for other parties.
- **MONITORING (M):** Involves regular inspections where the verifying party attends the task execution, either continually or occasionally, as deemed suitable.

5.0 LIST OF QC FORMS

NLNG-TPD-CIV-FOM- 001	MRIR- MATERIAL RECEIVING INSPECTION REPORT
FORM-CIV-302_A	INSPECTION REPORT OF FINISHED MASONRY WORKS
FORM-CIV-306_A	INSPECTION REPORT OF DOORS AND WINDOWS FINAL INSTALLATION
FORM-CIV-308_A	INSPECTION REPORT OF SUSPENDED FALSE CEILING
FORM-CIV-309_A	INSPECTION REPORT OF PAINTING WORKS
FORM-CIV-310_A	BUILDINGS PLUMBING INSPECTION CHECKLIST
FORM-CIV-311_A	PLUMBING SYSTEM WATERTIGHTNESS TEST REPORT
FORM-CIV-312_A	INSPECTION CHECKLIST OF CERAMIC TILES FOR WALL AND FLOOR
FORM-IST-720	SLIT UNIT INSTALLATION
FORM-ELE-939_B	REPORT OF LIGHTING SYSTEM INSTALLATION ILLUMINATION TEST
FORM-ELE-531_B	REPORT OF LV DISTRIBUTION BORD- INSTALLATION CHECKLIST
FORM-ELE-530_A	REPORT OF LV DISTRIBUTION BORD- PRECOM CHECK

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA	AREA: RA	CONTRACT NO: B250180ESD	
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	Page: 10 of 42	
		DOC NO:	Rev OA
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

FORM-ELE-914_A	BEFORE ENERGIZING
NLNG-TPD-CIV-REP-003	REPORT OF EARTH PROTECTIVE AND BONDING
NLNG-TPD-CIV-CKL-005	CONDUCTORS - MEASUREMENT TEST
FORM-QC-22F1	Cube Compression Report
	MESONRY BLOCK WORK ERRECTION CHECKLIST
	Survey As-built Report

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA	AREA: RA	CONTRACT NO: B250180ESD	
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	Page: 11 of 42	
		DOC NO:	Rev OA
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	


6.0 INSPECTION & TEST PLAN


INSPECTION AND TEST PLAN FOR BUILDING WORKS									
Title of ITP: INSPECTION AND TEST PLAN FOR BUILDING CONSTRUCTION WORKS		Date: 27/11/2025	 INSPECTION AND TEST PLAN RECORD Revision: OA	Location: BONNY ISLAND					
PROJECT: RA APARTMENTS AND VISITORS CENTER RENOVATION WORK									
Activity No	Description of Operation Activity	Controlling Procedures/ Document	Acceptance Criteria/Reference	Records to be used to verify compliance	Inspection Level	VERIFIED BY Name/Signature/ Date	Inspection Level	VERIFIED BY Name/Sign ature/ Date	Remarks/ Comments
	Activity Description:					EGSL - Executor		NLNG - Inspection	
1.0	DOCUMENTATION								
1.01	Documentation review shall include drawings, specifications and method statement which must be approved prior to commencement of work	BS EN 206, DEP 34.19.20.31-Gen Project Specification	ASTM C33, ASTM C150/150M Test Certificates	NLNG-T7-CIV-FOM-009,010,011	R		R		
1.02	Approval of Concrete Mix Designs	BSEN206, ACI 311, DEP 34.19.20.31 Gen, Project specification,	Approval of Concrete Mix Design Document	Concrete Mix Design Document	H		H		

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 12 of 42
			DOC NO: Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001


1.03	Ensure Calibration of all Equipment/Batching plant	DEP 34.19.20.31 Gen, Project specification,	Calibration Certificates	Calibration Certificates / Log	H		R		Where third party is used, calibration certificate is also required
2.0	SURVEY ACTIVITY								
2.1	Title: SURVEY INSTRUMENT STATION • Include survey equipment certificates/calibration	Method statement, Project Specification	Method statement, Project Specification	FORM-QC-22F1	R		R		Include calibration frequency
3.0	MATERIAL RECEIVING								
3.1	MATERIAL RECEIVING INSPECTION • Quality check shall be carried out for acceptance or rejection on project supplied materials to verify compliance	Method statement, Project Specification	Method statement, Project Specification	MRIR	H	OA	H	OA	• Provide Supplier/Manufacturers Material Certificates of Test/Compliance • Verify Quality and Quantity of materials supplied as per P.O/waybill • Packing list and other applicable documentation • Conduct test to verify materials properties compliance as per project specification
4.00	MASONRY AND PLASTERING								

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 13 of 42
			DOC NO: Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001

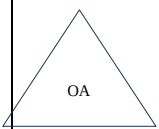4.01	Check & verify the mix ratio of the mortar for plastering	DEP 34.17.10.32 AFC drawing, MTS	DEP 34.17.10.32 AFC drawing, MTS	Plant Trial Mix Adopted	H		H		
4.02	Surface Preparation - Ensure gauges are in place - Confirm thickness - Ensure the walls are completely dry before Plastering	DEP 34.17.10.32 AFC drawing, MTS	DEP 34.17.10.32 Section: 8.3 - Cement mill certificate verification for each batch. - Sand test report to be verified. Mortar mix ratio shall be as per approved mix design.	INSPECTION FORM-CIV-302_A	H		W		- Mixture is not to be too wet or too dry. - The plaster thickness shall be standard 20 mm or as specified in AFC drawing.
4.03	Final inspection Ensure the walls are completely plain, smooth, and without fault	DEP 34.17.10.32 AFC drawing, MTS	AFC drawing, MTS	INSPECTION FORM-CIV-302_A	H		W		
4.04	Trial mix and comprehensive strength test	19.014-E-0035	DEP 34.17.10.32-Gen section 8.3.1, BS EN 771-3:2011	Plant Trial Mix Adopted	H		W		
4.05	Comprehensive strength test 7 & 28 days for Mortar	19.014-E-0035	DEP 34.17.10.32-Gen section 8.3.1, BS EN 771-3:2011	Cube Compression Report	H		W		Minimum compressive strength test at 28days shall be as follows. - Min. of 3.45N/mm² for load bearing blocks - Min of 2.5N/mm² for Mortar using prism mold
4.06	Check & verify the mix ratio of mortar for Block work erection	19.014-E-0035	DEP 34.17.10.32-Gen section 8.3.1, BS EN 771-3:2011	MASONRY BLOCK WORK ERRECTION CHECKLIST	H		W		

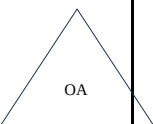

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 14 of 42
			DOC NO: _____ Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001



4.07	Checks of surface preparation before starting operations	19.014-E-0035	DEP 34.17.10.32-Gen section 8.3.1, BS EN 771-3:2011	MESONRY BLOCK WORK ERRECTION CHECKLIST	H		W		
4.08	Check bedding thickness is maintained within 15mm Bedding thickness shall not exceed 15mm	19.014-E-0035	DEP 34.17.10.32-Gen section 8.3.1, BS EN 771-3:2011	MESONRY BLOCK WORK ERRECTION CHECKLIST	H		W		
4.09	Ensure that blocks are erected in a staggering form	19.014-E-0035	DEP 34.17.10.32-Gen section 8.3.1, BS EN 771-3:2011	MESONRY BLOCK WORK ERRECTION CHECKLIST	H		W		
4.10	Inspection of the plan position of walls in line with approved for construction drawing	19.014-E-0035	DEP 34.17.10.32-Gen section 8.3.1, BS EN 771-3:2011	MESONRY BLOCK WORK ERRECTION CHECKLIST / SURVEY REPORT	H		W		
4.11	Verify alignment and verticality of walls	19.014-E-0035	DEP 34.17.10.32-Gen section 8.3.1, BS EN 771-3:2011	MESONRY BLOCK WORK ERRECTION CHECKLIST	H		W		
4.12	Inspection carried out on the wall and Final inspection after completing installation of block walls	19.014-E-0035	DEP 34.17.10.32-Gen section 8.3.1, BS EN 771-3:2011	NLNG-TPD-CIV-CKL-005 / SURVEY REPORT	H		W		
5.00	Tiling (Wall/Floor)								
5.01	Check & verify Substrate condition • Level cleanliness	AFC drawing	BS 5385, AFC drawing, MTS	Survey Report	H		R		
5.02	Confirm the following: ▪ Surface to receive tile shall be structurally sound, clean, dry, and free of oily.	DEP 34.17.10.32 AFC drawing, MTS	BS 5385, ISO 10545-2, AFC DRAWING AND MTS. • The tiles joint sealed with approved sealant. The adhesive used for tiles shall be approved.	INSPECTION CHECKLIST OF CERAMIC TILES FOR WALL AND FLOOR	H		W		

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS

LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 15 of 42
			DOC NO: Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001

	- Surface to receive tile shall be in plumb, level, and true with square corners. - Shade consistency and color - Spacers shall be provided to give correct vertical and horizontal joint lines - Damaged tiles: Discard any tiles that are cracked or damaged. - Cutting tiles: - Cut tiles neatly and accurately. - Maintain general joint width along cut edges. - Cut and fit tiling neatly around pipes, electrical boxes, etc.							
5.03	Cleanliness: - Brush backgrounds and bases clean and remove all rubbish, debris, and dirt - Coved tile skirting: Fix coved tile skirting to align with the joints in floors when the skirting and floor tiles are the same size, unless otherwise specified	DEP 34.17.10.32 AFC drawing, MTS	AFC Drawings DEP 34.17.10.32 - The tiles Shall be cleaned and free from dust before use. - The adhesive used to place the tiles shall be cleaned. from tile surface if there is any. - The tile joints shall be cleaned before	INSPECTION CHECKLIST OF CERAMIC TILES FOR WALL AND FLOOR	H		W	

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	
UNIT: 0000		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	
		CONTRACT NO: B250180ESD	
		Page: 16 of 42 DOC NO: _____ Rev OA	
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

	▪ Setting out and accuracy of tiling: ▪ Setting out tiling for walls and related surfaces ▪ Check whether the width of joints is specified before setting out tiling. Allow for manufacturing tolerance especially when fixing metric modular tiles with modular spacing. ▪ Set out the tiling with joints of consistent width, ensuring they are horizontal and vertical or, where required, parallel with architectural features that limit the extent of the tiling. ▪ Ensure that where adjoining tile surfaces are in different planes the joints are continuous from one surface to the next. ▪ Avoid cut courses as far as practicable. Where it is necessary to cut a course, set out the tiling so that the cut course is as wide as possible and in the least prominent position available.		application of the sealant						
--	--	--	----------------------------	--	--	--	--	--	--

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 17 of 42
			DOC NO: Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001

6.00	CEILING INSTALLATION								
6.01	INSTALLATION INSPECTION OF CEILING BOARD - Check the space between the ceiling and the roof to allow for ducts, lighting fixtures, and trays as per the approved AFC drawings. - Angular displacement of the longitudinal axis of one member with respect to the other shall not be visually apparent. - The final assembly shall not deviate from horizontal, flat planar surface in either direction by more than the specified. - Assembly devices shall provide sufficient spacing control so that final horizontal gaps between intersecting member shall not exceed the specified tolerance.	AFC drawing, MTS	AFC Drawings DEP 34.17.10.32 Section: 8.5 - As per Manufacturer recommendations. - Check all hangers are fixed as per AFC drawing and manufacturer recommendation. Check all panel are securely fitted in place.	INSPECTION REPORT OF SUSPENDED FALSE CEILING	H			H	
6.02	Final inspection on Ceiling: Smooth finish, uniform level, no gaps, meets project specs. Visual and dimensional check	AFC drawing, MTS	AFC Drawings, BS EN 13964, Project Specs	INSPECTION REPORT OF SUSPENDED FALSE CEILING	H			W	

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	
UNIT: 0000		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	
		CONTRACT NO: B250180ESD	
		Page: 18 of 42	
		DOC NO:	Rev OA
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

7.0	Plumbing Works							
7.01	Plumbing system Installation Inspection: Portable water System: check (Disinfectant) & Pressure test Sanitary/Drainage system: - Check (gradient, orientation) - UPVC Pipe: Check Clean, Align & Apply uPVC Glue - Check Gradient, Orientation, Flush & Clean Pipe system Firefighting System: Above ground (Galvanized Pipe): - Check Thread/Groove on pipe and fittings is clean - Teflon material or approved sealant is applied on threaded or grooved Pipe part - Fittings is used where necessary. - Check Welded Joints (if applicable) - If Flange connection - check gasket, alignment and bolt tightened. - Check Gradient, Orientation Underground (HDPE Pipe):	AFC Drawings, DEP 34.17.10.32 section: 9.3 - Piping material shall be copper for hot water and Upvc for cold water. HDPE for (Underground) firefighting/Sewage/Drainage. Galvanized pipe for (Above ground) firefighting - All the fittings and fixtures shall be from approved vendor. GFS IG. 34.85.32 Section: 6.4	AFC Drawings DEP 34.17.10.32 GFS IG.34.85.32 Material/Product Data Sheet. DEP 80.47.10.30-Gen.	BUILDINGS PLUMBING INSPECTION CHECKLIST	H		W	

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 19 of 42
			DOC NO: _____ Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001

	• Check Clean, Trim & Align Pipe Surface/End before fusion weld. • Use End Caps for exposed pipe end • HDPE Pipe Fusion at right Temp. • Visual Check & Trial leak/pressure test on fused Joints and spool. • Check Gradient, Orientation								
7.02	Hydro-Pressure / Gravity Leak Test on Plumbing Fixtures: Water & Firefighting, Sewage & Drainage piping/distribution of the isolation valve and within the building (Pressure testing & flushing)	AFC Drawings DEP 34.17.10.32	AFC Drawings DEP 34.17.10.32 • Water leak test shall be carried out by filling water in the pipe to check the joints in the pipeline.	BUILDINGS PLUMBING INSPECTION CHECKLIST	H		H		
8.00	Electrical Works								
8.01	Lighting Fixtures Installation: - Illumination/lux Test	AFC DRAWING	BS EN 60598, BS EN 12464-1, BS EN 60598-2-22, BS 5266, ASTM E283, BS 7671, ASTM F1507	FORM-ELE-939 B	H		W		
8.02	Distribution Board Installation	Breaker ratings correct, secure connections, lockable	BS EN 61439, BS 7671, ASTM F844	FORM-ELE-531_B, FORM-ELE-530 A	H		W		
8.03	Switches & Socket Outlets Installation: - Functional & Load Test - Signal & Continuity Test - Proper isolation IP rated	AFC DRAWING AND PROJECT SPECIFICATION	BS 7671, BS EN 60669, BS EN 50173, BS EN 50174, BS 1363,	FORM-ELE-914_A	H		W		

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	
UNIT: 0000		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	
		CONTRACT NO: B250180ESD	
		Page: 20 of 42	
		DOC NO:	Rev OA
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

	enclosure, safe operation - Check Switch operates correctly, secure mounting								
8.04	Sanitary Electrical Appliances: Functional & Power Test	AFC DRAWING AND PROJECT SPECIFICATION	BS EN 60335-2-23, ASTM F2285	VISUAL INSPECTION	H		W		
8.05	Safety Device Installation (smoke detector)	AFC Drawing and project specification	BS EN 14604, ASTM E1354	VISUAL INSPECTION	H		W		
9.00	SPLIT UNIT INSTALLATION								
9.01	Indoor Unit Mounting (Split AC) Visual & Level Check	AFC DRAWING AND PROJECT SPECIFICATION	BS 7671	FORM-IST-720	H		W		
9.02	Outdoor Condenser Installation Visual & Clearance Check	AFC DRAWING AND PROJECT SPECIFICATION	BS EN 378	FORM-IST-720	H		W		
10.00	Ceiling installation								
10.01	INSTALLATION INSPECTION OF CEILING BOARD - Check the space between the ceiling and the roof to allow for ducts, lighting fixtures, and trays as per the approve AFC drawings. - Angular displacement of the longitudinal axis of one member with	AFC drawing, MTS.	AFC Drawings DEP 34.17.10.32 Section: 8.5 - As per Manufacturer recommendations. - Check all hangers are fixed as per AFC drawing and manufacturer recommendation. Check all panel are securely fitted in place.	INSPECTION FORM-CIV-308_A	H		W		

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 21 of 42
			DOC NO: _____ Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001

	respect to the other shall not be visually apparent. - The final assembly shall not deviate from horizontal, flat planar surface in either direction by more than the specified. - Assembly devices shall provide sufficient spacing control so that final horizontal gaps between intersecting member shall not exceed the specified tolerance.								
10.02	Final inspection on Ceiling: Smooth finish, uniform level, no gaps, meets project specs. Visual and dimensional check	AFC drawing, MTS	AFC Drawings, BS EN 13964, Project Specs	INSPECTION FORM-CIV-308_A	H		W		
11.00	PAINTING APPLICATION								
11.01	Painting Application Inspection: - Check the Application of anti-algal primer paint. - Verify the surface leveling of the wall done with POP if applicable. - Ensure proper sand papering of the surface before painting - Review MSDS and material data sheet. Check for the manufacturer's	AFC drawing, MTS	AFC Drawings - The paint application as per manufacturer recommendation. - The paint selection is done as per AFC drawing. The paint shall be from approved vendor.	INSPECTION FORM-CIV-309_A	H		W		


RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS						
LOCATION: BONNY ISLAND, NIGERIA			AREA: RA		CONTRACT NO: B250180ESD	OA
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 22 of 42			
			DOC NO:			Rev OA
CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001						

	certificate of conformity								
11.02	Final inspection on Painting: Verify the paint color and finishes is without stain, spots, runs sags or contaminations. Inspection carried out at 10%	AFC drawing, MTS	AFC Drawings - The paint application as per manufacturer recommendation. - The paint selection is done as per AFC drawing. The paint shall be from approved vendor.	INSPECTION FORM-CIV-309_A	H		W		
12.00	DOORS AND WINDOWS INSTALLATION								
12.01	Doors and windows: Checks before installation: Verify the approved for construction drawings status Review the door and windows manufacturer's data sheet and certificate of conformity (if required)	MTS, AFC Drawings DEP 34.17.10.32	AFC Drawings, DEP 34.17.10.32 Section: 8.7, 8.9 Installation as per manufacturer recommendation	INSPECTION FORM-CIV-306_A	H		W		
12.02	Final Installation Inspection: - Check if the doors and windows are in the correct position and elevation in line with AFC drawings. - Verify the free opening and closing of the doors and windows without hindrance or restrain	AFC Drawings, DEP 34.17.10.32	AFC Drawings, DEP 34.17.10.32 Section: 8.7, 8.9 Installation as per manufacturer recommendation	INSPECTION FORM-CIV-306_A	H		W		

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS					
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA		CONTRACT NO: B250180ESD	
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 23 of 42		
			DOC NO: _____ Rev OA		
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001		

Key For Inspection Levels:		All QC Activities are Complete and Item is Ready for Operation	
H = Mandatory Hold Point (Do Not proceed without Signature) W = Witness (Mandatory Notification)		EGSL- Executor Name	Fortune Kpakue
S = Sample Inspection R = Review Records M = Monitor		NLNG - Name	
T = Test V= Visual			

OA

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		
			
			Page: 24 of 42
		DOC NO:	Rev OA
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

 		NLNG PROJECT INSPECTION REPORT OF FINISHED MASONRY WORKS		Doc. no: FORM- CIV-302-A REV. _____ Date: _____ PAGE 1 of 1 REF. DOC: _____	
REPORT No:					
PLACE:					
DWG/CHART / SPECIFICATION:					
ITEM / EQUIPMENT / MATERIAL					
MEASURING DEVICE TYPE AND TRACEABILITY:					
S/No.	Description of QC Activities	INSPECTION RESULT & SIGNATURE/DATE			
		CONTRACTOR QC		NLNG QC	
		Result	Signature/Date	Result	Signature/Date
1	Check masonry blocks, insulation board, wall ties, DPC material all are approved.				
2	Masonry blocks thickness/ compressive strength is compliant with specification.				
3	Mortar used for masonry works in in compliant with approved mix design.				
4	Check DPC is provided as specified in AFC drawing.				
5	Check control/ Expansion joint locations are correct and as per AFC drawing.				
6	Check wall location and dimension of Doors/ openings are as per AFC drawing.				
7	Check surface finishing, plumbness and straightness are satisfactory.				
8	Check finished surface of external and internal wall plaster is satisfactory.				
Legend: A - Accepted UA - Un Accepted N/A - Not Applicable					
Remarks:				INSPECTION NOTIFICATION REFERENCE	
				RFI No.	
				ISSUE DATE:	
EVOMECE QA/QC			COMPANY QC NLNG		
NAME			NAME		
SIGNATURE			SIGNATURE		
Date			Date		

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS					
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA		CONTRACT NO: B250180ESD	
UNIT: 0000		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 25 of 42	
				DOC NO: _____ Rev OA	
				CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

 		NLNG PROJECT		Doc. no: FORM- CIV-312_A	
		INSPECTION CHECKLIST OF CERAMIC TILES FOR WALL AND FLOOR		REV.	Date:
				PAGE 1 of 1	
				REF. DOC:	
REPORT No.:					
PLACE:					
DWG / CHART / SPECIFICATION No.:					
ITEM / EQUIPMENT / MATERIAL:					
MEASURING DEVICE TYPE AND TRACEABILITY:					
S/No.	Description of QC Activities	INSPECTION RESULT & SIGNATURE/DATE			
		CONTRACTOR QC		NLNG QC	
		Result	Signature/Date	Result	Signature/Date
1	All types of tiles, adhesives and grout materials and colours are approved.				
2	Check adhesive is applied as per manufacturer recommendation.				
3	Check tiles are laid flat, straight and joints are aligned.				
4	Check slopes in floor are according to the AFC drawings and towards the floor drain.				
5	Check control/ expansion joint locations are correct.				
6	Check all joints are properly grouted with the approved material.				
7	Check tile surfaces are clean and free of cracks and scratches.				
8	Check finished surfaces are properly protected.				
Legend: A - Accepted UA - Un Accepted N/A - Not Applicable					
Remarks:				INSPECTION NOTIFICATION REFERENCE	
				RFI No.	
				ISSUE DATE:	
EVOMECE QA/QC			COMPANY QAQC NLNG		
NAME			NAME		
SIGNATURE			SIGNATURE		
Date			Date		

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS					
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA		CONTRACT NO: B250180ESD	
UNIT: 0000		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 26 of 42	
				DOC NO:	Rev OA
CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001					

 		NLNG PROJECT		DOC. No.: FORM-CIV-310 A	
		BUILDING PLUMBING INSPECTION CHECKLIST		REV.	DATE:
				PAGE 1 of 1	
				REF. DOC.	
REPORT No:					
PLACE:					
DWG/CHART / SPECIFICATION:					
ITEM / EQUIPMENT / MATERIAL					
MEASURING DEVICE TYPE AND TRACEABILITY:					
S/N	INSPECTION ITEM DESCRIPTION	INSPECTION RESULTS			
		YES	NO	NA	SIGNATURE
POTABLE SYSTEM	1. Document Review				
	2. Plumbing materials				
	3. Floor Drain				
	4. Potable water system				
	5. Water Treatment Plant, Tank				
	6. Plumbing fittings Pipes Connections: Valves, Fittings, Elbow, Coupling, Tee, cap, Reducer, Adaptor & Finishing				
	7. Shower Room System				
	8. Water Heater Hangers and supports				
	9. Piping connections Fittings and Isolations				
	10. Joints				
	11. W.C.				
	12. Service Test				
	13. Water pressure, volume if adequate				
	14. Water system Installation				
	15. Flushing of Plumbing system network				
	16. Wash Hand Basins				
	17. Plumbing Connection & Equipment Installation: Foundation status, Anchor Bolts level verification, Nuts, washers, Tie In				
	18. Water tightness (leak) test				
SEWAGE SYSTEM	19. Sanitary water system installation				
	20. Inspection Chambers				
	21. Pit installation, size, Pit inlet/outlet pipes opening, location, orientation and invert levels				
	22. Sanitary waste and vent system				
	23. Laid pipes diameter, dimension, gradient, Invert level, Position as per approved				
	24. Functionality				
	25. Connection Fitting				
	26. Pits Sizes, Pit Installations & Pits Inlet Pipes opening orientation				
	27. Elevation/Coordinates				
REMARKS:		INSPECTION NOTIFICATION REFERENCE RFI No.: N/A ISSUED DATE:			
EVOMEK QA/QC		NLNG		OTHERS	
NAME:		NAME:		NAME:	
SIGNATURE:		SIGNATURE:		SIGNATURE:	
Date:		Date:		Date:	

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS					
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA		CONTRACT NO: B250180ESD	
UNIT: 0000		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 27 of 42	
				DOC NO:	Rev OA
				CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

 		NLNG PROJECT		DOC. No.: FORM-CIV-310_A	
		BUILDING PLUMBING INSPECTION CHECKLIST		REV.	DATE:
PAGE 1 of 2					
REPORT No:		REF DOC:			
PLACE:					
DWG/CHART / SPECIFICATION:					
ITEM / EQUIPMENT / MATERIAL:					
MEASURING DEVICE TYPE AND TRACEABILITY:					
S/N	INSPECTION ITEM DESCRIPTION	INSPECTION RESULTS			
		YES	NO	NA	SIGNATURE
DRAINAGE SYSTEM	28. Drainage system Installation				
	28. Inspection Chambers/Manholes installed, free from silt				
	30. Pit installation, size, Pit inlet/outlet pipes opening, location, orientation and invert levels				
	31. Drainage catch-basin/gully traps installed as per approved				
	32. Pipe bedded on approved granular fill within trench				
	33. Pipe Entry and Exit supported/sealed				
	34. Laid pipes diameter, dimension, gradient, Invert levels, Position as per approved				
	35. Backfilling level, location and compaction around pipe				
	36. Functionality & Leak test				
	37. Connection, Joints, Fittings				
38. Elevation/Coordinates					
HVAC SYSTEM	39. HVAC Drain System installation				
	40. Condensate drain system insulation & leak tested				
	41. Drain trap installation & connection as per approved				
	42. Pipe specification, diameter, dimension, gradient & location				
	43. Secure ductwork, install the air handler, hood or furnace, and ensuring proper ventilation				
	44. Functionality & Leak test				
	45. Connection, Fittings				
	46. Elevation/Coordinates				

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS					
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD		
UNIT: 0000		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	Page: 28 of 42		
			DOC NO:		Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001		

	NLNG PROJECT		DOC. No.: FORM-CIV-310_A		
			REV.	DATE:	
	BUILDING PLUMBING INSPECTION CHECKLIST		PAGE 1 of 3		
			REF DOC:		
REPORT No:					
PLACE:					
DWG/CHART / SPECIFICATION:					
ITEM / EQUIPMENT / MATERIAL:					
MEASURING DEVICE TYPE AND TRACEABILITY:					
S/N	INSPECTION ITEM DESCRIPTION	INSPECTION RESULTS			
		YES	NO	NA	SIGNATURE
FIRE FIGHTING SYSTEM	47. Firefighting System Installation done as per AFC drawing				
	48. Pipe Specification, Sizes, Dimensions, diameter & orientation				
	49. Pipe riser, Vent system installed as per AFC drawing				
	50. Connection, Joints, Fittings, pipe supports				
	51. Hose reel, nozzle specification, size, diameter installed				
	52. Functionality & Pressure/leak test				
	53. Hydrants, Hydrants caps, Cabinet installed				
	54. Visual inspection of welded/fused joints for neatness				
	55. Approved primer and paint are uniformly applied on Pipe system. Apply touch-up paint wherever necessary.				
	56. Valves are provided at the correct locations				

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 29 of 42
			DOC NO:
			Rev OA
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001

 	NLNG PROJECT	Doc. no. FORM-CIV-311_A
	PLUMBING SYSTEM WATER TIGHTNESS TEST REPORT	Rev. 01 Date:
		Page 1 of 1
		Ref Doc.
REPORT No.:		
PLACE:		
DWG / CHART / SPECIFICATION No.:		
ITEM / EQUIPMENT / MATERIAL:		
MEASURING DEVICE TYPE AND TRACEABILITY:		

Inspection Verification:	
Building _____ Sanitary sewage System ☐	Potable water System ☐
Firefighting System ☐ Drainage System ☐ HVAC ☐	
From _____ - to _____	
Test Pressure _____ Type of Fluid _____	
Atmospheric Test	
Duration (When required) _____	
Date of Test _____	
Non-Destructive Examination Records No (if any)	

Acceptable ☐ Test Result		Not –Acceptable (Leaks) ☐
NOTES:		INSPECTION NOTIFICATION
		RFI No
		Date:
EVOMECE QA/QC	NLNG	OTHERS
NAME	NAME	NAME
SIGNATURE	SIGNATURE	SIGNATURE

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA	AREA: RA	CONTRACT NO: B250180ESD	
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	Page: 30 of 42	
		DOC NO:	Rev OA
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

DATE	DATE	DATE
------	------	------

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS 		
LOCATION: BONNY ISLAND, NIGERIA	AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	Page: 31 of 42
		DOC NO: Rev OA
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001

 		NLNG PROJECT INSPECTION REPORT OF SUSPENDED FALSE CEILING		Doc. no: FORM- CIV-308_A REV. _____ Date: _____ PAGE 1 of 1 REF. DOC: _____	
REPORT No:					
PLACE:					
DWG/CHART / SPECIFICATION:					
ITEM / EQUIPMENT / MATERIAL					
MEASURING DEVICE TYPE AND TRACEABILITY:					
S/No.	Description of QC Activities	INSPECTION RESULT & SIGNATURE/DATE			
		CONTRACTOR QC		NLNG QC	
		Result	Signature/Date	Result	Signature/Date
1	Check that all materials are approved.				
2	Check layout is as per AFC drawing.				
3	Check hangers, grid and bracings are properly installed as per AFC drawings and manufacturer's recommendation.				
4	Check joints are properly fitted.				
5	Check all tiles are properly fitted.				
6	Check tile/ panels secured to grid.				
7	Check tile/ panels are undamaged.				
Legend: A - Accepted UA - Un Accepted N/A - Not Applicable					
Remarks:				INSPECTION NOTIFICATION REFERENCE	
				RFI No.	
				ISSUE DATE:	
EVOMECE QA/QC			COMPANY QAQC NLNG		
NAME			NAME		
SIGNATURE			SIGNATURE		
Date			Date		

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS					
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA		CONTRACT NO: B250180ESD	
UNIT: 0000		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 32 of 42	
				DOC NO: _____ Rev OA	
				CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

 	NLNG PROJECT INSPECTION REPORT OF PAINTING WORKS	Doc. no: FORM- CIV-309_A REV. _____ Date: _____ PAGE 1 of 1 REF. DOC: _____			
REPORT No:					
PLACE:					
DWG/CHART / SPECIFICATION:					
ITEM / EQUIPMENT / MATERIAL					
MEASURING DEVICE TYPE AND TRACEABILITY:					
S/No.	Description of QC Activities	INSPECTION RESULT & SIGNATURE/DATE			
		CONTRACTOR QC		NLNG QC	
		Result	Signature/Date	Result	Signature/Date
1	Check that all materials are approved, and batch numbers have been recorded.				
2	Check paint material "self-life".				
3	Check concrete/plastering surface preparation are completed and satisfactory for painting application.				
4	Check the weather conditions are suitable.				
5	Check application of primer/ filler is satisfactory.				
6	Internal Plaster Surfaces: Check mixing and application of first and second coats are as per specification and drawing requirements.				
7	External rendered surfaces: Check application of first and second coats are as per specification.				
Legend: A - Accepted UA - Un Accepted N/A - Not Applicable					
Remarks:				INSPECTION NOTIFICATION REFERENCE	
				RFI No.	
				ISSUE DATE:	
EVOMEK QA/QC			COMPANY QAQC NLNG		
NAME:			NAME:		
SIGNATURE:			SIGNATURE:		
Date:			Date:		

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS				
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD	
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 33 of 42	
			DOC NO: _____ Rev OA	
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS LOCATION: BONNY ISLAND, NIGERIA AREA: RA CONTRACT NO: B250180ESD UNIT: 0000 INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS DOC NO: Rev OA CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001			OA NLNG
---	--	--	---

 		NLNG PROJECT		Doc. no: FORM- CIV-306_A	
		INSPECTION REPORT OF DOORS AND WINDOWS FINAL INSTALLATION		REV.	Date:
				PAGE 1 of 1	
				REF. DOC:	
REPORT No:					
PLACE:					
DWG/CHART / SPECIFICATION:					
ITEM / EQUIPMENT / MATERIAL					
MEASURING DEVICE TYPE AND TRACEABILITY:					
S/No.	Description of QC Activities	INSPECTION RESULT & SIGNATURE/DATE			
		CONTRACTOR QC		NLNG QC	
		Result	Signature/Date	Result	Signature/Date
1	Check doors and door fixtures are approved.				
2	Check fixing of frame and anchors are as per specification and manufacturer's recommendation.				
3	Check that frame is set in position, plumbed, aligned and braced securely until permanent anchors are set.				
4	Check vision panels/glazing beads in frame are installed as per specification/drawing.				
5	Check door/ Window properly fitted & swings easily with no interference.				
6	Check door properly fitted and swings easily with no interference.				
7	Check all hardware are fixed, adjusted and working as per schedule.				
8	Check door weather sealing is properly installed.				
9	Check locksets keys are working.				
Legend: A - Accepted UA - Un Accepted N/A - Not Applicable					
Remarks:				INSPECTION NOTIFICATION REFERENCE	
				RFI No.	
				ISSUE DATE:	
EVOMECH QA/QC			COMPANY QAQC NLNG		
NAME:			NAME:		
SIGNATURE:			SIGNATURE:		
Date:			Date:		

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS					
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA		CONTRACT NO: B250180ESD	
UNIT: 0000		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 35 of 42	
				DOC NO:	
				Rev OA	
CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001					

		NLNG PROJECT		Doc. no: FORM- CIV-312_A	
		INSPECTION CHECKLIST OF CERAMIC TILES FOR WALL AND FLOOR		REV. _____	Date: _____
				PAGE 1 of 1	
				REF. DOC: _____	
REPORT No.: _____					
PLACE: _____					
DWG / CHART / SPECIFICATION No.: _____					
ITEM / EQUIPMENT / MATERIAL: _____					
MEASURING DEVICE TYPE AND TRACEABILITY: _____					
S/No.	Description of QC Activities	INSPECTION RESULT & SIGNATURE/DATE			
		CONTRACTOR QC		NLNG QC	
		Result	Signature/Date	Result	Signature/Date
1	All types of tiles, adhesives and grout materials and colours are approved.				
2	Check adhesive is applied as per manufacturer recommendation.				
3	Check tiles are laid flat, straight and joints are aligned.				
4	Check slopes in floor are according to the AFC drawings and towards the floor drain.				
5	Check control/ expansion joint locations are correct.				
6	Check all joints are properly grouted with the approved material.				
7	Check tile surfaces are clean and free of cracks and scratches.				
8	Check finished surfaces are properly protected.				
Legend: A - Accepted UA - Un Accepted N/A - Not Applicable					
Remarks: _____				INSPECTION NOTIFICATION REFERENCE	
				RFI No. _____	
				ISSUE DATE: _____	
EVOMECH QA/QC			QAQC NLNG		
NAME			NAME		
SIGNATURE			SIGNATURE		
Date			Date		

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS					
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA		CONTRACT NO: B250180ESD	
		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 36 of 42	
UNIT: 0000				DOC NO: _____	Rev OA _____
				CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

 	NLNG PROJECT PLUMBING SYSTEM WATER TIGHTNESS TEST REPORT	Doc. no. FORM-CIV-311_A Rev. 01 Date: _____ Page 1 of 1 Report No: _____
Inspection Verification:		
Building _____ Sanitary sewage System ☐ Potable water System ☐		
From _____ to _____		
Test Pressure _____ Type of Fluid _____		
Atmospheric Test ☐		
Duration (When required) _____		
Date of Test _____		
Non-Destructive Examination Records No (if any) _____		
Test Result Acceptable ☐ Not –Acceptable (Leaks) ☐		
NOTES:		INSPECTION NOTIFICATION RFI No _____ Date: _____
EVOMEK QA/QC	COMPANY QAQC NLNG	
NAME	NAME	
SIGNATURE	SIGNATURE	
DATE	DATE	

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS			
LOCATION: BONNY ISLAND, NIGERIA	AREA: RA	CONTRACT NO: B250180ESD	
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	Page: 37 of 42	
		DOC NO:	Rev OA
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

 		NLNG PROJECT REPORT OF LIGHTING SYSTEM ILLUMINATION TEST		Doc. no. FORM-ELE-939 B Rev. 01 Date: _____ Page 1 of 1 Ref. Doc. _____		
Location.				Report No:		
TAG:		Equipment Description:				
Data Sheet.		Manufacturer:				
Model Number:		Serial No.:				
Test Equipment		Sub system No:				
Make:	Model:	Serial No.	Expiry Date:			
TESTING DEVICES LIST						
Device type						
Serial number						
INSTALLATION DATA						
Fixture type :			Reference standards:			
Manufacturer :			Lamp [type] :			
Installation [new / in operation since] :			Lamp [Watt / lumen] :			
			H [m] :			
MEASUREMENT OF THE ILLUMINANCE LEVELS						
Anticipated illumination reading value:						
Point	Area	Illuminance values		Illuminance anticipated	Test result	
		Plane	E [lux]		Ea [lux]	P
NOTES: Check suitability of LUX meter for type of lighting.				INSPECTION NOTIFICATION REFERENCE		
				RFI/IN No.		
EVOMECH QA/QC		NLNG		OTHERS		
NAME		NAME		NAME		
SIGNATURE		SIGNATURE		SIGNATURE		
Date		Date		Date		


RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS					
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA		CONTRACT NO: B250180ESD	
UNIT: 0000		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 38 of 42 DOC NO: _____ Rev OA _____ CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

 		NLNG PROJECT REPORT OF LV DISTRIBUTION BOARD -PRECOM CHECKS BEFORE ENERGIZATION		Doc.no. FORM-ELE-531 B Rev. 01 Date: _____ Page 1 of 1 Ref. Doc. _____	
Location.				Report No:	
TAG:		Equipment Description:			
Data Sheet.		Manufacturer:			
Model Number:		Serial No.:			
Test Equipment		Sub system No:			
Make:		Model:		Serial	Expiry Date:
No.	Items to be Checked			SATISFIED.	Non SATISFIED.
1	Check the panel is ready for energization, all incomer cable connected and tested.				
2	Check the functionality of electrical auxiliary devices, switches (anti-condensation heater, lighting, etc.)				
3	Testing of sequences of local control alarms and inter-trips.				
4	Test the correct functionality of earth fault current protection unit/devices.				
5	Testing of sequences of remote-control alarms and inter-trips.				
NOTES				INSPECTION NOTIFICATION REFERENCE	
				RFI/IN No.	
EVOMECE QA/QC		NLNG		OTHERS	
NAME		NAME		NAME	
SIGNATURE		SIGNATURE		SIGNATURE	
Date		Date		Date	

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS				
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD	
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 39 of 42	
			DOC NO: _____ Rev OA	
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

 		NLNG PROJECT REPORT OF LV DISTRIBUTION BOARD – INSTALLATION CHECKS		Doc. no. FORM-ELE-530 A Rev. 01 Date: _____ Page 1 of 1 Ref. Doc. _____	
Location.				Report No:	
TAG:		Equipment Description:			
Data Sheet.		Manufacturer:			
Model Number:		Serial No.:			
Test Equipment		Sub system No:			
Make:		Serial No.		Expiry Date:	
No.	Items to be Checked			SATISFIED.	Non SATISFIED.
1	Check Panel name plate / tag is correct as per drawing				
2	Panel installation check as per approved layout drawing				
3	Holding down arrangement checked				
4	Check panel circuit breakers, lamps, relays, and push button, etc. not damaged				
5	Check of measuring instruments and relevant certificates				
6	Check panel door and painting not damaged				
7	All internal cabling and wiring correct.				
8	Bus bars and connecting links tight.				
9	Phase identification is correct.				
10	Check internals for cleanliness.				
11	Check the earthing connection is correct as per drawing				
NOTES				INSPECTION NOTIFICATION REFERENCE	
				RFI/IN No.	
EVOMECE QA/QC		NLNG		OTHERS	
NAME		NAME		NAME	
SIGNATURE		SIGNATURE		SIGNATURE	
Date		Date		Date	

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS					
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA		CONTRACT NO: B250180ESD	
UNIT: 0000		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 40 of 42 DOC NO: _____ Rev OA _____ CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

 		RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS	
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	
UNIT: 0000		CONTRACT NO: B250180ESD	
INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 41 of 42	
		DOC NO:	
		Rev OA	
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

 	NLNG TRAIN 7 PROJECT SPLIT UNIT INSTALLATION	Doc. no. FORM-IST-720 Rev. 01 Date: _____ Page 1 of 2 Ref. Doc. _____																														
REPORT No: _____ PLACE: _____ DWG / CHART / SPECIFICATION No.: _____ ITEM / EQUIPMENT / MATERIAL: _____ MEASURING DEVICE TYPE AND TRACEABILITY: _____																																
SPLIT UNIT INSTALLATION CHECKLIST																																
<table style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="text-align: left; width: 60%;"><u>CHECK LIST</u></th> <th style="width: 10%;"></th> <th style="text-align: left; width: 30%;"><u>STATUS</u></th> </tr> </thead> <tbody> <tr> <td>Pre-Installation - Site & Material Verification</td> <td style="text-align: center;">☐</td> <td>CHECKED</td> </tr> <tr> <td>Indoor Unit - Location & Mounting Plate</td> <td style="text-align: center;">☐</td> <td>CHECKED</td> </tr> <tr> <td>Indoor Unit - Drainage Pipe Slope</td> <td style="text-align: center;">☐</td> <td>CHECKED</td> </tr> <tr> <td>Indoor Unit - Electrical & Insulation</td> <td style="text-align: center;">☐</td> <td>CHECKED</td> </tr> <tr> <td>Outdoor Unit - Location & Vibration Pads</td> <td style="text-align: center;">☐</td> <td>CHECKED</td> </tr> <tr> <td>Outdoor Unit - Anchoring & Levelling</td> <td style="text-align: center;">☐</td> <td>CHECKED</td> </tr> <tr> <td>Outdoor Unit - Electrical & Piping</td> <td style="text-align: center;">☐</td> <td>CHECKED</td> </tr> <tr> <td>Refrigerant Piping - Size & Insulation</td> <td style="text-align: center;">☐</td> <td>CHECKED</td> </tr> <tr> <td>Refrigerant Piping - Leak & Joint Test</td> <td style="text-align: center;">☐</td> <td>CHECKED</td> </tr> </tbody> </table>			<u>CHECK LIST</u>		<u>STATUS</u>	Pre-Installation - Site & Material Verification	☐	CHECKED	Indoor Unit - Location & Mounting Plate	☐	CHECKED	Indoor Unit - Drainage Pipe Slope	☐	CHECKED	Indoor Unit - Electrical & Insulation	☐	CHECKED	Outdoor Unit - Location & Vibration Pads	☐	CHECKED	Outdoor Unit - Anchoring & Levelling	☐	CHECKED	Outdoor Unit - Electrical & Piping	☐	CHECKED	Refrigerant Piping - Size & Insulation	☐	CHECKED	Refrigerant Piping - Leak & Joint Test	☐	CHECKED
<u>CHECK LIST</u>		<u>STATUS</u>																														
Pre-Installation - Site & Material Verification	☐	CHECKED																														
Indoor Unit - Location & Mounting Plate	☐	CHECKED																														
Indoor Unit - Drainage Pipe Slope	☐	CHECKED																														
Indoor Unit - Electrical & Insulation	☐	CHECKED																														
Outdoor Unit - Location & Vibration Pads	☐	CHECKED																														
Outdoor Unit - Anchoring & Levelling	☐	CHECKED																														
Outdoor Unit - Electrical & Piping	☐	CHECKED																														
Refrigerant Piping - Size & Insulation	☐	CHECKED																														
Refrigerant Piping - Leak & Joint Test	☐	CHECKED																														
NOTES		INSPECTION NOTIFICATION REFERENCE RFI/IN NO: _____																														
EVOMECE QA/QC	NLNG	OTHERS																														
NAME	NAME	NAME																														
SIGNATURE	SIGNATURE	SIGNATURE																														
Date	Date	Date																														

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS				
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA	CONTRACT NO: B250180ESD	
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 42 of 42	
			DOC NO: _____ Rev OA _____	
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

PROJECT TITLE:		 			
CONTRACTOR:					
PROJECT NUMBER:					
CONSTRUCTION QUALITY CHECKLIST					
MASONRY - BLOCKWORK ERECTION CHECKLIST		Form No.: NLNG-TPD-CIV-CKL-005			
		Report No:			
		Rev.No:			
Date of Inspection:					
Building:					
Section:					
Drawing No.:					
Attachment:					
No.	Description of QC Activity	Inspection result and Signature/Date			
		Contractor QA/QC		NLNG Representative	
		Result	Signature	Result	Signature
1	Soundness of Support/DPC (AFC Drwg)				
2	Mortar used for Block work				
3	Internal/External Surface Finishing				
4	Anchoring Rails				
5	Filling of Blocks				
6	Bonding of Blocks				
7	Plumbness				
8	Expansion Joints				
9	Opening Size/Location (AFC Drwg)				
10	Lintel (AFC Drwg)				
REMARKS:					
<i>Legend A : Acceptable , UA : Un Acceptable , N/A : Not Applicable</i>					
Signed :		_____		_____	
		Name (Contractor Construction)		Signature	
				Date	
Signed :		_____		_____	
		Name (Contractor QA/QC)		Signature	
				Date	
Signed :		_____		_____	
		Name (NLNG Representative)		Signature	
				Date	

Form No.: NLNG-TPD-CIV-CKL-005

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS				
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA		
UNIT: 0000		INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		CONTRACT NO: B250180ESD
				Page: 43 of 42
				DOC NO:
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001		Rev OA

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS LOCATION: BONNY ISLAND, NIGERIA AREA: RA CONTRACT NO: B250180ESD			
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	Page: 44 of 42 DOC NO:	Rev OA
CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001			

DOC. No.: FORM-QC-22F1

DATE:

PAGE 1 of 1

REF. DOC.

QC CODE:

REPORT No:

PLACE:

DWG/CHART / SPECIFICATION:

ITEM / EQUIPMENT / MATERIAL

AS-BUILT OF PIONTS

PREPARED BY:

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS

LOCATION: BONNY ISLAND, NIGERIA

AREA: RA

CONTRACT NO: B250180ESD

UNIT:
0000

**INSPECTION AND TEST PLAN FOR RA
APARTMENTS AND VISITORS CENTER
RENOVATION WORKS – BUILDING
CONSTRUCTION WORKS**

Page: 45 of 42

DOC NO:

Rev OA

CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS 		
LOCATION: BONNY ISLAND, NIGERIA	AREA: RA	CONTRACT NO: B250180ESD
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	Page: 46 of 42
		DOC NO:
		Rev OA
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS LOCATION: BONNY ISLAND, NIGERIA AREA: RA CONTRACT NO: B250180ESD			OA 
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS	Page: 47 of 42	
		DOC NO:	Rev OA
		CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001	

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS

MATERIAL INSPECTION RECEIVING REPORT

SUPPLIER:-				REPORT NUMBER: EGSL--NLNG-RACP-CIV-MIR-				Page 1 of 1	
S/N O	ITEM DESCRIPTION	TOTAL QUANTITY RECEIVED	TYPE	MATERIAL SOURCE/VENDOR		CERTIFICATE No.;		INSPECTION POINT ACCEPTED /REJECTED	REMARKS
		QTY				ACCEPTED			
							OA		

INSPECTION NOTE:

EGSL QA/QC NAME:		NLNG REP NAME	
SIGNATURE:		SIGNATURE	
DATE:		DATE	

RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS					
LOCATION: BONNY ISLAND, NIGERIA		AREA: RA		CONTRACT NO: B250180ESD	
UNIT: 0000	INSPECTION AND TEST PLAN FOR RA APARTMENTS AND VISITORS CENTER RENOVATION WORKS – BUILDING CONSTRUCTION WORKS		Page: 48 of 42		
			DOC NO: Rev OA		
			CONTR. DOC NO: EGSL-NLNG-RACP-ITP-8001		