


EWR D&I ANNOTATION

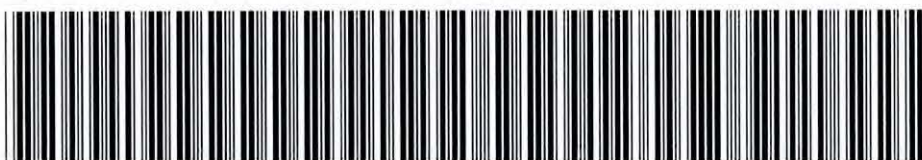

FAN-000001L083001DP473-9570

Artemis # : 000001L083001DP473

Record Created Date : 09/14/2009

Printed Date : 09/17/2009

Description :

DI09-003-SEQ-473 ON SEPTEMBER 29, 2008, GENERAL MOTORS RECEIVED A PHONE CALL FROM THE FATHER OF THE DRIVER OF A 2007 SATURN ION 4-DOOR SEDAN WHO REPORTED HIS SON HAD BEEN INVOLVED IN A COLLISION ON INTERSTATE 294 NEAR PROVISO TOWNSHIP, ILLINOIS, ON SEPTEMBER 21, 2008, AND THE AIRBAGS DID NOT DEPLOY. AS A RESULT HIS SON SUFFERED A CONCUSSION, BRUISES, MULTIPLE LACERATIONS AND MEMORY LOSS. THE FATHER WAS SEEKING AN EXPLANATION FOR THE LACK OF DEPLOYMENT. THE ILLINOIS STATE POLICE REPORT INDICATED THE INCIDENT TOOK PLACE SHORTLY AFTER FIVE IN THE MORNING IN THE RIGHT LANE OF THE INTERSTATE AND COMPRISED THE SATURN IMPACTING THE REAR OF A 1998 VOLVO TRACTOR TRAILER RIG. PER THE REPORT THE DRIVER WAS TRAVELING TOO FAST FOR THE EXISTING CONDITIONS (A LEGEND FOR DECODING THE CONDITIONS WAS NOT INCLUDED IN THE REPORT) WHEN HE IMPACTED THE REAR OF THE TRAILER. THE REPORT ALSO INCLUDED A STATEMENT BY THE DRIVER THAT HE HAD FALLEN ASLEEP PRIOR TO IMPACT. THE DRIVER WAS TRANSPORTED BY SCHILLER PARK EMERGENCY MEDICAL SERVICES TO A HOSPITAL IN MAYWOOD FOR TREATMENT. THE DRIVER WAS CITED FOR TRAVELING TOO FAST FOR CONDITIONS, FAILURE TO REDUCE SPEED AND OPERATING AN UNINSURED VEHICLE. THE VEHICLE HAD NOT BEEN INSPECTED AT THE TIME OF THE D&I SUBMISSION. GENERAL MOTORS DID NOT PROVIDE AN ASSESSMENT OF THE CIRCUMSTANCES THAT LED TO THE INCIDENT AND MADE NO COMMENT REGARDING A CLAIM AND/OR NOTICE ALLEGING A DEFECT. A SEARCH OF ODI/ARTEMIS DATA SPECIFIC TO AIRBAG NONDEPLOYMENT ISSUES IN MY2007 SATURN ION MODELS (LAST YEAR OF PRODUCTION) FOUND: THREE VEHICLE OWNER QUESTIONNAIRE COMPLAINTS (10178130, 10237833 AND 10248859) DESCRIBING NONDEPLOYMENT INCIDENTS; ONE FIELD REPORT (000001L063002FP-SFYION-0707-14-10864.PDF); NO FOREIGN CAMPAIGNS, PURSUITS, RECALLS OR TECHNICAL SERVICE BULLETINS. GM

Print

Close



U.S. Department
of Transportation
**National Highway
Traffic Safety
Administration**

1200 New Jersey Avenue SE.
Washington, DC 20590

CERTIFIED MAIL
RETURN RECEIPT REQUESTED

February 13, 2009

Ms. Gay P. Kent
General Motors Corp.
Mail Code 480-210-G11
30001 Van Dyke
Warren, MI 48090

NVS-217kb
DI09-003

Dear Ms. Kent:

The Office of Defects Investigation (ODI) of the National Highway Traffic Safety Administration (NHTSA) has received information about certain death and injury incidents reported by General Motors Corp. (GM) in its light early warning report from 3rd quarter of 2008. We are writing to request additional information about the following incidents:

Selected Death and Injury Incidents	
For Reporting Category: L	
For the following Sequence IDs: 26, 34, 36, 41, 64, 101, 103, 112, 113, 127, 128, 129, 147, 157, 179, 184, 186, 231, 234, 235, 237, 243, 246, 264, 266, 304, 312, 315, 317, 318, 323, 331, 358, 363, 368, 399, 402, 414, 429, 460, 461, 470, 473, 476	

Unless otherwise stated in the text, the following definitions apply to these information requests:

Incident: each incident identified in the above table.

Claim and Notice: shall have the meanings stated in 49 CFR §579.4(c). Claim and notice also specifically refer to the claim(s) and notice(s) that are the predicate for the early warning report on the incident.

Manufacturer: refers to GM.

Vehicle: the vehicle produced by GM that is identified in the claim or notice.

Tire: the tire produced by GM that is identified in the claim or notice.

Equipment: the item of motor vehicle equipment produced by GM that is identified in the claim or notice.

Defect: means any failure, malfunction, lack of durability, or other problem in performance, construction, a component, or material of a motor vehicle or piece of motor vehicle equipment.

Document: "Document(s)" is used in the broadest sense of the word and shall mean all written, typed, graphic and photographic matter whatsoever (except autopsy photographs), be it in original, copy or electronic form. Any photograph originally produced in color must be provided in color and in electronic form, if possible. Furnish all documents whether verified by GM or not. If a document is not in the English language, provide both the original document and an English translation of the document. Document(s) includes all documents in GM's custody and/or control.

Please provide numbered responses to the following inquiries, repeating the applicable request verbatim before each response. After GM's response to each request, identify the source of the information and indicate the last date the information was gathered. When documents are produced, the documents shall be produced in an identified, organized manner that corresponds to each pertinent information request. A separate response must be provided for each incident. Each response, document or attachment must be clearly identified with the incident Sequence ID (SeqID) number.

1. Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.
2. Provide a copy of the Police Accident Report.
3. At your option, provide GM's assessment of the circumstances that led to the incident including GM's analysis of the claim and/or notice regarding allegations of a defect.

If GM claims that any of the information or documents provided in response to this information request constitute confidential commercial material within the meaning of 5 U.S.C. § 552(b) (4), or are protected from disclosure pursuant to 18 U.S.C. § 1905, GM must submit supporting information together with the materials that are the subject of the confidentiality request, in accordance with 49 CFR Part 512, as amended (69 Fed. Reg. 21409 et seq; April 21, 2004), to the Office of Chief Counsel (NCC-110), National Highway Traffic Safety Administration, 1200 New Jersey Avenue, S.E., Washington, D.C. 20590. GM is required to submit two copies of the documents containing allegedly confidential information (except only one copy of blueprints) and one copy of the documents from which information claimed to be confidential has been deleted. Please remember that the words "CONFIDENTIAL BUSINESS INFORMATION" must appear at the top of each page containing information claimed to be confidential, and the information must be clearly identified in accordance with 5 U.S.C. § 512.6. If you submit a request for confidentiality

for all or part of your response to this letter, that is in an electronic format (e.g., CD-ROM), your request and associated submission must conform to the new requirements in NHTSA's Confidential Business Information Rule regarding submissions in electronic formats (49CRF 512.(c)). See Federal Register, volume 72, page 59434 (October 19, 2007).

Your response to this letter, together with a copy of any confidentiality request, must be submitted to this office by **March 27, 2009**. Please include in your response the identification codes referenced on page one of this letter. If you are unable to provide all of the information requested within the time allotted, you must request an extension from me at (202) 366-4238, no later than five business days before the response due date. If all of the information requested by the original deadline is unavailable, you must submit a partial response by the original deadline with whatever information then is available, even if an extension is granted.

If you have any technical questions concerning this matter, please contact Mr. Leo Yon at (202) 366-7028 or by fax at (202) 366-7882.

Sincerely,

A handwritten signature in black ink that reads "Christina Morgan". The script is cursive and fluid, with the first name "Christina" and last name "Morgan" clearly distinguishable.

Christina Morgan, Chief
Early Warning Division
Office of Defects Investigation
Enforcement



GENERAL MOTORS CORPORATION

Vehicle Structure & Safety Integration

March 27, 2009

March 27, 2009

Ms. Christina Morgan, Chief
Early Warning Division, NVS-217
Office of Defects Investigation
National Highway Traffic Safety Administration
1200 New Jersey Ave., S.E.
Washington, DC 20590

NVS-217kb
DI09-003

Dear Ms. Morgan:

This is General Motors' (GM) response to your inquiry dated February 13, 2009 regarding certain death and injury incidents reported by GM in its light vehicle early warning report from 3rd quarter of 2008.

GM's response is comprised of 50 disks for the incidents that are the subject of DI09-003.

Attachment "A" includes instructions for navigating the disk. Each disk, on its face, is identified by the NHTSA Sequence ID number, the Manufacturer's Unique ID number and the year, make and model of the vehicle involved in the incident, e.g., 26 259693756 - 657480 and 2007 CADILLAC CTS. When the disk is launched, this identification number appears again along with all of the documents on the disk (including photographs and videos, if applicable) listed under "Filename." The first document listed under Filename is an index with the Request and Responses, e.g., identified as 26 259693756 - 657480_00_Request and Responses. The index is numbered 1 through 3 to correspond to Inquiries 1 through 3, which are repeated verbatim below. The index also details whether any documents responsive to each inquiry were located.

For example, the first two Inquiries and Responses in the index for the disk are as follows:

DI09-003
26 259693756-657480
2007 CADILLAC CTS

Request for Information:

1. Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.

Response: See attached document.

2. Provide a copy of the Police Accident Report.

Response: See attached documents and photographs.

The remaining document listed under Filename, reference the Manufacturer's Unique ID number along with the responsive Inquiry number. For example:

26 259693756-657480_01_001 - is the first document responsive to Inquiry no. 1.
26 259693756-657480_02_001 - is the first document responsive to Inquiry no. 2.

Your inquiries and our corresponding replies are as follows:

Product Investigations

Mail Code: 480-210-G11 • 30001 Van Dyke • Warren, MI 48090
DI09-003 Response.doc

1. Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.

Response: See attached document.

The table below lists the incidents that are the subject of DI09-003, by Reporting Category, Sequence ID, VIN and type of notice received by GM (as "notice" is commonly used, not as it is defined by 49 C.F.R. §579.4(c)). Incidents reported on GM's Early Warning Report Death and Injury worksheet fall into four categories: Lawsuit (LIT), NISM (Not In Suit Matters), Product Allegation Resolution (PAR), or Rumor (RMR). Lawsuit and NISM case types generally meet the §579.4(c) definition of "claim." PAR cases, in this context, refer to customer contacts in which an injury or fatality is alleged to have occurred as a result of a product defect, and are accompanied by a writing that may or may not meet the §579.4(c) definition of "claim" or "notice." Rumor incidents do *not* involve a written or verbal, implied or express allegation of a defect by a customer. Rather, rumor cases generally refer to incidents that GM learned of through the media, which were subsequently investigated further. As such, the document included in response to Inquiry 1 that can be found on the enclosed disk for the PAR and Rumor case listed in the table, may not be a claim or notice of the type generally defined as such by §579.4(c).

(44 Vehicles from the Light Vehicle Template)		
SEQUENCE ID	VEHICLE IDENTIFICATION NUMBER (VIN)	TYPE
26	1G6DM57T970	NISM
34	1G6KD57YX7U	NISM
36	1G6KD57Y78U	NISM
41	1GYEC63847R	LIT
64	KL1TD52635B	NISM
101	1G1AL15F077	NISM
103	1G1AL15F677	NISM
112	1G1AL58F087	NISM
113	1G1AL15F587	NISM
127	1G1YY26E485	NISM
128	1G1YY36W185	NISM
129	1G1YY26E985	NISM
147	3GNDA23D48S	RMR
157	2G1WF52E759	NISM
179	1G1ZT61826F	LIT
184	1G1ZT58N98F	NISM
186	1G1ZH57B08F	NISM
231	2GCEC13T561	NISM
234	2GCEK13T161	RUMOR
235	2GCEC13T261	PAR
237	2GCEK13M271	NISM
243	2GCEC13J681	NISM
246	3GCEC13C38G	NISM
264	3GNFC16JX7G	NISM
266	3GNFC16J57G	NISM
304	1GNDT13S952	NISM
312	1GNDT13S762	RUMOR
315	1GNDT13S772	NISM
317	1GNDS13S882	FOREIGN FATALITY
318	1GNDT13S482	NISM
323	1GNDV23L56D	LIT
331	1GKER13757J	NISM
358	3GTEC13J37G	NISM
363	1GTEK19J48Z	NISM
368	1GTHC29K28E	NISM
SEQUENCE ID	VEHICLE IDENTIFICATION NUMBER (VIN)	TYPE

SEQUENCE ID	VEHICLE IDENTIFICATION NUMBER (VIN)	TYPE
399	1G2AS18H097 [REDACTED]	NISM
402	1G2ZF55B464 [REDACTED]	NISM
414	6G2EC57Y09L [REDACTED]	NISM
429	2G2WP552X71 [REDACTED]	NISM
460	1G8ZS57B29F [REDACTED]	NISM
461	5GZER33758J [REDACTED]	NISM
470	1G8AY11P66Z [REDACTED]	PAR
473	1G8AL55F37Z [REDACTED]	NISM
476	1G8AJ55F77Z [REDACTED]	NISM

2. **Provide a copy of the Police Accident Report.**

Response: If available, see attached document(s) and photograph(s) on the enclosed disk(s).

3. **At your option, provide GM's assessment of the circumstances that led to the incident including GM's analysis of the claim and/or notice regarding allegations of a defect.**


Response: GM opts not to respond.

GM claims that certain information, in documents that are part of rumor, claim and lawsuit files maintained by the GM Legal Staff and its outside counsel, is attorney work product and/or privileged. That information includes notes, memos, reports, photographs, and evaluations by attorneys (and by consultants, claims analysts, investigators, and engineers working at the request of attorneys). GM is producing responsive documents from its rumor, claim and lawsuit files that are neither attorney work product nor privileged and withholding those that are attorney work product and/or privileged.

This response was compiled and prepared by this office upon review of documents retrieved by GM and does not include documents generated or received subsequent to the searches.

Please contact me at if you require further information.

Sincerely,




Gay P. Kent
Director

Product Investigations


Enclosures: 50 Disks
Attachment A

Attachment A Instructions for using Disk Viewer


1. Insert the disk into the disk ROM drive; the disk will open automatically.
2. Click the "Run JPegger" button on the pop up window.

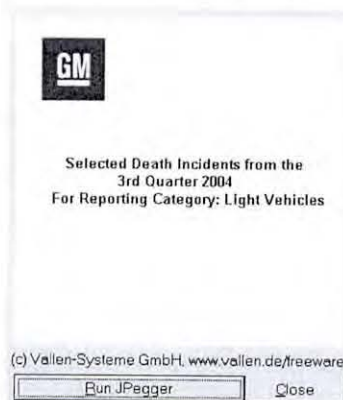

3. The program will launch in the browsing mode, which is shown in the image below.
4. You can use the down arrow key on your keyboard to browse through the images.

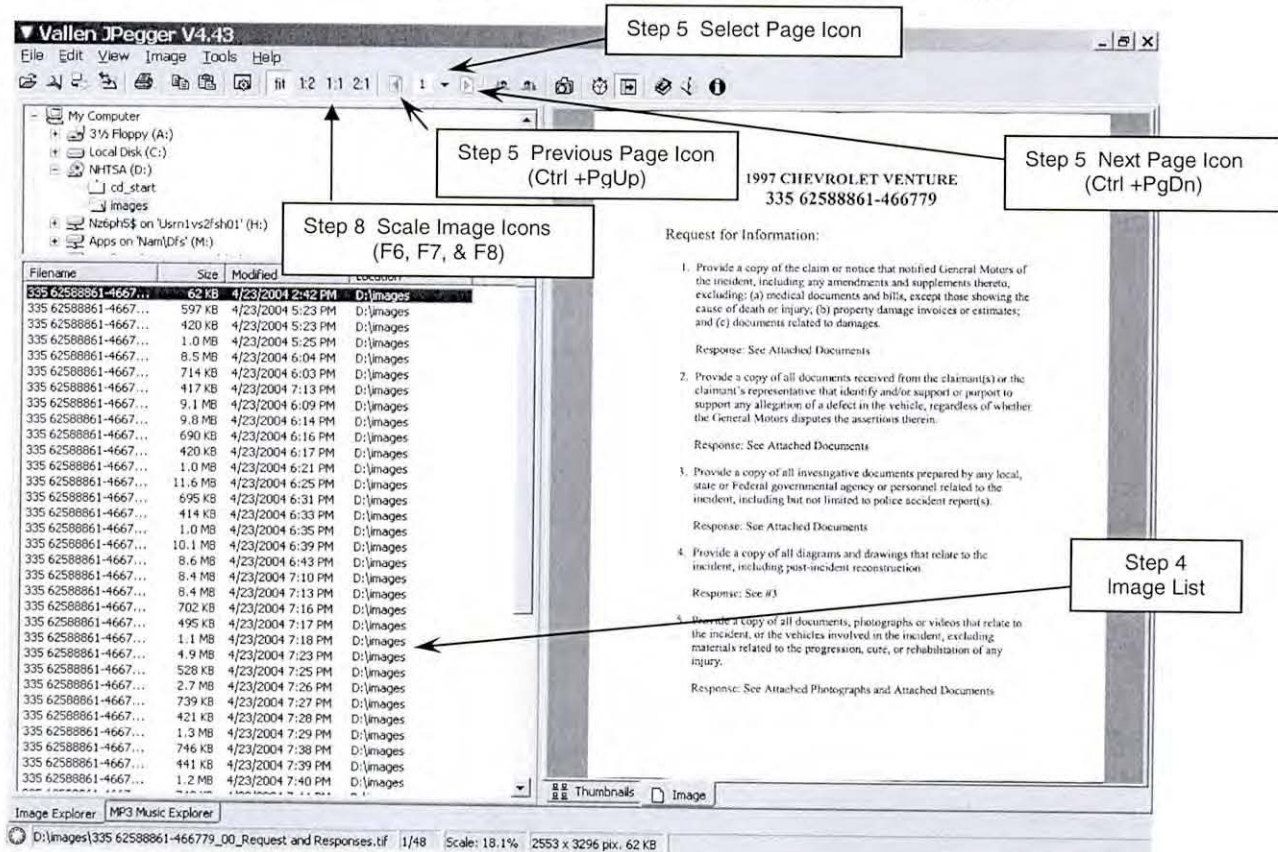

- Each image file may contain multiple pages. In the browsing mode use **Next Page Icon (Ctrl +PgDn)**, **Select Page Icon** or **Previous Page Icon (Ctrl +PgUp)** to browse through all of the pages within an image file. (Note: Some image files may contain up to 80 pages)
- By double-clicking on an image from the file list, a slide show will initiate, however, it will not automatically advance through the pages. Use **Ctrl +PgDn** or **Ctrl +PgUp** to browse through all of the pages within an image file. Left-clicking on an image, while in the slide show mode, will advance to the first page of the next image file.
- Right click on the image to see the image properties, as shown below. Image properties can also be used to view each page within the documents (Next page), or to view the next document within the file list (Next Image).
- If the image is difficult to view, the scale may be changed. Use **F5**, **F6**, **F7**, and **F8** to alternate between scales that fit the screen, or are 50%, 100%, and 200% of the image's original size.

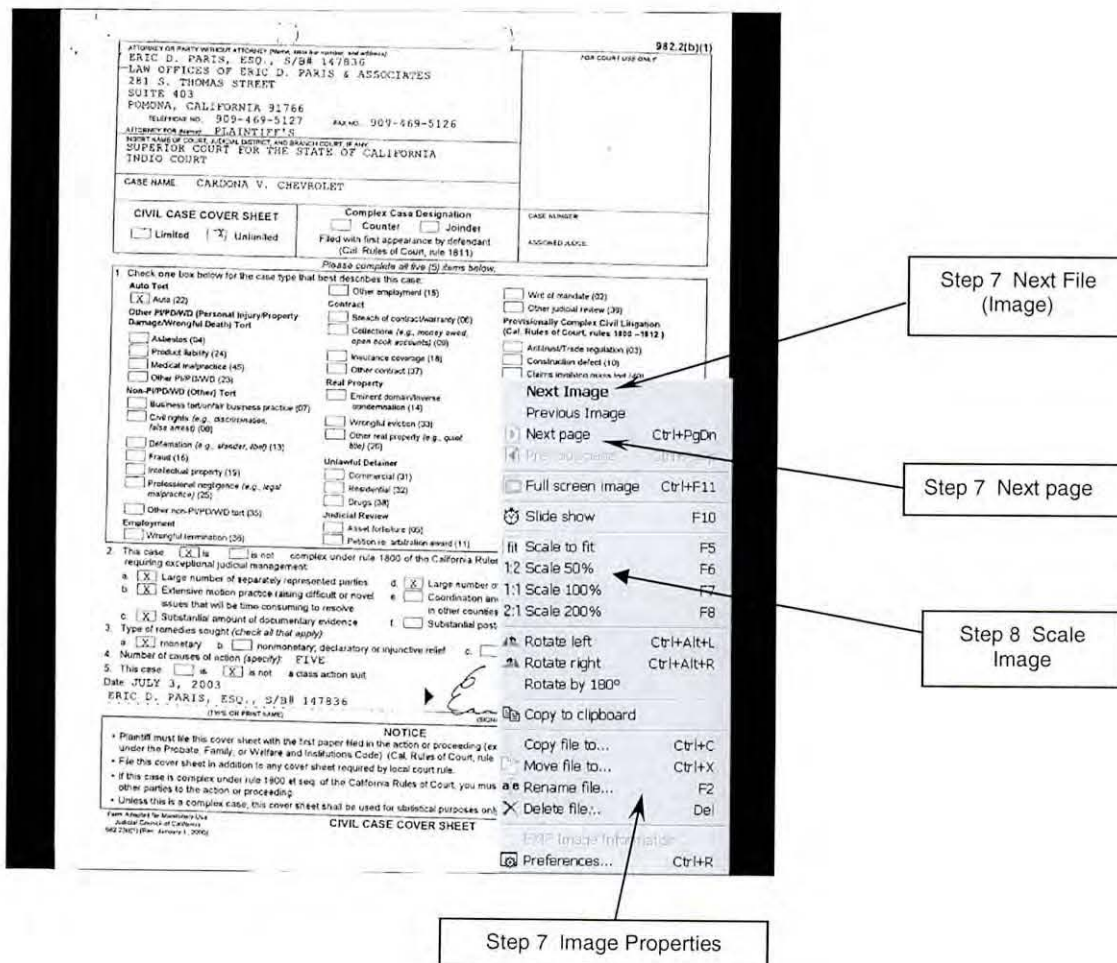

DI09-003
473 259695266 – 661066
2007 SATURN ION

Request for Information:

1. Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.

Response: See Attached Document.

2. Provide a copy of the Police Accident Report.

Response: See Attached Document.

3. At your option, provide GM's assessment of the circumstances that led to the incident including GM's analysis of the claim and/or notice regarding allegations of a defect.

Response: GM opts not to respond.

Service Request Detail

SR No. (b) (6)	Ref No.	Goodwill	No Goodwill Offered	BRC Type	PAR
Account	Site	GW SubType		Bus. Unit	BRC
Last Name	First Name	Approval	Not Initiated	Area	PAR
Daytime #	Evening #	UCC	Restraints - (SIR) - Driver Front	Sub-Area	Initial PAR- Injury
Address	City Oak Lawn	Involved Dir	W. Gordon Walker	Safety	Yes
State IL ZipCd	Con Acct	Source	Phone	Updated	9/30/2008 01:11:57 PM
Serial #/VIN 1G8AL55F37Z	Model Year 2007	Priority	Medium License #	Owner	KINZERTH
Make Saturn	Warr. Start 10/04/2006	Status	Open	Opened	9/29/2008 11:25:09 AM
Model ION 3	Mileage 58756	Sub-Status	Satisfied	Closed	
Abstract	Airbags - Non-Deployment w/injuries				
Customer Description	This is a BRC-PAR case / do not assume / forward all inquiries to Thaddeus Kinzer x41039				

Pre-PAR

PAR Notifier	Incident Date/Time 9/21/2008 04:30:00 AM	Injuries Y#	1	Other Veh	1	Road Surface	Asphalt	Road Cond.	Dry	Fire Report#	n/a	Police Report#	unknown
Owner	Driver Last Name	Driver First Name	DOB	Height	5'8"	Disabilities	no	Insurance Agent Last Name	n/a	Insurance Agent First Name	n/a	Phone #	(866) 338-6480 x54
								Insurance Agency	State Farm				
Incident Loc	Restricted Access Tow Road, Hwy 294						Incident Desc	My son drove the vehicle and rear ended the truck into the vehicle ahead of him					
Component	No Airbags Deployed						Damage Desc	Front End of the vehicle					
Vehicle Loc	J and J Auto Rebuilders, 708-597-1744						Add'l Info						
Emgoy Svc Names	Illinois State Police						Maint Loc	Saturn of Oaklawn					

PAR Detail

Collision	Y	Non Collision	Property Damage	N	Thermal Evt	N	Spec Equip	None
Vehicle Speed	60	Weather Condition	nighttime / dry	Prop Owner	n/a	Property Type	n/a	
Last Service Date		Loc Last Service		Property Location	n/a	Prop Est Repair Cost		
Veh Est Repair Cost		Spec Equip Installer	n/a	Prop Damage Description	n/a			
Primary Veh Use	Personal	Inspection Type		Inspected By	Inspection Not Performed	Inspection Date/Time		
Veh Damage Description	front end crushed in			Explain Other	forwarded to ESIS			

Service Request Detail

PAR Injuries

Last Name	First Name	DOB	Location	Phone #	Seating Pos	Restraint Type
			Occupant of Owner's Vehicle		Driver	Seatbelt
Injury Description			Medical Rpt#		Treatment Location	Treated By
Concussion, bruises and cuts over his head and hands - memory loss (does not remember accident)			unknown		Olyola medical center and Christ medical center	unknown
Street Address			City	State	Zip Code	
			Oak Lawn	IL		

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 01:16:18 PM	KINZERTH	KINZERTH	Scheduled Follow-up		Scheduled Alarm		ESIS

Contact Last Name	Contact First Name	Account	BAC Code

Comments

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 01:15:53 PM	KINZERTH	KINZERTH	BRC PAR	ESIS - Injuries	Done	9/30/2008 01:15:15 PM	ESIS - Injuries

Contact Last Name	Contact First Name	Account	BAC Code

Comments

File forwarded to ESIS due to injuries

Thaddeus Kinzer/PA/ATX

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 01:15:06 PM	KINZERTH	ESISBIQU	Escalation	ESIS - Injuries	In Progress		ESIS - Injuries

Contact Last Name	Contact First Name	Account	BAC Code

Comments

Cust claims frontal airbags did not deploy during frontal collision

Injuries include concussion and memory loss to driver of veh

Confidential Comments

Service Request Detail

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 01:11:57 PM	KINZERTH	KINZERTH	Ownership Changed	Ownership Escalated to BRC	Done	9/30/2008 01:11:57 PM	Ownership Escalated to BRC

Contact Last Name	Contact First Name	Account	BAC Code

Comments

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 01:00:05 PM	KINZERTH	KINZERTH	Outbound Call Customer	Reached Wrong No./Disconnect	Done	9/30/2008 01:00:05 PM	Called

Contact Last Name	Contact First Name	Account	BAC Code

Comments

Attempted to reach cust for acknowledgement, number listed on file was for Ind body shop where veh is located - was provided with cell number for cust

Thaddeus Kinzer/PA/ATX

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 12:06:36 PM	DRAHEICM	KINZERTH	Ownership Changed		Done	9/30/2008 12:06:36 PM	Service Request Ownership has changed FROM: LERNOUDE TO: KINZERTH

Contact Last Name	Contact First Name	Account	BAC Code

Comments

Confidential Comments

Service Request Detail

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 12:06:12 PM	DRAHEICM	KINZERTH	BRC PAR	Initial Contact- Phone	Done	9/30/2008 01:14:45 PM	Called
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

Spoke with cust

- * Cust claims frontal airbag did not deploy during frontal collision
- * Verified pre-par and completed par detail
- * Injuries include concussion and memory loss to driver of veh, cust's son
- * Insurance company waiting for GM inspection of airbags before beginning repairs - claim number
- * Advised cust file would be forwarded to ESIS
- * Provided contact information

Thaddeus Kinzer/PA/ATX

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 12:06:07 PM	DRAHEICM	KINZERTH	BRC PAR	Initial Contact- Dealer	Done	9/30/2008 01:05:02 PM	Called
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

Spoke with Wally Glogoski, svc mgr at Saturn Of Oaklawn

- * Confirmed no previous related repairs

Thaddeus Kinzer/PA/ATX

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 12:06:02 PM	DRAHEICM	KINZERTH	BRC PAR	Initial Contact- AVM	Done	9/30/2008 12:15:51 PM	Not required due to brand
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

Confidential Comments

Service Request Detail

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 12:05:57 PM	DRAHEICM	KINZERTH	BRC PAR	Acknowledgement	Done	9/30/2008 01:06:19 PM	Called

Contact Last Name	Contact First Name	Account	BAC Code

Comments

Initial completed during acknowledgment

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 12:05:53 PM	DRAHEICM	KINZERTH	Notify CRM		Done	9/30/2008 12:14:07 PM	File Assigned

Contact Last Name	Contact First Name	Account	BAC Code

Comments

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 12:05:48 PM	DRAHEICM	KINZERTH	Research		Done	9/30/2008 12:54:38 PM	Research VIN

Contact Last Name	Contact First Name	Account	BAC Code

Comments

Open Recalls:None
Related Repairs:None
Previous SRS:None

Thaddeus Kinzer/PAR/ATX

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 12:05:32 PM	DRAHEICM	KINZERTH	BRC PAR	Case Assigned	Done	9/30/2008 12:12:58 PM	Assigned to Thaddeus Kinzer x41039

Contact Last Name	Contact First Name	Account	BAC Code

Comments

Confidential Comments

Service Request Detail

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 10:12:16 AM	DRAHEICM	LERNOUDE	SR Opened		Done	9/30/2008 10:12:16 AM	SR in Status of Closed has been Re-Opened by DRAHEICM
Contact Last Name		Contact First Name		Account		BAC Code	
Comments							
Confidential Comments							

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/30/2008 10:12:14 AM	DRAHEICM	LERNOUDE	SR Closed - Dissatisfied		Done	9/30/2008 10:12:14 AM	Service Request has been Closed Dissatisfied.
Contact Last Name		Contact First Name		Account		BAC Code	
Comments							
Confidential Comments							

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/29/2008 11:52:04 AM	LERNOUDE	DRAHEICM	Escalation	Initiate PAR	Done	9/30/2008 10:11:32 AM	Assigning activity to PAR QUEUE
Contact Last Name		Contact First Name		Account		BAC Code	
Comments							
CRS advised that a person from the PAR Department will contact the customer within 2 business days							
Received and assigned in PAR. Chad Draheim/ATX/Workflow PAR							
Confidential Comments							

Service Request Detail

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/29/2008 11:44:10 AM	LERNOUDE	LERNOUDE	Inbound Call Customer	Complex Request	Done	9/29/2008 11:46:57 AM	Cust called in
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

Cust states:

- My son was in an accident
- I have photos of the accident that I want to mail in
- I want to know why the airbags didn't go off on my vehicle
- My son has a concussion

Cust seeks:

- RFI to know why airbags didn't go off

CCC advises:

- I need to gather information regarding the incident so our team can look into this further for you

Cust states:

- I will not give the insurance #. I am not looking to have someone come out
- I want to know why they went off and send the pictures in that is all

CCC advises:

- In order for our team to look into this, we need as much information as possible.
- I will forward what information you have provided today to the PAR team and they will get back with you in 2 business days.

Deb Lernout/Chatham/Tier 1/Satum/Level 2

Confidential Comments

UCC Information

UCC Code	Symptom	Description
C46	SIR - Did Not Deploy	Restraints - (SIR) - Driver Front

GM Vehicle Inquiry System Summary

[Home](#) - [Summary](#) - [Claim History](#) - [Vehicle Build](#) - [Vehicle Component](#) - [Delivery Information](#) - [Dealer Information](#) - [Service Contract](#) - [Warranty Block](#) - [Branded Title](#)

[Help](#)

VIN :	1G8AL55F37Z
-------	-------------

VEHICLE INFORMATION

Merchandising Model :	ZAL69 -2007 ION 3 SEDAN AUTOMATIC	Warranty Start Date :	10/04/2006
BARS Order Type :	70 - RETAIL - STOCK		
Delivering Dealer :	N/A	Selling Source :	N/A
		Site Code :	N/A
		Business Associate Code :	N/A
Service Contract :	Yes	Branded Title :	No
		Warranty Block :	No
		PDI Status :	Open

REQUIRED FIELD ACTIONS

Vehicle Has No Current Record Of Outstanding Campaigns

SERVICE INFORMATIONAL ITEMS

Vehicle Has No Current Record Of Outstanding Service Information

ON STAR AND XM SATELLITE RADIO INFORMATION

OnStar Equipped	Yes	OnStar Status	Active	Refer to Help page for details or go to OnStar Online Enrollment (located on the "OnStar" tab in GM InfoNET) or (888)ONSTAR1 (888) 667-8271.		
XM Equipped	No	XM Radio ID	N/A	XM Status	N/A	Refer to Help page for details or: www.xmradio.gm.ca or Dealer Hotline 1.877.GET.XMST (1-877-438-9677).

APPLICABLE WARRANTIES

Description	Effective Date	Effective Odometer	End Date	End Odometer
36/36000 BUMPER TO BUMPER LIMITED WARRANTY	10/04/2006	76 miles	10/04/2009	36076 miles
72/100000 SHEET METAL COVERAGE RUST THROUGH LIMITED WARRANTY	10/04/2006	76 miles	10/04/2012	100076 miles
96/80000 FEDERAL EMISSION CATALYTIC CONV. AND PCM	10/04/2006	76 miles	10/04/2014	80076 miles
60/100000 POWERTRAIN COVERAGE LIMITED WARRANTY	10/04/2006	76 miles	10/04/2011	100076 miles
36/36000 FEDERAL EMISSION	10/04/2006	76 miles	10/04/2009	36076 miles

http://198.208.187.167/gmvis/main/Summary?languageSelected=EN&VIN=1G8AL55F37... 10/1/2008

CLAIM HISTORY

R.O Date	R.O Number	Type	Labor Operation	Odometer Reading
06/13/2007	420392	#	R0754 - RADIO RECEIVER-RETURN TO AC/DELCO ESC	1012 miles

CHECK HISTORY INFORMATION

Vehicle Has No Associated Check History Information.

© 1998-2005 General Motors Corporation. All Rights Reserved.

GM Vehicle Inquiry System

Claim History

[Home](#) - [Summary](#) - [Claim History](#) - [Vehicle Build](#) - [Vehicle Component](#) - [Delivery Information](#) - [Dealer Information](#) - [Service Contract](#) - [Warranty Block](#) - [Branded Title](#)

[Help](#)

VIN :	IG8AL55F37Z
-------	-------------

CLAIM HISTORY

Repair Order Date :		06/13/2007		Repair Order Number :		420392		Odometer Reading :		1012 miles	
Serviced By :		AJR INTERNATIONAL 300 REGENCY DRIVE GLENDALE HEIGHTS, IL 60139-2283				Selling Source :		45 - A/C DELCO			
						Site Code :		51927			
						Business Associate Code :		192113			
Cycle Date	Cycle Nbr	Case	Type	Labor Operation			Part		Auth Code	Person Code	Line Total

GM Vehicle Inquiry System Vehicle Build

[Home](#) - [Summary](#) - [Claim History](#) - [Vehicle Build](#) - [Vehicle Component](#) - [Delivery Information](#) - [Dealer Information](#) - [Service Contract](#) - [Warranty Block](#) - [Branded Title](#)

[Help](#)

VIN	1G8AL55F37Z
-----	-------------

VEHICLE BUILD

Merchandising Model :	ZAL69 -2007 ION 3 SEDAN AUTOMATIC		
Gross Vehicle Weight Rating :	1719 kg (3790 lb)	Order Number :	KJZKWZ
Build Date :	09/13/2006	Build Plant :	17ZA

GMVIS is not the definitive source of GM Vehicle RPO information and is intended for service reference only. Should there be any questions about the vehicle's original build or RPO information please refer to the original vehicle invoice or window sticker.

OPTION CODES

AK5 - DR & PASS SEAT RESTRAINT SYSTEM	AR9 - DLXE FRT BKT SEAT
BBC - BODY COLOR APPLIQUES	B37 - FLOOR MATS FRONT & REAR
C60 - A/C W/DUST & POLLEN FILTER	C74 - MAP LIGHTS
DF5 - AUTO-DIMMING INSIDE MIRROR EXTERIOR TEMPERATURE GAUGE DIGITAL COMPASS	DG7 - PWR. REMOTE EXTERIOR MIRRORS
FE1 - SOFT RIDE SUSPENSION SYSTEM	FE9 - FEDERAL EMISSIONS
FY1 - RATIO - 3.63	HCG - TRAVEL PACKAGE INCLUDES: * AUTO DIMMING INSIDE MIRROR * EXTERIOR TEMPERATURE GAUGE * DIGITAL COMPASS * MAP LIGHTS
IJE - TRIM INTERIOR DESIGN	JM4 - ANTI-LOCK BRAKES W/ TRAC CTRL
K62 - 105 AMP GENERATOR	L61 - 2.2L 4CYL DOHC 16V 145 HP ENG. W/DUAL BALANCE SHAFTS
MN5 - 4 SPEED AUTO TRANS	MX0 - MERCHANDISED TRANS AUTO PROVIS
NK5 - STANDARD STEERING WHEEL	NT7 - EMISSION SYSTEM FEDERAL
NW7 - TRACTION CONTROL	PFD - 16" MACHINED-FACED ALLOY WHEEL
QLG - P205/55R16 PERFORMANCE TIRES	RF5 - MERCHANDISED PKG SATURN
R6H - SDS CHARGE	R6P - SPECIAL PAINT
R7Y - COMMUNICATIONS PLUS	R9N - LEATHER APPOINTMENTS
SLM - SALES PROCESSING STOCK ORDERS	UE1 - ONSTAR SERVICE: INCLUDES 1 YEAR SAFE AND SOUND PLAN
UH8 - CLUSTER INST, COOL TEMP, TRIP ODOM,	US6 - FIXED ANTENNA, PAINTED, RADIO

<http://198.208.187.167/gmvis/main/VehicleBuild?languageSelected=EN&VIN=1G8AL55...> 10/1/2008

TACH	
US8 - AM/FM STEREO W/CD & MP3	U79 - 4 COAXIAL SPEAKERS
VK3 - LICENSE PLATE FRONT FRT	V73 - VEHICLE STATEMENT USA/CANADA
1SZ - DISCOUNT OPTION PKG	17E - GRAY CLOTH
17I - GRAY	6AA - SUSPENSION
63L - BERRY RED	63U - BERRY RED
7AA - SUSPENSION	8AA - SUSPENSION
9AA - SUSPENSION	

© 1998-2005 General Motors Corporation. All Rights Reserved.

ILLINOIS TRAFFIC CRASH REPORT

SHEET 1 OF 1

(b) (6)



8983186

DRAC	DRAC	PEDV	PEDV	TRFD	TRFD	WEAT	WEAT	DRVA	DRVA	VS	VS	VEID	VEID	LOIT	COLL	MANY	MANY	PPA	PPA	PPL	PPL
5	1			12	4	1	7	1	1	1	1	1	1	5	11	1	1				
U1	U2	U1	U2	U1	U2	U1	U2	U1	U2	U1	U2	U1	U2	U1	U2	U1	U2	U1	U2	U1	U2

INVESTIGATING AGENCY ILLINOIS STATE POLICE		TYPE OF REPORT 1 On-scene		TYPE OF CRASH B Injury		AGENCY CRASH REPORT NO. (b) (6)		DATE OF CRASH 09/21/2008		TIME OF CRASH 05:20 AM		TRFW 3							
ADDRESS NO. 1-294		CITY/TOWNSHIP PROVISO TWP		INTERSECTION RELATED N		NO. VEHICLES 2		LARI CODE N		VEH1 1									
DISTANCE 0.21		UNIT Miles		DIRECTION North		NAME OF INTERSECTION OR ROAD FEATURE I-294 MILE POST 32		COUNTY COOK		PROPERTY N		LARI CODE N		VEH1 1					
NAME (LAST, FIRST, MI) [REDACTED]		DRIVER Driver		MAKE Saturn		MODEL Ion		YEAR 2007		DAMAGED AREA(S) NONE		TOWED Y		VEH2 7					
STREET ADDRESS [REDACTED]		SEX M		SAFT 2		AIR 1		STATE IL		YEAR 2009		UNDER CARRIAGE TOTAL		HAZMAT N		VEH2 10			
CITY OAK LAWN		STATE IL		ZIP [REDACTED]		DRURY 11		EJECT 1		VIN 1GBA155F37Z		POINT OF 1ST CONTACT 1		COMVED N		ALON 1			
TELEPHONE [REDACTED]		LICENSE NO. [REDACTED]		STATE IL		CLASS D*		VEHICLE OWNER (LAST, FIRST, MI) [REDACTED]		INSURANCE CO. Non E		POLICY NO. NA		RUR 1					
TAKEN TO LOYOLA HOSPITAL		EAG AGENCY Schiller Park		OWNER ADDRESS (STREET, CITY, STATE, ZIP) [REDACTED] OAK LAWN, IL, [REDACTED]		MAKE Volvo		MODEL Vn		YEAR 1998		DAMAGED AREA(S) NONE		TOWED N		VEH3 2			
NAME (LAST, FIRST, MI) [REDACTED]		DRIVER Driver		SEX M		SAFT 2		AIR 1		STATE IL		YEAR 2009		UNDER CARRIAGE TOTAL		HAZMAT N		VEH3 20	
CITY OAK PARK		STATE IL		ZIP [REDACTED]		DRURY 0		EJECT 1		VIN 4VG7DAGF5WN		POINT OF 1ST CONTACT 11		COMVED Y		RUR 1			
TELEPHONE [REDACTED]		LICENSE NO. [REDACTED]		STATE IL		CLASS A*		VEHICLE OWNER (LAST, FIRST, MI) EAGLE EXPRESS LINES, NA NA		INSURANCE CO. Liberty Mutual Insurance Company		POLICY NO. [REDACTED]		RUR 1					
TAKEN TO [REDACTED]		EAG AGENCY [REDACTED]		OWNER ADDRESS (STREET, CITY, STATE, ZIP) 715 W 172ND STREET, SOUTH HOLLAND, IL, 60473		MAKE [REDACTED]		MODEL [REDACTED]		YEAR [REDACTED]		DAMAGED AREA(S) [REDACTED]		TOWED [REDACTED]		VEH4 96			
UNIT [REDACTED]		SEAT [REDACTED]		DOB [REDACTED]		SEX [REDACTED]		SAFT [REDACTED]		AIR [REDACTED]		EJECT [REDACTED]		PASSENGER & WITNESSES ONLY (NAME, ADDR, TEL) [REDACTED]		RUR 96			
EVNO 1		MOST X		EVT 11		LOC 1		DAMAGE PROPERTY OWNER NAME [REDACTED]		DAMAGED PROPERTY [REDACTED]		CONTRIBUTORY CAUSE (primary) 28 Failing to reduce speed to avoid crash		CONTRIBUTORY CAUSE (secondary) 17 Physical condition of driver		CRP 5			
1		[REDACTED]		[REDACTED]		[REDACTED]		PROPERTY OWNER ADDRESS (STREET, CITY, STATE, ZIP) [REDACTED]		SECTION Oper of uninsured motor veh		DATE NOTIFIED 09/21/2008		TIME NOTIFIED 05:20 AM		CRP 5			
3		[REDACTED]		[REDACTED]		[REDACTED]		[REDACTED]		SECTION Too fast for cond/fail reduce		COURT DATE 10/27/2008		COURT TIME 09:00 AM		CRP 5			
1		X		11		1		OFFICER ID 5618		SEAT / DIST 15		SUPERVISOR ID [REDACTED]		[REDACTED]		[REDACTED]			
3		[REDACTED]		[REDACTED]		[REDACTED]		[REDACTED]		[REDACTED]		[REDACTED]		[REDACTED]		[REDACTED]			

TA000099557

DIAGRAM

I-294 SOUTHBOUND AT MILEPOST 32.5		→
Not to Scale		
U2	U1	LANE = 5
		LANE = 4
		LANE = 3
		LANE = 2
		LANE = 1

NARRATIVE (Refer to vehicle by Unit No.)

UNIT #1 AND UNIT #2 WERE TRAVELING I-294 SOUTHBOUND AT MILEPOST 32.5 (LANE 5). THE DRIVER OF UNIT #1 ADVISED HE FELL ASLEEP AND STRUCK THE TRAILER OF UNIT #2. UNIT #1 SUSTAINED MAJOR FRONT END DAMAGE. UNIT #2 SUSTAINED REAR END DAMAGE.

SEMI TRAILER INFORMATION: 1995 OSHK VIN: 4MLT14528SE [REDACTED] IL REGISTRATION (b) (6)

LOCAL USE ONLY Nothing

U1 Colors Red	U1 Towed By / To: Roger's Auto Service / Roger's Auto Service
U2 Colors Red	U2 Towed By / To: /

COMMERCIAL VEHICLE		Unit 1
CARRIER NAME		SOURCE
ADDRESS		SIDE OF TRUCK
CITY STATE ZIP		PAPERS
ID Number:		DRIVER
USDOT	ICCNC	LOG BOOK
OR State No.	State Name	GVWR
HAZARDOUS MATERIALS		PLACARDED ?
IF YES: 4 DIGITS 1 DIGIT Name		
HAZARDOUS CARGO RELEASED FROM TRUCK?		N
VIOLATION OF HAZMAT REGS. CONTRIBUTE TO CRASH?		
VIOLATION OF MCS REGS CONTRIBUTE TO CRASH?		
INSPECTION FROM COMPLETED?		FORM NO.
HAZMAT	OUT OF SERVICE?	
MCS	OUT OF SERVICE?	
IDOT PERMIT#	WideLoad	
TRAILER WIDTH(S)	TRAILER LENGTH(S)	Vehicle Length
TRAILER 1	TRAILER 1	Total - Ft
TRAILER 2	TRAILER 2	No Of Axles
Vehicle Configuration	Cargo Body Type	Load Type

COMMERCIAL VEHICLE		Unit 2
CARRIER NAME		SOURCE
ADDRESS		SIDE OF TRUCK
CITY STATE ZIP		PAPERS
ID Number:		DRIVER
USDOT	ICCNC	LOG BOOK
OR State No.	State Name	GVWR
HAZARDOUS MATERIALS		PLACARDED ?
IF YES: 4 DIGITS 1 DIGIT Name		No
HAZARDOUS CARGO RELEASED FROM TRUCK?		N
VIOLATION OF HAZMAT REGS. CONTRIBUTE TO CRASH?		N
VIOLATION OF MCS REGS CONTRIBUTE TO CRASH?		N
INSPECTION FROM COMPLETED?		FORM NO.
HAZMAT	OUT OF SERVICE?	N
MCS	OUT OF SERVICE?	N
IDOT PERMIT#	WideLoad	N
TRAILER WIDTH(S)	TRAILER LENGTH(S)	Vehicle Length
TRAILER 1 0-96"	TRAILER 1 45	Total - Ft 56
TRAILER 2	TRAILER 2	No Of Axles 5
Vehicle Configuration 6	Cargo Body Type 2	Load Type 5