


EWR D&I ANNOTATION

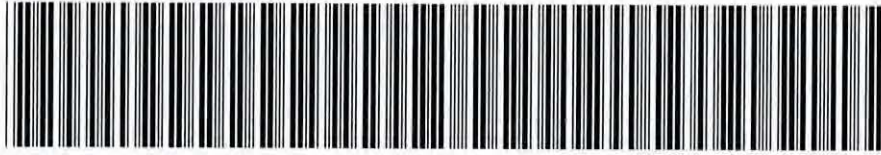

FAN-000001L103001DP541-5766

Artemis # : 000001L103001DP541**Record Created Date :** 04/21/2011**Printed Date :** 04/21/2011**Description :**

DI11-005 SEQUENCE ID 541. A GM CUSTOMER COMPLAINT LOG CONTAINS A CALL LOG FROM A CUSTOMER WHOSE SON WAS KILLED IN A SINGLE VEHICLE CAR CRASH. ACCORDING TO THE CALLER AND THE PROVIDED POLICE REPORT THE DECEDENT WAS DRIVING A 2007 PONTIAC G5 WHEN THEY LOST CONTROL, LEFT THE RIGHT SIDE OF THE ROADWAY AND STRUCK A TREE. THE CAR STRUCK THE TREE WITH THE DRIVER SIDE DOOR. THE DOOR WAS PUSHED IN 24 INCHES; THE DRIVER WAS KILLED. THE CALLER STATES THAT THE ROADS WERE WET AND THERE WAS BLACK ICE IN THE AREA. THE CALLER LATER HEARD ABOUT STEERING PROBLEMS WITH THESE VEHICLES AND FEELS THE STEERING MAY HAVE BEEN THE CAUSE OF THE CRASH. THEY WANT TO KNOW WHEN GM ISSUED THE STEERING RECALL AND HOW LONG THEY KNEW ABOUT THE STEERING PROBLEMS. THERE ARE VOQS WITH COMPLAINTS OF HARD STEERING AND LOSS OF STEERING CONTROL. THERE ARE ALSO SEVERAL FIELD REPORTS WITH COMPLAINTS OF STEERING PROBLEMS. TSB NUMBER 10020890 ADDRESSES POTENTIAL STEERING JUDDER AND VIBRATION DURING SLOW SPEED RIGHT HAND TURNS. RECALL 10V073000 ADDRESSES POTENTIAL LOSS OF POWER STEERING. THIS RECALL WAS ISSUED IN MARCH OF 2010, APPROXIMATELY FOUR MONTHS AFTER THIS CRASH. *RC

Print

Close



U.S. Department
of Transportation
**National Highway
Traffic Safety
Administration**

1200 New Jersey Avenue SE.
Washington, DC 20590

CERTIFIED MAIL
RETURN RECEIPT REQUESTED

February 15, 2011

Ms. Carmen Benavides
General Motors Corp.
Mail Code 480-210-2V1
30001 Van Dyke
Warren, MI 48090

NVS-217kb
DII11-005

Dear Ms. Benavides:

The Office of Defects Investigation (ODI) of the National Highway Traffic Safety Administration (NHTSA) has received information about certain death and injury incidents reported by General Motors Corp. (GM) in its light early warning report from 3rd quarter of 2010. We are writing to request additional information about the following incidents:

Selected Death and Injury Incidents	
For Reporting Category: L	
For the following Sequence IDs: 7, 8, 19, 20, 21, 23, 24, 50, 51, 68, 73, 83, 94, 113, 124, 136, 138, 147, 170, 172, 175, 177, 181, 183, 187, 191, 195, 197, 205, 225, 227, 274, 321, 323, 324, 327, 329, 369, 374, 375, 376, 377, 378, 379, 401, 418, 419, 437, 454, 455, 461, 468, 473, 474, 481, 483, 484, 487, 504, 511, 541, 560, 565, 570, 618, 619, 633	

Unless otherwise stated in the text, the following definitions apply to these information requests:

Incident: each incident identified in the above table.

Claim and Notice: shall have the meanings stated in 49 CFR §579.4(c). Claim and notice also specifically refer to the claim(s) and notice(s) that are the predicate for the early warning report on the incident.

Manufacturer: refers to GM.

Vehicle: the vehicle produced by GM that is identified in the claim or notice.

Tire: the tire produced by GM that is identified in the claim or notice.



Equipment: the item of motor vehicle equipment produced by GM that is identified in the claim or notice.

Defect: means any failure, malfunction, lack of durability, or other problem in performance, construction, a component, or material of a motor vehicle or piece of motor vehicle equipment.

Document: “Document(s)” is used in the broadest sense of the word and shall mean all written, typed, graphic and photographic matter whatsoever (except autopsy photographs), be it in original, copy or electronic form. Any photograph originally produced in color must be provided in color and in electronic form, if possible. Furnish all documents whether verified by GM or not. If a document is not in the English language, provide both the original document and an English translation of the document. Document(s) includes all documents in GM’s custody and/or control.

Please provide numbered responses to the following inquiries, repeating the applicable request verbatim before each response. After GM’s response to each request, identify the source of the information and indicate the last date the information was gathered. When documents are produced, the documents shall be produced in an identified, organized manner that corresponds to each pertinent information request. A separate response must be provided for each incident. Each response, document or attachment must be clearly identified with the incident Sequence ID (SeqID) number.

1. Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.
2. Provide a copy of the Police Accident Report.
3. At your option, provide GM’s assessment of the circumstances that led to the incident including GM’s analysis of the claim and/or notice regarding allegations of a defect.

If GM claims that any of the information or documents provided in response to this information request constitute confidential commercial material within the meaning of 5 U.S.C. § 552(b) (4), or are protected from disclosure pursuant to 18 U.S.C. § 1905, GM must submit supporting information together with the materials that are the subject of the confidentiality request, in accordance with 49 CFR Part 512, as amended (69 Fed. Reg. 21409 et seq; April 21, 2004), to the Office of Chief Counsel (NCC-110), National Highway Traffic Safety Administration, 1200 New Jersey Avenue, S.E., Washington, D.C. 20590. GM is required to submit two copies of the documents containing allegedly confidential information (except only one copy of blueprints) and one copy of the documents from which information claimed to be confidential has been deleted. Please remember that the words “CONFIDENTIAL BUSINESS INFORMATION” must appear at the top of each page containing information claimed to be confidential, and the information must be clearly

identified in accordance with 5 U.S.C. § 512.6. If you submit a request for confidentiality for all or part of your response to this letter, that is in an electronic format (e.g., CD-ROM), your request and associated submission must conform to the new requirements in NHTSA's Confidential Business Information Rule regarding submissions in electronic formats (49CRF 512.(c)). See Federal Register, volume 72, page 59434 (October 19, 2007).

Your response to this letter, together with a copy of any confidentiality request, must be submitted to this office by **March 18, 2011**. Please include in your response the identification codes referenced on page one of this letter. If you are unable to provide all of the information requested within the time allotted, you must request an extension from me at (202) 366-4238, no later than five business days before the response due date. If all of the information requested by the original deadline is unavailable, you must submit a partial response by the original deadline with whatever information then is available, even if an extension is granted.

If you have any technical questions concerning this matter, please contact Mr. Leo Yon at (202) 366-7028 or by fax at (202) 366-7882.

Sincerely,

A handwritten signature in black ink that reads "Christina Morgan". The script is cursive and fluid, with the first name "Christina" and last name "Morgan" clearly legible.

Christina Morgan, Chief
Early Warning Division
Office of Defects Investigation
Enforcement



GENERAL MOTORS LLC
Global Interior and Safety Center

March 17, 2011

MAR 18 2011

Ms. Christina Morgan, Chief
Early Warning Division, NVS-217
Office of Defects Investigation
National Highway Traffic Safety Administration
1200 New Jersey Ave., S.E.
Washington, DC 20590

NVS-217kb
DI11-005

Dear Ms. Morgan:

This is General Motors' (GM) response to your inquiry dated February 15, 2011 regarding certain death and injury incidents reported by GM in its light vehicle early warning report from the 3rd quarter of 2010.

GM's response is comprised of 68 disks for the incidents that are the subject of DI11-005.

Attachment "A" includes instructions for navigating the disk. Each disk, on its face, is identified by the NHTSA Sequence ID number, the Manufacturer's Unique ID number and the year, make and model of the vehicle involved in the incident, e.g., 7 316869715-696125 and 2010 BUICK ENCLAVE. When the disk is launched, this identification number appears again along with all of the documents on the disk (including photographs and videos, if applicable) listed under "Filename". The first document listed under Filename is an index with the Request and Responses, e.g., identified as 7 316869715-696125_00_Request and Responses. The index is numbered 1 through 3 to correspond to Inquiries 1 through 3, which are repeated verbatim below. The index also details whether any documents responsive to each inquiry were located.

For example, the Inquiry and Response in the index
for the disk are as follows:

DI11-005
7 316869715-696125
2010 BUICK ENCLAVE

Request for Information:

1. **Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.**



Response: See attached document.

2. Provide a copy of the Police Accident Report.

Response: See attached documents and photographs.

The remaining documents listed under Filename, reference the Manufacturer's Unique ID number along with the responsive Inquiry number. For example:

7 316869715-696125_01_001- is the first document responsive to Inquiry no.1.

7 316869715-696125_02_001- is the first document responsive to Inquiry no. 2.

Your inquiries and our corresponding replies are as follows:

1. Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.

Response: See attached document.

The table below lists the incident that is the subject of DI10-107, by Reporting Category, Sequence ID, VIN and type of notice received by GM (as "notice" is commonly used, not as it is defined by 49 C.F.R. §579.4(c)). Incidents reported on GM's Early Warning Report Death and Injury worksheet fall into four categories: Lawsuit (LIT), NISM (Not In Suit Matters), Product Allegation Resolution (PAR) or Rumor (RMR). Lawsuit and NISM case types generally meet the §579.4(c) definition of "claim". PAR cases, in this context, refer to customer contacts in which an injury or fatality is alleged to have occurred as a result of a product defect, and are accompanied by a writing that may or may not meet the §579.4(c) definition of "claim" or "notice". Rumor incidents do *not* involve a written or verbal, implied or express allegation of a defect by a customer. Rather, rumor cases generally refer to incidents that GM learned of through the media, which were subsequently investigated further.

(67 Vehicles from the Light Vehicle Template)		
SEQUENCE ID	VEHICLE IDENTIFICATION NUMBER (VIN)	TYPE
7	5GALRBED2AJ [REDACTED]	NISM
8	5GALRAEDXAJ [REDACTED]	NISM
19	1G4HD572X7U [REDACTED]	NISM
20	1G4HD57257U [REDACTED]	NISM
21	1G4HR57Y77U [REDACTED]	NISM
23	1G4HA5EM8AU [REDACTED]	NISM
24	1G4HC5EM3AU [REDACTED]	NISM
50	1G6DE5EG6A0 [REDACTED]	NISM
51	1G6DE5EY7B0 [REDACTED]	NISM
68	3GYFNFEY9AS [REDACTED]	NISM
73	3GNEC12097G [REDACTED]	LIT
83	KL1TD66638B [REDACTED]	NISM

SEQUENCE ID	VEHICLE IDENTIFICATION NUMBER (VIN)	TYPE
94	2G1FB1EV5A9	NISM
113	1G1AK15F567	NISM
124	1G1AK55F267	NISM
136	1G1AK15F967	NISM
138	1G1AL55F767	NISM
147	1G1AL15F277	PAR
170	1G1AL18F087	NISM
172	1G1AL58F887	NISM
175	1G1AK18F087	NISM
177	1G1AK18F987	NISM
181	1G1AK18H197	PAR
183	1G1AS18H397	NISM
187	1G1AT58H697	NISM
191	1G1AS58H297	NISM
195	1G1AB5F59A7	NISM
197	1G1AB5F57A7	NISM
205	1GTJTCDE1A8	NISM
225	2CNALDEW3A6	PAR
227	2CNALBEC0B6	NISM
274	2G1WA5EN4A1	NISM
321	1G1ZC5E05AF	NISM
323	1G1ZD5E7XAF	NISM
324	1G1ZA5E08AF	NISM
327	1G1ZE5EB4AF	NISM
329	1G1ZC5EU2BF	NISM
369	1GCEC290X9Z	RMR
374	1GCEK290X9Z	NISM
375	3GCRKSE31AG	NISM
376	3GCRKSE39AG	NISM
377	3GCXKTE29AG	NISM
378	1GCSKREA0AZ	NISM
379	1GCSKSEA2AZ	NISM
401	1GNUKKE32AR	NISM
418	1GNFK13017R	NISM
419	1GNFC13J97R	NISM
437	1GNDS13S052	LIT
454	1GNLRFEDXAS	PAR
455	1GNLVGED3AS	NISM
461	1GNDV33178D	LIT
468	1GNDV23E45D	NISM
473	1GKEV23738J	NISM
474	1GKEV23798J	NISM
481	1GKDS13SX52	NISM
483	1GKDT13S652	NISM
484	1GKDS13S652	NISM
487	1GKET63M672	NISM
504	1GTPKVE02AZ	PAR
511	1GKEC13T75R	LIT
541	1G2AL15F677	NISM

SEQUENCE ID	VEHICLE IDENTIFICATION NUMBER (VIN)	TYPE
560	1G2ZH36N874 [REDACTED]	NISM
565	1G2ZM177984 [REDACTED]	NISM
570	1G2ZG57N494 [REDACTED]	NISM
618	1G8AJ55F47Z [REDACTED]	NISM
619	1G8AN15F17Z [REDACTED]	NISM
633	3GSCL33P58S [REDACTED]	NISM

2. Provide a copy of the Police Accident Report.

Response: If available, see attached document(s) and photograph(s) on the enclosed disk(s).

3. At your option, provide GM's assessment of the circumstances that led to the incident including GM's analysis of the claim and/or notice regarding allegations of a defect.

Response: GM opts not to respond.

GM claims that certain information, in documents that are part of rumor, claim and lawsuit files maintained by the GM Legal Staff and its outside counsel, is attorney work product and/or privileged. That information includes notes, memos, reports, photographs and evaluations by attorneys (and by consultants, claims analysts, investigators and engineers working at the request of attorneys). GM is producing responsive documents from its rumor, claim and lawsuit files that are neither attorney work product nor privileged and withholding those that are attorney work product and/or privileged.

This response was compiled and prepared by this office upon review of documents retrieved by GM and does not include documents generated or received subsequent to the searches.

Please contact me at if you require further information.

Sincerely,




M. Carmen Benavides
Director, Product Investigations
and Safety Regulations

Enclosures: 68 Disks
Attachment A


Attachment A

Instructions for using Disk Viewer

1. Insert the disk into the disk ROM drive; the disk will open automatically.
2. Click the "Run JPegger" button on the pop up window.

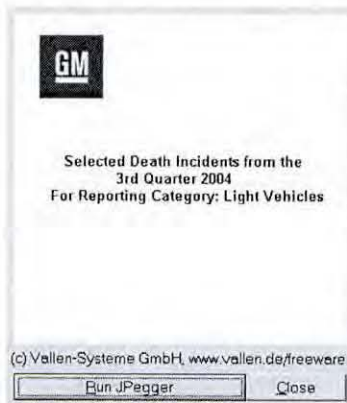

3. The program will launch in the browsing mode, which is shown in the image below.
4. You can use the down arrow key on your keyboard to browse through the images.

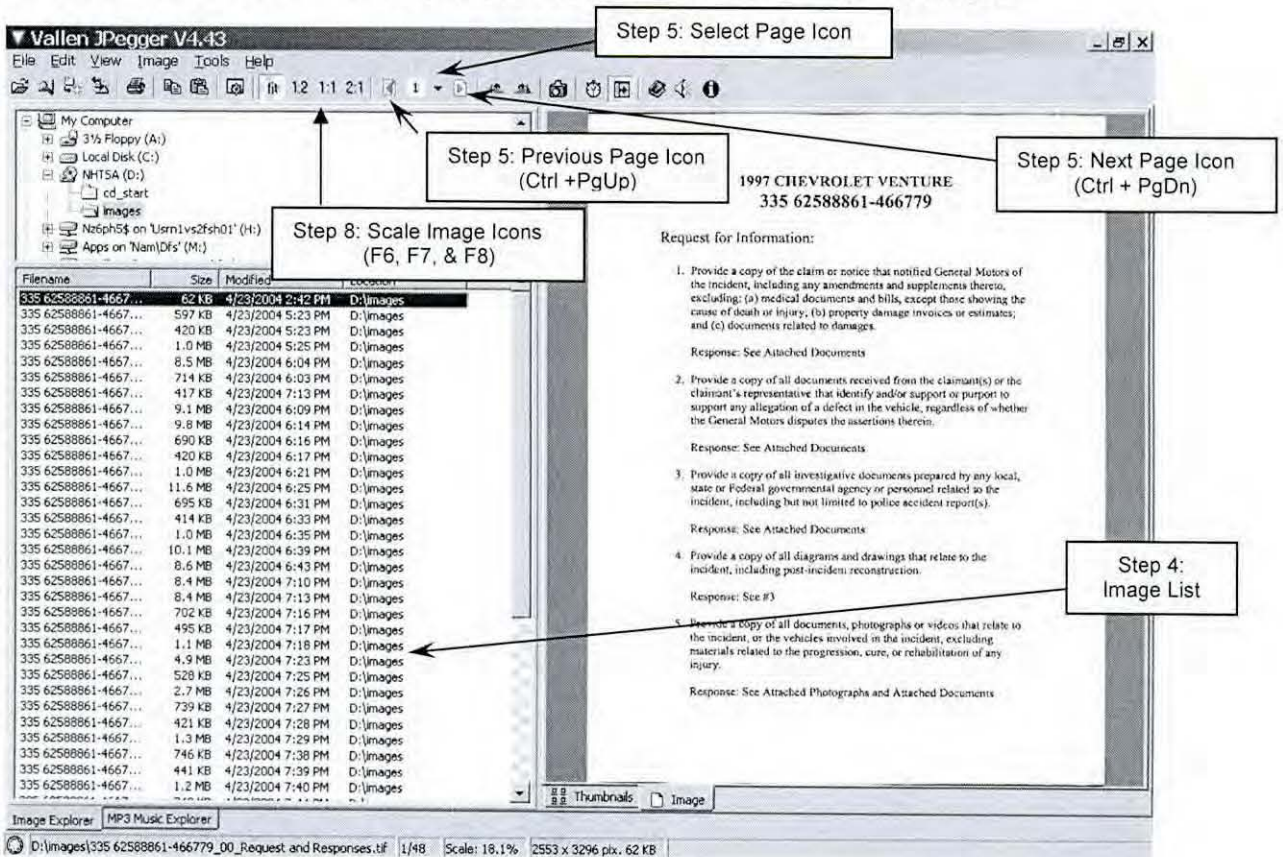

- Each image file may contain multiple pages. In the browsing mode use **Next Page Icon (Ctrl + PgDn)**, **Select Page Icon** or **Previous Page Icon (Ctrl + PgUp)** to browse through all of the pages within an image file. (Note: Some image files may contain up to 80 pages.)
- By double-clicking on an image from the file list, a slide show will initiate, however, it will not automatically advance through the pages. Use **Ctrl + PgDn** or **Ctrl + PgUp** to browse through all of the pages within an image file. Left-clicking on an image, while in the slide show mode, will advance to the first page of the next image file.
- Right click on the image to see the image properties, as shown below. Image properties can also be used to view each page within the documents (Next Page), or to view the next document within the file list (Next Image).
- If the image is difficult to view, the scale may be changed. Use **F5**, **F6**, **F7** and **F8** to alternate between scales that fit the screen, or are 50%, 100%, and 200% of the image's original size.

The screenshot shows a 'CIVIL CASE COVER SHEET' form for the case 'CARDONA V. CHEVROLET'. The form includes sections for case information, case type, and case details. A right-click context menu is open over the form, showing options for navigating between images and pages, as well as scaling the image.

Step 7: Next File (Image) points to the 'Next Image' button in the context menu.

Step 7: Next Page points to the 'Next page' button in the context menu.

Step 8: Scale Image points to the 'Fit Scale to fit', '1:2 Scale 50%', '1:1 Scale 100%', and '2:1 Scale 200%' options in the context menu.

Step 7: Image Properties points to the 'Properties...' button at the bottom of the context menu.

Form Details:

- ATTESTATION OF PARTY MEMBER ATTORNEY FILING:** ERIC D. PARIS, ESQ., S/B# 147936, LAW OFFICES OF ERIC D. PARIS & ASSOCIATES, 281 S. THOMAS STREET, SUITE 403, PUNAH, CALIFORNIA 91766. TELEPHONE NO. 909-469-5127. FAX NO. 909-469-5126.
- REPORT NAME OF COURT, JUDICIAL DISTRICT AND BRANCH COURT, IF ANY:** SUPERIOR COURT FOR THE STATE OF CALIFORNIA, INDIO COURT.
- CASE NAME:** CARDONA V. CHEVROLET
- CIVIL CASE COVER SHEET:** ☐ Limited, ☒ Unlimited.
- Complex Case Designation:** ☐ Counter, ☐ Joinder, ☐ Filed with first appearance by defendant (Cal. Rules of Court, rule 1811).
- Check one box below for the case type that best describes this case:**
 - ☒ Auto Tort (22)
 - ☐ Other PUPCWD (Personal Injury/Property Damage/Wrongful Death) Tort
 - ☐ Asbestos (34)
 - ☐ Product Liability (24)
 - ☐ Medical malpractice (45)
 - ☐ Other PUPCWD (23)
 - ☐ Non-PUPCWD (Other) Tort
 - ☐ Business tortious business practice (27)
 - ☐ Civil rights (e.g., discrimination, false arrest) (30)
 - ☐ Defamation (e.g., slander, libel) (13)
 - ☐ Fraud (16)
 - ☐ Intellectual property (15)
 - ☐ Professional negligence (e.g., legal malpractice) (25)
 - ☐ Other non-PUPCWD tort (25)
 - ☐ Employment
 - ☐ Wrongful termination (36)
 - ☐ Other employment (15)
 - ☐ Contract
 - ☐ Breach of contract/warranty (26)
 - ☐ Collateral (e.g., money award, open trial accounts) (28)
 - ☐ Insurance coverage (18)
 - ☐ Other contract (37)
 - ☐ Real Property
 - ☐ Endowed domain/inverse condemnation (14)
 - ☐ Wrongful eviction (33)
 - ☐ Other real property (e.g., quiet title) (20)
 - ☐ Unlawful Detainer
 - ☐ Commercial (21)
 - ☐ Residential (22)
 - ☐ Drugs (29)
 - ☐ Judicial Review
 - ☐ Asset forfeiture (26)
 - ☐ Petition for satisfaction award (11)
 - ☐ Use of mandamus (23)
 - ☐ Other judicial review (26)
 - ☐ Provisionally Complex Civil Litigation (Cal. Rules of Court, rules 1800-1812)
 - ☐ Arbitral/Trade regulation (23)
 - ☐ Construction defect (10)
 - ☐ Claims, wrongful death (25)
- 2. This case:** ☒ is, ☐ is not, complex under rule 1800 of the California Rules requiring exceptional judicial management.
 - ☒ Large number of separately represented parties
 - ☒ Extensive motion practice raising difficult or novel issues that will be time-consuming to resolve
 - ☒ Substantial amount of documentary evidence
 - ☒ Type of remedies sought (check all that apply):
 - ☒ monetary
 - ☐ nonmonetary, declaratory or injunctive relief
 - ☒ Large number of coordination in other counties
 - ☐ Substantial post
- 3. Type of remedies sought (check all that apply):** ☒ monetary, ☐ nonmonetary, declaratory or injunctive relief
- 4. Number of causes of action (specify):** FIVE
- 5. This case:** ☐ is, ☒ is not, a class action suit.
- Date:** JULY 3, 2003
- ERIC D. PARIS, ESQ., S/B# 147936** (TYPE OR PRINT NAME)
- NOTICE:** Plaintiff must file this cover sheet with the first paper filed in the action or proceeding (see under the Probate, Family, or Welfare and Institutions Code), (Cal. Rules of Court, rule 1800). This cover sheet is in addition to any cover sheet required by local court rule. If this case is complex under rule 1800 of the California Rules of Court, you must file other parties to the action or proceeding. Unless this is a complex case, this cover sheet shall be used for statistical purposes only.
- Form Approved for Mandatory Use:** Superior Courts of California, 888-282-1100 (Rev. January 1, 2005)

DI11-005
541 316870699 – 698202
2007 PONTIAC G5

Request for Information:

1. Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.

Response: See Attached Document.

2. Provide a copy of the Police Accident Report.

Response: See Attached Document.

3. At your option, provide GM's assessment of the circumstances that led to the incident including GM's analysis of the claim and/or notice regarding allegations of a defect.

Response: GM opts not to respond.

Service Request Detail

SR No.		Ref No.	Goodwill	No Goodwill Offered	BRC Type	PAR
Account		Site	GW SubType		Bus. Unit	BRC
Last Name		First Name	Approval	Not Initiated	Area	PAR
Daytime #		Evening #	UCC	Steering - Power Steering Pump /	Sub-Area	Initiate PAR- Injury
Address		City	Involved Dir	Patterson Incorporated	Safety	Yes
State	VA	ZipCd	Source	Phone	Updated	9/14/2010 06:18:06 PM
Serial #VIN	1G2AL15F677	Model Year	Priority	Medium License #	Owner	STEWARDE
Make	Pontiac	Warr. Start	Status	Open	Opened	9/13/2010 06:26:40 PM
Model	G5	Mileage	Sub-Status	Dissatisfied	Closed	
Abstract	(ESIS)Steering - Power Steering Pump / Brackets					
Customer Description	This is a BRC PAR File. Please do not Assume. Forward all inquiries to Debbie Stewart @ ext 31117					

Pre-PAR

PAR-Notifier	Incident Date/Time	Injuries: #	Other Veh	# People in Veh	Road Surface	Road Cond.	Fire Report#	Police Report#
Owner	12/13/2009 11:45:00 AM	Y	0	1	Asphalt	Wet	unknown	unknown
Driver Last Name	Driver First Name	Height	DOB	Disabilities				
		6'		None				
Insurance Agency Last Name	Insurance Agent First Name	Phone #	Insurance Agency					
unknown	Ellen	(800) 735-erte	Erie Insurance(Fry Insurance)					
Incident Loc	on Stony Point Rd off Rt 20 N in Albemore County				Incident Desc	My son was driving and going around a curve and lost control and hit a tree on the driver's door. It went in 24". He had his seatbelt on. Son passed away from blunt force trauma.		
Component	power steering				Damage Desc	totalled		
Vehicle Loc	unknown, Insurance took possession				Add'l Info	No repair estimate, unsure of veh speed		
Emgcy Svc Names	Holly Meed Rescue, Albemore County Police				Maint Loc	Independent		

PAR Detail

Collision	Y	Non Collision	Property Damage	N	Thermal Evt	N	Spec Equip	None	
Vehicle Speed			Weather Condition	raining			Prop Owner	N/A	Property Type N/A
Last Service Date	11/28/2009		Loc Last Service				Property Location	N/A	Prop Est Repair Cost \$0.00
Veh Est Repair Cost			Spec Equip Installer	N/A			Prop Damage Description	N/A	
Primary Veh Use	Personal		Inspection Type	Steering and Suspension Sys			Inspected By	Inspection Not Performed	Inspection Date/Time
Veh Damage Description	totalled						Explain Other	Forwarding to ESIS	

Service Request Detail

PAR Injuries

Last Name	First Name	DOB	Location	Seating Pos	Restraint Type
			Occupant of Owner's Vehicle	Driver	seatbelt
Injury Description	Medical Rpt#	Treatment Location	Treated By		
fatality	N/A	at the scene and medical examiner	EMS		
Street Address	City	State	Zip Code		
	Charlottesville	VA			

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/15/2010 10:19:51 AM	GARCIAJR	ESISBIOU	Escalation	ESIS - Fatalities	In Progress		Fatality - Insurance Involvement - ESIS

Contact Last Name	Contact First Name	Account	BAC Code
-------------------	--------------------	---------	----------

Comments
fatality

Erie Insurance
Ellen - claim rep
(800) 735-erie
unk claim #

Insurace company paid out on claim

Joe G/PAR/ATX

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/14/2010 06:16:25 PM	STEWARDE	STEWARDE	Scheduled Follow-up		Scheduled Alarm		ESIS

Contact Last Name	Contact First Name	Account	BAC Code
-------------------	--------------------	---------	----------

Comments

Check to see if ESIS picked up file

Debbie Stewart/PAR/ATX

Confidential Comments

Service Request Detail

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/14/2010 06:16:03 PM	STEWARDE	GARCIAJR	Notify CRM		Done	9/15/2010 10:19:27 AM	Forwarding to ESIS

Contact Last Name	Contact First Name	Account	BAC Code
-------------------	--------------------	---------	----------

Comments

Cust alleges power steering failure caused a collision.

Fatality

Insurance involvement-paid out claim

Forwarding to ESIS

Debbie Stewart/PAR/ATX

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/14/2010 06:14:49 PM	STEWARDE	STEWARDE	BRC PAR	Business Case	Done	9/14/2010 06:16:58 PM	Business Case

Contact Last Name	Contact First Name	Account	BAC Code
-------------------	--------------------	---------	----------

Comments

Cust alleges power steering failure caused a collision.

Fatality

Insurance involvement-paid out claim

Forwarding to ESIS

Debbie Stewart/PAR/ATX

Confidential Comments

Service Request Detail

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/14/2010 06:12:22 PM	STEWARDE	STEWARDE	Research		Done	9/14/2010 06:14:47 PM	Research VIN
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

VIN and CUST scan-no files

Recalls:

Product Safety Recall N100023 10023 LOSS OF POWER STEERING ASSIST - REPLACE ELECTRIC POWER STEERING MOTOR 03/18/2010 Open

branded title and warranty block

Research completed

Debbie Stewart/PAR/ATX

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/14/2010 05:30:26 PM	STEWARDE	STEWARDE	BRC PAR	Initial Contact-AVM	Done	9/14/2010 06:12:07 PM	Called FFOM Lindsay James @ 804-514-0994
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

FFOM Name:

This is Debbie calling from the GM Product Allegation Dept to make you aware of a file that was received in your area.

The request number is:

The Customer's name is:

The dealer involved is: Patterson Incorporated

Located in: Mount Airy, NC

The vehicle is a: 2007 Pontiac G5

With current mileage: 25,000

The last 8 digits of the VIN# are: 77

This involves: Cust alleges power steering failure caused a collision resulting in a fatality.

I will be forwarding this file to our Central Claims office, ESIS for further handling. This message is for informational purposes only, however if you do have any questions please feel free to give me a call at 866-790-5600 x31117.

Debbie Stewart/PAR/ATX

Confidential Comments

Service Request Detail

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/14/2010 05:29:44 PM	STEWARDE	STEWARDE	BRC PAR	Initial Contact- Dealer	Done	9/14/2010 05:30:24 PM	No call made
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

No Initial Contact required, Vehicle has not been to dealer in two years.

Debbie Stewart/PAR/ATX

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/14/2010 05:18:25 PM	STEWARDE	STEWARDE	Ownership Changed	Ownership Escalated to BRC	Done	9/14/2010 05:18:25 PM	Ownership Escalated to BRC
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/14/2010 04:31:07 PM	STEWARDE	STEWARDE	BRC PAR	Initial Contact- Phone	Done	9/14/2010 05:29:42 PM	Called
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

confirmed contact info and allegation

Cust sts: My son was driving and going around a curve and lost control and hit a tree on the driver's door. It went in 24". He had his seatbelt on. Son passed away from blunt force trauma.

The steering wheel was turned all the way to the left.

There was black ice in the area. It wasn't sunny and was cloudy.

An EMT came upon the accident right after it happened.

We heard on tv that there was possibly something wrong with power steering on these cars. We are looking for answers. Did GM know about this and not tell us?

Why didn't they notify us about the recall sooner?

The insurance picked up the car and took it. I don't have the claim# with me. I called the dlr to see if the police and insurance pulled the computer info. They didn't know.

If we don't get satisfactory answers I will sue GM.

CRS adv: I'm sorry this happened and appreciate you taking the time to contact GM. I will be forwarding your file to our Central Claims office for further handling.

Someone from that office will be in contact with you within 7 to 10 business days. Gave contact info and SR#.

Cust sts: Thank you

Debbie Stewart/PAR/ATX

Confidential Comments

Service Request Detail

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/14/2010 04:30:27 PM	STEWARDE	STEWARDE	BRC PAR	Acknowledgement	Done	9/14/2010 04:32:27 PM	Called Brenda
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

Crs Adv: This is Debbie calling from the GM Product Allegation Dept. I have received your file and do require further information. Do you have a moment to speak to me?

Cust sts: Yes

Continued in Initial

Debbie Stewart/PAR/ATX

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/14/2010 04:30:14 PM	STEWARDE	STEWARDE	BRC PAR	Case Assigned	Done	9/14/2010 04:30:29 PM	STEWARDE x 31117
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/14/2010 04:28:10 PM	STEWARDE	STEWARDE	Ownership Changed		Done	9/14/2010 04:28:10 PM	Service Request Ownership has changed FROM: ARANDEAL TO: STEWARDE
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

Confidential Comments

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/13/2010 08:43:05 PM	ARANDEAL	ARANDEAL	Scheduled Follow-up	Other	Done	9/14/2010 04:30:08 PM	#up
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

waiting for approval

Confidential Comments

Service Request Detail

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/13/2010 06:35:52 PM	ARANDEAL	BRCPARQ	Notify CRM	Other	Done	9/14/2010 04:29:21 PM	cust initiates PAR
Contact Last Name		Contact First Name		Account		BAC Code	

Comments

**Customer claims product failure caused death
**Cust receives notification for RC for her veh and stated that this RC killed her Son..
**Cust no longer owns the veh and would like GM to do something about it.

Alvin/ CAC/ Tier 1/ mia/ Level 0

Confidential Comments

Service Request Detail

Activities

Created	Created By	Assigned To	Activity Type	Activity Sub-Type	Status	Completed	Description
9/13/2010 06:26:43 PM	ARANDEAL	ARANDEAL	Inbound Call Customer	Complex Request	Done	9/13/2010 06:42:33 PM	Par- collision
Contact Last Name	Contact First Name	Account	BAC Code				

Comments

CUST STS:

- receive letter for RC 2007 pontiac G5
 - when did you first send out this recall notice to our customers
 - RC 10023
 - my son Died December 13 of 2009
 - what should I do regarding this, who should I contact to
 - GM has to admit that there is something wrong, it really is unfortunate
 - the veh was a total lost,
 - My son Died because of this RC and veh is totaled
- Customer claims vehicle was involved in a collision due to product failure.

CUST SKS:

- seeks assistance from GM regarding this issue

CRS ADV:

- feel so sorry about what happened.
- will document everything for your inconvenience
- will see if we would be able to get in touch with one of our department that can better assist you regarding this

Crs adv cust that this will be subject for review

crs will adv cust that wasnt able to transfer cust to dept. which handles her case, but cust is not answering on the other line, heard noises, cust is talking with somebody else for a long minute already

Alvin/ CAC/ Tier 1/ mta/ level 0

Confidential Comments

UCC Information

UCC Code	Symptom	Description
M30	Inoperative	Steering - Power Steering Pump / Brackets

 **Global Warranty**

Mr. GMVIS 2
September 15, 2010

Global Warranty Management: Main > Interface With Customer > View Vehicle Summary

INTERFACE WITH
CUSTOMER

View Vehicle Summary



This screen allows GMVIS users to view the Summary of Vehicle Information, Field Actions, Service Information, Applicable Warranties, Transaction History, Service Contract(s) if applicable, Warranty Block, Branded Title information and OnStar and XM Radio information (if applicable)

For this

View V

Vehicle Information

VIN 1G2AL15F677 Model 2AL37-2007 PONTIAC G5 COUPE
Service Contract No Branded Title Yes Warranty Block Yes PDI Status No
Order Type 70 - RETAIL - STOCK
Field Actions 1 Open

View V

View V

Comp

View V

Transa

Detail

View V

Inform

Required Field Actions

Open field actions are
highlighted

Type	Number	Original Nbr	Description	Release Date	Status
Product Safety Recall	N100023	10023	LOSS OF POWER STEERING ASSIST - REPLACE ELECTRIC POWER STEERING MOTOR	03/18/2010	Open

Branded Title

*The VIN information contained herein and information derived therefrom is the proprietary property of The Polk Company and is to be used only for the purpose of warranty verification and shall not be used for any other purpose whatsoever

Brand Description: JUNK

Date Branded: 05/01/2007

Title Number

Reported By VA

Reporting Source Code.

Effective Date 03/02/2010

Warranty Block

Code	Description	Effective Date
BT	BRANDED TITLE	03/02/2010
Block Transaction Types:		Blocked Labour Ops.
ZPDI		
ZPTI		
ZREG		
ZSCT		

Service Information

Vehicle has no current record of outstanding service information.

OnStar and XM Satellite Radio Information

Refer to Help page for details. For OnStar contact 888.ON.STAR1 (888.667.8271) and for XM Radio contact 877.GET.XMST (877.438.9677).

OnStar Equipped: N		OnStar Status: NA
XM Equipped: Y	XM Radio ID: DH9UK048	XM Status: Inactive
OnStar Vehicle Diagnostics: N		DMN Enabled: N

Applicable Warranties

Valid warranties are highlighted

Valid	Description	Warranty Add Date	Start Date	Effective Odometer	End Date	End Odometer
	Bumper to Bumper Limited Warranty	03/14/2010	04/19/2007	318 MI	04/19/2010	36,318 MI
	Corrosion Limited Warranty	03/14/2010	04/19/2007	318 MI	04/19/2013	100,318 MI
	Emission Select Component Ltd Wty	03/14/2010	04/19/2007	318 MI	04/19/2015	80,318 MI
	Powertrain Limited Warranty	03/14/2010	04/19/2007	318 MI	04/19/2012	100,318 MI

Service Contract

Vehicle has no current record of service contracts.


Transaction History[View Details](#)

Job Card Date	Job Card Number	Transaction Type	Transaction Adjustment	Labour Operation	Odometer Reading
07/15/2008	466501	ZREG—Regular Vehicle Transaction		K5225 - Control Assembly, Floor Shift - Replace	16,475 MI
07/31/2006	A27811	ZPDI—Pre-Delivery Inspection		Z7000 - Pre-Delivery Inspection - Base Time	0 MI

Global Warranty Management: Site Map

[Privacy Policy](#) | [Terms of Use](#)

© 2005 General Motors.



Mr. GMVIS 2

September 15, 2010

Global Warranty Management: Main > Interface With Customer > View Vehicle Build

INTERFACE WITH
CUSTOMER

View Vehicle Build



This screen allows GMVIS users to view the initial build information on the selected VIN including option codes with descriptions (where available)

For this

View V

Vehicle Information

VIN 1G2AL15F677

Model 2AL37-2007 PONTIAC G5 COUPE

Service Contract: No

Branded Title: Yes

Warranty Block: Yes

PDI Status: No

Order Type: 70 - RETAIL - STOCK

Field Actions: [Open](#)

View V

View V

Comp

View V

Transa

Detail

View V

Inform

Vehicle Build

Model 2AL37-2007 PONTIAC G5 COUPE

Order Number: KFFBQX

Gross Vehicle Weight: 1,732

Build Date: 07/31/2006

Build Plant: 7-

Option Codes

*GMVIS is not the definitive source of GM Vehicle RPO information and is intended for service reference only. Should there be any questions about the vehicle's original build or RPO information please refer to the original vehicle invoice or window sticker.

192 - EBONY

191 - EBONY

41U - BLACK

6AP - COMPUTER SELECTED SUSPENSION

7AP - COMPONENT FRT RH COMPUTER
SEL

8AB - COMPONENT RR LH COMPUT SEL SUS

9AB - COMPONENT RR RH COMPUT SEL
SUS

AK5 - DUAL FRONTAL AIR BAGS

AL0 - SENSOR INDICATOR INFLATABLE
RESTRAINT, FRT PASSCHILD PRESENCE
DETECTOR

AP9 - CONVENIENCE NET, CARGO

AR9 - SEATS, FRONT BUCKET, FULL
LEATHER

AU0 - REMOTE KEYLESS ENTRY

AU3 - POWER DOOR LOCKS

B34 - FLOOR MATS

B35 - REAR FLOOR MATS

B84 - BODY COLOR BODYSIDE MOLDING

C67 - AIR CONDITIONING

CF5 - POWER SUNROOF

DC4 - READING LMP5-1/S RR VIEW
MIRROR

DG7 - BODY COLOR POWER MIRRORS

FE1 - SUSPENSION SYSTEM, SOFT

FE9 - FEDERAL EMISSIONS

FY1 - AXLE RATIO 3.63

HJS - PARTS SPORT PKG

IP2 - TRIM INTERIOR DESIGN

JM4 - ANTILOCK BRAKE SYSTEM WITH TRACTION ASSIST

K34 - CRUISE CONTROL

K64 - 115 AMP GENERATOR

KA1 - HEATED DRIVER & RIGHT FRONT
PASSENGER SEATS

L61 - ENGINE, 2.2L DOHC 4 CYL

LOD - ASM PLT LORDSTOWN OHIO

MN5 - 4 SPEED AUTO TRANSMISSION

MX0 - TRANSMISSION, 4-SPD AUTOMATIC
TRACTION ASSIST

N11 - EXHAUST, STAINLESS-STEEL

N34 - 3 SPOKE LEATHER STEERING
WHEEL

NT7 - FED EMIS SYS, TIER 2

NW7 - TRACTION ASSIST	NZ0 - 16" MACHINE-FACED ALUMINUM WHLS
PCM - PREFERRED PACKAGE INCLUDES: *ANTILOCK BRAKE SYSTEM *BODYSIDE MOLDINGS *CONVENIENCE NET, TRUNK *CRUISE CONTROL	PCQ - PREMIUM PACKAGE INCLUDES: *LEATHER APPOINTED SEATS *DRIVER & FRONT PASSENGER HEATED SEATS
PDE - SUN AND SOUND PACKAGE INCLUDES: *POWER SUNROOF *AUDIO SYSTEM, HIGH PERFORMANCE WITH 7 PIONEER SPEAKERS	PDX - SPORT PACKAGE INCLUDES: *WHEELS, 16" ALUMINUM MACHINE FACED *CHROME EXHAUST TIP *FOG LAMPS *LEATHER WRAP STEERING WHEEL *LEATHER WRAP SHIFT KNOB *STEERING WHEEL RADIO CONTROLS
QLG - TIRE ALL P205/55R-89H BW	R6K - ONSTAR TURN-BY-TURN NAVIG AVAIL
R6P - PREMIUM PAINT	R7A - * G5 DIGITAL MIX INTRO OFFER INCLUDES NO- CHARGE XM W/12MOS SERVICE & 365 MUSIC DOWNLOADS
R9N - LEATHER SEAT TRIM	RE8 - UPGRADE ORNAMENTATION
ROO - ORDER FULFILLMENT TRACKING CODE	SLM - SALES STOCK ORDERS
T37 - LAMP FOG, DELUXE	T43 - SPOILER, REAR DECK LID
U2K - XM SATELLITE RADIO-SERVICE FEE EXTRA. 1ST 3 MONTHS INCL	UK3 - STEERING WHEEL W/RADIO CONTROLS
UQ3 - AUDIO SYSTEM, HIGH PERFORMANCE WITH 7 PIONEER SPEAKERS	US8 - AM/FM STEREO W/CD & MP3 PLAYER (REPLACES STD/OPD RADIO)
V73 - VEHICLE CERTIFICATION U.S.	VK3 - FRONT LICENSE PLATE BRACKET
VT7 - OWNERS MANUAL ENGLISH	VY7 - KNOB-SHIFTER LEVER, LEATHER


Added Option Codes

Vehicle has no current record of SAIO codes.

Global Warranty Management: Site Map

[Privacy Policy](#) | [Terms of Use](#)

© 2005 General Motors.



Mr. GMVIS 2

September 15, 2010

Global Warranty Management: Main > Interface With Customer > View Vehicle Component Summary

INTERFACE WITH
CUSTOMER

View Vehicle Component Summary

②

This screen allows GMVIS users to view the information on various major components added to the VIN selected during vehicle build.

For this

- View V

Vehicle Information

VIN 1G2AL15F677

Model: 2AL37-2007 PONTIAC G5 COUPE

Service Contract No

Branded Title Yes

Warranty Block Yes

PDI Status No

Order Type: 70 - RETAIL - STOCK

Field Actions [1 Open](#)

- View V

View V

- Comp

View V

- Trans

Detail

View V

Inform

Vehicle Component

Component Code: 10-ENGINE ASSEMBLY

Traceability 607261565

Source Plant T-CPC TONAWANDA, NEW YORK

Part / Number Broadcast: AWD

Date Scanned: 07/31/2006

Time Scanned: 07:41:00 Scan Station: 04

Component Code: 61-TRANSMISSION

Traceability 1U4A

Source Plant J-HYDRAMATIC WINDSOR, ONTARIO

Part / Number Broadcast: 7EHJ

Date Scanned: 07/31/2006

Time Scanned: 07:41:00 Scan Station: 04

Component Code: 74-ELECTRON BRAKE & TRACTION CTRL
MOD ASM

Traceability 1916G4301

Source Plant P-

Part / Number Broadcast:
7529

Date Scanned: 07/31/2006

Time Scanned: 08:55:00 Scan Station:
04Component Code: 86-ELECTRONIC CONTROL MODULE
(ECM)

Traceability 161610065

Source Plant 2-

Part / Number Broadcast:
YPCX

Date Scanned: 08/01/2006

Time Scanned: 00:28:00 Scan Station:
06

Component Code: 87-BODY CONTROL MODULE

Traceability A61620539

Source Plant R-

Part / Number Broadcast: 6911

Date Scanned: 08/01/2006

Time Scanned: 00:28:00 Scan Station: 04

Component Code: AB-IR-MODULE ASM-INFLATOR

Traceability 2A1980724

Source Plant M-MORTON-THIOKOL

Part / Number Broadcast: 6199

Date Scanned: 07/31/2006

Time Scanned: 08:35:00 Scan Station: 04

Component Code: AL-IR-MODULE ASM-I/P

Traceability G186D1029

Source Plant I-INLAND

Part / Number Broadcast: 5892

Date Scanned: 07/28/2006

Time Scanned: 23:14:00 Scan Station: 04

Component Code: BK-INTERNATIONAL TRANS. CONTROL
MODULE

Traceability 062040020

Source Plant K-

Part / Number Broadcast:
YHRL

Date Scanned: 08/01/2008

Time Scanned: 00:28:00 Scan Station:
04

Component Code: CB-SEQ NUM (FLEX) BODY ASM

Traceability: 0280558

Source Plant: -

Part / Number Broadcast: 1ZZ

Date Scanned: 07/26/2008

Time Scanned: 05:25:00 Scan Station:

Service Agent Installed Component

Vehicle has no current record of vehicle component.

Global Warranty Management: Site Map[Privacy Policy](#) | [Terms of Use](#)

© 2005 General Motors.



Mr. GMVIS 2

September 15, 2010

Global Warranty Management: Main > Interface With Customer > View Vehicle Transaction History Detail

INTERFACE WITH
CUSTOMER

View Vehicle Transaction History Detail



This screen allows GMVIS users to view the available information on individual transaction for the VIN selected.

For this

View V

Vehicle Information

VIN 1G2AL15F677

Model: 2AL37-2007 PONTIAC G5 COUPE

Service Contract No

Branded Title: Yes

Warranty Block Yes

PDI Status: No

Order Type: 70 - RETAIL - STOCK

Field Actions 1 Open

View V

View V

Compt

View V

Transa

Detail

View V

Inform

Job Card Date: 07/15/2008

Job Card Number: 466501

Repair Service Agent: 115660

Odometer Reading: 16,475 MI

HCM/MTE ASSOCIATES, INC.

Authorization Code.

100 MYERS DRIVE

CHARLOTTESVILLE VA 22901-1139

4349511000

Process Date

07/18/2008

Transaction Type:

ZREG---Regular Vehicle Transaction

Transaction Expense Category:

Customer Complaint Code

0000-Converted Claim

Job Card Line # 1

Transaction Adjustment:

Cause Code: 0000-Converted Claims

Labour Op K5225-Control Assembly, Floor Shift - Replace

Causal Part Number

-See other Parts and/or Nel Items

Line Total USD 165.57

Job Card Date: 07/31/2006

Job Card Number: A27811

Repair Service Agent: 115711

Odometer Reading 0 MI

PATTERSON INCORPORATED

Authorization Code.

538 N ANDY GRIFFITH PARKWAY

MOUNT AIRY NC 27030-2521

3367862181

Process Date

08/04/2006

Transaction Type:

ZPDI---Pre-Delivery Inspection

Transaction Expense Category:

Customer Complaint Code

0000-Converted Claim

Job Card Line # 1

Transaction Adjustment:

Cause Code: 0000-Converted Claims


Labour Op Z7000-Pre-Delivery Inspection - Base Time
Causal Part Number

Line Total: USD 71.50

Global Warranty Management: Site Map

[Privacy Policy](#) | [Terms of Use](#)

© 2005 General Motors.



Mr. GMVIS 2

September 15, 2010

Global Warranty Management: Main > Interface With Customer > View Vehicle Delivery Information

INTERFACE WITH
CUSTOMER

View Vehicle Delivery Information



This screen allows GMVIS users to view the available information for the selected VIN delivered to the Service Agent and the ultimate customer. Not all sections will be populated for all VINs.

For this

- View V

Vehicle Information

VIN 1G2AL15F677

Model: 2AL37-2007 PONTIAC G5 COUPE

Service Contract No

Branded Title: Yes

Warranty Block Yes

PDI Status: No

Order Type: 70 - RETAIL - STOCK

Field Actions [1 Open](#)

- View V

View V

Compt

View V

- Transa

Detail

- View V

Inform:

Invoice Information

Invoicing Service Agent 115711

PATTERSON INCORPORATED

538 N ANDY GRIFFITH PARKWAY

MOUNT AIRY NC 27030-2521 3367862181

Invoice Date: 07/31/2006

Ship to Information

Invoicing Service Agent 115711

PATTERSON INCORPORATED

538 N ANDY GRIFFITH PARKWAY

MOUNT AIRY NC 27030-2521 3367862181

Ship to Date: N/A

Delivery Information

Delivery Service Agent 115660

HCM/MTE ASSOCIATES, INC.

100 MYERS DRIVE

CHARLOTTESVILLE VA 22901-1139 4349511000

Delivery Date: 04/19/2007

Delivery Type: 010—INDIVIDUAL

Delivery Odometer: 318

In Service Information

Invoicing Service Agent

In Service Date: N/A

In Service Type: 0000

In Service Odometer: 0

Global Warranty Management, Site Map

[Privacy Policy](#) | [Terms of Use](#)

© 2005 General Motors

Revised Report

Fatal

Police Crash Report



Page 1 of 4

CRASH

Crash Date 12 13 2009 SUNDAY

MILITARY Time (24 hr clock) 1146

GPS Lat. 38.087573
County of Crash ALBEMARLE COUNTY

GPS Long. 78.398368

Official DMV Use

City of Town of

City or Town Name

Landmarks at Scene

2989

Location of Crash (route/street)

STONY POINT ROAD

Railroad Crossing ID no. (if within 120 ft.)

Local Case Number

A2009-11437

Mile Marker Number

Number of Vehicles

001

At Intersection With or 0.5 Miles Feet

N S E W

Location of Crash (route/street)

PROFFIT ROAD

VEHICLE # 1

DRIVER

Driver's Name (Last, First, Middle)

Address (Street and Number)

City CHARLOTTESVILLE

Birth Date Drivers License Number

Driver's Sex

Gender

State

VA

State

DL

CDL

Safety Equip. Used

Air Bag Ejected Date of Death

3 2 1 12 13 2009 1

Injury Type EMS Transport

Summons Issued As Result of Crash

Offenses Charged to Driver

VEHICLE

Vehicle Owner's Name (Last, First, Middle)

Same as Driver

Address (Street and Number)

City CHARLOTTESVILLE

Vehicle Year 2007 Vehicle Make Pontiac Vehicle Model G5

Disabled CMV Towed

Vehicle Plate Number

State

VA

Approximate Repair Cost 9000

VIN

Oversize

Cargo Spill

Name of Insurance Company (not agent)

Override

ERIE

Underwrite

Speed Before Crash

Speed Limit

Maximum Safe Speed

Under ALL Passengers Age Count Over

UNK 45 35 0 0 8-17 0 18-21 21 0

PASSENGER (only if injured or killed)

Name of Injured (Last, First, Middle)

EMS Transport

Date of Death

Position In/On Vehicle

Safety Equip. Used

Airbag Ejected

Injury Type

Birthdate

Gender

Name of Injured (Last, First, Middle)

EMS Transport

Date of Death

Position In/On Vehicle

Safety Equip. Used

Airbag Ejected

Injury Type

Birthdate

Gender

Name of Injured (Last, First, Middle)

EMS Transport

Date of Death

Position In/On Vehicle

Safety Equip. Used

Airbag Ejected

Injury Type

Birthdate

Gender

Codes

POSITION IN/ON VEHICLE

1. Driver
- 2-6. Passengers
7. Cargo Area
8. Riding/Hanging On Outside
- 9-98. All Other Passengers

SAFETY EQUIPMENT USED

1. Lap Belt Only
2. Shoulder Belt Only
3. Lap and Shoulder Belt
4. Child Restraint
5. Helmet
6. Other
7. Booster Seat
8. No Restraint Used
9. Not Applicable

AIRBAG

1. Deployed - Front
2. Not Deployed
3. Unavailable/Not Applicable
4. Keyed Off
5. Unknown
6. Deployed - Side
7. Deployed - Other (Knee, Air Belt, etc.)
8. Deployed - Combination

EJECTED FROM VEHICLE

1. Not Ejected
2. Partially Ejected
3. Totally Ejected

SUMMONS ISSUED AS A RESULT OF CRASH

1. Yes
2. No
3. Pending

INJURY TYPE

1. Dead Before Report Made
2. Visible Signs of Injury, as Bleeding Wound or Distorted Member or Had to be Carried From Scene.
3. Other Visible Injury, as Bruises, Abrasions, Swelling, Limping, etc.
4. No Visible Injury, but Complaint of Pain, or Momentary Unconsciousness.
5. No Injury (driver only)

Officer's Name (Last, First, Middle)

Badge or Code Number

Agency/Department Name and Code

Reviewing Officer

Report File Date

MPO MCCORMIC R

L 35

ALBEMARLE COUNTY PD/002

C. S. C. Hocking

12 13 2009

CRASH

Crash Date 12 13 2009 1146 MILITARY Time (24 hr clock): County of Crash ALBEMARLE COUNTY

City of
Town of

Local Case Number

DRIVER INFORMATION

Veh 1

Veh 1

Driver's Action

P1

1. No Improper Action
2. Exceeded Speed Limit
3. Exceeded Safe Speed But Not Speed Limit
4. Overtaking On Hill
5. Overtaking On Curve
6. Overtaking at Intersection
7. Improper Passing of School Bus
8. Cutting In
9. Other Improper Passing
10. Wrong Side of Road - Not Overtaking
11. Did Not Have Right-of-Way
12. Following Too Close
13. Fail to Signal or Improper Signal
14. Improper Turn - Wide Right Turn
15. Improper Turn - Cut Corner on Left Turn
16. Improper Turn From Wrong Lane
17. Other Improper Turn
18. Improper Backing
19. Improper Start From Parked Position
20. Disregarded Officer or Flagger
21. Disregarded Traffic Signal
22. Disregarded Stop or Yield Sign
23. Driver Distraction
24. Fail to Stop at Through Highway - No Sign
25. Drive Through Work Zone
26. Fail to Set Out Flares or Flags
27. Fail to Dim Headlights
28. Driving Without Lights
29. Improper Parking Location
30. Avoiding Pedestrian
31. Avoiding Other Vehicle
32. Avoiding Animal
33. Crowded Off Highway
34. Hit and Run
35. Car Ran Away - No Driver
36. Blinded by Headlights
37. Other
38. Avoiding Object In Roadway
39. Eluding Police
40. Fail to Maintain Proper Control
41. Improper Passing
42. Improper or Unsafe Lane Change
43. Over Correction

Condition of Driver Contributing to the Crash

P2

1. No Defects
2. Eyesight Defective
3. Hearing Defective
4. Other Body Defects
5. Illness
6. Fatigued
7. Apparently Asleep
8. Other
9. Unknown

Driver Vision Obscured

P3

1. Not Obscured
2. Rain, Snow, etc. on Windshield
3. Windshield Otherwise Obscured
4. Vision Obscured by Load on Vehicle
5. Trees, Crops, etc.
6. Building
7. Embankment
8. Sign or Signboard
9. Hillcrest
10. Parked Vehicle(s)
11. Moving Vehicle(s)
12. Sun or Headlight Glare
13. Other
14. Blind Spot
15. Smoke/Dust
16. Stopped Vehicle(s)

Type of Driver Distraction

P4

1. Looking at Roadside Incident
2. Driver Fatigue
3. Looking at Scenery
4. Passenger(s)
5. Radio/CD, etc.
6. Cell Phone
7. Eyes Not on Road
8. Daydreaming
9. Eating/Drinking
10. Adjusting Vehicle Controls
11. Other
12. Navigation Device

Drinking

P5

1. Had Not Been Drinking
2. Drinking - Obviously Drunk
3. Drinking - Ability Impaired
4. Drinking - Ability Not Impaired
5. Drinking - Not Known Whether Impaired
6. Unknown

Method of Alcohol Determination (by police)

P6

1. Blood
2. Breath
3. Refused
4. No Test

Drug Use

P7

1. Yes
2. No
3. Unknown

VEHICLE INFORMATION

Veh 1

Veh 1

Vehicle Maneuver

V1

1. Going Straight Ahead
2. Making Right Turn
3. Making Left Turn
4. Making U-Turn
5. Slowing or Stopping
6. Merging Into Traffic Lane
7. Starting From Parked Position
8. Stopped in Traffic Lane
9. Ran Off Road - Right
10. Ran Off Road - Left
11. Parked
12. Backing
13. Passing
14. Changing Lanes
15. Other
16. Entering Street From Parking Lot

Skidding Tire/Mark

V2

1. Before Application of Brakes
2. After Application of Brakes
3. Before and After Application of Brakes
4. No Visible Skid Mark/Tire Mark

Vehicle Body Type

V3

1. Passenger car
2. Truck - Pick-up/Passenger Truck
3. Van
4. Truck - Single Unit Truck (2-Axles)
5. Motor Home, Recreational Vehicle
6. Special Vehicle - Oversized Vehicle /Earthmoving Equipment
7. Bicycle
8. Moped
9. Motorcycle
10. Emergency Vehicle (Regardless of Vehicle Type)
11. Bus - School Bus
12. Bus - City Transit Bus/Private Owned Church Bus
13. Bus - Commercial Bus
14. Other (Scooter, Go-cart, Hoovers, Bookmobile, Golf Cart, etc.)
15. Special Vehicle - Farm Machinery
16. Special Vehicle - ATV
17. Special Vehicle - Low-Speed Vehicle
18. Truck - Sport Utility Vehicle (SUV)
19. Truck - Single Unit Truck (3 Axles or More)
20. Truck - Tractor/Tractor-Drawn Trailer

Vehicle Damage

V4

1. Unknown
2. No damage
3. Overturned
4. Motor
5. Undercarriage
6. Tinted
7. Fire
8. Other

Vehicle Condition

V5

1. No Defects
2. Lights Defective
3. Brakes Defective
4. Steering Defective
5. Puncture/Blowout
6. Worn or Slick Tires
7. Motor Trouble
8. Chains in Use
9. Other
10. Vehicle Altered
11. Mirrors Defective
12. Power Train Defective
13. Suspension Defective
14. Windows/Windshield Defective
15. Wipers Defective
16. Wheels Defective
17. Exhaust System

Special Function Motor Vehicle

V6

1. No Special Function
2. Taxi
3. School Bus (Public or Private)
4. Transit Bus
5. Intercity Bus
6. Charter Bus
7. Other Bus
8. Military
9. Police
10. Ambulance
11. Fire Truck
12. Tow Truck
13. Maintenance
14. Unknown

EMV in service

V7

1. Yes
2. No

Truck Cover

V8

1. Yes
2. No

Police Crash Report

Revised Report

CRASH

Crash Date 12 13 2008 MILITARY Time (24 hr clock) 1146 County of Crash ALBEMARLE COUNTYCity of
Town of

Local Case Number

CRASH INFORMATION

Location of First Harmful
Event in Relation to Roadway C1

- 1. On Roadway
- 2. Shoulder
- 3. Median
- 4. Roadside
- 5. Gore
- 6. Separator
- 7. In Parking Lane or Zone
- 8. Off Roadway, Location Unknown
- 9. Outside Right-of-Way

Weather Condition C2

- 1. No Adverse Condition (Clear/Cloudy)
- 2. Fog
- 3. Mist
- 4. Rain
- 5. Snow
- 6. Sleet/Hail
- 7. Smoke/Dust
- 8. Other
- 9. Blowing Sand, Soil, Dirt, or Snow
- 10. Severe Crosswinds

Light Conditions C3

- 1. Dawn
- 2. Daylight
- 3. Dusk
- 4. Darkness - Road Lighted
- 5. Darkness - Road Not Lighted
- 6. Darkness - Unknown Road Lighting
- 7. Unknown

Traffic Control Device C4

- 1. Yes - Working
- 2. Yes - Working and Obscured
- 3. Yes - Not Working
- 4. Yes - Not Working and Obscured
- 5. Yes - Missing
- 6. No Traffic Control Device Present

Traffic Control Type C5

- 1. No Traffic Control
- 2. Officer or Flagger
- 3. Traffic Signal
- 4. Stop Sign
- 5. Slow or Warning Sign
- 6. Traffic Lanes Marked
- 7. No Passing Lines
- 8. Yield Sign
- 9. One Way Road or Street
- 10. Railroad Crossing With Markings and Signs
- 11. Railroad Crossing With Signals
- 12. Railroad Crossing With Gate and Signals
- 13. Other
- 14. Pedestrian Crosswalk
- 15. Reduced Speed - School Zone
- 16. Reduced Speed - Work Zone
- 17. Highway Safety Corridor

Roadway Alignment C6

- 1. Straight - Level
- 2. Curve - Level
- 3. Grade - Straight
- 4. Grade - Curve
- 5. Hillcrest - Straight
- 6. Hillcrest - Curve
- 7. Dip - Straight
- 8. Dip - Curve
- 9. Other
- 10. On/Off Ramp

Roadway Surface Condition C7

- 1. Dry
- 2. Wet
- 3. Snowy
- 4. Icy
- 5. Muddy
- 6. Oil/Other Fluids
- 7. Other
- 8. Natural Debris
- 9. Water (Standing, Moving)
- 10. Slush
- 11. Sand, Dirt, Gravel

Roadway Surface Type C8

- 1. Concrete
- 2. Blacktop, Asphalt, Bituminous
- 3. Brick or Block
- 4. Slag, Gravel, Stone
- 5. Dirt
- 6. Other

Roadway Description C9

- 1. Two-Way, Not Divided
- 2. Two-Way, Divided, Unprotected Median
- 3. Two-Way, Divided, Positive Median Barrier
- 4. One-Way, Not Divided
- 5. Unknown

Roadway Defects C10

- 1. No Defects
- 2. Holes, Ruts, Bumps
- 3. Soft or Low Shoulder
- 4. Under Repair
- 5. Loose Material
- 6. Restricted Width
- 7. Slick Pavement
- 8. Roadway Obstructed
- 9. Other
- 10. Edge Pavement Drop Off

Relation to Roadway C11

Interchange Area:

- 1. Main-Line Roadway
- 2. Acceleration/Deceleration Lanes
- 3. Gore Area (Between Ramp and Highway Edgelines)
- 4. Collector/Distributor Road
- 5. On Entrance/Exit Ramp
- 6. Intersection at end of Ramp
- 7. Other location not listed above within an interchange area (median, shoulder and roadside)

Intersection Area:

- 1. Non-Intersection
- 2. Within Intersection
- 3. Intersection-Related - Within 150'
- 4. Intersection-Related - Outside 150'

Other Location:

- 1. Crossover Related
- 2. Driveway, Alley, Access - Related
- 3. Railway Grade Crossing
- 4. Other Crossing (Crossings for Bikes, School, etc.)

Intersection Type C12

- 1. Not at Intersection
- 2. Two Approaches
- 3. Three Approaches
- 4. Four Approaches
- 5. Five-Point, or more
- 6. Roundabout

Work Zone C13

- 1. Yes
- 2. No

Work Zone Workers Present C14

- 1. With Low Enforcement
- 2. With No Low Enforcement
- 3. No Workers Present

Work Zone Location C15

- 1. Advance Warning Area
- 2. Transition Area
- 3. Activity Area
- 4. Termination Area

Work Zone Type C16

- 1. Lane Closure
- 2. Lane Shift/Crossover
- 3. Work on Shoulder or Median
- 4. Interchange or Moving Work
- 5. Other

School Zone C17

- 1. Yes
- 2. Yes - With School Activity
- 3. No

Type of Collision C18

- 1. Rear End
- 2. Angle
- 3. Head On
- 4. Sideswipe - Same Direction
- 5. Sideswipe - Opposite Direction
- 6. Fixed Object in Road
- 7. Train
- 8. Non-Collision
- 9. Fixed Object - Off Road
- 10. Deer
- 11. Other Animal
- 12. Pedestrian
- 13. Bicyclist
- 14. Motorcycleist
- 15. Backed Into
- 16. Other

Police Crash Report

Revised Report CRASH

Crash Date: 12 13 2009
MILITARY Time (24 hr clock): 1145
County of Crash: ALBEMARLE COUNTY

City of
Town of

Local Case Number

CRASH DIAGRAM

VEHICLE # 1

Fill in Impact Area(s).
Initial Impact: 9

12
11 1
10 2
9 13 3
8 4
7 5


6
N
Veh Dir of Travel-N/S/E/W

VEHICLE #

Fill in Impact Area(s).
Initial Impact:

12
11 1
10 2
9 13 3
8 4
7 5
6

Veh Dir of Travel-N/S/E/W

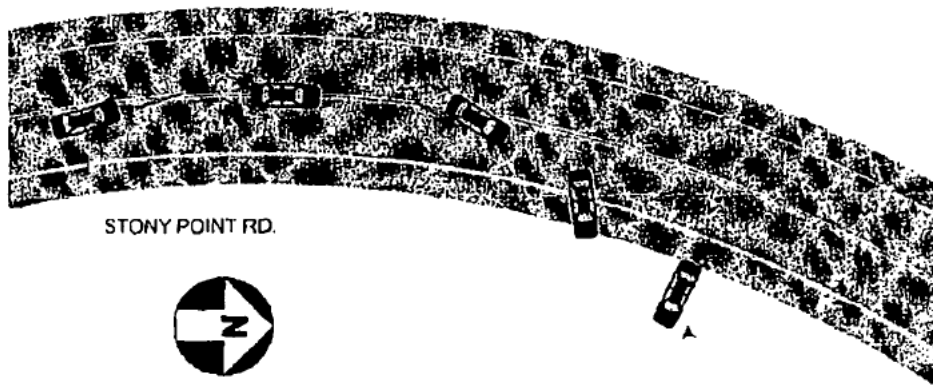

VEHICLE #

Fill in Impact Area(s).
Initial Impact:

12
11 1
10 2
9 13 3
8 4
7 5

Veh Dir of Travel-N/S/E/W

VEHICLE #

Fill in Impact Area(s).
Initial Impact:

12
11 1
10 2
9 13 3
8 4
7 5
6

Veh Dir of Travel-N/S/E/W

DAMAGE TO PROPERTY OTHER THAN VEHICLES

Appraiser Report Cost Object Street (Rte, Fence, etc.) Property Owners Name (Last, First, Middle)

Address (Street and Number)

VDOT Property

CRASH DESCRIPTION

VEHICLE #1 WAS NORTHBOUND ON STONY POINT ROAD. IN THE MIDDLE OF A RIGHT CURVE VEHICLE #1 CROSSED CENTERLINE. THE DRIVER ATTEMPTED TO STEER VEHICLE #1 BACK INTO THE CORRECT LANE. THE DRIVER LOST CONTROL OF THE VEHICLE AS IT SKIDDED BACK INTO THE NORTHBOUND LANE. VEHICLE #1 THEN LEFT THE ROADWAY ON THE RIGHT-SIDE STRIKING A TREE. THE TREE IMPACTED THE DRIVER-SIDE DOOR CAUSING SEVERE INTRUSION INTO THE PASSAGE COMPARTMENT. THE ACCIDENT OCCURRED IN BEAT #10. THE VEHICLE WAS TOWED BY CHARLOTTESVILLE WRECKER.

CRASH EVENTS

Vehicle #	First Event	Second Event	Third Event	Fourth Event	Most Harmful Event	Vehicle #	First Event	Second Event	Third Event	Fourth Event	Most Harmful Event
1	36	36	28	2	2						
Vehicle #	First Event	Second Event	Third Event	Fourth Event	Most Harmful Event	Vehicle #	First Event	Second Event	Third Event	Fourth Event	Most Harmful Event

First Harmful Event
of Vehicle Grade that
Results in First Injury
or Damage.

COLLISION WITH FIXED OBJECT

1. Bank Or Lodge
2. Trees
3. Utility Pole
4. Fence Or Post
5. Guard Rail
6. Parked Vehicle
7. Tunnel, Bridge, Underpass, Culvert, etc.
8. Sign, Traffic Signal
9. Impact Cushioning Device
10. Other
11. Jersey Wall
12. Building/Structure
13. Curb
14. ditch
15. Other Fixed Object
16. Other Traffic Barrier
17. Traffic Sign Support
18. Mailbox

COLLISION WITH PERSON, MOTOR VEHICLE OR NON-FIXED OBJECT

19. Pedestrian
20. Motor Vehicle In Transport
21. Train
22. Bicycle
23. Animal
24. Work Zone
25. Maintenance Equipment
26. Other Movable Object
27. Unknown Movable Object
28. Other

NON-COLLISION

28. Run Off Road
29. Jack Knife
30. Overturn (Rollover)
31. Downhill Runaway
32. Cargo Loss or Shift
33. Explosion or Fire
34. Separation of Units
35. Cross Median
36. Cross Centerline
37. Equipment Failure (Tire, etc)
38. Imagination
39. Fell/Jumped From Vehicle
40. Thrown or Falling Object
41. Non-Collision Unknown
42. Other Non-Collision

Police Crash Report

Revised Report

CRASH

Crash Date 12 13 2009
City of Albemarle
Location of Crash (route/street)

Day of Week
MILITARY Time (24 hr clock) 1146
County of Crash ALBEMARLE
Landmarks at Scene

GPS Lat.

GPS Long.

Official DMV Use

Railroad Crossing ID no. (if within 150 ft.)

Local Case Number

At Intersection With or _____ Miles East of _____
N S E W

Location of Crash (route/street)

Mile Marker Number

Number of Vehicles

VEHICLE

VEHICLE

DRIVER

Driver's Name (Last, First, Middle)

Driver Fled Scene

Gender

DRIVER

Driver's Name (Last, First, Middle)

Driver Fled Scene

Gender

Address (Street and Number)

Address (Street and Number)

City

State ZIP

City

State ZIP

Birth Date

Drivers License Number

State DL CDL

Birth Date

Drivers License Number

State DL CDL

Safety Equip. Used Air Bag Ejected Date of Death

Injury Type EMS Transport

Safety Equip. Used Air Bag Ejected Date of Death

Injury Type EMS Transport

Summons Issued As Result of Crash

Offenses Charged to Driver

Summons Issued As Result of Crash

Offenses Charged to Driver

VEHICLE

Vehicle Owner's Name (Last, First, Middle)

Same as Driver

VEHICLE

Vehicle Owner's Name (Last, First, Middle)

Same as Driver

Address (Street and Number)

Address (Street and Number)

City

State ZIP

City

State ZIP

Vehicle Year Vehicle Make Vehicle Model

Disabled CMV Towed

Vehicle Year Vehicle Make Vehicle Model

Disabled CMV Towed

Vehicle Plate Number

State Approximate Repair Cost

Vehicle Plate Number

State Approximate Repair Cost

VIN

Oversize Cargo Spill

VIN

Oversize Cargo Spill

Name of Insurance Company (not agent)

Override Underwrite

Name of Insurance Company (not agent)

Override Underwrite

Speed Before Crash Speed Limit Maximum Safe Speed Under 8 ALL Passengers Age Count Over 21

Speed Before Crash Speed Limit Maximum Safe Speed Under 8 ALL Passengers Age Count Over 21

PASSENGER (only if injured or killed)

Name of Injured (Last, First, Middle) EMS Transport Date of Death

PASSENGER (only if injured or killed)

Name of Injured (Last, First, Middle) EMS Transport Date of Death

Position In/On Vehicle Safety Equip Used Airbag Ejected Injury Type Birthdate Gender

Name of Injured (Last, First, Middle) EMS Transport Date of Death

Position In/On Vehicle Safety Equip Used Airbag Ejected Injury Type Birthdate Gender

Name of Injured (Last, First, Middle) EMS Transport Date of Death

Position In/On Vehicle Safety Equip Used Airbag Ejected Injury Type Birthdate Gender

Name of Injured (Last, First, Middle) EMS Transport Date of Death

Position In/On Vehicle Safety Equip Used Airbag Ejected Injury Type Birthdate Gender

Name of Injured (Last, First, Middle) EMS Transport Date of Death

Position In/On Vehicle Safety Equip Used Airbag Ejected Injury Type Birthdate Gender

Codes

POSITION IN/ON VEHICLE
1. Driver
2-6. Passengers
7. Cargo Area
8. Riding/Hanging On Outside
9-98. All Other Passengers

SAFETY EQUIPMENT USED
1. Lap Belt Only
2. Shoulder Belt Only
3. Lap and Shoulder Belt
4. Child Restraint
5. Helmet
6. Other
7. Booster Seat
8. No Restraint Used
9. Not Applicable

AIRBAG
1. Deployed - Front
2. Not Deployed
3. Unavailable/Not Applicable
4. Koyod Off
5. Unknown
6. Deployed - Side
7. Deployed - Other (Knee, Air Bolt, etc.)
8. Deployed - Combination

EJECTED FROM VEHICLE
1. Not Ejected
2. Partially Ejected
3. Totally Ejected
SUMMONS ISSUED AS A RESULT OF CRASH
1. Yes
2. No
3. Pending

INJURY TYPE
1. Dead Before Report Made
2. Visible Signs of Injury, as Bleeding Wound or Distorted Member or Had to be Carried From Scene.
3. Other Visible Injury, as Bruises, Abrasions, Swelling, Limping, etc.
4. No Visible Injury, But Complaint of Pain, or Momentary Unconsciousness.
5. No Injury (driver only)

Investigating Officer

Badge/Code Number

Agency/Department Name and Code

Referring Officer

Report File Date

RL McCormick

85

ALBEMARLE CO. PD 002

Revised Report

Police Crash Report

Page 2 of 4

CRASH

Crash Date 12/13/2009 11:46 AM County of Crash ARLING

City of
Town of

Local Case Number

DRIVER INFORMATION

VEHICLE INFORMATION

Veh

Veh

Veh

Veh

Driver's Action P1

1. No Improper Action
2. Exceeded Speed Limit
3. Exceeded Safe Speed But Not Speed Limit
4. Overtaking On Hill
5. Overtaking On Curve
6. Overtaking at Intersection
7. Improper Passing of School Bus
8. Cutting In
9. Other Improper Passing
10. Wrong Side of Road - Not Overtaking
11. Did Not Have Right-of-Way
12. Following Too Close
13. Fell to Signal or Improper Signal
14. Improper Turn - Wide Right Turn
15. Improper Turn - Cut Corner on Left Turn
16. Improper Turn From Wrong Lane
17. Other Improper Turn
18. Improper Backing
19. Improper Start From Parked Position
20. Disregarded Officer or Flagger
21. Disregarded Traffic Signal
22. Disregarded Stop or Yield Sign
23. Driver Distraction
24. Failed to Stop at Through Highway - No Sign
25. Drive Through Work Zone
26. Failed to Set Out Flares or Flags
27. Failed to Dim Headlights
28. Driving Without Lights
29. Improper Parking Location
30. Avoiding Pedestrian
31. Avoiding Other Vehicle
32. Avoiding Animal
33. Crowded Off Highway
34. Hit and Run
35. Car Bore Away - No Driver
36. Blinded by Headlights
37. Other
38. Avoiding Object in Roadway
39. Eluding Police
40. Failed to Maintain Proper Control
41. Improper Passing
42. Improper or Unsafe Lane Change
43. Over Connection

Condition of Driver Contributing to the Crash P2

1. No Defects
2. Eyesight Defective
3. Hearing Defective
4. Other Body Defects
5. Illness
6. Fatigued
7. Apparently Asleep
8. Other
9. Unknown

Driver Vision Obscured P3

1. Not Obscured
2. Rain, Snow, etc. on Windshield
3. Windshield Otherwise Obscured
4. Vision Obscured by Load on Vehicle
5. Trees, Crops, etc.
6. Building
7. Embankment
8. Sign or Signboard
9. Hillcrest
10. Parked Vehicle(s)
11. Moving Vehicle(s)
12. Sun or Headlight Glare
13. Other
14. Blind Spot
15. Smoke/Dust
16. Stopped Vehicle(s)

Type of Driver Distractions P4

1. Looking at Roadside Incident
2. Driver Fatigue
3. Looking at Scenery
4. Passenger(s)
5. Radio/CD, etc.
6. Cell Phone
7. Eyes Not on Road
8. Daydreaming
9. Eating/Drinking
10. Adjusting Vehicle Controls
11. Other
12. Navigation Device

Drinking P5

1. Had Not Been Drinking
2. Drinking - Obviously Drunk
3. Drinking - Ability Impaired
4. Drinking - Ability Not Impaired
5. Drinking - Not Known Whether Impaired
6. Unknown

Method of Alcohol Determination (by police) P6

1. Blood
2. Breath
3. Refused
4. No Test

Drug Use P7

1. Yes
2. No
3. Unknown

Vehicle Maneuver V1

1. Going Straight Ahead
2. Making Right Turn
3. Making Left Turn
4. Making U-Turn
5. Slowing or Stopping
6. Merging Into Traffic Lane
7. Starting From Parked Position
8. Stopped in Traffic Lane
9. Ran Off Road - Right
10. Ran Off Road - Left
11. Parked
12. Backing
13. Passing
14. Changing Lanes
15. Other
16. Entering Street From Parking Lot

Skidding Tire/Mark V2

1. Before Application of Brakes
2. After Application of Brakes
3. Before and After Application of Brakes
4. No Visible Skid Mark/Tire Mark

Vehicle Body Type V3

1. Passenger car
2. Truck - Pick-up/Passenger Truck
3. Van
4. Truck - Single Unit Truck (2-Axles)
5. Motor Home, Recreational Vehicle
6. Special Vehicle - Oversized Vehicle/Earthmover/Road Equipment
7. Bicycle
8. Moped
9. Motorcycle
10. Emergency Vehicle (Regardless of Vehicle Type)
11. Bus - School Bus
12. Bus - City Transit Bus/Private Owned Church Bus
13. Bus - Commercial Bus
14. Other (Scooter, Go-cart, Horse, Bookmobile, Golf Cart, etc.)
15. Special Vehicle - Farm Machinery
16. Special Vehicle - ATV
17. Special Vehicle - Low-Speed Vehicle
18. Truck - Sport Utility Vehicle (SUV)
19. Truck - Single Unit Truck (3 Axles or More)
20. Truck - Truck Tractor (Ballast-No Trailer)

Vehicle Damage V4

1. Unknown
2. No damage
3. Overturned
4. Motor
5. Undercarriage
6. Totaled
7. Fire
8. Other

Vehicle Condition V5

1. No Defects
2. Lights Defective
3. Brakes Defective
4. Steering Defective
5. Puncture/Blowout
6. Worn or Slick Tires
7. Motor Trouble
8. Chains In Use
9. Other
10. Vehicle Altered
11. Mirrors Defective
12. Power Train Defective
13. Suspension Defective
14. Windows/Windshield Defective
15. Wipers Defective
16. Windows Defective
17. Exhaust System

Special Function Motor Vehicle V6

1. No Special Function
2. Taxi
3. School Bus (Public or Private)
4. Transit Bus
5. Intercity Bus
6. Charter Bus
7. Other Bus
8. Military
9. Police
10. Ambulance
11. Fire Truck
12. Tow Truck
13. Maintenance
14. Unknown

EMV in service V7

1. Yes
2. No

Truck Cover V8

1. Yes
2. No

Officer Initial RLL Sadge: 35

Commonwealth of Virginia - Department of Motor Vehicles

Police Crash Report

FR300P (Rev 7/07)

Revised Report

Page 3 of 4

CRASH

Crash Date 12/13/2009 MILITARY Time (24 hr clock) 1146 County of Crash ALSEMARLECity of
Town of

Local Case Number

CRASH INFORMATION

Location of First Harmful Event In Relation to Roadway	C1	Traffic Control Type	C5	Roadway Description	C9	Intersection Type	C12
1. On Roadway		1. No Traffic Control		1. Two-Way, Not Divided		1. Not at Intersection	
2. Shoulder		2. Officer or Flagger		2. Two-Way, Divided, Unprotected Median		2. Two Approaches	
3. Median		3. Traffic Signal		3. Two-Way, Divided, Positive Median Barrier		3. Three Approaches	
4. Roadside		4. Stop Sign		4. One-Way, Not Divided		4. Four Approaches	
5. Gore		5. Slow or Warning Sign		5. Unknown		5. Five-Point, or more	
6. Separator		6. Traffic Lanes Marked				6. Roundabout	
7. In Parking Lane or Zone		7. No Passing Lines					
8. Off Roadway, Location Unknown		8. Yield Sign					
9. Outside Right-of-Way		9. One Way Road or Street				Work Zone Related	C13
		10. Railroad Crossing With Markings and Signs		Roadway Defects	C10	1. Yes	
		11. Railroad Crossing With Signals		1. No Defects		2. No	
		12. Railroad Crossing With Gate and Signals		2. Holes, Ruts, Bumps			
		13. Other		3. Soft or Low Shoulder		Work Zone Workers Present	C14
		14. Pedestrian Crosswalk		4. Under Repair		1. With Law Enforcement	
		15. Reduced Speed - School Zone		5. Loose Material		2. With No Law Enforcement	
		16. Reduced Speed - Work Zone		6. Restricted Width		3. No Workers Present	
		17. Highway Safety Corridor		7. Slick Pavement			
Weather Condition	C2	Roadway Alignment	C6	8. Roadway Obstructed		Work Zone Location	C15
1. No Adverse Condition (Clear/Cloudy)		1. Straight - Level		9. Other		1. Advance Warning Area	
2. Fog		2. Curve - Level		10. Edge Pavement Drop Off		2. Transition Area	
3. Mist		3. Grade - Straight				3. Activity Area	
4. Rain		4. Grade - Curve				4. Termination Area	
5. Sleet		5. Hillcrest - Straight					
6. Snow		6. Hillcrest - Curve		Relation to Roadway	C11	Work Zone Type	C16
7. Sleet/Hail		7. Dip - Straight		Interchange Area:		1. Lane Closure	
8. Smoke/Dust		8. Dip - Curve		1. Main-Line Roadway		2. Lane Shift/Crossover	
9. Other		9. Other		2. Acceleration/Deceleration Lanes		3. Work on Shoulder or Median	
10. Blowing Sand, Soil, Dirt, or Snow		10. On/Off Ramp		3. Gore Area (Between Ramp and Highway Edgelines)		4. Intermittent or Moving Work	
11. Severe Crosswinds				4. Collector/Distributor Road		5. Other	
Light Conditions	C3	Roadway Surface Condition	C7	5. On Entrance/Exit Ramp		School Zone	C17
1. Dawn		1. Dry		6. Intersection at end of Ramp		1. Yes	
2. Daylight		2. Wet		7. Other location not listed above within an interchange area (median, shoulder and roadside)		2. Yes - With School Activity	
3. Dusk		3. Snowy				3. No	
4. Darkness - Road Lighted		4. Icy		Intersection Area:			
5. Darkness - Road Not Lighted		5. Muddy		8. Non-Intersection		Type of Collision	C18
6. Darkness - Unknown Road Lighting		6. Oil/Other Fluids		9. Within Intersection		1. Rear End	
7. Unknown		7. Other		10. Intersection-Related - Within 150'		2. Angle	
		8. Natural Debris		11. Intersection-Related - Outside 150'		3. Head On	
		9. Water (Standing, Moving)				4. Sideswipe - Same Direction	
		10. Slush		Other Location:		5. Sideswipe - Opposite Direction	
		11. Sand, Dirt, Gravel		12. Crossover Related		6. Fixed Object in Road	
Traffic Control Mechanical Device	C4	Roadway Surface Type	C8	13. Driveway, Alley-Access - Related		7. Train	
1. Yes - Working		1. Concrete		14. Railway Grade Crossing		8. Non-Collision	
2. Yes - Working and Obscured		2. Blacktop, Asphalt, Bituminous		15. Other Crossing (Crossings for Bikes, School, etc.)		9. Fixed Object - Off Road	
3. Yes - Not Working		3. Brick or Block				10. Deer	
4. Yes - Not Working and Obscured		4. Clay, Gravel, Stone				11. Other Animal	
5. Yes - Missing		5. Dirt				12. Pedestrian	
6. No Traffic Control Device Present		6. Other				13. Bicyclist	
						14. Motorcyclist	
						15. Backed into	
						16. Other	

Unitor Initials AA Badge # 33

Commonwealth of Virginia - Department of Motor Vehicles

Police Crash Report

FR300P (Rev 7/07)

Revised Report ☒

Page 4 of 4

CRASH

Crash ☒ IMITARY Time (24 hr clock) 1146 County of Crash ALBEMARLE

Date 12/13/2009


City of
Town of

Local Case Number

CRASH DIAGRAM

VEHICLE #


Fill in Impact Area(s).
Initial Impact.

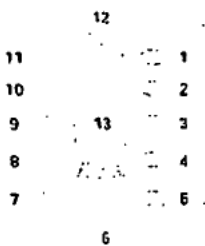

Veh Dir of Travel-N/S/E/W

VEHICLE #

Fill in Impact Area(s).
Initial Impact.

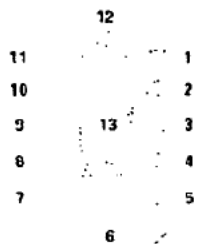

Veh Dir of Travel-N/S/E/W

VEHICLE #


Fill in Impact Area(s).
Initial Impact.



Veh Dir of Travel-N/S/E/W

VEHICLE #

Fill in Impact Area(s).
Initial Impact.

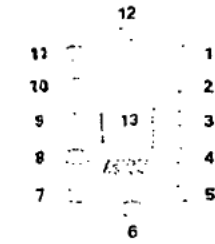

Veh Dir of Travel-N/S/E/W

Indicate North
by Arrow

DAMAGE TO PROPERTY OTHER THAN VEHICLES

Approx. Repair Cost Object Struck (Tree, Fence, etc.) Property Owners Name (Last, First, Middle)

Address (Street and Number)

VOOT Property

CRASH DESCRIPTION

CRASH EVENTS

Vehicle #	First Event	Second Event	Third Event	Fourth Event	Most Harmful Event
<u> </u>	<u> </u>	<u> </u>	<u> </u>	<u> </u>	<u> </u>
Vehicle #	First Event	Second Event	Third Event	Fourth Event	Most Harmful Event
<u> </u>	<u> </u>	<u> </u>	<u> </u>	<u> </u>	<u> </u>

First Harmful Event
of Entire Crash that
Results in First Injury
or Damage.

COLLISION WITH FIXED OBJECT

1. Bank Or Ledger
2. Tree
3. Utility Pole
4. Fence Or Post
5. Guard Rail
6. Parked Vehicle
7. Tunnel, Bridge, Underpass, Culvert, etc.
8. Sign, Traffic Signal
9. Impact Cushioning Device
10. Other
11. Jersey Wall
12. Building/Structure
13. Curb
14. Ditch
15. Other Fixed Object
16. Other Traffic Barrier
17. Traffic Sign Support
18. Mailbox

COLLISION WITH PERSON, MOTOR VEHICLE OR NON-FIXED OBJECT

19. Pedestrian
20. Motor Vehicle In Transport
21. Train
22. Bicycle
23. Animal
24. Work Zone
25. Maintenance Equipment
26. Other Movable Object
27. Other

NON-COLLISION

28. Ran Off Road
29. Jack Knife
30. Overturn (Rollover)
31. Newhill Runaway
32. Cargo Loss or Shift
33. Explosion or Fire
34. Separation of Units
35. Cross Median
36. Cross Centerline
37. Equipment Failure (Tire, etc)
38. Immersion
39. Fall/Jumped From Vehicle
40. Thrown or Falling Object
41. Non-Collision Unknown
42. Other Non-Collision

TA000111921