


## EWR D&I ANNOTATION

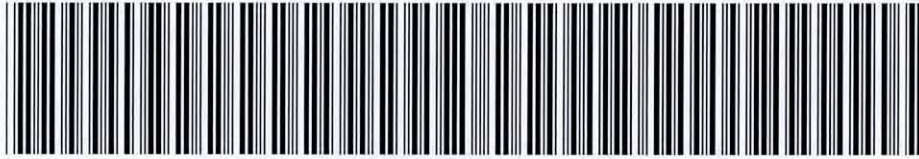

FAN-000001L123001DP492-9895

**Artemis # :** 000001L123001DP492**Record Created Date :** 06/19/2013**Printed Date :** 06/19/2013**Description :**

DI12-108. SEQUENCE ID 492. QUARTER 3. 2006 SATURN ION. 1 INJURY. THIS RESPONSE INCLUDES SERVICE REQUEST DETAIL DOCUMENTS AND CRASH DATA RETRIEVAL DOCUMENTS. ACCORDING TO THE SERVICE REQUEST DOCUMENTS, THE DRIVER OF THE SUBJECT VEHICLE TURNED THE CORNER AT AN INTERSECTION GOING ABOUT 40 MPH AND THERE WAS A VEHICLE IN FRONT OF THE SUBJECT VEHICLE GOING ABOUT 20 MPH. THE SUBJECT VEHICLE MOVED INTO THE LEFT LANE TO GO AROUND THE OTHER VEHICLE. THE DRIVER OF THE OTHER VEHICLE (A TRUCK) STOPPED ABRUPTLY. WHEN THE DRIVER OF THE OTHER VEHICLE STOPPED, THE SUBJECT VEHICLE RAN INTO IT. THE SUBJECT VEHICLE'S AIRBAG DID NOT DEPLOY. THE WEATHER WAS NOTED AS WARM. THE ROAD CONDITION WAS NOTED AS DRY. THE DRIVER REPORTED A NECK AND SHOULDER SPRAIN. THERE ARE SEVERAL FIELD REPORTS IN ARTEMIS RELATED TO AIRBAG NON DEPLOYMENT IN THIS MODEL YEAR VEHICLE. THE FOLLOWING COMPLAINTS CAN BE FOUND IN ARTEMIS RELATED AIRBAG NON DEPLOYMENT IN THIS MODEL YEAR VEHICLE: 10497828, 10349343, 10286648, 10266873, 10253290, 10229360, 10184279. \*TGW

Print

Close



U.S. Department  
of Transportation  
**National Highway  
Traffic Safety  
Administration**

1200 New Jersey Avenue SE  
Washington, DC 20590

**CERTIFIED MAIL**  
**RETURN RECEIPT REQUESTED**

**December 19, 2012**

Ms. Carmen Benavides  
General Motors Corp.  
Mail Code 480-210-2V1  
30001 Van Dyke  
Warren, MI 48090

NVS-217kb  
DI12-108

Dear Ms. Benavides:

The Office of Defects Investigation (ODI) of the National Highway Traffic Safety Administration (NHTSA) has received information about certain death and injury incidents reported by General Motors Corp. (GM) in its light early warning report from 3<sup>rd</sup> quarter of 2012. We are writing to request additional information about the following incidents:

| Selected Death and Injury Incidents                                                                                                                                                                                                                                          |  |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--|
| For Reporting Category: L                                                                                                                                                                                                                                                    |  |
| For the following Sequence IDs: 1, 2, 36, 39, 47, 64, 66, 87, 92, 93, 106, 143, 148, 149, 153, 157, 158, 163, 166, 168, 169, 189, 192, 229, 231, 232, 284, 290, 305, 317, 323, 328, 329, 333, 334, 371, 372, 374, 381, 389, 392, 394, 418, 423, 428, 439, 446, 460, 492, 497 |  |

Unless otherwise stated in the text, the following definitions apply to these information requests:

**Incident:** each incident identified in the above table.

**Claim and Notice:** shall have the meanings stated in 49 CFR §579.4(c). Claim and notice also specifically refer to the claim(s) and notice(s) that are the predicate for the early warning report on the incident.

**Manufacturer:** refers to GM.

**Vehicle:** the vehicle produced by GM that is identified in the claim or notice.

**Tire:** the tire produced by GM that is identified in the claim or notice.



**Equipment:** the item of motor vehicle equipment produced by GM that is identified in the claim or notice.

**Defect:** means any failure, malfunction, lack of durability, or other problem in performance, construction, a component, or material of a motor vehicle or piece of motor vehicle equipment.

**Document:** “Document(s)” is used in the broadest sense of the word and shall mean all written, typed, graphic and photographic matter whatsoever (except autopsy photographs), be it in original, copy or electronic form. Any photograph originally produced in color must be provided in color and in electronic form, if possible. Furnish all documents whether verified by GM or not. If a document is not in the English language, provide both the original document and an English translation of the document. Document(s) includes all documents in GM’s custody and/or control.

Please provide numbered responses to the following inquiries, repeating the applicable request verbatim before each response. After GM’s response to each request, identify the source of the information and indicate the last date the information was gathered. When documents are produced, the documents shall be produced in an identified, organized manner that corresponds to each pertinent information request. A separate response must be provided for each incident. Each response, document or attachment must be clearly identified with the incident Sequence ID (SeqID) number.

1. Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.
2. Provide a copy of any related Police Accident Report that is in your possession.
3. At your option, provide GM’s assessment of the circumstances that led to the incident including GM’s analysis of the claim and/or notice regarding allegations of a defect.

If GM claims that any of the information or documents provided in response to this information request constitute confidential commercial material within the meaning of 5 U.S.C. § 552(b) (4), or are protected from disclosure pursuant to 18 U.S.C. § 1905, GM must submit supporting information together with the materials that are the subject of the confidentiality request, in accordance with 49 CFR Part 512, as amended (69 Fed. Reg. 21409 et seq; April 21, 2004), to the Office of Chief Counsel (NCC-110), National Highway Traffic Safety Administration, 1200 New Jersey Avenue, S.E., Washington, D.C. 20590. GM is required to submit two copies of the documents containing allegedly confidential information (except only one copy of blueprints) and one copy of the documents from which information claimed to be confidential has been deleted. Please remember that the words “CONFIDENTIAL BUSINESS INFORMATION”

must appear at the top of each page containing information claimed to be confidential, and the information must be clearly identified in accordance with 5 U.S.C. § 512.6. If you submit a request for confidentiality for all or part of your response to this letter, that is in an electronic format (e.g., CD-ROM), your request and associated submission must conform to the new requirements in NHTSA's Confidential Business Information Rule regarding submissions in electronic formats (49CFR 512.(c)). See Federal Register, volume 72, page 59434 (October 19, 2007).

Your response to this letter, together with a copy of any confidentiality request, must be submitted to this office by **January 25, 2013**. Please include in your response the identification codes referenced on page one of this letter. If you are unable to provide all of the information requested within the time allotted, you must request an extension from me at (202) 366-7028, no later than five business days before the response due date. If all of the information requested by the original deadline is unavailable, you must submit a partial response by the original deadline with whatever information then is available, even if an extension is granted.

If you have any technical questions concerning this matter, please contact Mr. Leo Yon at (202) 366-7028 or by fax at (202) 366-7882.

Sincerely,

A handwritten signature in black ink, appearing to read "Leo Yon". The signature is fluid and cursive, with the first name "Leo" and last name "Yon" clearly distinguishable.

Leo Yon, Acting Chief  
Early Warning Division  
Office of Defects Investigation  
Enforcement



GENERAL MOTORS LLC  
Vehicle Safety and Crashworthiness

January 31, 2013

FEB 22 2013

Leo Yon, Acting Chief  
Early Warning Division, NVS-217  
Office of Defects Investigation  
National Highway Traffic Safety Administration  
1200 New Jersey Ave, SE  
Washington, DC 20590

NVS-217kb  
DI12-108

Dear Ms. Morgan:

This is General Motors' (GM) response to your inquiry dated December 19, 2012, regarding certain death and injury incidents reported by GM in its light vehicle early warning report from the 3rd quarter of 2012.

GM's response is comprised of 50 disks for the incidents that are the subject of DI12-108.

Attachment "A" includes instructions for navigating the disk. Each disk, on its face, is identified by the NHTSA Sequence ID number, the Manufacturer's Unique ID number and the year, make and model of the vehicle involved in the incident, e.g., 1 384415629-746629 and 2010 BUICK ENCLAVE. When the disk is launched, this identification number appears again along with all of the documents on the disk (including photographs and videos, if applicable) listed under "Filename". The first document listed under Filename is an index with the Request and Responses, e.g., identified as 1 384415629-746629\_00\_**Request and Responses**. The index is numbered 1 through 3 to correspond to Inquiries 1 through 3, which are repeated verbatim below. The index also details whether any documents responsive to each inquiry were located.

For example, the Inquiry and Response in  
the index for the disk are as follows:

DI12-108  
1 384415629-746629  
2010 BUICK ENCLAVE

Request for Information:

1. **Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.**

Response: See attached document.





## 2. Provide a copy of the Police Accident Report.

Response: See attached documents and photographs.

The remaining documents listed under Filename, reference the Manufacturer's Unique ID number along with the responsive Inquiry number. For example:

- 1 384415629-746629\_01\_001- is the first document responsive to Inquiry no.1.
- 1 384415629-746629\_02\_001- is the first document responsive to Inquiry no. 2.

Your inquiries and our corresponding replies are as follows:

1. **Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.**

Response: See attached document.

The table below lists the incident that is the subject of DI12-108, by Reporting Category, Sequence ID, VIN and type of notice received by GM (as "notice" is commonly used, not as it is defined by 49 C.F.R. §579.4(c)). Incidents reported on GM's Early Warning Report Death and Injury worksheet fall into four categories: Lawsuit (LIT), NISM (Not In Suit Matters), Product Allegation Resolution (PAR) or Rumor (RMR). Lawsuit and NISM case types generally meet the §579.4(c) definition of "claim". PAR cases, in this context, refer to customer contacts in which an injury or fatality is alleged to have occurred as a result of a product defect, and are accompanied by a writing that may or may not meet the §579.4(c) definition of "claim" or "notice". Rumor incidents do *not* involve a written or verbal, implied or express allegation of a defect by a customer. Rather, rumor cases generally refer to incidents that GM learned of through the media, which were subsequently investigated further.

| (65 Vehicles from the Light Vehicle Template) |                                     |      |
|-----------------------------------------------|-------------------------------------|------|
| SEQUENCE ID                                   | VEHICLE IDENTIFICATION NUMBER (VIN) | TYPE |
| 1                                             | 5GALRCED8A                          | NISM |
| 2                                             | 5GAKVCED9C                          | NISM |
| 36                                            | 1G6DK5EG0A                          | NISM |
| 39                                            | 1G6DE5EY7B                          | NISM |
| 47                                            | 1GYS4BEF9B                          | LIT  |
| 64                                            | 1G6DW67756                          | NISM |
| 66                                            | 2G61R5S34D                          | NISM |
| 87                                            | KL1TD5DE5B                          | NISM |
| 92                                            | 2G1FA1E39C                          | NISM |
| 93                                            | 2G1FT1EW2C                          | NISM |
| 106                                           | 1G1AK55F46                          | NISM |
| 143                                           | 1GCHTDFP5C                          | NISM |
| 148                                           | 1G1PH5S94B                          | NISM |
| 149                                           | 1G1PC5SH5B                          | NISM |

| SEQUENCE ID | VEHICLE IDENTIFICATION NUMBER (VIN) | TYPE  |
|-------------|-------------------------------------|-------|
| 153         | 1G1PF5S94B7 [REDACTED]              | LIT   |
| 157         | UNKNOWN                             | NISM  |
| 158         | UNKNOWN                             | NISM  |
| 163         | 1G1PC5SH3C7 [REDACTED]              | NISM  |
| 166         | 1G1PC5SH9C7 [REDACTED]              | NISM  |
| 168         | UNKNOWN                             | NISM  |
| 169         | 1G1PE5SC2C7 [REDACTED]              | NISM  |
| 189         | 2GNALBEK8C1 [REDACTED]              | NISM  |
| 192         | 2GNFLNEK2C6 [REDACTED]              | LIT   |
| 229         | 2G1WF5EK3B1 [REDACTED]              | NISM  |
| 231         | 2G1WG5E38C1 [REDACTED]              | NISM  |
| 232         | 2G1WF5E35C1 [REDACTED]              | NISM  |
| 284         | 1G1ZD5EU6CF [REDACTED]              | PAR   |
| 290         | 1G1ZC5E01CF [REDACTED]              | NISM  |
| 305         | 2GCEC13C181 [REDACTED]              | NISM  |
| 317         | 1GCRKSE75CZ [REDACTED]              | RUMOR |
| 323         | 1GCHK23D06F [REDACTED]              | NISM  |
| 328         | 1G1JC5SBXC4 [REDACTED]              | NISM  |
| 329         | 1G1JC5SH3C4 [REDACTED]              | NISM  |
| 333         | UNKNOWN                             | NISM  |
| 334         | UNKNOWN                             | NISM  |
| 371         | 1GNKRGED1CJ [REDACTED]              | NISM  |
| 372         | 1GNKVGED1CJ [REDACTED]              | NISM  |
| 374         | 1GNKVJED7CJ [REDACTED]              | NISM  |
| 381         | 1G1RD6E48CU [REDACTED]              | NISM  |
| 389         | 1GKLRLD6AJ [REDACTED]               | NISM  |
| 392         | 1GKKRRED7CJ [REDACTED]              | NISM  |
| 394         | 1GKKRSED8CJ [REDACTED]              | NISM  |
| 418         | 1GTR1VE03BZ [REDACTED]              | NISM  |
| 423         | 2GKFLUE54C6 [REDACTED]              | NISM  |
| 428         | 1GKS2CE05CR [REDACTED]              | NISM  |
| 439         | 5GTDN136X68 [REDACTED]              | NISM  |
| 446         | 1G2AL18FX87 [REDACTED]              | NISM  |
| 460         | 1G2ZH17NX84 [REDACTED]              | NISM  |
| 492         | 1G8AJ55F36Z [REDACTED]              | RUMOR |
| 497         | 1G8MF35XX8Y [REDACTED]              | NISM  |

**2. Provide a copy of the Police Accident Report.**

Response: If available, see attached document(s) and photograph(s) on the enclosed disk(s).

**3. At your option, provide GM's assessment of the circumstances that led to the incident including GM's analysis of the claim and/or notice regarding allegations of a defect.**



Response: GM opts not to respond.

GM claims that certain information, in documents that are part of rumor, claim and lawsuit files maintained by the GM Legal Staff and its outside counsel, is attorney work product and/or privileged. That information includes notes, memos, photographs, reports and evaluations by attorneys (and by consultants, claims analysts, investigators and engineers working at the request of attorneys). GM is producing responsive documents from its rumor, claim and lawsuit files that are neither attorney work product nor privileged and withholding those that are attorney work product and/or privileged.

This response was compiled and prepared by this office upon review of documents retrieved by GM and does not include documents generated or received subsequent to the searches.

Please contact me at if you require further information.

Sincerely,

A handwritten signature in black ink, appearing to read "M. Carmen Benavides". The signature is fluid and cursive, with the first name "M." followed by "Carmen" and "Benavides" in a stylized script.

M. Carmen Benavides, Director  
Product Investigations and Safety Regulations

Enclosures: 50 Disks  
Attachment A





## Attachment A

### *Instructions for using Disk Viewer*

1. Insert the encrypted disk into the disk ROM drive and click on your DVD drive.
2. Double-click on the **.zip file** file.

| Name                                      | Date modified      | Type                  | Size     |
|-------------------------------------------|--------------------|-----------------------|----------|
| Files Currently on the Disc (1)           |                    |                       |          |
| 200689_001.zip                            | 2/19/2013 11:53 AM | WinZip File           | 3,448 KB |
| Files Ready to Be Written to the Disc (1) |                    |                       |          |
| desktop.ini                               | 2/21/2013 7:57 AM  | Configuration sett... | 1 KB     |

3. Double-click the **images file....** Insert encryption password

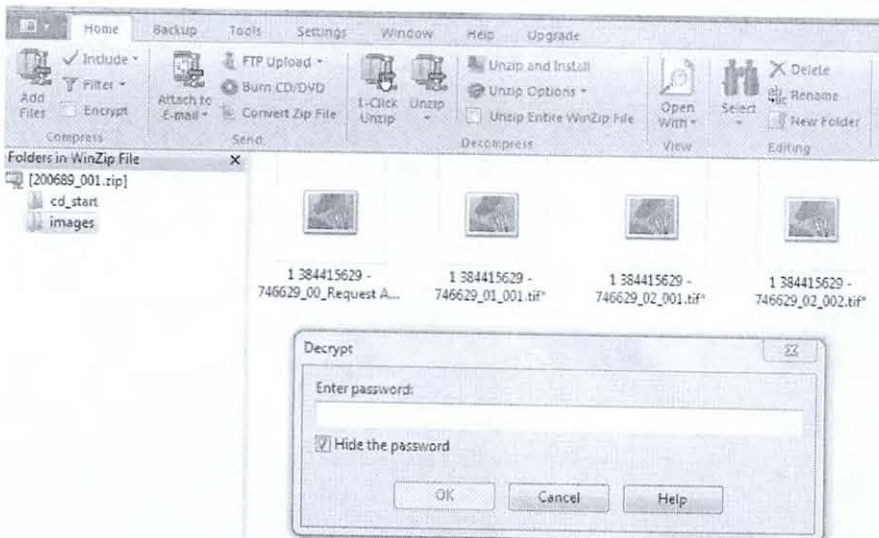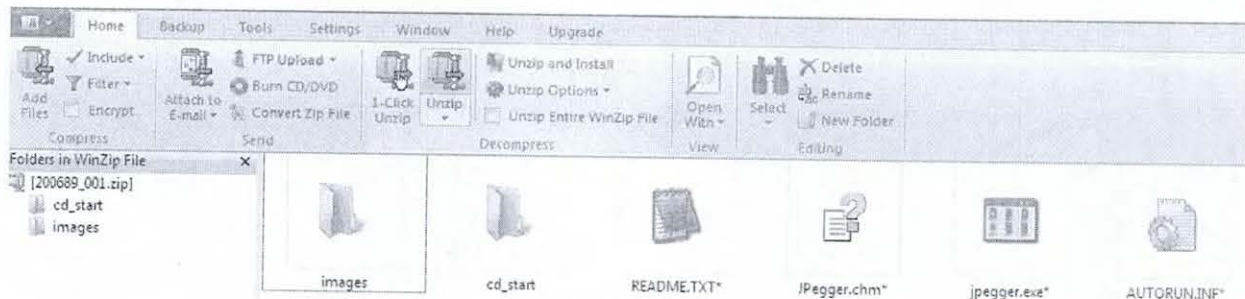

4. Double-click on any of the files and view



**DI12-108**  
**492 384415923-747261**  
**2006 SATURN ION**

**Request for Information:**

1. Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.

Response: See Attached Documents.

2. Provide a copy of the Police Accident Report.

Response: None.

3. At your option, provide GM's assessment of the circumstances that led to the incident including GM's analysis of the claim and/or notice regarding allegations of a defect.

Response: See Attached Documents. Assessments of claims may be attorney work product and/or privileged. Therefore, information and documents provided in this response, if any, consist only of non-attorney work product and/or non-privileged material for incidents that have been investigated and assessed.



## Service Request Detail

|                          |                                                                                                  |              |                                   |           |                      |
|--------------------------|--------------------------------------------------------------------------------------------------|--------------|-----------------------------------|-----------|----------------------|
| SR No. (b) (6)           | Ref No.                                                                                          | Goodwill     | No Goodwill Offered               | BRC Type  | PAR                  |
| Account                  | Site                                                                                             | GW SubType   |                                   | Bus. Unit | BRC                  |
| Last Name                | First Name                                                                                       | Approval     | Not Initiated                     | Area      | PAR                  |
| Daytime #                | Evening #                                                                                        | UCC          | Restraints - (SIR) - Driver Front | Sub-Area  | ESIS Escalation      |
| Address                  | City Grand Rapids                                                                                | Involved Dir | Todd Wenzel Buick GMC, Inc.       | Safety    | Yes                  |
| State MI ZipCd           | Con Acct                                                                                         | Source       | Email                             | Updated   | 9/6/2012 04:32:42 PM |
| Serial #/VIN 1G8AJ55F302 | Model Year 2006                                                                                  | Priority     | Medium License # SATURN -         | Owner     | BABBSKE              |
| Make Saturn - GM         | Warr. Start 05/08/2008                                                                           | Status       | Open                              | Opened    | 9/6/2012 09:29:47 AM |
| Model ION 2              | Mileage 87600                                                                                    | Sub-Status   | Satisfied                         | Closed    |                      |
| Abstract                 | airbags non-deployment                                                                           |              |                                   |           |                      |
| Customer Description     | This is a BRC PAR File. Please do not Assume. Forward all Inquiries to Kellin Bobbs @ ext. 41026 |              |                                   |           |                      |

## Pre-PAR

|                           |                                                               |                |                                                                                                                  |                  |              |            |              |                |
|---------------------------|---------------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------|------------------|--------------|------------|--------------|----------------|
| PAR Notifier              | Incident Date/Time                                            | Injuries       | # Other Veh                                                                                                      | # People in Veh  | Road Surface | Road Cond. | Fire Report# | Police Report# |
| Owner                     | 8/29/2012 04:30:00 PM                                         | Y              | 1                                                                                                                | 1                | Asphalt      | Dry        | na           |                |
| Driver Last Name          | Driver First Name                                             | Height         | DOB                                                                                                              | Disabilities     |              |            |              |                |
|                           |                                                               | 5'6            |                                                                                                                  | Injured/ glasses |              |            |              |                |
| Insurance Agent Last Name | Insurance Agent First Name                                    | Phone #        | Insurance Agency                                                                                                 |                  |              |            |              |                |
| unk                       | unk                                                           | (888) 244-6163 | 21st Century                                                                                                     |                  |              |            |              |                |
| Incident Loc              | Grand Rapids MI                                               | Incident Desc  | Customer ended up hitting another vehicle from behind when they were making a right turn through an intersection |                  |              |            |              |                |
| Component                 | airbags                                                       | Damage Desc    | whole front end is crunched on the driver side.                                                                  |                  |              |            |              |                |
| Vehicle Loc               | Star Collision - 1560 Plainfield Ave NE Grand Rapids MI 49505 | Add'l info     | loc last svc date: unk<br>inspec date time: unk                                                                  |                  |              |            |              |                |
| Emgcy Svc Names           | unk                                                           | Metnl Loc      | GM dealerships                                                                                                   |                  |              |            |              |                |

## PAR Detail

|                        |                                                 |                      |                                |                         |                                        |                      |                          |                      |
|------------------------|-------------------------------------------------|----------------------|--------------------------------|-------------------------|----------------------------------------|----------------------|--------------------------|----------------------|
| Collision              | Y                                               | Non Collision        | Property Damage                | Y                       | Thermal Evt                            | N                    | Spec Equip               | none                 |
| Vehicle Speed          | 40                                              | Weather Condition    | 83 degrees                     | Prop Owner              |                                        | Property Type        | 2004 Chevrolet Avalanche | K1500                |
| Last Service Date      | 9/9/2011                                        | Loc Last Service     |                                | Property Location       | Rupius MI                              | Prop Est Repair Cost | \$0.00                   |                      |
| Veh Est Repair Cost    | \$4,638.00                                      | Spec Equip Installer | na                             | Prop Damage Description | no damage                              | Inspected By         | Inspection Not Performed | Inspection Date/Time |
| Primary Veh Use        | Personal                                        | Inspection Type      | Restraint System SIR/Seat Belt | Explain Other           | case is being sent to esis for medical |                      |                          |                      |
| Veh Damage Description | whole front end is crunched on the driver side. |                      |                                |                         |                                        |                      |                          |                      |

## Service Request Detail

### PAR Injuries

| Last Name                | First Name | DOB          | Location                    | Phone #            | Seating Pos | Restraint Type |
|--------------------------|------------|--------------|-----------------------------|--------------------|-------------|----------------|
|                          |            | 11/27/52     | Occupant of Owner's Vehicle |                    | Driver      | SIR            |
| Injury Description       |            | Medical Rpt# |                             | Treatment Location |             | Treated By     |
| neck and shoulder sprain |            | unk          |                             | Spectrum Health    |             | Dr. Koolstra   |
| Street Address           |            | City         | State                       | Zip Code           |             |                |
|                          |            | Grand Rapids | MI                          |                    |             |                |

### Activities

| Created                             | Created By | Assigned To        | Activity Type | Activity Sub-Type | Status      | Completed | Description     |
|-------------------------------------|------------|--------------------|---------------|-------------------|-------------|-----------|-----------------|
| 9/7/2012 09:20:21 AM                | KINZERTH   | ESISBIQU           | Escalation    | ESIS - Injuries   | In Progress |           | ESIS - Injuries |
| Contact Last Name                   |            | Contact First Name | Account       |                   | BAC Code    |           |                 |
|                                     |            |                    |               |                   |             |           |                 |
| Comments                            |            |                    |               |                   |             |           |                 |
| airbag non-deployment with injuries |            |                    |               |                   |             |           |                 |
| Confidential Comments               |            |                    |               |                   |             |           |                 |
|                                     |            |                    |               |                   |             |           |                 |

| Created                                                                                                                                                                             | Created By | Assigned To        | Activity Type       | Activity Sub-Type | Status          | Completed | Description    |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|--------------------|---------------------|-------------------|-----------------|-----------|----------------|
| 9/6/2012 04:43:50 PM                                                                                                                                                                | BABBSKE    | BABBSKE            | Scheduled Follow-up |                   | Scheduled Alarm |           | esis - medical |
| Contact Last Name                                                                                                                                                                   |            | Contact First Name | Account             |                   | BAC Code        |           |                |
|                                                                                                                                                                                     |            |                    |                     |                   |                 |           |                |
| Comments                                                                                                                                                                            |            |                    |                     |                   |                 |           |                |
| Customer is alleging that they were making a right turn into an intersection when another vehicle stopped causing them to hit them from behind and having their airbags not deploy. |            |                    |                     |                   |                 |           |                |
| esis - medical                                                                                                                                                                      |            |                    |                     |                   |                 |           |                |
| kellinbabbs/par/ax                                                                                                                                                                  |            |                    |                     |                   |                 |           |                |
| Confidential Comments                                                                                                                                                               |            |                    |                     |                   |                 |           |                |
|                                                                                                                                                                                     |            |                    |                     |                   |                 |           |                |

## Service Request Detail

### Activities

| Created              | Created By         | Assigned To | Activity Type | Activity Sub-Type | Status | Completed            | Description    |
|----------------------|--------------------|-------------|---------------|-------------------|--------|----------------------|----------------|
| 9/6/2012 04:43:19 PM | BABBEKE            | KINZERTH    | Notify CRM    |                   | Done   | 9/7/2012 09:20:43 AM | esis - medical |
| Contact Last Name    | Contact First Name | Account     | BAC Code      |                   |        |                      |                |
|                      |                    |             |               |                   |        |                      |                |

#### Comments

Customer is alleging that they were making a right turn into an intersection when another vehicle stopped causing them to hit them from behind and having their airbags not deploy.

esis - medical

kellinbabbs/pa/abx

Confidential Comments

## Service Request Detail

### Activities

| Created              | Created By         | Assigned To | Activity Type  | Activity Sub-Type | Status | Completed            | Description            |
|----------------------|--------------------|-------------|----------------|-------------------|--------|----------------------|------------------------|
| 9/8/2012 04:42:05 PM | BABBSKE            | BABBSKE     | Outbound Email | DVM/CAMField      | Done   | 9/8/2012 04:42:28 PM | christine.price@gm.com |
| Contact Last Name    | Contact First Name | Account     | BAC Code       |                   |        |                      |                        |

#### Comments

A product allegation claim has been made in your region. The customer is alleging that they were making a right turn into an intersection when another vehicle stopped causing them to hit them from behind and having their airbags not deploy. This case is being escalated to ESIS because of medical treatment.

2006 Saturn Ion 2

1G8AJ55F36Z

Todd Wenzel Buick GMC, Inc. Grand Rapids MI 183998

(616) 949-7700

This is only a notification. No action is required on your part at this time.

Respectfully,  
Kellin Babbs | CRS

Aditya Birla Minacs | Inspired every day  
7401 E. Ben White Blvd, Bldg. F, Austin, TX 78741  
Phone: 866-790-5700 | Fax: 866-311-2784 | [www.minacs.adityabirla.com](http://www.minacs.adityabirla.com) Follow us on Twitter

#### Confidential Comments

| Created              | Created By         | Assigned To | Activity Type     | Activity Sub-Type          | Status | Completed            | Description                |
|----------------------|--------------------|-------------|-------------------|----------------------------|--------|----------------------|----------------------------|
| 9/8/2012 04:32:43 PM | BABBSKE            | BABBSKE     | Ownership Changed | Ownership Escalated to BRC | Done   | 9/8/2012 04:32:43 PM | Ownership Escalated to BRC |
| Contact Last Name    | Contact First Name | Account     | BAC Code          |                            |        |                      |                            |

#### Comments

#### Confidential Comments

Report Generated for toporowm

on 9/10/2012

Page 4 of 13

TA000129918



## Service Request Detail

### Activities

| Created              | Created By         | Assigned To | Activity Type | Activity Sub-Type | Status   | Completed            | Description   |
|----------------------|--------------------|-------------|---------------|-------------------|----------|----------------------|---------------|
| 9/8/2012 01:47:39 PM | BABBSKE            | BABBSKE     | BRC PAR       | Business Case     | Done     | 9/8/2012 04:38:33 PM | business case |
| Contact Last Name    | Contact First Name |             | Account       |                   | BAC Code |                      |               |

#### Comments

Customer is alleging that they were making a right turn into an intersection when another vehicle stopped causing them to hit them from behind and having their airbags not deploy.

esis - medical

kellinbabbs/parfabx

Confidential Comments

| Created              | Created By         | Assigned To | Activity Type | Activity Sub-Type | Status   | Completed            | Description               |
|----------------------|--------------------|-------------|---------------|-------------------|----------|----------------------|---------------------------|
| 9/8/2012 01:47:32 PM | BABBSKE            | BABBSKE     | Other         |                   | Done     | 9/8/2012 04:35:44 PM | vehicle incident location |
| Contact Last Name    | Contact First Name |             | Account       |                   | BAC Code |                      |                           |

#### Comments

Grand Rapids M

kellinbabbs/parfabx

Confidential Comments

| Created              | Created By         | Assigned To | Activity Type            | Activity Sub-Type   | Status   | Completed            | Description |
|----------------------|--------------------|-------------|--------------------------|---------------------|----------|----------------------|-------------|
| 9/8/2012 01:23:13 PM | MERCADTO           | KINZERTH    | Inbound Call Third Party | Voice Mail Received | Done     | 9/8/2012 01:23:27 PM | PAR V/M     |
| Contact Last Name    | Contact First Name |             | Account                  |                     | BAC Code |                      |             |

#### Comments

71-1104558928

customer

airbag non-deployment

Sep 8 9:41am

Confidential Comments

## Service Request Detail

### Activities

| Created              | Created By         | Assigned To | Activity Type     | Activity Sub-Type | Status | Completed            | Description                                                      |
|----------------------|--------------------|-------------|-------------------|-------------------|--------|----------------------|------------------------------------------------------------------|
| 9/8/2012 10:20:12 AM | MERCADTO           | BABBSKE     | Ownership Changed |                   | Done   | 9/8/2012 10:20:12 AM | Service Request Ownership has changed FROM: PAGATPPE TO: BABBSKE |
| Contact Last Name    | Contact First Name | Account     | UAC Code          |                   |        |                      |                                                                  |
|                      |                    |             |                   |                   |        |                      |                                                                  |
| Comments             |                    |             |                   |                   |        |                      |                                                                  |

Confidential Comments

| Created              | Created By | Assigned To        | Activity Type | Activity Sub-Type       | Status | Completed            | Description            |
|----------------------|------------|--------------------|---------------|-------------------------|--------|----------------------|------------------------|
| 9/8/2012 10:18:57 AM | MERCADTO   | BABBSKE            | BRC PAR       | Initial Contact - Field | Done   | 9/8/2012 04:42:03 PM | christine.price@gm.com |
| Contact Last Name    |            | Contact First Name |               | Account                 |        | BAC Code             |                        |
|                      |            |                    |               |                         |        |                      |                        |
| Comments             |            |                    |               |                         |        |                      |                        |

A product allegation claim has been made in your region. The customer is alleging that they were making a right turn into an intersection when another vehicle stopped causing them to hit them from behind and having their airbags not deploy. This case is being escalated to ESIS because of medical treatment.

2006 Saturn ION 2

1G8AJ55F36Z

Todd Wenzel Buick GMC, Inc. Grand Rapids MI 49508

(616) 949-7700

This is only a notification. No action is required on your part at this time.

Respectfully,  
Kellin Babbs | CRS

Aditya Birla Minacs | Inspired every day  
7401 E. Ben White Blvd, Bldg. F, Austin, TX 78741  
Phone: 866-750-5700 | Fax: 866-311-2784 | [www.minacs.adityabirla.com](http://www.minacs.adityabirla.com) Follow us on Twitter

Confidential Comments

Report Generated for toporowm

on 9/10/2012

Page 6 of 13

TA000129920

## Service Request Detail

### Activities

| Created              | Created By         | Assigned To | Activity Type | Activity Sub-Type       | Status | Completed            | Description                                |
|----------------------|--------------------|-------------|---------------|-------------------------|--------|----------------------|--------------------------------------------|
| 9/8/2012 10:18:48 AM | MERCADTO           | BABBSKE     | BRC PAR       | Initial Contact- Dealer | Done   | 9/8/2012 04:40:58 PM | Todd Wenzel Buick GMC, Inc. (616) 948-7700 |
| Contact Last Name    | Contact First Name | Account     | BAC Code      |                         |        |                      |                                            |

#### Comments

CRS spoke with Tim Cumigan

divided of cust product allegation.

dir sts: have not seen them since september of 2011.

sept 28th 2011 76,264 clunk noise in the front and they recommended us replading the sway bar links. That is the last thing I see.

Maint:n

Evidence of abuse misuse or lack of maint: n

Known product concerns relating to customer's allegation: n

kellinbabbs/pa/raix

Confidential Comments

## Service Request Detail

### Activities

| Created              | Created By         | Assigned To | Activity Type | Activity Sub-Type     | Status | Completed            | Description |
|----------------------|--------------------|-------------|---------------|-----------------------|--------|----------------------|-------------|
| 9/6/2012 10:19:38 AM | MERCADTO           | BABBSKE     | BRC PAR       | Initial Contact Phone | Done   | 9/6/2012 04:35:09 PM |             |
| Contact Last Name    | Contact First Name | Account     | BAC Code      |                       |        |                      |             |

#### Comments

crs spoke w

crs verified address

crs verified customer contact information.

crs verified email

Grand Rapids MI

Cust. states: turned corner at intersection going slow about 40 mph and there was a car in front of me going about 20 mph so I moved into the left lane to go around them. The driver in a truck next to me on a cell phone stopped abruptly. When he stopped I was behind him and my car slid over a yard. I slid right in front of him on the driver's side. The impact I think should have had the airbags deploy.

Original owner? yes

rental? n

medical attn?

neck and shoulder sprain.

spectrum health

Koolstra

par form notes:

loc last svc date: unk

inspec date time: unk

Crs gathered prePAR and PAR Detail Info.

CRS advised customer of required verbiage as stated in d\_1075834

Cust requested the file to be referred to the Central Claims dept.

Crs advised cust someone from our Central Claims department will follow up with you within 7-10 business days.

Crs provided contact information and the case number

kel@babbs/par/atx

Confidential Comments

## Service Request Detail

### Activities

| Created              | Created By         | Assigned To | Activity Type | Activity Sub-Type | Status | Completed            | Description |
|----------------------|--------------------|-------------|---------------|-------------------|--------|----------------------|-------------|
| 9/8/2012 10:19:30 AM | MERCADTO           | BABBSKE     | BRC PAR       | Acknowledgement   | Done   | 9/8/2012 04:11:08 PM |             |
| Contact Last Name    | Contact First Name | Account     | BAC Code      |                   |        |                      |             |

#### Comments

crs adv: This is Kellin calling from the GM Product Allegation Dept. I have received your file and do require further information. Do you have a moment to speak to me?

Cust sta: Yes

(Continued in initial)

kellinbabbs/par/atx

Confidential Comments

| Created              | Created By         | Assigned To | Activity Type | Activity Sub-Type | Status | Completed            | Description  |
|----------------------|--------------------|-------------|---------------|-------------------|--------|----------------------|--------------|
| 9/8/2012 10:19:21 AM | MERCADTO           | BABBSKE     | Research      |                   | Done   | 9/8/2012 01:53:53 PM | Research VIN |
| Contact Last Name    | Contact First Name | Account     | BAC Code      |                   |        |                      |              |

#### Comments

S/R's:  
ST-1-24068932- saturn salute goodwill items  
068932-EBVPM - parent sr number  
068932-EBVPM - parent sr number  
71-970559573 - air issue  
71-981896091 - power steering

Recalls:  
Special Coverage 09014 06/07/2012 05/06/2006 11 MI 05/06/2011 150,011 MI  
Special Coverage 10187 06/07/2012 05/06/2006 11 MI 05/06/2010 150,011 MI

Branded: n

Warranty Block: n

Repairs: 0

research complete

kellinbabbs/par/atx

Confidential Comments



## Service Request Detail

### Activities

| Created              | Created By | Assigned To | Activity Type | Activity Sub-Type | Status | Completed            | Description   |
|----------------------|------------|-------------|---------------|-------------------|--------|----------------------|---------------|
| 9/6/2012 10:18:08 AM | MERCADTO   | BABBSKE     | Notify CRM    |                   | Done   | 9/6/2012 05:32:30 PM | File assigned |

| Contact Last Name | Contact First Name | Account | BAC Code |
|-------------------|--------------------|---------|----------|
|                   |                    |         |          |

Comments  
file received

kellinbabbs/parfax

Confidential Comments

| Created              | Created By | Assigned To | Activity Type | Activity Sub-Type | Status | Completed            | Description               |
|----------------------|------------|-------------|---------------|-------------------|--------|----------------------|---------------------------|
| 9/6/2012 10:18:35 AM | MERCADTO   | BABBSKE     | BRC PAR       | Case Assigned     | Done   | 9/6/2012 05:32:33 PM | Assigned to Kellin x31460 |

| Contact Last Name | Contact First Name | Account | BAC Code |
|-------------------|--------------------|---------|----------|
|                   |                    |         |          |

Comments  
file received

kellinbabbs/parfax

Confidential Comments

| Created              | Created By | Assigned To | Activity Type | Activity Sub-Type | Status | Completed            | Description                                           |
|----------------------|------------|-------------|---------------|-------------------|--------|----------------------|-------------------------------------------------------|
| 9/6/2012 10:18:26 AM | MERCADTO   | PAGATPPE    | SR Opened     |                   | Done   | 9/6/2012 10:18:28 AM | SR In Status of Closed has been Re-Opened by MERCADTO |

| Contact Last Name | Contact First Name | Account | BAC Code |
|-------------------|--------------------|---------|----------|
|                   |                    |         |          |

Comments

Confidential Comments

| Created              | Created By | Assigned To | Activity Type         | Activity Sub-Type | Status | Completed            | Description                                |
|----------------------|------------|-------------|-----------------------|-------------------|--------|----------------------|--------------------------------------------|
| 9/6/2012 10:18:25 AM | MERCADTO   | PAGATPPE    | SR Closed - Satisfied |                   | Done   | 9/6/2012 10:18:25 AM | Service Request has been Closed Satisfied. |

| Contact Last Name | Contact First Name | Account | BAC Code |
|-------------------|--------------------|---------|----------|
|                   |                    |         |          |

Comments

Confidential Comments

## Service Request Detail

### Activities

| Created              | Created By | Assigned To | Activity Type | Activity Sub-Type | Status | Completed            | Description                |
|----------------------|------------|-------------|---------------|-------------------|--------|----------------------|----------------------------|
| 9/8/2012 08:41:57 AM | PAGATPPE   | KINZERTH    | Notify CRM    |                   | Done   | 9/8/2012 10:16:21 AM | PAR-airbags did not deploy |

| Contact Last Name | Contact First Name | Account | BAC Code |
|-------------------|--------------------|---------|----------|
|                   |                    |         |          |

Comments

Confidential Comments

| Created              | Created By | Assigned To | Activity Type          | Activity Sub-Type | Status | Completed            | Description |
|----------------------|------------|-------------|------------------------|-------------------|--------|----------------------|-------------|
| 9/8/2012 09:33:37 AM | PAGATPPE   | PAGATPPE    | Outbound Call Customer | Made Contact      | Done   | 9/8/2012 09:41:54 AM | Spoke with  |

| Contact Last Name | Contact First Name | Account | BAC Code |
|-------------------|--------------------|---------|----------|
|                   |                    |         |          |

Comments

Crs sts:  
-introduced myself  
-advised that I am calling to verify some info

Cust sts:  
-G2203300 with 87600 miles  
-original owner  
-veh is in Star Collision at this time  
-they are the one who provided the estimate of the damage  
-veh is not driveable so I took it to the Collision place instead  
-airbags did not deploy at the time of the accident that's why I was into an accident  
-august 29, 2012  
-no related repairs in the past, front right tire was repaired before when I got into a pot hole last time

Crs sts:  
-provided the s#  
-advised that I will forward the info to one of our PAR rep for further assistance  
-advised that someone will get back to her within 24-48 hours

Pearl-RR-Survey-WM-Email-CAC-T1-MLA-L1

Confidential Comments

## Service Request Detail

### Activities

| Created              | Created By | Assigned To        | Activity Type   | Activity Sub-Type | Status | Completed            | Description                           |
|----------------------|------------|--------------------|-----------------|-------------------|--------|----------------------|---------------------------------------|
| 8/5/2012 03:10:53 PM |            | PAGATPPE           | Email - Inbound |                   | Done   | 9/8/2012 09:33:35 AM | FW: Thank you for your Buick question |
| Contact Last Name    |            | Contact First Name |                 | Account           |        | UAC Code             |                                       |
|                      |            |                    |                 |                   |        |                      |                                       |
| Comments             |            |                    |                 |                   |        |                      |                                       |
| [THREAD ID:149CVKQ]  |            |                    |                 |                   |        |                      |                                       |

—Original Message—

From: feq@buick.com  
Sent: 8/5/2012 12:21:35 AM  
To: feq@buick.com  
Subject: Thank you for your Buick question

<html>  
<head>  
<meta http-equiv="Content-Type" content="text/html; charset=iso-8859-1" />  
<title></title>  
</head>  
<body>

<p>Name: <br>  
Email Address: <br>  
Address: <br>  
Grand Rapids, MI <br>  
Day Phone: ex <br>  
Evening Phone: ()- ex  
</p>

<p>Comments: My name is I have a 2008-Saturn Ion 2, I have owned this car for 6yr.Never had a Accident until now. I LOVE this Car. Aug 29,2012. I had a Run-In to a Person on a Cellphone in front of me. The Impact Really messed up my Front. But For some Reason My Air-Bags did not Deploy. I suffered a Neck and Shoulder Sprain. I feel my Car was somehow (Defective). I have pictures also. There is \$4600.00, of damage to my car. Please have someone contact me on this issue.</p>

<p>Website Concern Info:<br>Website: buick<br>Operating System: windows<br>Browser: eol  
</p>

</body>  
</html>

Confidential Comments

## Service Request Detail

### UCC Information

| UCC Code | Symptom              | Description                                      |
|----------|----------------------|--------------------------------------------------|
| C46      | SIR - Did Not Deploy | Restraints - (SIR) - Driver Front                |
| C47      | SIR - Did Not Deploy | Restraints - (SIR) - Driver Side - Side Impact   |
| C48      | SIR - Did Not Deploy | Restraints - (SIR) - Passenger Front             |
| C49      | SIR - Did Not Deploy | Restraints - (SIR) - Passenger Side -Side Impact |

[Logout](#)

September 10, 2012

Global Warranty Management: Mah &gt; Interface With Customer &gt; View Vehicle Summary

INTERFACE WITH  
CUSTOMERView Vehicle Summary ?

This screen allows IVH users to view the Summary of Vehicle Information, Field Actions, Service Information, Applicable Warranties, Transaction History, Service Contract(s) if applicable, Warranty Block, Branded Title information and OnStar and XM Radio information (if applicable)

## Vehicle Information

VIN 1G8AJ55F36Z XXXXXXXXXX Model: ZAJ69-2006 ION.2 BASE SEDAN  
 Service Contract No XXXXXXXXXX Branded Title No XXXXXXXXXX Warranty Block No XXXXXXXXXX PDI Status Yes  
 Order Type T - DEALER STOCK  
 Field Actions [Open](#) XXXXXXXXXX

For this vehicle:

[View Vehicle Summary](#)

- [Service Contract](#)
- [Branded Title](#)
- [Warranty Block](#)

- [View Vehicle Build](#)
- [View Vehicle Component Summary](#)
- [View Vehicle Transaction History Detail](#)
- [View Vehicle Delivery Information](#)

## Required Field Actions

Open field actions are highlighted

Vehicle has no current record of required field actions.

## Branded Title

Vehicle has no current record of branded titles.

## Warranty Block

Vehicle has no current record of warranty block.

## Service Information

Vehicle has no current record of outstanding service information.

## OnStar and XM Satellite Radio Information

Refer to Help page for details. For OnStar contact 888.ON.STAR1 (888.667.8271) and for XM Radio contact 877.GET.XMST (877.438.9877 Canada) and in the USA: 800-356-3690.

|                              |                       |
|------------------------------|-----------------------|
| OnStar Equipped Y            | OnStar Status: Active |
| XM Equipped N                | XM Status: NA         |
| OnStar Vehicle Diagnostics N | DMN Enabled: N        |

## Applicable Warranties

Valid warranties are highlighted

| Valid | Description                              | Warranty Add Date | Start Date | Effective Odometer | End Date   | End Odometer |
|-------|------------------------------------------|-------------------|------------|--------------------|------------|--------------|
|       | Saturn 96/80M Emission select components | 06/07/2012        | 05/06/2006 | 11 MI              | 05/06/2014 | 80,011 MI    |
|       | Saturn 36/36K Bumper to Bumper           | 06/07/2012        | 05/06/2006 | 11 MI              | 05/06/2009 | 36,011 MI    |
|       | Saturn 72/100K Corrosion                 | 06/07/2012        | 05/06/2006 | 11 MI              | 05/06/2012 | 100,011 MI   |
|       | Special Coverage 09014                   | 06/07/2012        | 05/06/2006 | 11 MI              | 05/06/2021 | 150,011 MI   |
|       | Special Coverage 10187                   | 06/07/2012        | 05/06/2006 | 11 MI              | 05/06/2018 | 150,011 MI   |

[https://gmvis2.gotd.gm.com/gmvis2/showVehicleHistorySummary.do?\\_SEC\\_TOKEN\\_=6...](https://gmvis2.gotd.gm.com/gmvis2/showVehicleHistorySummary.do?_SEC_TOKEN_=6...) 9/10/2012

**Service Contract**

Vehicle has no current record of service contracts.

**Transaction History**[View Details](#)

| Job Card Date | Job Card Number | Transaction Type                                | Transaction Adjustment | Labour Operation                                                          | Odometer Reading |
|---------------|-----------------|-------------------------------------------------|------------------------|---------------------------------------------------------------------------|------------------|
| 09/01/2011    | 16044672        | ZREG—Regular Vehicle Transaction                |                        | T5783 - 10187 - Replace Power Steering Motor Control Module               | 75,092 MI        |
| 08/19/2011    | 16043775        | ZREG—Regular Vehicle Transaction                |                        | E3851 - Strut, Front - Left - Replace                                     | 74,469 MI        |
| 08/19/2011    | 16043775        | ZREG—Regular Vehicle Transaction                |                        | E3551 - Bushings And/Or Shaft, Front Control Arm - Lower - Left - Replace | 74,469 MI        |
| 07/01/2011    | 16040206        | ZREG—Regular Vehicle Transaction                |                        | T6721 - 09014 - Engine Control Module - Emission Related Reprogramming    | 72,383 MI        |
| 03/15/2010    | 2302903         | ZPTI—Part Transaction - Service Agent Installed |                        | L1020 - Fuel Tank Filler Cap Replacement                                  | 58,821 MI        |
| 11/20/2008    | Z17877          | ZREG—Regular Vehicle Transaction                |                        | Z8025 - ONSTAR - FLAT TIRE                                                | 0 MI             |
| 11/11/2008    | 2281897         | ZSET—Service Event                              |                        | M5005 - TOP OFF ALL FLUIDS                                                | 40,356 MI        |
| 11/11/2008    | 2281897         | ZSET—Service Event                              |                        | M5105 - BRAKE INSPECTION (FLUID CHECK)                                    | 40,356 MI        |
| 05/29/2008    | 2273830         | ZSET—Service Event                              |                        | M5005 - TOP OFF ALL FLUIDS                                                | 32,174 MI        |
| 05/01/2008    | 2272507         | ZREG—Regular Vehicle Transaction                |                        | J6354 - Powertrain Control Module Engine Reprogramming with SPS           | 30,360 MI        |
| 04/07/2008    | 0271333         | ZREG—Regular Vehicle Transaction                |                        | C0180 - Regulator, Front Door Window - Right Manual - R&R Or Replace      | 28,526 MI        |
| 12/28/2007    | 0266933         | ZSET—Service Event                              |                        | M5005 - TOP OFF ALL FLUIDS                                                | 23,873 MI        |
| 10/05/2007    | P91834          | ZREG—Regular Vehicle Transaction                |                        | Z4535 - ROADSIDE SERVICE (FLAT TIRE) - SATURN U.S.                        | 20,223 MI        |
| 10/05/2007    | 0232795         | ZSET—Service Event                              |                        | M5120 -                                                                   | 20,227 MI        |
| 08/21/2007    | 0258489         | ZSET—Service Event                              |                        | M5005 -                                                                   | 14,808 MI        |
| 06/21/2007    | 0258489         | ZREG—Regular Vehicle Transaction                |                        | B7611 - Molding, Windshield Side Roof Rail Drip - Left - R&R Or Replace   | 14,808 MI        |
| 05/14/2007    | 0256696         | ZREG—Regular Vehicle Transaction                |                        | C0183 - Front Side Door Window Regulator Replacement - Left Side          | 11,680 MI        |
| 02/05/2007    | 0252233         | ZSET—Service Event                              |                        | M5005 -                                                                   | 7,021 MI         |
| 02/05/2007    | 0252233         | ZSET—Service Event                              |                        | M5025 -                                                                   | 7,021 MI         |
| 02/05/2007    | 0252233         | ZREG—Regular Vehicle Transaction                |                        | Z4632 - 2-DAY CAR RENTAL - SATURN U.S.                                    | 7,021 MI         |
| 02/05/2007    | 0252233         | ZREG—Regular Vehicle Transaction                |                        | J6354 - Powertrain Control Module Engine Reprogramming with SPS           | 7,021 MI         |
| 01/15/2007    | 0251366         | ZREG—Regular Vehicle Transaction                |                        | J3010 - Cooling System Leak-Analyze                                       | 6,439 MI         |
| 05/04/2006    | 0123070         | ZSET—Service Event                              |                        | M5090 -                                                                   | 10 MI            |
| 04/27/2006    | 0122833         | ZPDI—Pre-Delivery Inspection                    |                        | Z7000 -                                                                   | 1 MI             |

Global Warranty Management Site Map

[Privacy Policy](#) | [Terms of Use](#)

© 2005 General Motors. All rights reserved

[https://gmvis2.gotd.gm.com/gmvis2/showVehicleHistorySummary.do?\\_SEC\\_TOKEN\\_=6...](https://gmvis2.gotd.gm.com/gmvis2/showVehicleHistorySummary.do?_SEC_TOKEN_=6...) 9/10/2012



[Logout](#)

September 10, 2012

Global Warranty Management: Main &gt; Interface With Customer &gt; View Vehicle Build

INTERFACE WITH  
CUSTOMER

## View Vehicle Build

This screen allows IVH users to view the initial build information on the selected VIN including option codes with descriptions (where available)

## Vehicle Information

VIN 1G8AJ55F36Z Model ZAJ69-2006 ION.2 BASE SEDAN  
 Service Contract No Branded Title No Warranty Block No PDI Status: Yes  
 Order Type T - DEALER STOCK  
 Field Actions [Open](#)

## Vehicle Build

Model ZAJ69-2006 ION.2 BASE SEDAN Order Number GFL865  
 Gross Vehicle Weight 0 Build Date 04/12/2006  
 Build Plant 2

For this vehicle:

- [View Vehicle Summary](#)
  - Service Contract
  - Branded Title
  - Warranty Block
- [View Vehicle Build](#)
  - [View Vehicle](#)
  - [Component Summary](#)
  - [View Vehicle](#)
  - [Transaction History Detail](#)
  - [View Vehicle Delivery Information](#)

## Option Codes

\*IVH is not the definitive source of GM Vehicle RPO information and is intended for service reference only. Should there be any questions about the vehicle's original build or RPO information please refer to the original vehicle invoice or window sticker

|                                                                                                                                                         |                                                           |
|---------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------|
| 17C - GREY CLOTH                                                                                                                                        | 171 - GRAY                                                |
| 41L - BLACK                                                                                                                                             | 41U - BLACK ONYX                                          |
| 6AB - SUSPENSION                                                                                                                                        | 7AB - SUSPENSION                                          |
| 8AF - SUSPENSION                                                                                                                                        | 9AF - SUSPENSION                                          |
| A31 - POWER WINDOWS                                                                                                                                     | AG4 - DRIVER SEAT MANUAL HEIGHT ADJ.                      |
| AK5 - DR & PASS SEAT RESTRAINT SYSTEM                                                                                                                   | AR9 - DLXE FRT BKT SEAT                                   |
| AU0 - REMOTE KEYLESS ENTRY W/ALARM                                                                                                                      | B37 - FLOOR MATS FRONT & REAR                             |
| BBC - BODY COLOR APPLIQUES                                                                                                                              | C60 - AIR CONDITIONING W/DUST & POLLEN FILTER             |
| DG7 - PWR. REMOTE EXTERIOR MIRRORS                                                                                                                      | FE1 - SOFT RIDE SUSPENSION SYSTEM                         |
| FE9 - FEDERAL EMISSIONS                                                                                                                                 | FY1 - RATIO - 3.63                                        |
| HAA - PREFERRED PACKAGE: * POWER WINDOWS * REMOTE KEYLESS ENTRY W/ALARM * PWR. REMOTE EXTERIOR MIRRORS * CRUISE CONTROL * DRIVER SEAT MANUAL HEIGHT ADJ | IPC - TRIM INTERIOR DESIGN                                |
| J41 - POWER BRAKE SYSTEM                                                                                                                                | K34 - CRUISE CONTROL                                      |
| K62 - 105 AMP GENERATOR                                                                                                                                 | L61 - 2.2L 4CYL GAS ENGINE                                |
| MN5 - 4 SPEED AUTO TRANS                                                                                                                                | MX0 - MERCHANDISED TRANS AUTO PROVIS                      |
| NK5 - STANDARD STEERING WHEEL                                                                                                                           | NT7 - EMISSION SYSTEM FEDERAL                             |
| P2W - WHEEL COVER, FLUSH SPORT                                                                                                                          | PG1 - STEEL WHEEL 15 X 6                                  |
| QTU - TIRE P195/60R16                                                                                                                                   | R6H - SDS CHARGE                                          |
| R7Y - COMMUNICATIONS PLUS                                                                                                                               | RF3 - MERCHANDISED PKG SATURN                             |
| U1C - AM/FM STEREO W/CD & INPUT JACK                                                                                                                    | UE1 - ONSTAR SERVICE: INCLUDES 1 YEAR SAFE AND SOUND PLAN |
| UH8 - CLUSTER INST, COOL TEMP, TRIP ODOM, TACH                                                                                                          | U58 - FIXED ANTENNA, PAINTED, RADIO                       |
| UX7 - SPEAKER SYSTEM 4                                                                                                                                  | V73 - VEHICLE STATEMENT USA/CANADA                        |

[https://gmvis2.gotd.gm.com/gmvis2/showVehicleBuild.do?\\_SEC\\_TOKEN\\_=6776573468...](https://gmvis2.gotd.gm.com/gmvis2/showVehicleBuild.do?_SEC_TOKEN_=6776573468...) 9/10/2012

TA000129930

**Added Option Codes**

-BA -

-CC -

---

Global Warranty Management Site Map

[Privacy Policy](#) | [Terms of Use](#)

© 2005 General Motors. All rights reserved.

[Logout](#)

Global Warranty

September 10, 2012

Global Warranty Management: Main &gt; Interface With Customer &gt; View Vehicle Component Summary

INTERFACE WITH  
CUSTOMERView Vehicle Component Summary ?

This screen allows IVH users to view the information on various major components added to the VIN selected during vehicle build

## Vehicle Information

VIN: 1G8AJ55F38Z XXXXXXXXXX Model: ZAJ69-2006 ION.2 BASE SEDAN  
 Service Contract: No Branded Title: No Warranty Block: No PDI Status: Yes  
 Order Type: T - DEALER STOCK  
 Field Actions: [0 Open](#) XXXXXXXXXX

For this vehicle:

- [View Vehicle Summary](#)
  - Service Contract
  - Branded Title
  - Warranty Block
- [View Vehicle Build](#)
- [View Vehicle Component Summary](#)
- [View Vehicle Transaction History Detail](#)
- [View Vehicle Delivery Information](#)

## Vehicle Component

|                                                        |                                      |
|--------------------------------------------------------|--------------------------------------|
| Component Code: 10-ENGINE ASSEMBLY                     | Traceability: 604100198              |
| Source Plant: S-                                       | Part / Number Broadcast: TYD         |
| Date Scanned: 04/12/2006                               | Time Scanned: 16:17:00 Scan Station: |
| Component Code: 61-TRANSMISSION                        | Traceability: AFFM TN81              |
| Source Plant: J-HYDRAMATIC WINDSOR, ONTARIO            | Part / Number Broadcast: 6EHJ        |
| Date Scanned: 04/12/2006                               | Time Scanned: 16:17:00 Scan Station: |
| Component Code: 85-ELECTRONIC CONTROL MODULE (ECM)     | Traceability: 0Y7MR                  |
| Source Plant: T-                                       | Part / Number Broadcast: YMZK        |
| Date Scanned: 04/12/2006                               | Time Scanned: 16:17:00 Scan Station: |
| Component Code: 87-BODY CONTROL MODULE                 | Traceability: 813118093              |
| Source Plant: 6-                                       | Part / Number Broadcast: 8901        |
| Date Scanned: 04/12/2006                               | Time Scanned: 16:17:00 Scan Station: |
| Component Code: AB-IR-MODULE ASM-INFLATOR              | Traceability: H098D1303              |
| Source Plant: H-INLAND                                 | Part / Number Broadcast: 2528        |
| Date Scanned: 04/12/2006                               | Time Scanned: 09:57:00 Scan Station: |
| Component Code: AL-JR-MODULE ASM-I/P                   | Traceability: 302096080              |
| Source Plant: H-INLAND                                 | Part / Number Broadcast: 1596        |
| Date Scanned: 04/11/2006                               | Time Scanned: 19:14:00 Scan Station: |
| Component Code: AS-SENSING DIAGNOSTIC MODULE           | Traceability: 260944WBP              |
| Source Plant: K-DELCO ELECTRONICS KOKOMO, IN           | Part / Number Broadcast: 5728        |
| Date Scanned: 04/12/2006                               | Time Scanned: 16:17:00 Scan Station: |
| Component Code: BK-INTERNATIONAL TRANS. CONTROL MODULE | Traceability: 060940186              |
| Source Plant: K-                                       | Part / Number Broadcast: YLXP        |
| Date Scanned: 04/12/2006                               | Time Scanned: 16:17:00 Scan Station: |
| Component Code: CA-SEQ NUM (FLEX) BODY ASM             | Traceability: 875561                 |
| Source Plant: S-                                       | Part / Number Broadcast: Z696        |
| Date Scanned: 04/12/2006                               | Time Scanned: 06:48:00 Scan Station: |
| Component Code: DU---                                  | Traceability: 64061062               |
| Source Plant: 2-                                       | Part / Number Broadcast: 9677        |
| Date Scanned: 04/11/2006                               | Time Scanned: 19:14:00 Scan Station: |

[https://gmvis2.gotd.gm.com/gmvis2/showVehicleComponent.do?\\_SEC\\_TOKEN\\_=67765...](https://gmvis2.gotd.gm.com/gmvis2/showVehicleComponent.do?_SEC_TOKEN_=67765...) 9/10/2012

TA000129932

**Service Agent Installed Component**

---


Vehicle has no current record of vehicle component.

---

Global Warranty Management. Site Map

[Privacy Policy](#) | [Terms of Use](#)

© 2005 General Motors. All rights reserved


[Logout](#)

September 10, 2012

Global Warranty Management: Main &gt; Interface With Customer &gt; View Vehicle Transaction History Detail

INTERFACE WITH  
CUSTOMER

## View Vehicle Transaction History Detail

②

This screen allows IVH users to view the available information on individual transaction for the VIN selected

## Vehicle Information

VIN 1G8AJ55F362 [REDACTED] Model ZAJ69-2008 ION.2 BASE SEDAN  
 Service Contract No [REDACTED] Branded Title No [REDACTED] Warranty Block No [REDACTED] PDI Status Yes  
 Order Type T - DEALER STOCK  
 Field Actions [Open](#) [REDACTED]

For this vehicle:

[View Vehicle Summary](#)

- Service Contract
- Branded Title
- Warranty Block

[View Vehicle Build](#)[View Vehicle](#)[Component Summary](#)[View Vehicle](#)[Transaction History Detail](#)[View Vehicle Delivery Information](#)

Job Card Date: 09/01/2011

Job Card Number: 16044672

Repair Service Agent 163988  
 TODD WENZEL BUICK GMC  
 2727 28TH ST SE  
 GRAND RAPIDS MI 49512-1610  
 6169497700

Odometer Reading 75,092 MI  
 Authorization Code

Process Date  
 09/02/2011

Transaction Type:  
 ZREG—Regular Vehicle  
 Transaction

Transaction Expense Category:  
 Special Policy

Customer Complaint Code  
 0190-Drivability - Other Issues

Job Card Line # 1 Transaction Adjustment Cause Code: 9090-Other - Field Action / Tech Bulletin

Labour Op T5783-10187 - Replace Power Steering Motor Control Module

Causal Part Number 000000000019257879-MOTORKIT,P/SASST(REMANUFACT

[See other Parts and/or Net Items](#)

Job Card Date: 08/19/2011

Job Card Number: 16043775

Repair Service Agent 163988  
 TODD WENZEL BUICK GMC  
 2727 28TH ST SE  
 GRAND RAPIDS MI 49512-1610  
 6169497700

Odometer Reading 74,469 MI  
 Authorization Code: A

Process Date  
 08/24/2011

Transaction Type:  
 ZREG—Regular Vehicle Transaction  
 Transaction Expense Category:  
 Policy

Customer Complaint Code  
 0126-Drivability - Noise

Job Card Line # 4 Transaction Adjustment Cause Code: 6051-Module/Component - Leaks

Labour Op E3851-Strut, Front - Left - Replace

Causal Part Number 000000000022707167-STRUTKIT,FRTSUSP

[See other Parts and/or Net Items](#)

Job Card Date: 08/19/2011

Job Card Number: 16043775

Repair Service Agent 183998  
TODD WENZEL BUICK GMC  
2727 28TH ST SE  
GRAND RAPIDS MI 49512-1610  
6169497700

Odometer Reading 74,469 MI  
Authorization Code A

Process Date  
08/24/2011

Transaction Type  
ZREG—Regular Vehicle Transaction  
Transaction Expense Category  
Policy

Customer Complaint Code  
0126-Drivability - Noise

Job Card Line #: 3 Transaction Adjustment Cause Code: 6025-Module/Component - Loose

Labour Op E3551-Bushings And/Or Shaft, Front Control Arm - Lower - Left - Replace

Causal Part Number 000000000025984679-BUSHING-FRTLWRCONTARM

--See other Parts and/or Net Items

Job Card Date: 07/01/2011

Job Card Number: 16040206

Repair Service Agent 183998  
TODD WENZEL BUICK GMC  
2727 28TH ST SE  
GRAND RAPIDS MI 49512-1610  
6169497700

Odometer Reading 72,383 MI  
Authorization Code

Process Date  
07/01/2011

Transaction Type  
ZREG—Regular Vehicle  
Transaction  
Transaction Expense Category  
Special Policy

Customer Complaint Code  
0190-Drivability - Other Issues

Job Card Line #: 1 Transaction Adjustment Cause Code: 9090-Other - Field Action / Tech Bulletin

Labour Op T5721-09014 - Engine Control Module - Emission Related Reprogramming

Causal Part Number

--See other Parts and/or Net Items

Job Card Date: 03/15/2010

Job Card Number: 2302803

Repair Service Agent 164999  
SATURN OF GRAND RAPIDS  
2720 28TH STREET SE  
GRAND RAPIDS MI 49512-1621  
6169496550000

Odometer Reading 56,821 MI  
Authorization Code

Process Date  
03/15/2010

Transaction Type  
ZPTI—Part Transaction - Service Agent  
Installed

Transaction Expense Category  
Service Agent Installed Parts Warranty

Customer Complaint Code  
0321-Engine/Fuel/Exhaust - "Check  
Engine" Light

Job Card Line #: 2 Transaction Adjustment Cause Code: 6031-Module/Component - Poor Fits

Labour Op L1020-Fuel Tank Filter Cap Replacement

[https://gmvis2.gotd.gm.com/gmvis2/showClaimHistoryDetail.do?\\_SEC\\_TOKEN\\_=67765...](https://gmvis2.gotd.gm.com/gmvis2/showClaimHistoryDetail.do?_SEC_TOKEN_=67765...) 9/10/2012

Causal Part Number 00000000010372248-CAPASM-F/TNKFIL

--See other Parts and/or Net Items

Job Card Date: 11/20/2008

Job Card Number: Z17877

Repair Service Agent 207631

Odometer Reading: 0 MI

GM SATURN ROADSIDE ASSISTANCE/CCAS

Authorization Code

ONE CABOT RD

MEDFORD MA 02155-5117

Process Date  
12/26/2008Transaction Type  
ZREG—Regular Vehicle TransactionTransaction Expense Category  
Customer EnthusiasmCustomer Complaint Code  
0000-Converted Claim

Job Card Line # 1 Transaction Adjustment Cause Code: 0000-Converted Claims

Labour Op Z8025-ONSTAR - FLAT TIRE

Causal Part Number

--See other Parts and/or Net Items

Job Card Date: 11/11/2008

Job Card Number: 2281897

Repair Service Agent 164999

Odometer Reading 40,356 MI

SATURN OF GRAND RAPIDS

Authorization Code

2720 28TH STREET SE

GRAND RAPIDS MI 49512-1821

61694965550000

Process Date  
11/11/2008Transaction Type  
ZSET—Service EventTransaction Expense Category  
Service Event

Customer Complaint Code:

-

Job Card Line # 2 Transaction Adjustment Cause Code: -

Labour Op M5005-TOP OFF ALL FLUIDS

Causal Part Number

--See other Parts and/or Net Items

Job Card Date: 11/11/2008

Job Card Number: 2281897

Repair Service Agent 164999

Odometer Reading 40,356 MI

SATURN OF GRAND RAPIDS

Authorization Code

2720 28TH STREET SE

GRAND RAPIDS MI 49512-1821

61694965550000

Process Date  
11/11/2008Transaction Type  
ZSET—Service EventTransaction Expense Category  
Service Event

Customer Complaint Code:

-

Job Card Line # 1 Transaction Adjustment Cause Code: -

## Labour Op M5105-BRAKE INSPECTION (FLUID CHECK)

Causal Part Number

•See other Parts and/or Net Items

Job Card Date: 05/29/2008

Job Card Number: 2273830

Repair Service Agent 164999  
SATURN OF GRAND RAPIDS  
2720 28TH STREET SE  
GRAND RAPIDS MI 49512-1621  
61694965550000

Odometer Reading 32,174 MI  
Authorization Code

Process Date  
05/29/2008

Transaction Type  
ZSET—Service Event

Transaction Expense Category:

Customer Complaint Code

-

Job Card Line # 1

Transaction Adjustment

Cause Code -

Labour Op M5005-TOP OFF ALL FLUIDS

Causal Part Number

•See other Parts and/or Net Items

Job Card Date: 05/01/2008

Job Card Number: 2272507

Repair Service Agent 164999  
SATURN OF GRAND RAPIDS  
2720 28TH STREET SE  
GRAND RAPIDS MI 49512-1621  
61694965550000

Odometer Reading 30,360 MI  
Authorization Code

Process Date  
05/02/2008

Transaction Type  
ZREG—Regular Vehicle Transaction  
Transaction Expense Category  
Warranty

Customer Complaint Code  
0321-Engine/Fuel/Exhaust - "Check  
Engine" Light

Job Card Line # 1

Transaction Adjustment: Cause Code: 3067-Rotating Part - Resonance /  
from foreign part

Labour Op J6354-Powertrain Control Module Engine Reprogramming with SPS

Causal Part Number

Job Card Date: 04/07/2008

Job Card Number: 0271333

Repair Service Agent 164999  
SATURN OF GRAND RAPIDS  
2720 28TH STREET SE  
GRAND RAPIDS MI 49512-1621  
61694965550000

Odometer Reading 28,528 MI  
Authorization Code

Process Date  
04/07/2008

Transaction Type  
ZREG—Regular Vehicle  
Transaction

Transaction Expense Category  
Warranty



## Customer Complaint Code

0421-Exterior - FIV/Finish

Job Card Line # 1

Transaction Adjustment

Cause Code: 1011-Surface (exterior) -  
Alignment/Adjustment

Labour Op C0180-Regulator, Front Door Window - Right Manual - R&amp;R Or Replace

Causal Part Number 00000000021008318-NUT

-See other Parts and/or Net Items

Job Card Date: 12/28/2007

Job Card Number: 0266933

Repair Service Agent: 164999

Odometer Reading: 23,873 MI

SATURN OF GRAND RAPIDS

Authorization Code

2120 28TH STREET SE

GRAND RAPIDS MI 49512-1621

61694865550000

Process Date

12/28/2007

Transaction Type:

ZSET---Service Event

Transaction Expense Category

Customer Complaint Code:

-

Job Card Line # 1

Transaction Adjustment

Cause Code -

Labour Op M5005-TOP OFF ALL FLUIDS

Causal Part Number

-See other Parts and/or Net Items

Job Card Date: 10/05/2007

Job Card Number: P91834

Repair Service Agent: 207531

Odometer Reading: 20,223 MI

GM SATURN ROADSIDE ASSISTANCE/CCAS

Authorization Code: C

ONE CABOT RD

MEDFORD MA 02155-5117

Process Date

10/12/2007

Transaction Type:

ZREG---Regular Vehicle Transaction

Transaction Expense Category:

Customer Complaint Code:

0000-Converted Claim

Job Card Line # 1

Transaction Adjustment

Cause Code: 0000-Converted Claims

Labour Op Z4535-ROADSIDE SERVICE (FLAT TIRE) - SATURN U.S.

Causal Part Number

-See other Parts and/or Net Items

Job Card Date: 10/05/2007

Job Card Number: 0232795

Repair Service Agent: 164180

Odometer Reading: 20,227 MI

SATURN OF OKEMOS

Authorization Code

1728 GRAND RIVER AVE

OKEMOS MI 48864-5825

51734778900000

Process Date:

11/21/2007

Transaction Type:

ZSET---Service Event

Transaction Expense Category

## Customer Complaint Code:

0000-Converted Claim

Job Card Line #: 1

Transaction Adjustment:

Cause Code: -

Labour Op M5120-

Causal Part Number

Job Card Date: 06/21/2007

Job Card Number: 0258489

Repair Service Agent: 164999

Odometer Reading: 14,808 MI

SATURN OF GRAND RAPIDS

Authorization Code:

2720 28TH STREET SE

GRAND RAPIDS MI 49512-1621

61694865550000

## Process Date:

11/21/2007

Transaction Type:

ZSET—Service Event

Transaction Expense Category:

Customer Complaint Code:

0000-Converted Claim

Job Card Line #: 2

Transaction Adjustment:

Cause Code: -

Labour Op M5005-

Causal Part Number

--See other Parts and/or Not Items

Job Card Date: 06/21/2007

Job Card Number: 0258489

Repair Service Agent: 164889

Odometer Reading: 14,808 MI

SATURN OF GRAND RAPIDS

Authorization Code:

2720 28TH STREET SE

GRAND RAPIDS MI 49512-1621

61694865550000

## Process Date:

06/21/2007

Transaction Type:

ZREG—Regular Vehicle Transaction

Transaction Expense Category:

Customer Complaint Code:

0000-Converted Claim

Job Card Line #: 1

Transaction Adjustment:

Cause Code: 0000-Converted Claims

Labour Op B7611-Molding, Windshield Side Roof Rail Drip - Left - R&amp;R Or Replace

Causal Part Number

Job Card Date: 05/14/2007

Job Card Number: 0258696

Repair Service Agent: 164889

Odometer Reading: 11,880 MI

SATURN OF GRAND RAPIDS

Authorization Code:

2720 28TH STREET SE

GRAND RAPIDS MI 49512-1621

61694865550000

## Process Date:

05/14/2007

Transaction Type:

ZREG—Regular Vehicle Transaction

Transaction Expense Category:

Customer Complaint Code:

0000-Converted Claim

Job Card Line #: 1

Transaction Adjustment:

Cause Code: 0000-Converted Claims

Labour Op C0183-Front Side Door Window Regulator Replacement - Left Side  
Causal Part Number

---

---

|                           |                          |
|---------------------------|--------------------------|
| Job Card Date: 02/05/2007 | Job Card Number: 0252233 |
|---------------------------|--------------------------|

|                                                                                                                              |                                                 |
|------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------|
| Repair Service Agent 184989<br>SATURN OF GRAND RAPIDS<br>2720 28TH STREET SE<br>GRAND RAPIDS MI 49512-1821<br>61694985550000 | Odometer Reading 7,021 MI<br>Authorization Code |
|------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------|

---

Process Date:  
11/21/2007

Transaction Type:  
ZSET---Service Event

Transaction Expense Category

Customer Complaint Code  
0000-Converted Claim

|                   |                        |              |
|-------------------|------------------------|--------------|
| Job Card Line # 5 | Transaction Adjustment | Cause Code - |
|-------------------|------------------------|--------------|

Labour Op M5005-

Causal Part Number

-See other Parts and/or Net Items

---

---

|                           |                          |
|---------------------------|--------------------------|
| Job Card Date: 02/05/2007 | Job Card Number: 0252233 |
|---------------------------|--------------------------|

|                                                                                                                              |                                                  |
|------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------|
| Repair Service Agent 184989<br>SATURN OF GRAND RAPIDS<br>2720 28TH STREET SE<br>GRAND RAPIDS MI 49512-1821<br>61694985550000 | Odometer Reading: 7,021 MI<br>Authorization Code |
|------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------|

---

Process Date  
11/21/2007

Transaction Type:  
ZSET---Service Event

Transaction Expense Category

Customer Complaint Code  
0000-Converted Claim

|                    |                        |               |
|--------------------|------------------------|---------------|
| Job Card Line #: 4 | Transaction Adjustment | Cause Code: - |
|--------------------|------------------------|---------------|

Labour Op M5025-

Causal Part Number

---

---

|                           |                          |
|---------------------------|--------------------------|
| Job Card Date: 02/05/2007 | Job Card Number: 0252233 |
|---------------------------|--------------------------|

|                                                                                                                              |                                                  |
|------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------|
| Repair Service Agent 184989<br>SATURN OF GRAND RAPIDS<br>2720 28TH STREET SE<br>GRAND RAPIDS MI 49512-1821<br>61694985550000 | Odometer Reading: 7,021 MI<br>Authorization Code |
|------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------|

---

Process Date  
02/08/2007

Transaction Type:  
ZREG---Regular Vehicle Transaction

Transaction Expense Category

Customer Complaint Code  
0000-Converted Claim

|                    |                        |                                   |
|--------------------|------------------------|-----------------------------------|
| Job Card Line #: 3 | Transaction Adjustment | Cause Code: 0000-Converted Claims |
|--------------------|------------------------|-----------------------------------|

Labour Op Z4632-2-DAY CAR RENTAL - SATURN U.S.

Causal Part Number

---

→ See other Parts and/or Net Items

Job Card Date: 02/05/2007

Job Card Number: 0252233

Repair Service Agent: 184999  
SATURN OF GRAND RAPIDS  
2720 28TH STREET SE  
GRAND RAPIDS MI 49512-1621  
61694965550000

Odometer Reading: 7,021 MI  
Authorization Code:

Process Date  
02/08/2007

Transaction Type  
ZREG—Regular Vehicle Transaction

Transaction Expense Category

Customer Complaint Code  
0000-Converted Claim

Job Card Line #: 2

Transaction Adjustment:

Cause Code: 0000-Converted Claims

Labour Op J6354-Powertrain Control Module Engine Reprogramming with SPS

Causal Part Number

Job Card Date: 01/15/2007

Job Card Number: 0251368

Repair Service Agent: 164999  
SATURN OF GRAND RAPIDS  
2720 28TH STREET SE  
GRAND RAPIDS MI 49512-1621  
61694965550000

Odometer Reading: 5,439 MI  
Authorization Code:

Process Date  
01/15/2007

Transaction Type  
ZREG—Regular Vehicle Transaction

Transaction Expense Category

Customer Complaint Code  
0000-Converted Claim

Job Card Line #: 1

Transaction Adjustment:

Cause Code: 0000-Converted Claims

Labour Op J3010-Cooling System Leak-Analyze

Causal Part Number

Job Card Date: 05/04/2006

Job Card Number: 0123070

Repair Service Agent: 160723  
SATURN OF FLINT  
2430 DUTCHER ROAD  
FLINT MI 48532-4421  
81072088000000

Odometer Reading: 10 MI  
Authorization Code:

Process Date  
11/20/2007

Transaction Type  
ZSET—Service Event

Transaction Expense Category

Customer Complaint Code  
0000-Converted Claim

Job Card Line #: 1

Transaction Adjustment:

Cause Code: -

Labour Op M5090-

Causal Part Number

---

Job Card Date: 04/27/2006

Job Card Number: 0122833

Repair Service Agent: 180723  
SATURN OF FLINT  
2430 DUTCHER ROAD  
FLINT MI 48532-4421  
81072088000000Odometer Reading: 1 MI  
Authorization Code:

---

Process Date:  
11/20/2007Transaction Type:  
ZPD—Pre-Delivery Inspection  
Transaction Expense Category:Customer Complaint Code:  
0000-Converted Claim

Job Card Line #: 1

Transaction Adjustment:

Cause Code: -

Labour Op Z7000-


Causal Part Number

→ See other Parts and/or Net Items

---

Global Warranty Management Site Map[Privacy Policy](#) | [Terms of Use](#)

© 2005 General Motors. All rights reserved.

[Logout](#)

September 10, 2012

Global Warranty Management: Main &gt; Interface With Customer &gt; View Vehicle Delivery Information

INTERFACE WITH  
CUSTOMERView Vehicle Delivery Information ?

This screen allows IVH users to view the available information for the selected VIN delivered to the Service Agent and the ultimate customer. Not all sections will be populated for all VINs.

## Vehicle Information

VIN 1G8AJ55F36Z  
Service Contract: No    Branded Title: No    Warranty Block: No    PDI Status: Yes  
Order Type: T - DEALER STOCK  
Field Actions: [Open](#)

Model: ZAJ69-2006 ION.2 BASE SEDAN

## Invoice Information

Invoicing Service Agent: 160723  
SATURN OF FLINT  
2430 DUTCHER ROAD  
FLINT MI 48532-4421 81072088000000

Invoice Date: 05/06/2006

## Ship to Information

Ship to Service Agent: 160723  
SATURN OF FLINT  
2430 DUTCHER ROAD  
FLINT MI 48532-4421 81072088000000

Ship to Date: N/A

## Delivery Information

Delivery Service Agent: 160723  
SATURN OF FLINT  
2430 DUTCHER ROAD  
FLINT MI 48532-4421 81072088000000

Delivery Date: 05/06/2006  
Delivery Type:  
Delivery Odometer: 11

## In Service Information

Invoicing Service Agent: 2211085

In Service Date: N/A  
In Service Type: 0000  
In Service Odometer: 0

## Registration Information

Registration Service Agent: N/A

Registration Date: N/A  
Registration Number: N/A  
Registration Odometer: 0

For this vehicle:

[View Vehicle Summary](#)

- Service Contract
- Branded Title
- Warranty Block

[View Vehicle Build](#)[View Vehicle](#)[Component Summary](#)[View Vehicle](#)[Transaction History](#)[Detail](#)[View Vehicle Delivery](#)[Information](#)

Global Warranty Management Site Map

[Privacy Policy](#) | [Terms of Use](#)

© 2005 General Motors. All rights reserved.



**esis**

ESIS/GM Central Claims Unit  
P.O. Box 300  
Mail Code 482 C19 B61  
Detroit, MI 48265-3000

800.888.0164 *tel*  
313.665.0911 *fax*

**Lawrence Harrington**  
*Claim Administrator*

October 8, 2012

[REDACTED]  
GRAND RAPIDS, MI [REDACTED]

RE: Claimant: [REDACTED]  
Our File No.: 747261  
Our Client: General Motors LLC  
Date/Event: 8/29/2012  
Vehicle: 2006 SATURN ION 2  
VIN: 1G8AJ55F36Z [REDACTED]

Dear [REDACTED]:

This will confirm that we have completed our review of your claim regarding alleged defects to the 2006 SATURN ION 2. At this time, based on all documentation received and reviewed, ESIS, on behalf of General Motors LLC, will not be in a position to honor your request for damages. If you have any additional evidence that supports your claim of a product defect, please forward it to my attention for further review.

Also, you have an obligation and responsibility to ensure that the subject vehicle and its related components are maintained and preserved in their immediate post-incident condition for as long as you intend to pursue a claim and/or cause of action.

Sincerely,

*Lawrence Harrington*

Lawrence Harrington

**IMPORTANT NOTICE:** Robert Bosch LLC and the manufacturers whose vehicles are accessible using the CDR System urge end users to use the latest production release of the Crash Data Retrieval system software when viewing, printing or exporting any retrieved data from within the CDR program. Using the latest version of the CDR software is the best way to ensure that retrieved data has been translated using the most current information provided by the manufacturers of the vehicles supported by this product.

### CDR File Information

|                            |                                       |
|----------------------------|---------------------------------------|
| User Entered VIN           | 1G8AJ55F36Z [REDACTED]                |
| User                       | Bailey                                |
| Case Number                | 747261                                |
| EDR Data Imaging Date      | 09/17/2012                            |
| Crash Date                 | 08/29/2012                            |
| Filename                   | GANT 1G8AJ55F36Z [REDACTED] ACM.CDRX  |
| Saved on                   | Monday, September 17 2012 at 11:16:46 |
| Collected with CDR version | Crash Data Retrieval Tool 6.0         |
| Reported with CDR version  | Crash Data Retrieval Tool 6.0         |
| EDR Device Type            | Airbag Control Module                 |
| Event(s) recovered         | Non-Deployment                        |

### Comments

Method used to download: DLC  
Powered by: Vehicle Battery  
Location: [REDACTED] Grand Rapids, MI  
Present: Self & Owner  
Mileage: 87,932  
Lamp test results: On at ignition, flashes, then off

### Data Limitations

#### Recorded Crash Events:

There are two types of Recorded Crash Events. The first is the Non-Deployment Event. A Non-Deployment Event records data but does not deploy the air bag(s). It contains Pre-Crash and Crash data. The SDM can store up to one Non-Deployment Event. This event may be overwritten by another Non-Deployment Event. This event will be cleared by the SDM, after approximately 250 ignition cycle. This event can be overwritten by a second Deployment Event, referred to as a Deployment Level Event, if the Non-Deployment Event is not locked. The data in the Non-Deployment Event file will be locked, if the Non-Deployment Event occurred within five seconds before a Deployment Event. A locked Non-Deployment Event cannot be overwritten or cleared by the SDM.

The second type of SDM recorded crash event is the Deployment Event. It also contains Pre-Crash and Crash data. The SDM can store up to two different Deployment Events, if they occur within five seconds of one another. If a Deployment Level Event occurs within five seconds after the Deployment Event, the Deployment Level Event will overwrite any non-locked Non-Deployment Event. Deployment Events cannot be overwritten or cleared by the SDM. Once the SDM has deployed an air bag, the SDM must be replaced.

#### Data:

-SDM Recorded Vehicle Longitudinal Velocity Change reflects the change in longitudinal velocity that the sensing system experienced during the recorded portion of the event. SDM Recorded Vehicle Longitudinal Velocity Change is the change in velocity during the recording time and is not the speed the vehicle was traveling before the event, and is also not the Barrier Equivalent Velocity. For Deployment Events, the SDM will record 100 milliseconds of data after Deployment criteria is met and up to 50 milliseconds before Deployment criteria is met. For Non-Deployment Events, the SDM can record up to the first 150 milliseconds of data after algorithm enable. Velocity Change data is displayed in SAE sign convention.

-Event Recording Complete will indicate if data from the recorded event has been fully written to the SDM memory or if it has been interrupted and not fully written.

-SDM Recorded Vehicle Speed accuracy can be affected by various factors, including but not limited to the following:

- Significant changes in the tire's rolling radius
- Final drive axle ratio changes
- Wheel lockup and wheel slip

-Brake Switch Circuit Status indicates the open/closed state of the brake switch circuit.

-Pre-Crash data is recorded asynchronously.

-Pre-Crash Electronic Data Validity Check Status indicates "Data Invalid" if:

- The SDM receives a message with an "invalid" flag from the module sending the pre-crash data
- No data is received from the module sending the pre-crash data
- No module present to send the pre-crash data

-Driver's Belt Switch Circuit Status indicates the status of the driver's seat belt switch circuit. If the vehicle's electrical



system is compromised during a crash, the state of the Driver's Belt Switch Circuit may be reported other than the actual state.

-The Time between Non-Deployment to Deployment Events is displayed in seconds. If the time between the two events is greater than five seconds, "N/A" is displayed in place of the time.

-If power to the SDM is lost during a crash event, all or part of the crash record may not be recorded.

-All data should be examined in conjunction with other available physical evidence from the vehicle and scene.

**Data Source:**

All SDM recorded data is measured, calculated, and stored internally, except for the following:

-Vehicle Speed, Engine Speed, and Percent Throttle data are transmitted by the Powertrain Control Module (PCM), via the vehicle's communication network, to the SDM.

-Brake Switch Circuit Status data is transmitted by either the ABS module or the PCM, via the vehicle's communication network, to the SDM. Depending on vehicle option content, the Brake Switch Circuit Status data may not be available.

-The SDM may obtain Belt Switch Circuit Status data a number of different ways, depending on the vehicle architecture. Some switches are wired directly to the SDM, while others may obtain the data from various vehicle control modules, via the vehicle's communication network.


01014\_SDMDW\_r003

### System Status At Non-Deployment

|                                                                 |           |
|-----------------------------------------------------------------|-----------|
| SIR Warning Lamp Status                                         | OFF       |
| Driver's Belt Switch Circuit Status                             | BUCKLED   |
| Passenger Belt Switch Circuit Status (If Equipped)              | UNBUCKLED |
| Driver Seat Position Status (If Equipped)                       | Forward   |
| Passenger Seat Position Status (If Equipped)                    | Forward   |
| Ignition Cycles At Non-Deployment                               | 18211     |
| Ignition Cycles At Investigation                                | 18236     |
| Maximum SDM Recorded Velocity Change (MPH)                      | -10.44    |
| Algorithm Enable to Maximum SDM Recorded Velocity Change (msec) | 250       |
| A Deployment was Commanded Prior to this Event                  | No        |
| Event Recording Complete                                        | Yes       |

| Seconds Before<br>AE | Vehicle Speed<br>(MPH) | Engine Speed<br>(RPM) | Percent Throttle |
|----------------------|------------------------|-----------------------|------------------|
| -5                   | 50                     | 1792                  | 16               |
| -4                   | 50                     | 1728                  | 0                |
| -3                   | 47                     | 1600                  | 0                |
| -2                   | 37                     | 1280                  | 0                |
| -1                   | 22                     | 704                   | 0                |

| Seconds Before<br>AE | Brake Switch<br>Circuit State |
|----------------------|-------------------------------|
| -8                   | OFF                           |
| -7                   | OFF                           |
| -6                   | OFF                           |
| -5                   | OFF                           |
| -4                   | ON                            |
| -3                   | ON                            |
| -2                   | ON                            |
| -1                   | ON                            |

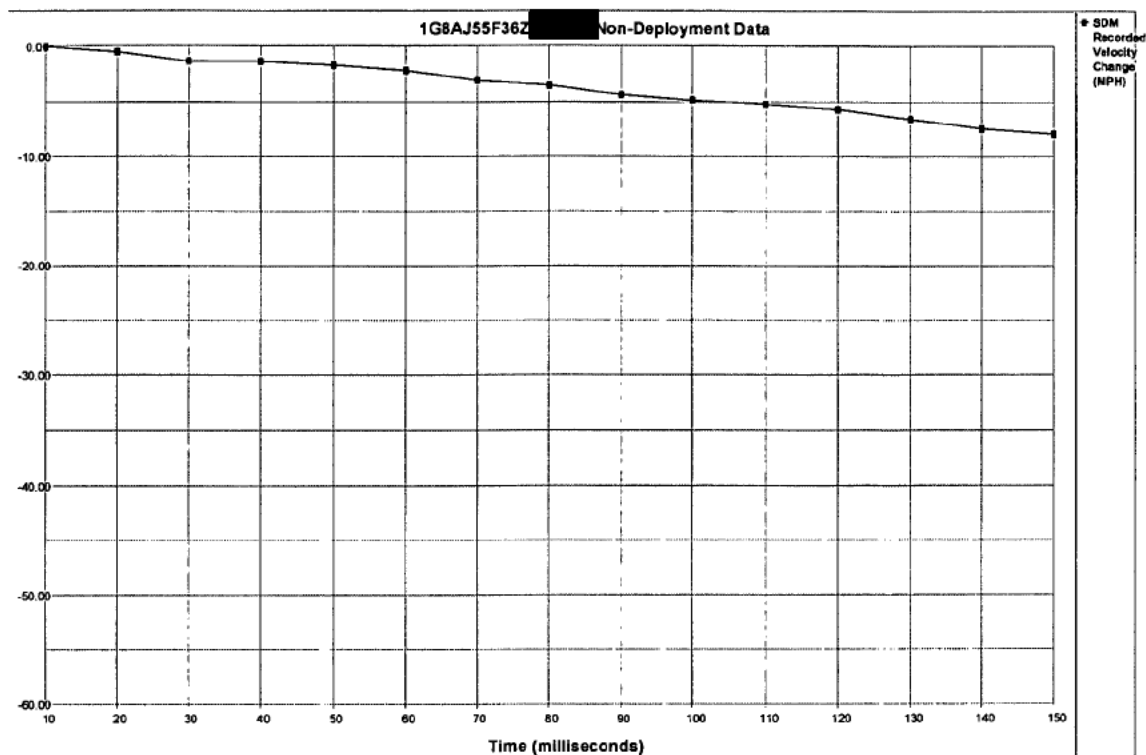

| Time (milliseconds)          | 10   | 20    | 30    | 40    | 50    | 60    | 70    | 80    | 90    | 100   | 110   | 120   | 130   | 140   | 150   |
|------------------------------|------|-------|-------|-------|-------|-------|-------|-------|-------|-------|-------|-------|-------|-------|-------|
| SDM Recorded Velocity Change | 0.00 | -0.44 | -1.32 | -1.32 | -1.76 | -2.19 | -3.07 | -3.51 | -4.39 | -4.83 | -5.27 | -5.70 | -6.58 | -7.46 | -7.90 |

## Hexadecimal Data

Data that the vehicle manufacturer has specified for data retrieval is shown in the hexadecimal data section of the CDR report. The hexadecimal data section of the CDR report may contain data that is not translated by the CDR program. The control module contains additional data that is not retrievable by the CDR system.

```
$01 A0 3B 00 00 00 00
$02 AB C7 00 00 00 00
$03 41 53 36 30 39 34
$04 4B 34 57 42 50 32
$05 02 41 00 00 C3 00
$06 22 72 57 28 00 00
$10 F7 18 F0 00 00 00
$11 96 00 00 00 00 84
$12 60 40 FF FF 00 00
$13 0A 00 00 00 00 00
$14 F3 04 ED 05 50 00
$18 84 84 84 4A FF 00
$1C 38 FA 41 FA FA FA
$1D FA 38 FA 41 FA FA
$1E FA FA 00 00 00 00
$1F 00 05 00 00 00 00
$20 40 00 00 11 FE 00
$21 FF FF FF FF FF FF
$22 FF FF FF FF 00 00
$23 00 01 03 03 04 05
$24 07 08 0A 0B 0C 0D
$25 0F 11 12 00 00 00
$26 24 3B 4B 51 51 F0
$27 00 00 00 00 29 00
$28 0B 14 19 1B 1C 00
$29 F7 1B F8 00 00 00
$2A 00 00 00 00 00 00
$2B 00 00 00 00 00 00
$2C 00 00 FF 2A 02 FA
$2D 00 00 00 00 00 00
$2E 00 00 22 00 00 00
$30 FF FF FF FF FF 00
$31 FF FF FF FF FF FF
$32 FF FF FF FF 00 00
$33 FF FF FF FF FF FF
$34 FF FF FF FF FF FF
$35 FF FF FF FF FF FF
$36 FF FF FF FF FF FF
$37 FF FF FF FF FF FF
$38 FF FF FF FF FF 00
$39 FF FF FF FF FF FF
$3A FF FF FF FF FF 00
$3B FF FF FF FF 00 00
$3C FF FF FF FF FF FF
$3D FF FF FF FF 00 00
$3E FF FF FF 00 00 00
$40 FF FF FF FF FF 00
$41 FF FF FF FF FF FF
$42 FF FF FF FF 00 00
$43 FF FF FF 00 00 00
$44 FF 00 00 00 00 00
$50 00 00 00 00 6C 43
$51 64 AA 00 00 00 00
```

\$60 FF FF FF FF FF FF  
\$61 FF 00 00 00 00 00

### **Disclaimer of Liability**

The users of the CDR product and reviewers of the CDR reports and exported data shall ensure that data and information supplied is applicable to the vehicle, vehicle's system(s) and the vehicle ECU. Robert Bosch LLC and all its directors, officers, employees and members shall not be liable for damages arising out of or related to incorrect, incomplete or misinterpreted software and/or data. Robert Bosch LLC expressly excludes all liability for incidental, consequential, special or punitive damages arising from or related to the CDR data, CDR software or use thereof.

# Tech2

**32 Megabyte**

*CANdi Module Attached*

Press [ENTER] to continue.  
Software Version: 32.006  
North American Operations

## Main Menu

**F0: Diagnostics**

F1: Service Programming System

F2: View Captured Data

F3: GM Performance Parts Diagnostics

F4: Tool Options

F5: Getting Started

## Vehicle Identification

Select one of the following  
Model Year(s)

(D) 2013

(C) 2012

(B) 2011

(A) 2010

(9) 2009

(8) 2008

(7) 2007

(6) 2006

(5) 2005

8 / 23 —

(6) 2006

## Vehicle Identification

Select one of the following  
Vehicle Type(s)

Passenger Car

LD Trk, MPV, Incomplete

Medium Duty Truck

Workhorse

1 / 4 —

Passenger Car

## Vehicle Identification

Select one of the following  
Product Make(s)

- (S) Daewoo
- (K) Daewoo
- (1) Chevrolet
- (2) Pontiac
- (4) Buick
- (6) Cadillac
- (8) Saturn

7 / 7

- (8) Saturn

## Diagnostics

- (6) 2006 Passenger Car
- (8) Saturn

F0: Powertrain

F1: Body

F2: Chassis

F3: Diagnostic Circuit Check



## Body

F0: Body Control Module  
F1: Digital Radio Receiver  
F2: Instrument Panel Cluster  
F3: Passenger Presence System  
F4: Radio  
F5: Supplemental Inflatable Restraint  
F6: Vehicle Comm. Interface Module

## Supplemental Inflatable Restraint

F0: Diagnostic Trouble Codes (DTC)  
F1: Data Display  
F2: Snapshot  
F3: Module ID Information  
F4: Module Setup

## Diagnostic Trouble Codes (DTC)

**F0: DTC Information**

**F1: Clear DTC Information**

## DTC Information

**F0: History Diagnostic Trouble Code(s)**

**F1: Test not Pass Since Code Cleared**

**F2: Current Diagnostic Trouble Code(s)**

## Diagnostic Trouble Codes History

No Diagnostic Trouble Codes.

## DTC Information

F0: History Diagnostic Trouble Code(s)

F1: Test not Pass Since Code Cleared

F2: Current Diagnostic Trouble Code(s)

## **Diagnostic Trouble Codes**

### **Current**

**No Diagnostic Trouble Codes.**

## **Supplemental Inflatable Restraint**

**F0: Diagnostic Trouble Codes (DTC)**

**F1: Data Display**

**F2: Snapshot**

**F3: Module ID Information**

**F4: Module Setup**

# Data Display

F0: Data

F1: System Configuration

## Data

|                         |             |
|-------------------------|-------------|
| Battery Voltage Signal  | 12.00 Volts |
| ADS A/D                 | 10.38 Volts |
| Driver Seat Belt Switch | Unbuckled   |

1 / 3

Battery Voltage Signal

Select  
Items

Quick  
Snapshot

More

## Data

|                                 |             |
|---------------------------------|-------------|
| Battery Voltage Signal          | 12.00 Volts |
| IDS A/D                         | 10.38 Volts |
| Driver Seat Belt Switch Buckled |             |

1 / 3

Battery Voltage Signal

Select  
Items

Quick  
Snapshot

More