


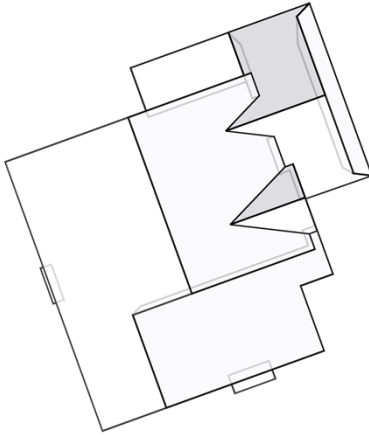

In this 3D model, facets appear as semi-transparent to reveal overhangs.

Contents

Lengths	1
Pitch (Degrees)	2
Pitch (on 12)	3
Rafters	4
Azimuth	5
Area	6
Roof Obstructions	7
Imagery	8
Roofing Report Summary	11

Property Address

3021 Carrington Ln
Lawrence, KS 66049

Measurements

Area:	2058.2 sq ft
Roof Facets:	11
Predominant Pitch:	27°
Number of Stories:	>1
Ridges/Hips:	68.4 ft
Valleys:	37.4 ft
Rakes:	180.4 ft
Eaves:	137.6 ft
Estimated Attic:	1769.3 sq ft
Roof Obstructions:	10
Roof Obstructions Perimeter:	38 ft
Roof Obstructions Area:	10 sq ft

Prepared for


Jesse Pacheco
Cromwell Solar
615 Vermont St
Lawrence, KS 66044
785-841-4612

Lengths


Ridges = 63 ft
Hips = 5.4 ft
Valleys = 37.4 ft

Rakes = 180.4 ft
Eaves = 137.6 ft
Flashing = 48.9 ft

Step flashing = 59.7 ft
Parapets = 0 ft

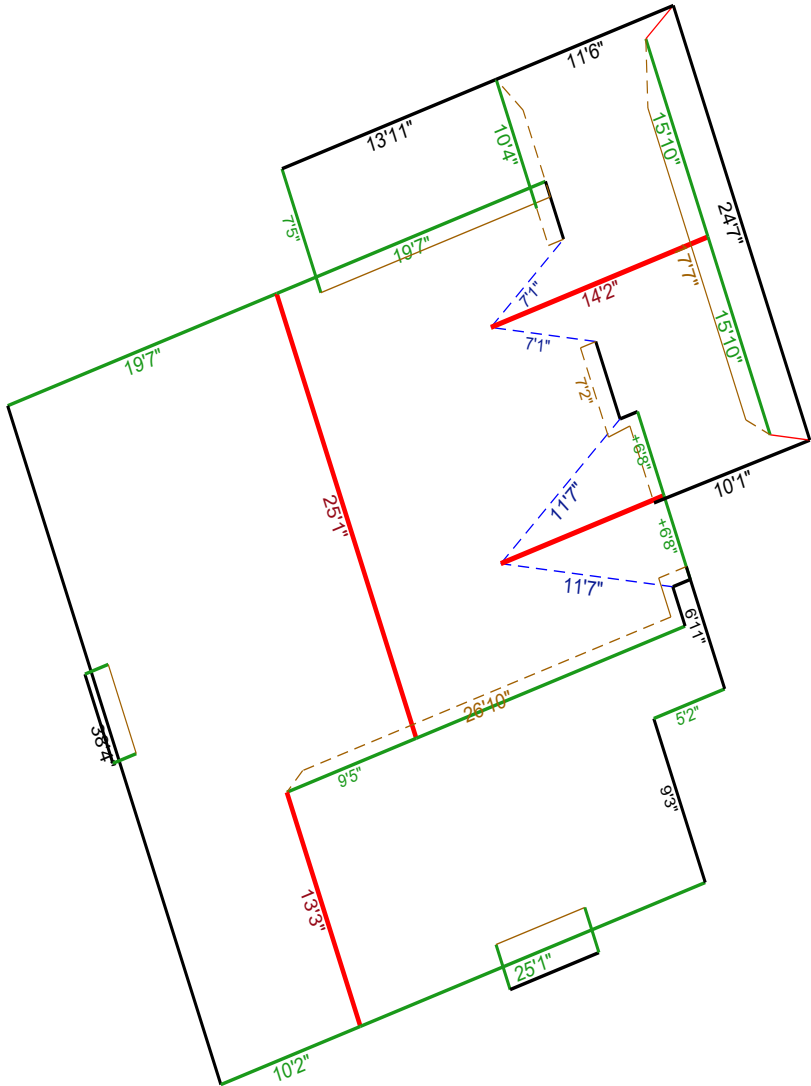


© 2025 Eagle View Technologies, Inc., All Rights Reserved.

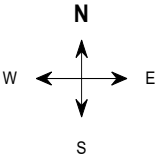

September 30, 2025
Property Address:
3021 Carrington Ln, Lawrence, KS 66049
Report: 67672828



Pitches are labeled for facet areas larger than 20 square feet. In some cases, pitch labels have been removed for readability. Flat facets are labeled 'F'.

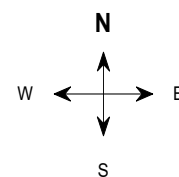


© 2025 Eagle View Technologies, Inc., All Rights Reserved.




Pitch (on 12)

Pitches are labeled for facet areas larger than 20 square feet. In some cases, pitch labels have been removed for readability. Flat facets are labeled 'F'.

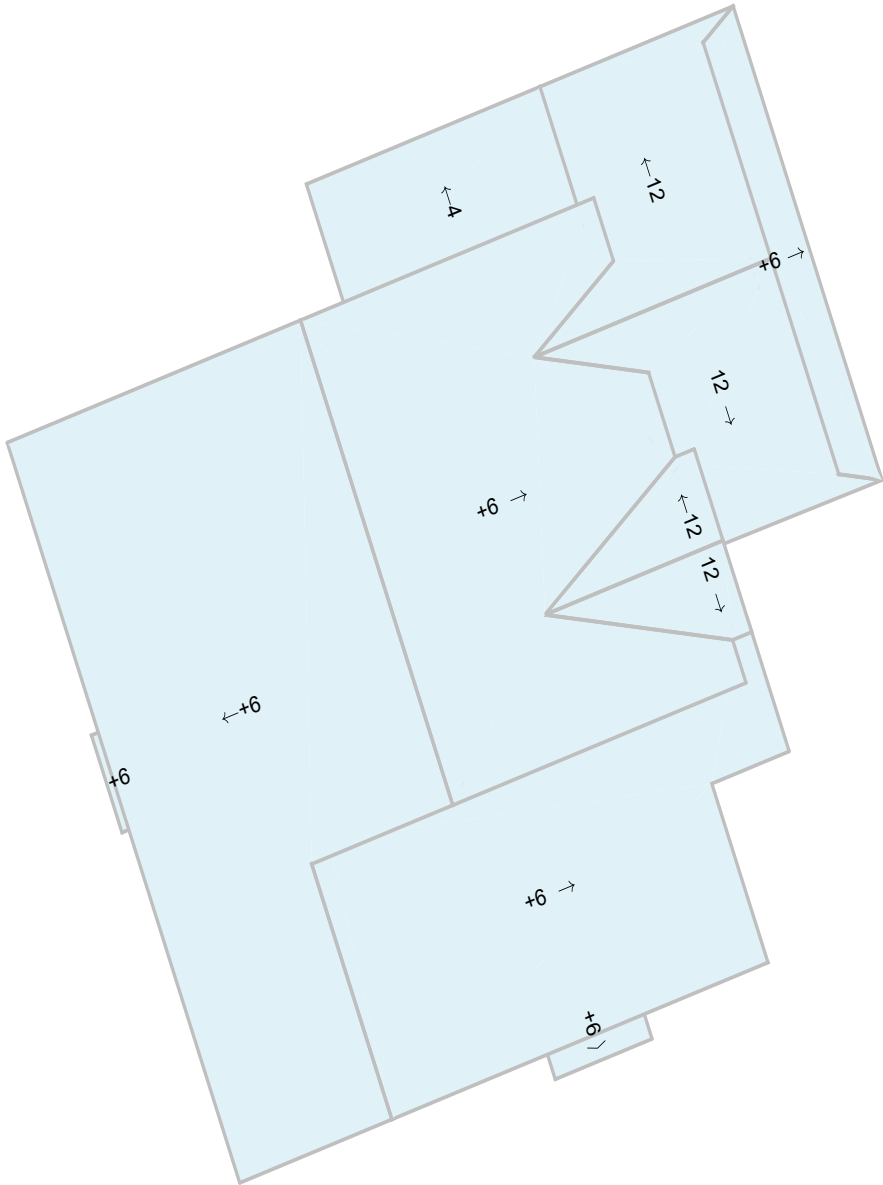

© 2025 Eagle View Technologies, Inc., All Rights Reserved.

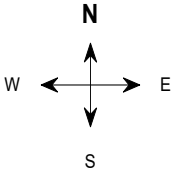


September 30, 2025
Property Address:
3021 Carrington Ln, Lawrence, KS 66049
Report: 67672828




Rafters

Rafter lengths (rounded to the nearest whole number) over 5 feet. In some cases, segment labels have been removed for readability. Some numbers are prefaced by “+” signs to avoid confusion when rotated (e.g. +6 and +9).

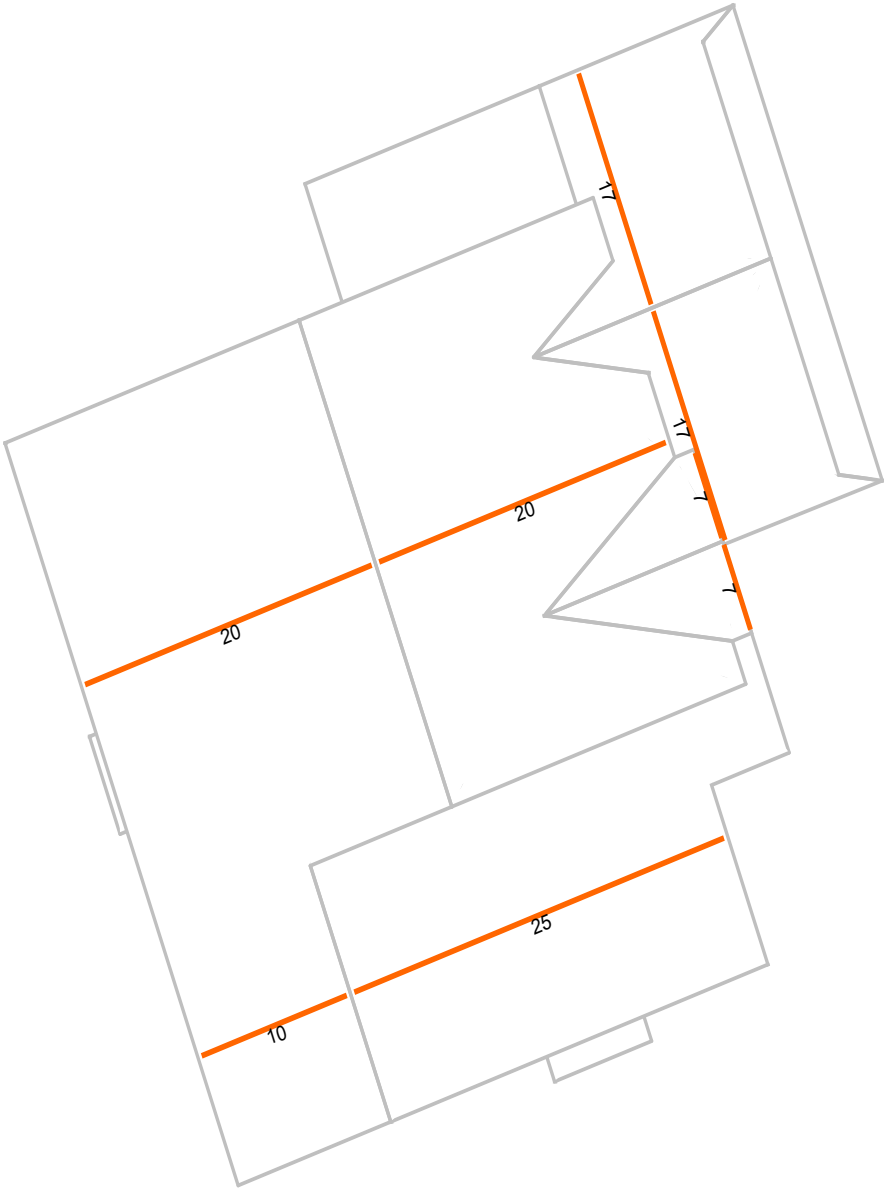

©2025 Eagle View Technologies, Inc., All Rights Reserved.

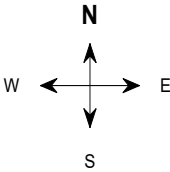


September 30, 2025
Property Address:
3021 Carrington Ln, Lawrence, KS 66049
Report: 67672828




Azimuth

The azimuth is the orientation of the structure to true north. In this diagram roof facet directions are labeled in degrees, with 0° (360°) as true north. Flat facets are labeled as 'F'.

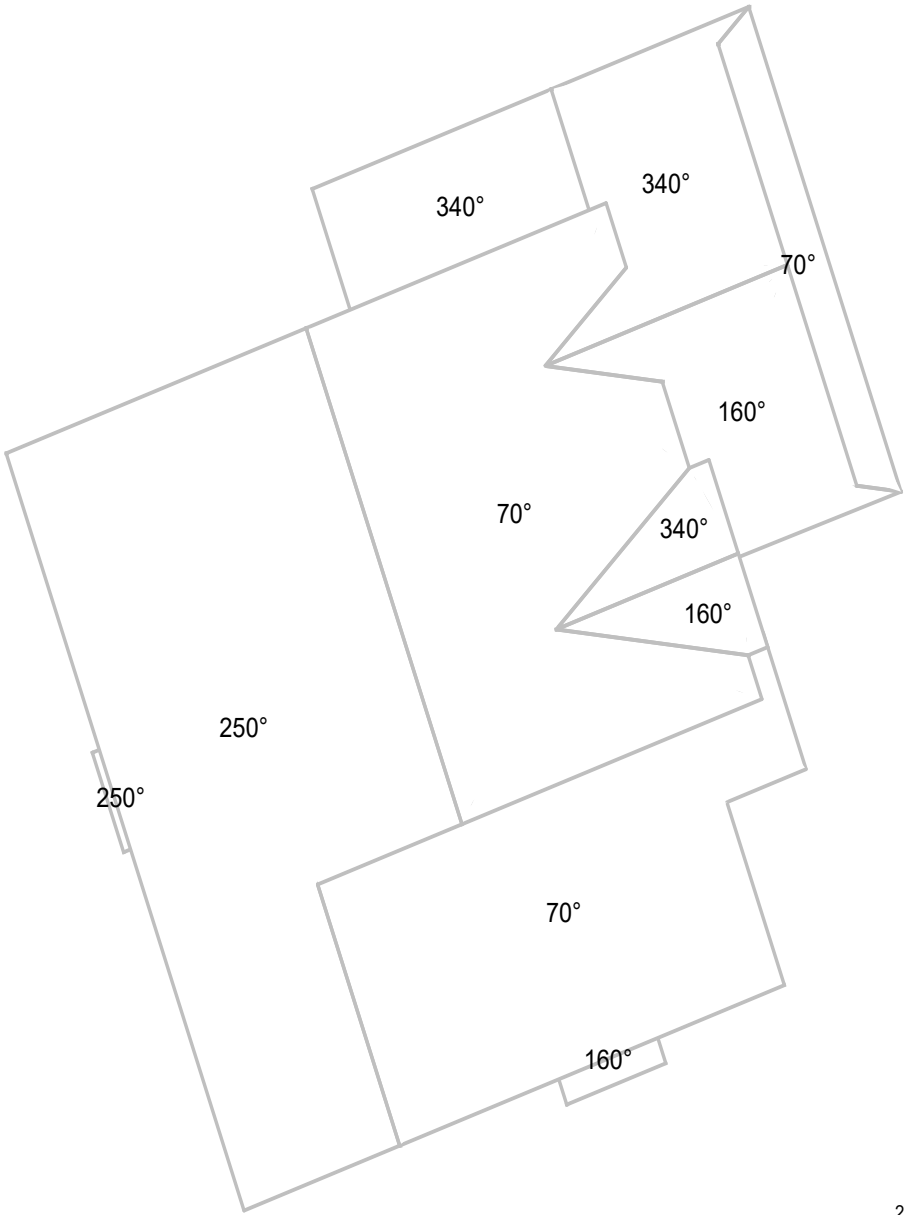

©2025 Eagle View Technologies, Inc., All Rights Reserved.

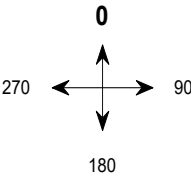


September 30, 2025
Property Address:
3021 Carrington Ln, Lawrence, KS 66049
Report: 67672828




Area

The area is measured in square feet per roof facet. The values have been rounded to the nearest foot square.

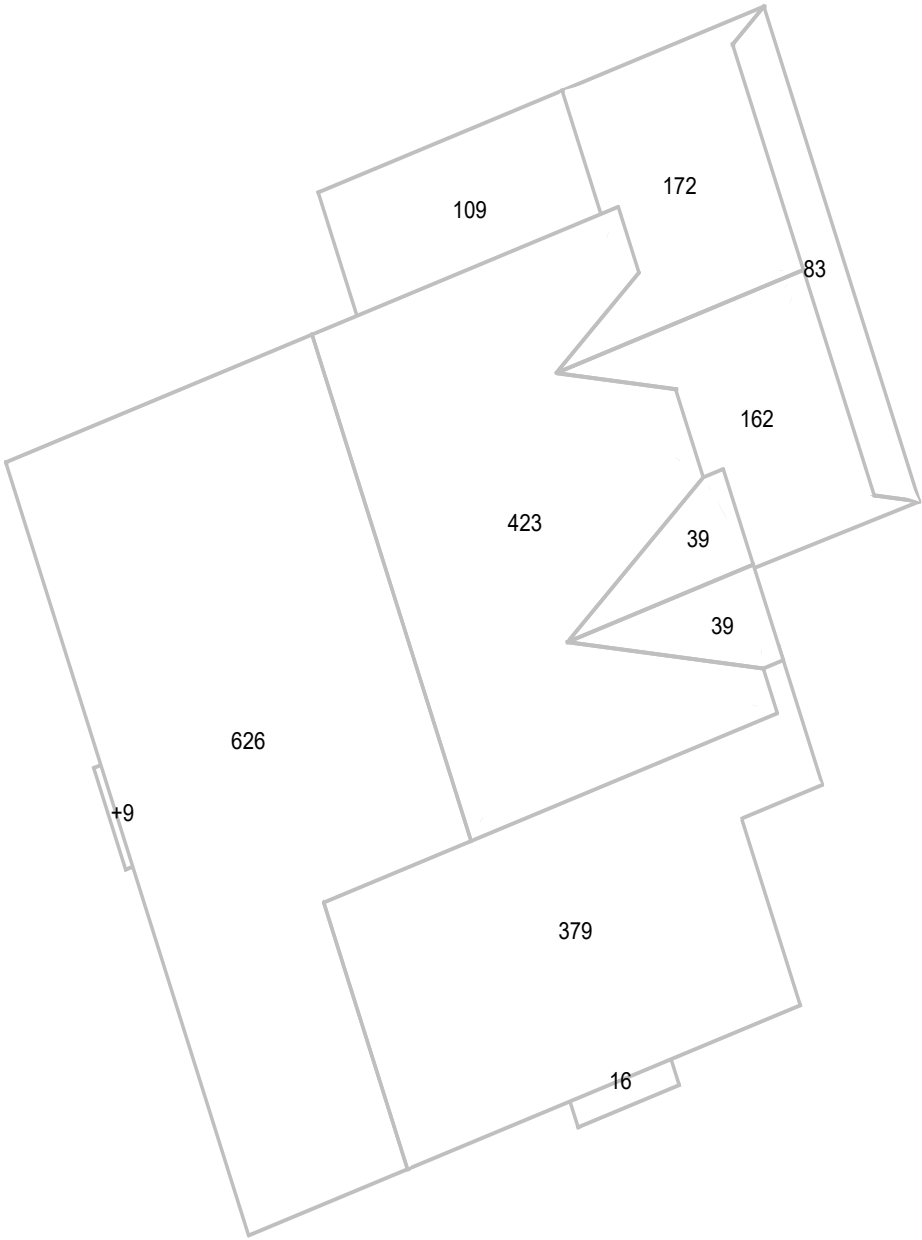


©2025 Eagle View Technologies, Inc., All Rights Reserved.

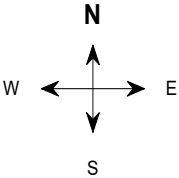


September 30, 2025
Property Address:
3021 Carrington Ln, Lawrence, KS 66049
Report: 67672828



Roof Obstructions

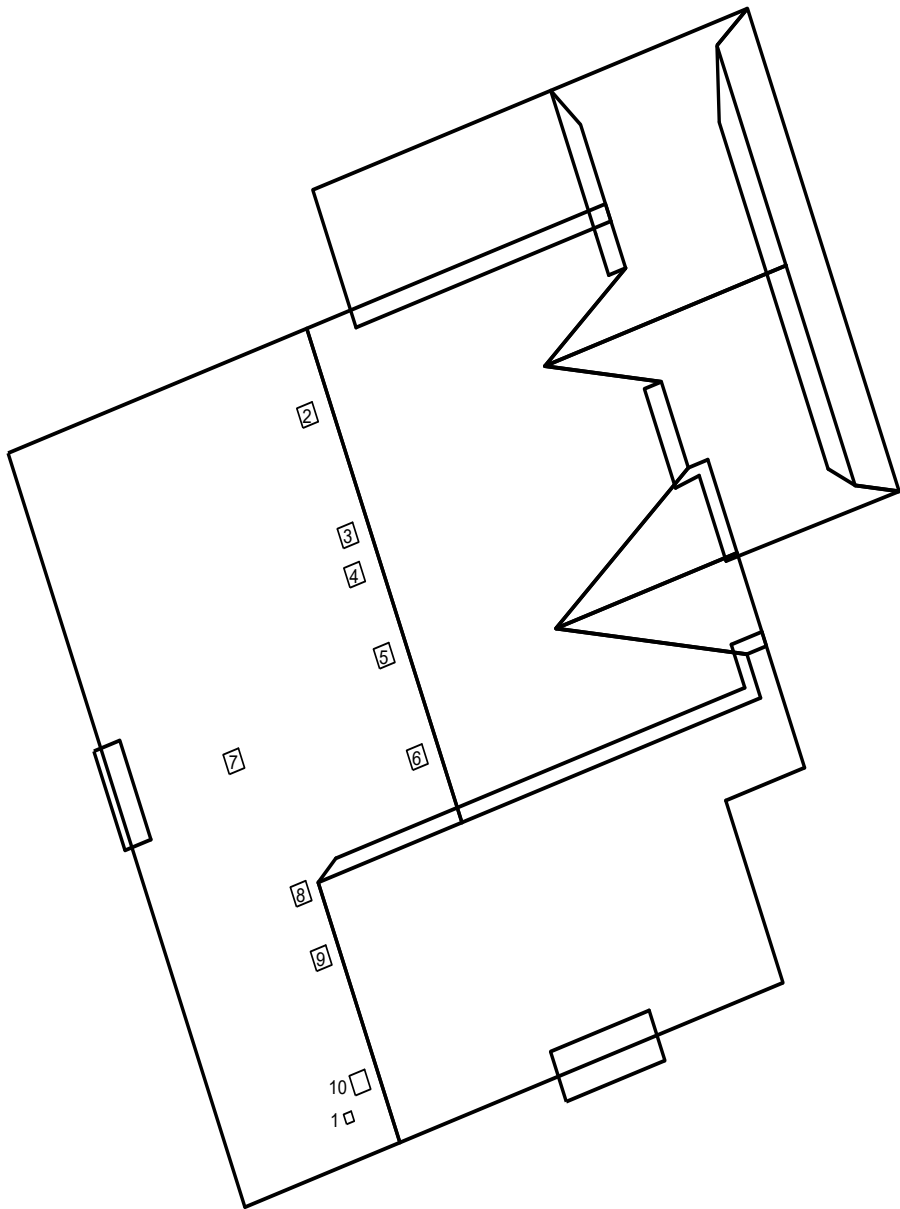

© 2025 Eagle View Technologies, Inc., All Rights Reserved.

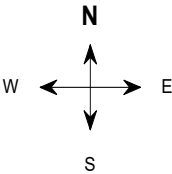

September 30, 2025
Property Address:
3021 Carrington Ln, Lawrence, KS 66049
Report: 67672828



Imagery

These are images of the property taken from multiple angles.

TOP VIEW



NORTH SIDE



September 30, 2025
Property Address:
3021 Carrington Ln, Lawrence, KS 66049
Report: 67672828



SOUTH SIDE



EAST SIDE



September 30, 2025
Property Address:
3021 Carrington Ln, Lawrence, KS 66049
Report: 67672828



Copyright © 2008-2025 EagleView Technologies, Inc. – All Rights Reserved – Covered by U.S. Patent Nos. 8,078,436; 8,145,578; 8,170,840; 8,209,152; 8,515,125.
Other Patents Pending.

WEST SIDE



September 30, 2025
Property Address:
3021 Carrington Ln, Lawrence, KS 66049
Report: 67672828



Copyright © 2008-2025 EagleView Technologies, Inc. – All Rights Reserved – Covered by U.S. Patent Nos. 8,078,436; 8,145,578; 8,170,840; 8,209,152; 8,515,125.
Other Patents Pending.

ROOFING REPORT SUMMARY

All Structures

Areas per Pitch			
Roof Pitches	4/12	6/12	12/12
Area (sq ft)	109.2	1536.1	412.9
% of Roof	5.3%	74.6%	20.1%

The table above lists each pitch on this roof and the total area and percent (both rounded) of the roof with that pitch.


Structure Complexity		
Simple	Normal	Complex

Waste Calculation									
NOTE: This waste calculation table is for asphalt shingle roofing applications. All values in table below only include roof areas of 3/12 pitch or greater. For total measurements of all pitches, please refer to the Lengths, Areas, and Pitches section below.									
Waste %	0%	2%	7%	10%	12%	14%	17%	22%	27%
Area (Sq ft)	2059	2101	2204	2265	2307	2348	2410	2512	2615
Squares *	20.66	21.33	22.33	22.66	23.33	23.66	24.33	25.33	26.33
	Measured				Suggested				

* Squares are rounded up to the 1/3 of a square

Additional materials needed for ridge, hip, and starter lengths are not included in the above table. The provided suggested waste factor is intended to serve as a guide—actual waste percentages may differ based upon several variables that EagleView does not control. These waste factor variables include, but are not limited to, individual installation techniques, crew experiences, asphalt shingle material subtleties, and potential salvage from the site. Individual results may vary from the suggested waste factor that EagleView has provided. The suggested waste is not to replace or substitute for experience or judgment as to any given replacement or repair work.

All Structures Totals

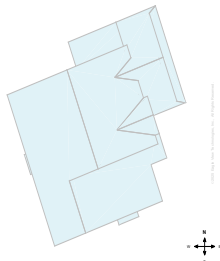

Total Roof Facets = 11
Total Roof Obstructions = 10

Lengths, Areas and Pitches

Ridges = 63 ft (4 Ridges)
Hips = 5.4 ft (2 Hips).
Valleys = 37.4 ft (4 Valleys)
Rakes[†] = 180.4 ft (17 Rakes)
Eaves/Starter[‡] = 137.6 ft (14 Eaves)
Drip Edge (Eaves + Rakes) = 318 ft (31 Lengths)
Parapet Walls = 0 (0 Lengths).
Flashing = 48.9 ft (8 Lengths)
Step flashing = 59.7 ft (10 Lengths)
Total Roof Obstructions Area = 10 sq ft
Total Roof Area Less Roof Obstructions = 2048.2 sq ft
Total Roof Obstructions Perimeter = 38 ft
Predominant Pitch = 6/12
Total Area (All Pitches) = 2058.2 sq ft

Property Location

Longitude = -95.2735747
Latitude = 38.9916658

Notes

This was ordered as a residential property. There were no changes to the structure in the past four years.

- † Rakes are defined as roof edges that are sloped (not level).
‡ Eaves are defined as roof edges that are not sloped and level.

September 30, 2025
Property Address:
3021 Carrington Ln, Lawrence, KS 66049
Report: 67672828

