




Roof

REPORT ID
65313315

August 23, 2025

PROPERTY
2332 New Holland Cir
Murfreesboro, TN 37128

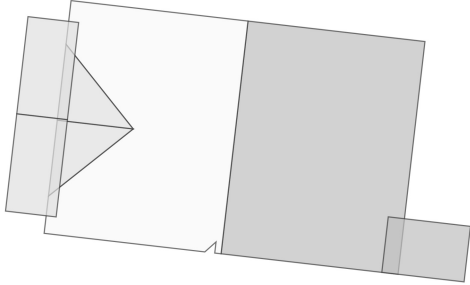

© 2025 Eagle View Technologies, Inc. All Rights Reserved

Contents

Lengths	1
Pitch (Degrees).....	2
Pitch (on 12)	3
Rafters	4
Azimuth	5
Area	6
Roof Obstructions	7
Imagery	8
Roofing Report Summary	11

Report Details

Report ID: 65313315

Property Address

2332 New Holland Cir
Murfreesboro, TN 37128

Measurements

Area:	1,228.4 sq ft
Roof Facets:	7
Predominant Pitch:	8/12
Number of Stories:	>1
Ridges/Hips:	37' 3"
Valleys:	25' 9"
Rakes:	125' 2"
Eaves:	48' 10"
Estimated Attic:	55.2 sq ft
Roof Obstructions:	7
Roof Obstructions Perimeter:	22'
Roof Obstructions Area:	4.8 sq ft

Prepared For

Doug Durham
321 Billingsly Ct, Suite 13
Franklin, TN 37067
(615) 778-1440



Open in EagleView One™




Satisfaction Guaranteed
www.eagleview.com/Guarantee.aspx




Lengths

Ridges = 37' 3"	Rakes = 125' 2"	Step flashing = 43'
Hips = 0'	Eaves = 48' 10"	Parapets = 0'
Valleys = 25' 9"	Flashing = 5' 9"	Other = 0'

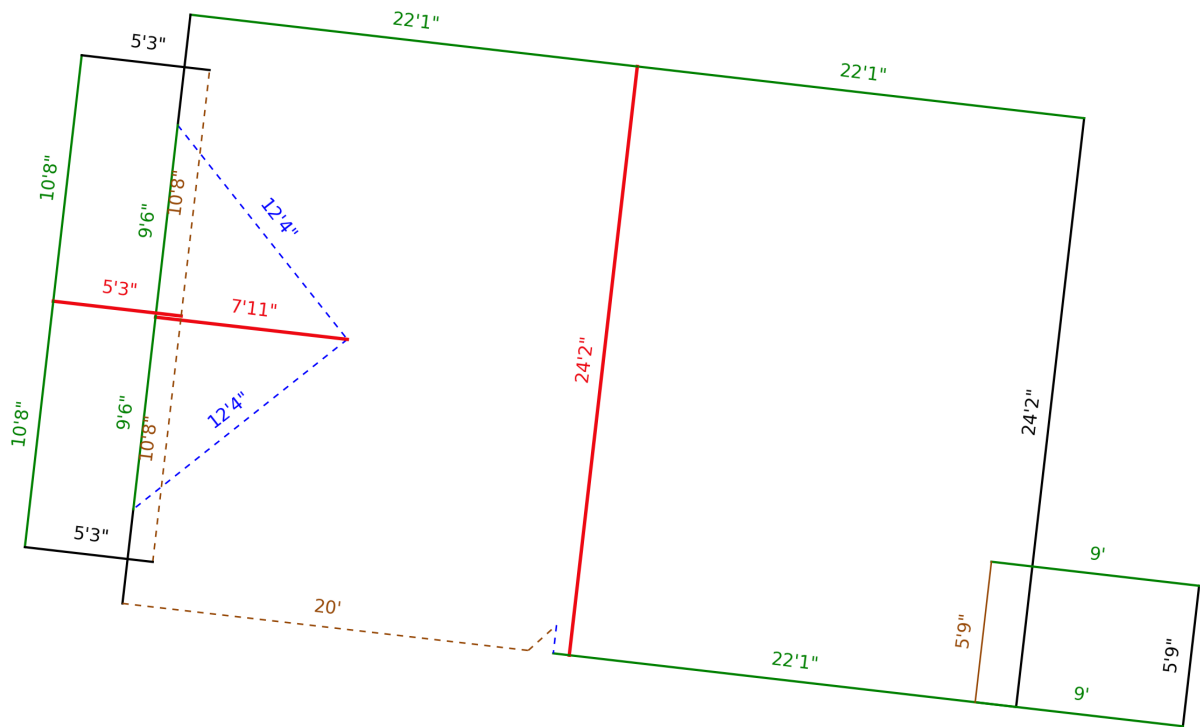

© 2025 Eagle View Technologies, Inc. All Rights Reserved


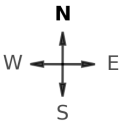


August 23, 2025
Property Address:
2332 New Holland Cir, Murfreesboro, TN 37128
Report: 65313315



Pitch (Degrees)

In some cases, pitch labels have been removed for readability. Flat facets are labels 'F'.

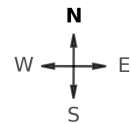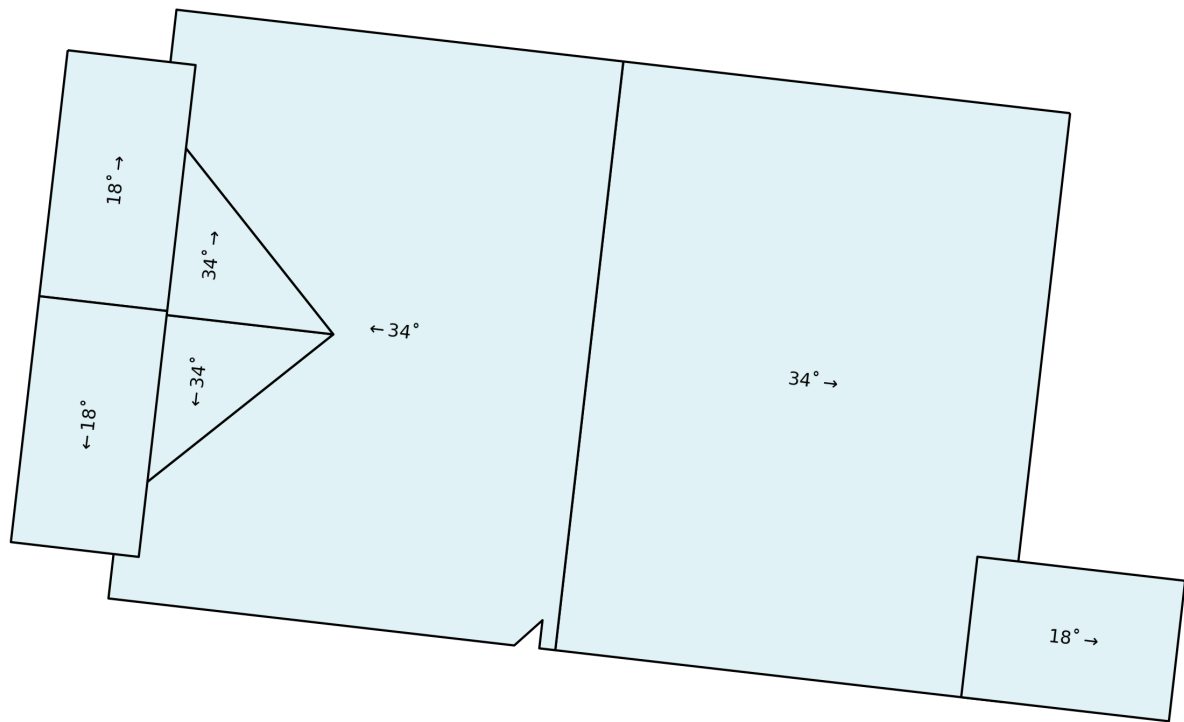


August 23, 2025
Property Address:
2332 New Holland Cir, Murfreesboro, TN 37128
Report: 65313315




Pitch (on 12)

In some cases, pitch labels have been removed for readability. Flat facets are labels 'F'.

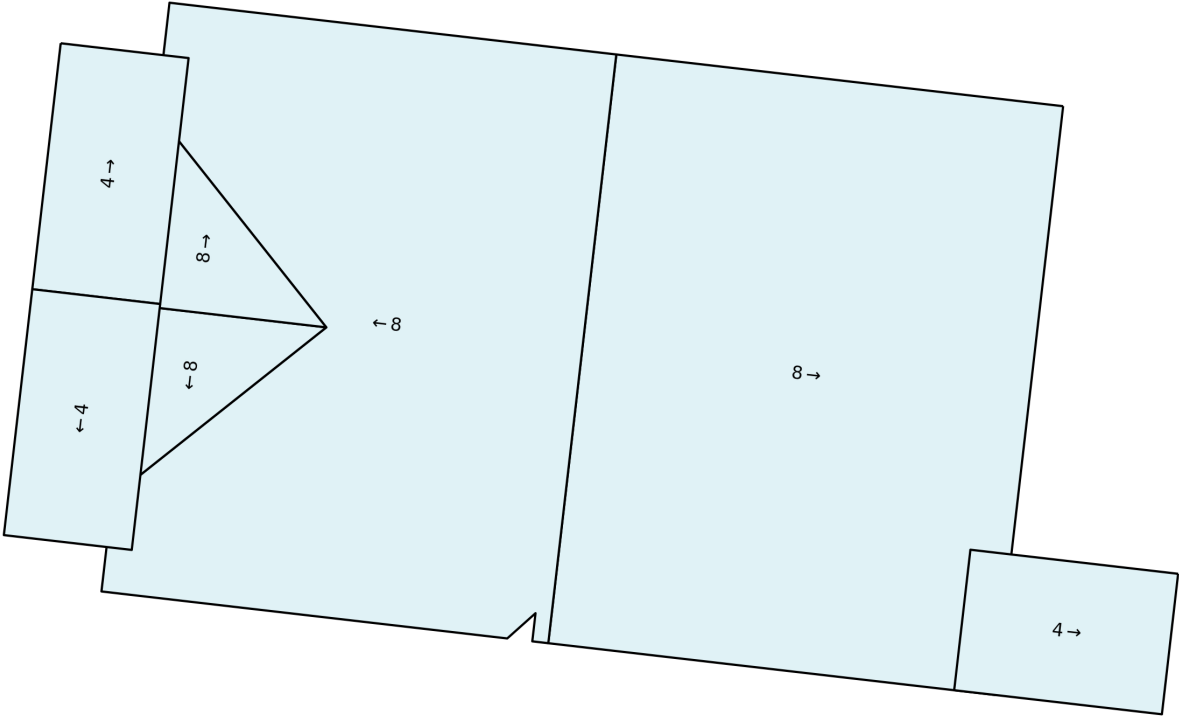


© 2025 Eagle View Technologies, Inc. All Rights Reserved

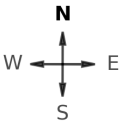


Rafters

Rafter lengths (rounded to the nearest whole number) over 5 feet. In some cases, segment labels have been removed for readability. Some numbers are prefaced by “+” signs to avoid confusion when rotated (e.g. +6 and +9).

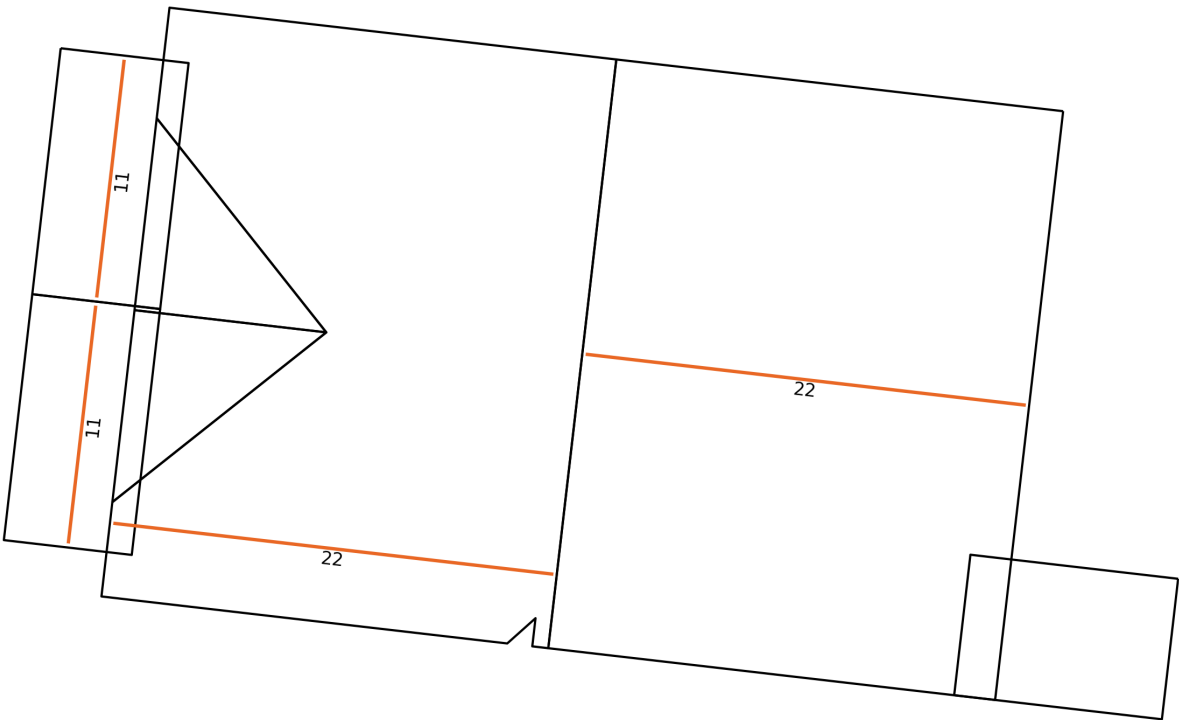


© 2025 Eagle View Technologies, Inc. All Rights Reserved

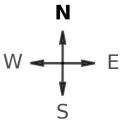


Azimuth

The azimuth is the orientation of the structure to true north. In this diagram roof facet directions are labeled in degrees, with 0° (360°) as true north. Flat facets are labeled as 'F'.

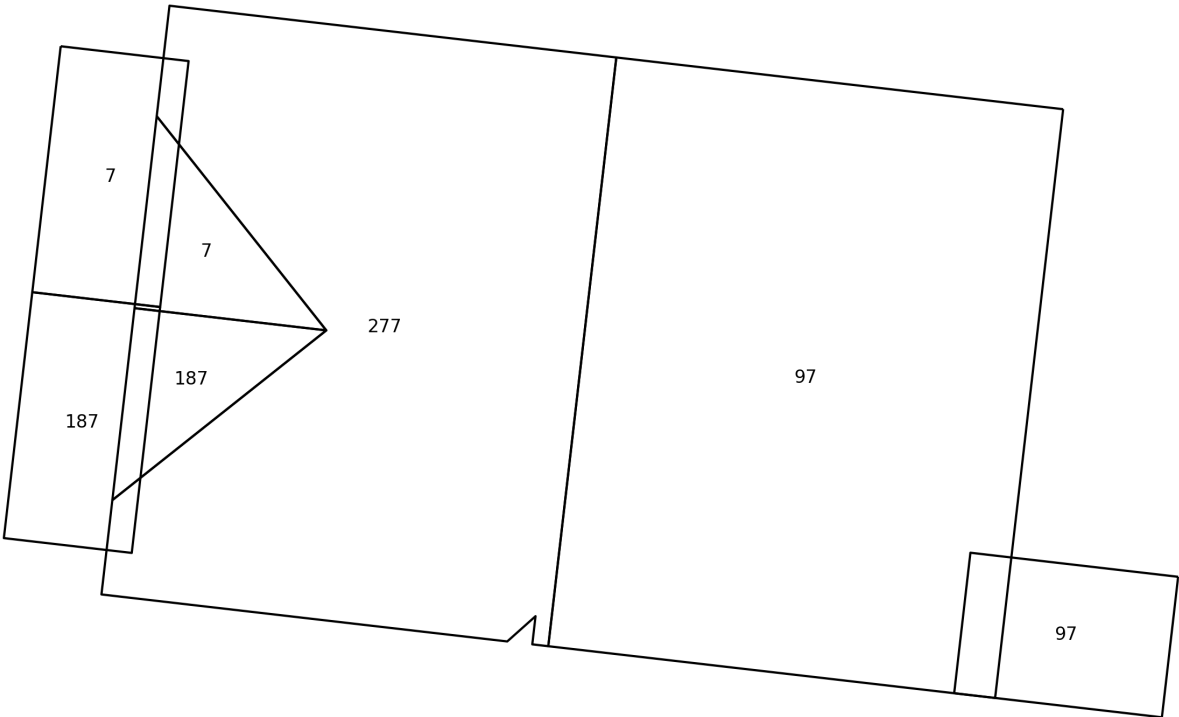


© 2025 Eagle View Technologies, Inc. All Rights Reserved

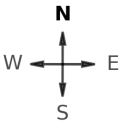


Area


The area is measured in square feet per roof facet. The values have been rounded to the nearest foot square.

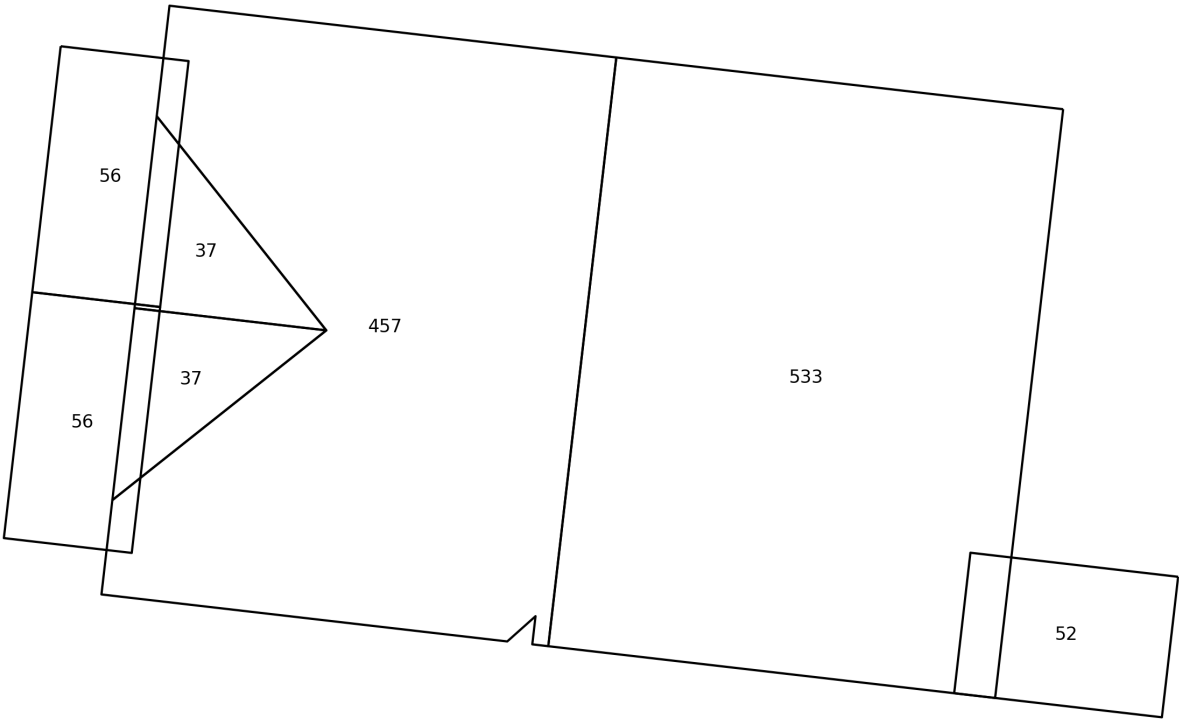


© 2025 Eagle View Technologies, Inc. All Rights Reserved



Roof Obstructions

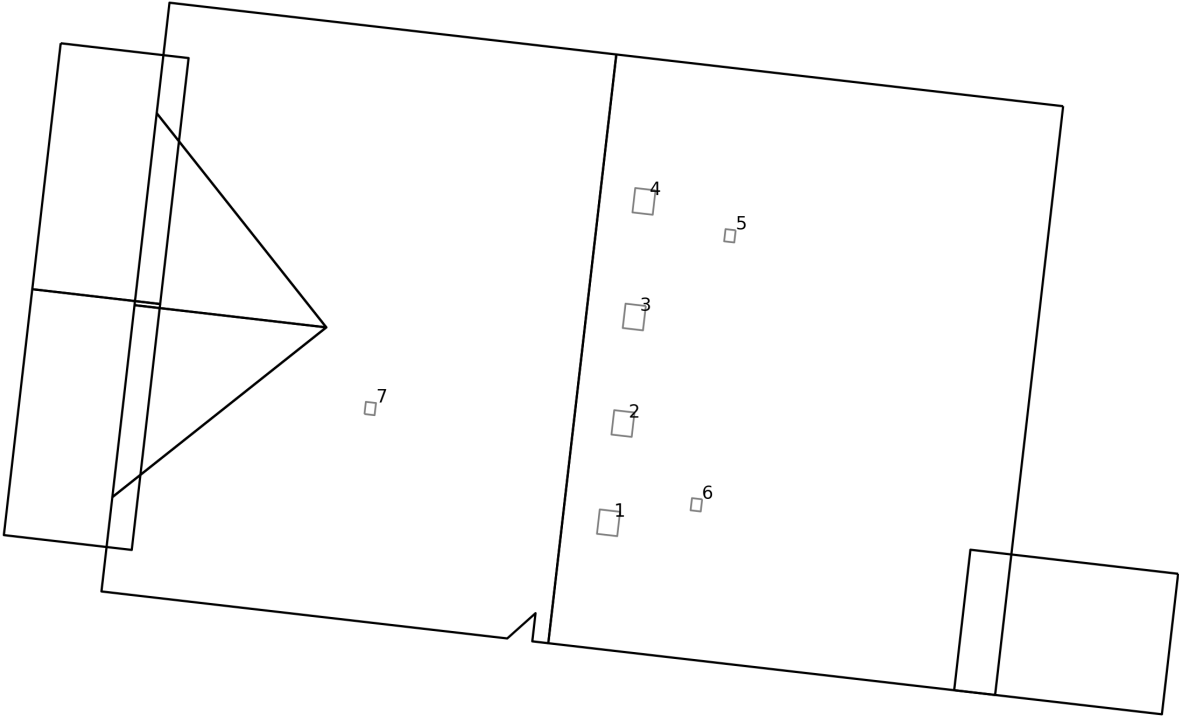

© 2025 Eagle View Technologies, Inc. All Rights Reserved

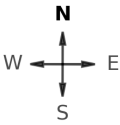


August 23, 2025
Property Address:
2332 New Holland Cir, Murfreesboro, TN 37128
Report: 65313315




Imagery

These are images of the property taken from multiple angles.

TOP VIEW

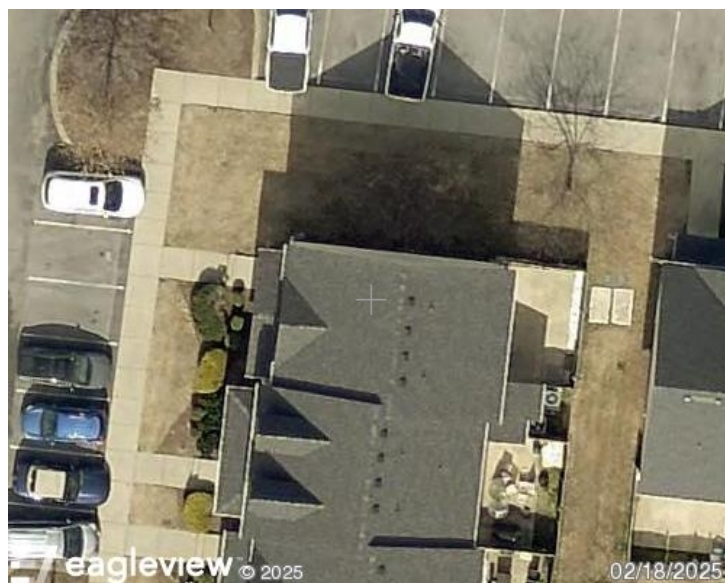


NORTH SIDE

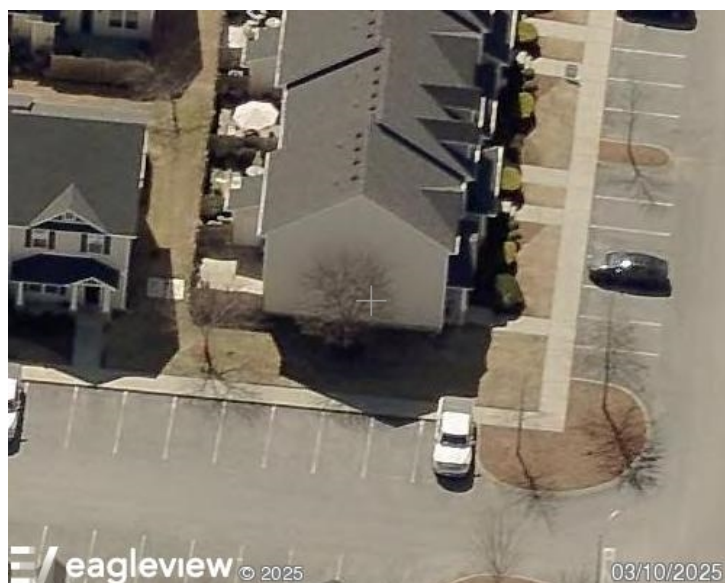

August 23, 2025
Property Address:
2332 New Holland Cir, Murfreesboro, TN 37128
Report: 65313315



SOUTH SIDE

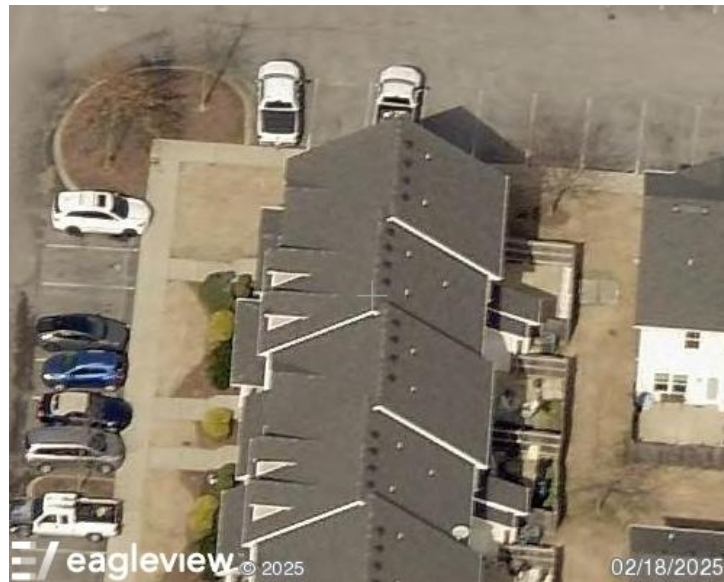

EAST SIDE



August 23, 2025
Property Address:
2332 New Holland Cir, Murfreesboro, TN 37128
Report: 65313315



WEST SIDE



August 23, 2025
Property Address:
2332 New Holland Cir, Murfreesboro, TN 37128
Report: 65313315



Copyright © 2008-2024 EagleView Technologies, Inc. - All Rights Reserved - Covered by U.S. Patent Nos. 8,078,436; 8,145,578; 8,170,840; 8,209,152; 8,515,125.
Other Patents Pending

ROOFING REPORT SUMMARY

All Structures

Areas per Pitch

Roof Pitches	4/12	8/12
Area (sq ft)	163.6	1064.8
% of Roof	13.3%	86.7%

The table above lists each pitch on this roof and the total area and percent of the roof with that pitch.

Structure Complexity

Simple

Normal

Complex

Waste Calculation

NOTE: This waste calculation table is for asphalt shingle roofing applications. All values in the table below only include roof areas of 3/12 pitch or greater. For total measurements of all pitches, please refer to Lengths, Areas, and Pitches section below.


Waste %	0%	2%	7%	10%	12%	14%	17%	22%	27%
Area (m ²)	114	116	122	125	127	130	133	139	144
Squares *	12.33	12.66	13.33	13.66	14.00	14.00	14.66	15.00	15.66

Measured

Suggested

*Squares are rounded up to the 1/3 of a square

Additional materials needed for ridge, hip, and starter lengths are not included in the above table. The provided suggested waste factor is intended to serve as a guide—actual waste percentages may differ based upon several variables that EagleView does not control. These waste factor variables include, but are not limited to, individual installation techniques, crew experiences, asphalt shingle material subtleties, and potential salvage from the site. Individual results may vary from suggested waste factor that EagleView has provided. The suggested waste is not to replace or substitute for experience or judgement as to any given replacement or repair work.

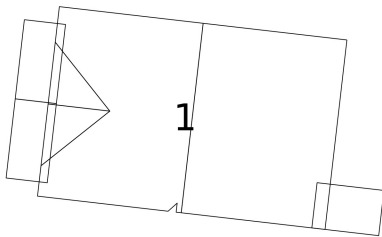

Lengths, Areas and Pitches

Ridges = 37' 3" (3 Ridges)
Hips = 0' (0 Hips)
Valleys = 25' 9" (3 Valleys)
Rakes† = 125' 2" (10 Rakes)
Eaves/Starkers‡ = 48' 10" (6 Eaves)
Drip Edge (Eaves + Rakes) = 174' (16 Lengths)
Parapet Walls = 0' (0 Lengths)
Flashing = 5' 9" (1 Lengths)
Step Flashing = 43' (4 Lengths)
Total Roof Obstructions Area = 4.8 sq ft
Total Roof Area Less Roof Obstructions = 1,223.6 sq ft
Total Roof Obstructions Perimeter = 22'
Predominant Pitch = 8/12
Total Area (All Pitches) = 1,228.4 sq ft

Property Location

Longitude = -86.4103630
Latitude = 35.8007610

Notes

This was ordered as a residential property. There were no changes to the structure in past four years.

Total Roof Facets = 7

Total Roof Obstructions = 7

† Rakes are defined as roof edges that are sloped (not level).

‡ Eaves are defined as edges that are not sloped and level

August 23, 2025

Property Address:
2332 New Holland Cir, Murfreesboro, TN 37128
Report: 65313315



2332 New Holland Cir, Murfreesboro, TN 37128

Report: 65313315

IMPORTANT LEGAL NOTICE AND DISCLAIMER**Notice and Disclaimer**

No Warranty: The Copyrighted Materials are provided to you "as is," and you agree to use it at your own risk.

EagleView Technologies makes no guarantees, representations or warranties of any kind, express or implied, arising by law or otherwise, including but not limited to, content, quality, accuracy, completeness, effectiveness, reliability, fitness for a particular purpose, usefulness, use or results to be obtained from the Copyrighted Materials.

Contractors agree to always conduct a preliminary site survey to verify Roof Report ordered. In the event of an error in a Report, your sole remedy will be a refund of the fees paid by you to obtain this Report.

August 23, 2025
Property Address:
2332 New Holland Cir, Murfreesboro, TN 37128
Report: 65313315

