

Westbrook Avenue Public Complaints and Flood Image Log

Project: Westbrook Avenue reconstruction and drainage upgrade. Complaint record export through 2026-05-29.
Use limit: public complaints and images document observed flood timing, approximate depth, and location. They do not control design storm recurrence, pipe slope, utility clearance, or surveyed elevations.

source_id	date	time	reporter reference	location text	station_interpretation	rainfall record	reported depth	photo_id	technical use limit
PC-001	2026-04-17	17:42	resident call	Westbrook southbound gutter near old	0+735	38 mm in 3 h	95	PH-001	Location evidence only; not design storm.
PC-002	2026-04-17	18:05	bus operator	water at southbound bus stop	0+820	38 mm in 3 h	70	PH-002	Separate bus stop location.
PC-003	2026-04-17	18:23	resident email	Pine Street ramp puddle at NE corner	0+513	38 mm in 3 h	25	PH-003	ADA ramp drainage context only.
PC-004	2026-05-08	06:54	maintenance call	same sag point by CB-14	0+735	61 mm in 4 h	160	PH-004	Flood depth supports ponding issue.
PC-005	2026-05-08	07:16	transit supervisor	bus stop curb water over shoes	0+820	61 mm in 4 h	110	PH-005	Separate station from sag point.
PC-006	2026-05-08	08:10	shop owner	water bypassed inlet near Pine approach	0+735	61 mm in 4 h	145	PH-006	Observed inlet bypass.
PC-007	2026-05-09	08:31	service request	upstream of CB-15	0+760	local rainfall under 25-year 2.8 IDF	28	PH-007	Location and timing evidence only.
PC-008	2026-05-10	09:34	service request	Westbrook sag point by CB-14	0+735	local rainfall under 25-year 2.6 IDF	26	PH-008	Location and timing evidence only.
PC-009	2026-05-11	10:37	service request	southbound bus stop drainage ponding	0+820	local rainfall under 25-year 2.4 IDF	24	PH-009	Location and timing evidence only.
PC-010	2026-05-12	06:40	service request	Pine Street ramp gutter	0+513	local rainfall under 25-year 2.2 IDF	22	PH-010	Location and timing evidence only.
PC-011	2026-05-13	07:43	service request	upstream of CB-15	0+760	local rainfall under 25-year 2.0 IDF	20	PH-011	Location and timing evidence only.


Complaint table continued

source_id	date	time	reporter reference	location text	station_interpretation	rainfall record	reported depth	photo_id	technical use limit
PC-012	2026-05-08	08:46	service request	Westbrook sag point by CB-14	0+735	local rainfall under 25-year	1.0 IDF	PH-012	Location and timing evidence only.
PC-013	2026-05-09	09:49	service request	southbound bus stop drainage ponding	0+820	local rainfall under 25-year	1.0 IDF	PH-013	Location and timing evidence only.
PC-014	2026-05-10	10:52	service request	Pine Street ramp gutter	0+513	local rainfall under 25-year	1.0 IDF	PH-014	Location and timing evidence only.
PC-015	2026-05-11	06:55	service request	upstream of CB-15	0+760	local rainfall under 25-year	1.0 IDF	PH-015	Location and timing evidence only.
PC-016	2026-05-12	07:58	service request	Westbrook sag point by CB-14	0+735	local rainfall under 25-year	1.0 IDF	PH-016	Location and timing evidence only.
PC-017	2026-05-13	08:11	service request	southbound bus stop drainage ponding	0+820	local rainfall under 25-year	1.0 IDF	PH-017	Location and timing evidence only.
PC-018	2026-05-08	09:14	service request	Pine Street ramp gutter	0+513	local rainfall under 25-year	1.0 IDF	PH-018	Location and timing evidence only.
PC-019	2026-05-09	10:17	service request	upstream of CB-15	0+760	local rainfall under 25-year	1.0 IDF	PH-019	Location and timing evidence only.
PC-020	2026-05-10	06:20	service request	Westbrook sag point by CB-14	0+735	local rainfall under 25-year	1.0 IDF	PH-020	Location and timing evidence only.
PC-021	2026-05-11	07:23	service request	southbound bus stop drainage ponding	0+820	local rainfall under 25-year	1.0 IDF	PH-021	Location and timing evidence only.
PC-022	2026-05-12	08:26	service request	Pine Street ramp gutter	0+513	local rainfall under 25-year	1.0 IDF	PH-022	Location and timing evidence only.

Image sheet A - Station 0+735 sag point

PH-001 - old CI-14 label visible on inlet wall


Station: 0+735 approximate water depth: 95 mm

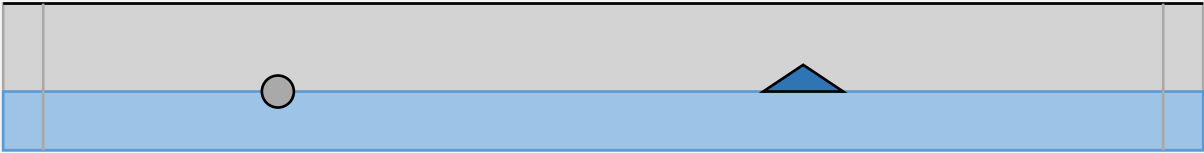

Water ponded along southbound curb. Image supports location; it does not prove design storm recurrence.

PH-004 - gutter ponding at CB-14 after May rainfall


Station: 0+735 approximate water depth: 160 mm

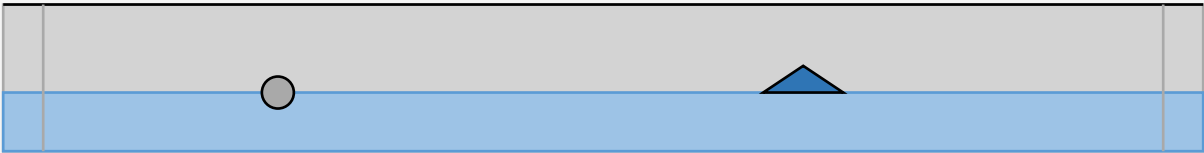

Approximate depth exceeds city sag ponding depth criterion when paired with survey gutter low point.

PH-006 - bypass flow entering Pine approach

Station: 0+735 approximate water depth: 145 mm

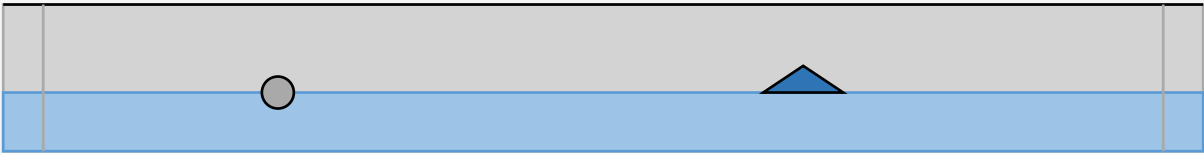


Flow path indicates inlet capacity and spread issue. Use survey and criteria for calculations.

Image sheet B - Station 0+820 bus stop and Pine Street ramps

PH-002 - bus stop ponding


Station: 0+820 approximate water depth: 70 mm

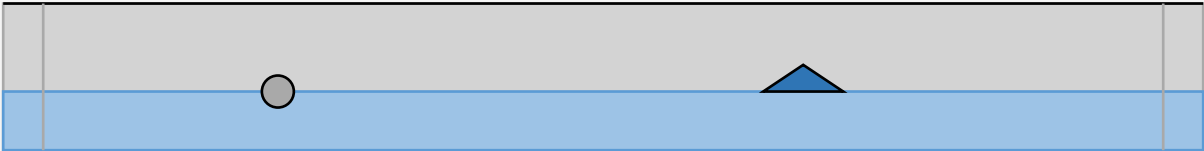

Bus stop location is separate from the 0+735 sag point and must not be merged without station evidence.

PH-005 - southbound bus stop water over curb shoe line

Station: 0+820 approximate water depth: 110 mm

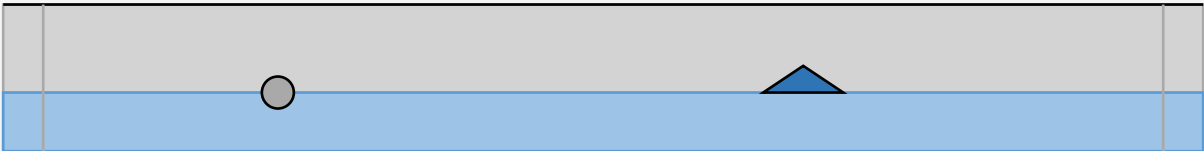

Complaint supports utility conflict area drainage observations only.

PH-003 - Pine Street ramp water edge

Station: 0+513 approximate water depth: 25 mm

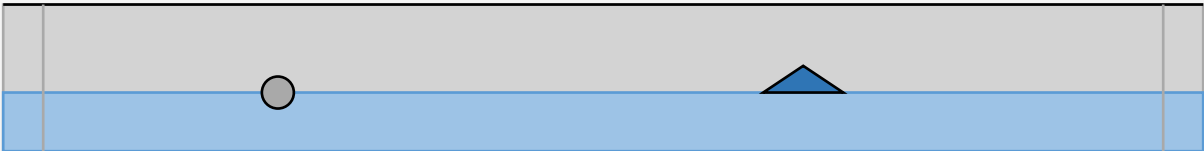


Image supports ramp drainage observation; ADA grade compliance is controlled by survey.

Rainfall summary and recurrence-use note

source_id	rain date	total depth	duration	nearest recurrence screen	design-use conclusion
PC-R1	2026-04-17	38 mm	3 h	below 10-year local screen	Complaint event cannot replace 25-year sag criteria.
PC-R2	2026-05-08	61 mm	4 h	between 5-year and 10-year local screen	Observed flooding below design storm indicates drainage sensitivity but
PC-R3	2026-05-13	22 mm	1 h	frequent event	Useful only for nuisance ponding location.

PC-N1: Two complaints use the old CI-14 location label, but station interpretation from images and service request map places those records at the CB-14 sag point near Station 0+735.

PC-N2: The bus stop complaints near Station 0+820 are distinct from the 0+735 sag point and should be analyzed as a separate local drainage and utility-conflict area.

PC-N3: The complaint record does not supply pipe invert elevations, CBR values, utility depths, or ADA measurements.