



Pre Export Vehicle Appraisal

Certificate No. : 20201116-733784
Date of Issue : 16/11/2020
Vehicle Make : TOYOTA
Vehicle Model : COROLLA FIELDER
Chassis No. : NZE141-9050873
Authorization : *Takeshi Takasaki*



1. Appraisal Details:

Client Details:	NEXCO JAPAN PTE LTD	Location:	YOKOHAMA, KANAGAWA
Date & Time:	13/11/2020 10:43 AM	Weather:	SUNNY
Inspector:	Yukihiro Matayoshi		
Window Sticker:	733784		

2. Vehicle Details:

Make:	TOYOTA	Chassis/VIN No.:	NZE141-9050873
Model:	COROLLA FIELDER	Engine Capacity:	1,490 cc/kw
Year of Manufacture:	2007	Odometer:	95,164 km
Year of Registration:	200710	Engine Number:	C620104
Body Type:	STATION WAGON	RHD/LHD Vehicle:	RHD
Vehicle Type:	Passenger	Transmission:	A/T
Colour:	BLACK	Drive:	2WD FF
Passenger Capacity:	5	Number of Doors:	5
Fuel Type:	Petrol	Model Code:	DBA-NZE141G
Auction Report:	No	Euro 4 Compliant:	Yes
Maintenance Record:	No	(Japan 05)	DBA
BioDecontamination OK:	Yes	Stolen:	No

3. Description of major areas (Summary of page 3):

Exterior Appearance: OK	Glazing: OK
Interior Appearance: OK	Lights: OK
Mechanical: OK	Gauges: OK
Structural: OK	Wheels: OK
Biosecurity: OK	Tyres: OK
EV HEV Battery: N/A	Emission Test: OK

This appraisal report does not confer or guarantee acceptance by the Land Transport Authority Fiji for the vehicle importation and registration for use in Fiji.

Important Note:



For Terms & Conditions please see www.JEVIC.com



Pre Export Vehicle Appraisal

Certificate No. : 20201116-733784
Date of Issue : 16/11/2020
Vehicle Make : TOYOTA
Vehicle Model : COROLLA FIELDER
Chassis No. : NZE141-9050873
Window Sticker : 733784



4. Photographs



Front Left



Front Right




Audio Dashboard



Rear Left



Rear Right

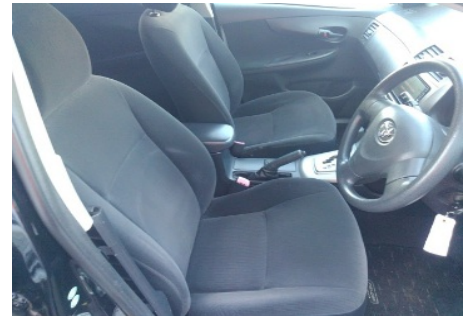

Seats Front



Engine Bay



Underneath Front



Seats Rear



Boot



Underneath Rear



Additional



Pre Export Vehicle Appraisal

Certificate No. : 20201116-733784

Date of Issue : 16/11/2020

Vehicle Make : TOYOTA

Chassis No. : NZE141-9050873

Vehicle Model : COROLLA FIELDER Window Sticker : 733784



5. Detailed description

Interior Equipment

Sunroof	No
Spare Key	Yes
Remote Key Lock	Yes
Power Steering	Yes
Tilt Steering	Yes
Cruise Control	No
Power Window(s)	Working
Central Locking	Working
Leather Seats	No
Power Seats	No
Heated Seats	No
Clearance Sonar	No
Air Conditioning	Yes
Audio Visual	Exist
Navigation	Yes
Radio	Yes
CD	Yes
DVD	No
iPod Link	No
SD Card	No
USB	No
HDMI	No
HIC	No
Other	
TV	

Interior Condition

Interior Odour	None
Steering Wheel	Normal
Aftermarket	No
Gear Knob	Present
Aftermarket	No
Seat Driver	Normal
Aftermarket	No
Seat Passenger	Normal
Aftermarket	No
Seat Rear	Normal
Seat 3rd Row	N/A
Seat-Headrests	All Present
Floor Mats	3
Carpets	Yes
Pedals	Normal
Condition	
Roof Lining	No Damage
Dashboard	Scratched
Instrument Panel	No Damage
Door Lining	
Driver	Vinyl
Passenger	OK
Rear Right	OK
Rear Left	OK
Hatch	OK

Mechanical

Gauge - Odometer	Working
Gauge - Fuel	Working
Gauge - Temp	Working
Gauge - Tach	Working
Warning Light(s)	OK
Warning Lights on	-
Horn	Working
Engine - Start	Yes
Engine - Idle	Smooth
Belt Noise	Not Present
Wipers(s) Front	Working
Wipers(s) Rear	Working
Washer(s) Front	Working
Washer(s) Rear	Working
Muffler Noise	Normal
Engine Oil	Normal
Condition	Normal
Brake Fluid	Normal
Condition	Normal
Oil Leak (Serious)	No
Open/Closing OK	
Drivers Door	OK
Passengers Door	OK
Rear Right Door	OK
Rear Left Door	OK
Boot/Hatch	OK
Bonnet	OK
Fuel Flap	OK
Glove Box	Yes

Side Mirrors	
Automatic	
Left Side	OK
Rear View Mirror	Normal
Right Side	OK
Lever - Wiper	Normal
Lever - Indicators	Normal
Lever - Lights	Normal
Switches - Lights	Normal
Switches - Audio	Normal
Switches - Aircon	Normal
Seat Belts	
Driver	OK
Passenger	OK
Rear Right	OK
Rear Left	OK
Rear Center	OK
3rd Seats	-
Lights OK	
Headlights	OK
Tail	OK
Side	OK
Indicators	OK
Brake	OK
Reverse	OK
Fog	N/A
Licence Plate	OK
Interior	OK
Other Lights Not Working	
N/A	
Window Condition	OK

Safety Equipment

Drivers Airbag	Yes
Passenger Airbag	Yes
Curtain Airbag	No
Knee Airbag	No
ABS System	Yes
Handicap Options	No
Spare Tyre	Yes
Tool Kit	Yes
Jack	Yes
Safety Triangle	No

Tyre(s)

Front Right Tread	8 mm
Front Right Type	A
Front Left Tread	8 mm
Front Left Type	A
Rear Right Tread	8 mm
Rear Right Type	A
Rear Left Tread	8 mm
Rear Left Type	A
Spare Tread	4 mm
Spare Type	B

Emission Test

CO < 1%	0,01
HC < 300ppm	0
Opacity < 50%	N/A

Exterior Equipment

Tinted Windows	Yes
Body Kit	No
Alloy Wheels	Yes
After-Market Electrical Items	N/A
Additional fittings	OK

HV EV Battery & Warnings

OBD Check	N/A
Error Code	No
Voltage DTC	N/A
Voltage Diff (v)	N/A
Resistance DTC	N/A
Temp DTC	N/A
SOC	N/A



Biosecurity

Exterior/Interior	OK
-------------------	----

*DTC = Diagnostic Trouble Code

*SOC = State of Charge

Vehicle Damage / Underside Inspection

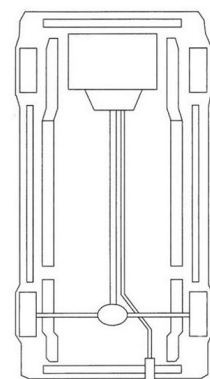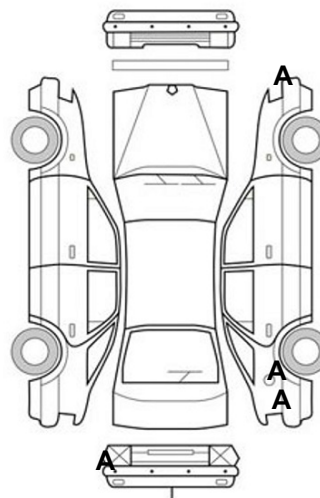

A = Scratch
B = Bent
H = Hble

P = Painted
R = Rust
T = Tear

U = Dent
W = Wave
X = Damage