Home — autonomy running

Bag playback, 11:46:02 CDT. All values from autonomy_demo_0.

CAVS Center for Advanced Vehicular Systems

Autonomous Vehicle Testing

LIVE · bag playback · autonomy_demo_0

LOCALIZATION	COMMS	SAFETY	
OK	0.1 s	OK	11:46:02 Sep 11, 2026 CDT


DRIVE STATUS

AUTONOMOUS
Navigating to Waypoint 1 of 2

Speed	1.9 m/s
Turn rate (cmd)	+2.3 °/s
Command source	autonomy
Command age	49 ms


CAMERAS

Camera | LiDAR | Faults

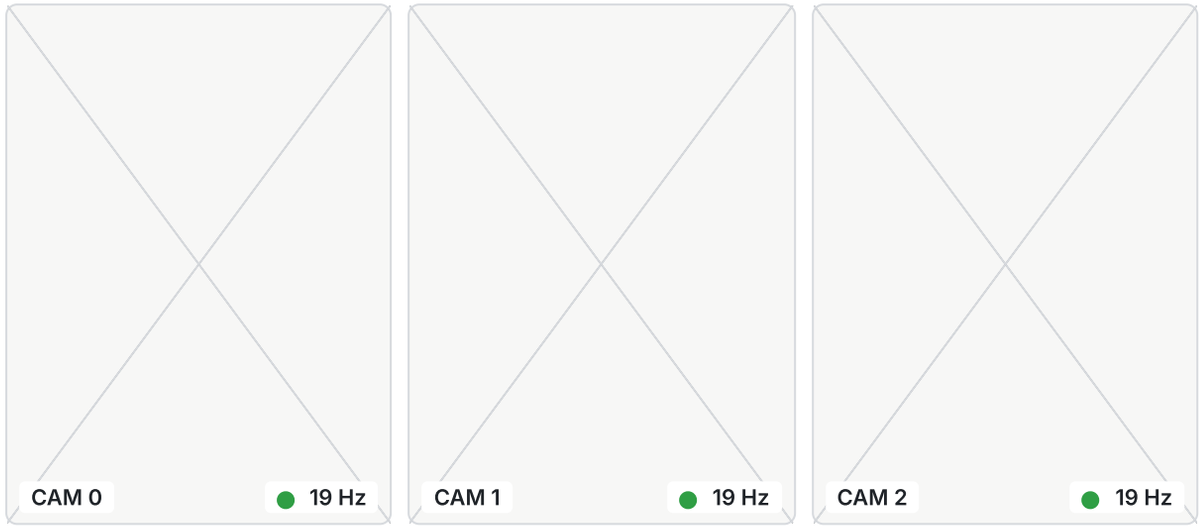

Previews refresh once per second · 320 × 240 JPEG

NAVIGATION

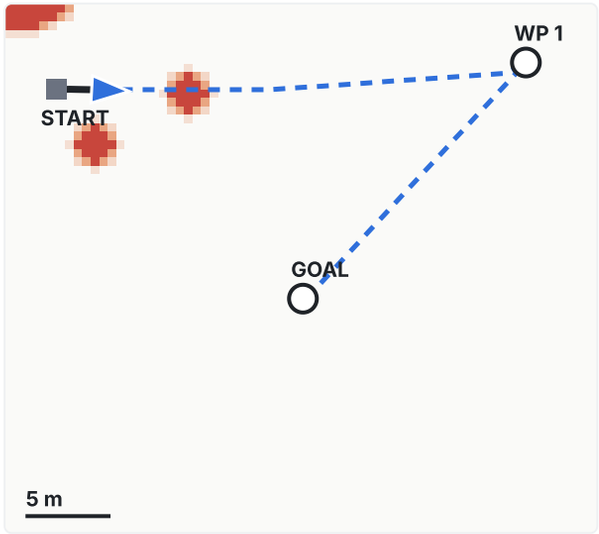


driven | planned | obstacle (global costmap)

SYSTEMS HEALTH

Localization	100 Hz · 0 ms
Cameras	3 / 3 · 19 Hz
LiDAR	10 Hz · 6 ms
Planning	planner alive
Control	controller alive
Safety	velocity filter OK

LiDAR TOP VIEW + LOCAL PATH

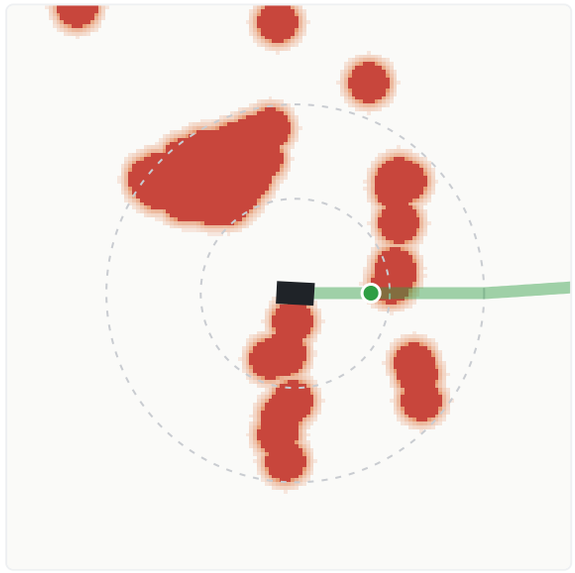

obstacle
near obstacle
local path
lookahead 4.0 m

rings 5 m / 10 m
grid 30 × 30 m
updated 1.7×/s

STOP TRIGGERS

T1 Camera frame gap > 158 ms	STOP	armed
T2 Camera rate < 15 Hz	STOP	armed
T3 Camera feed lost > 0.5 s	STOP	armed
T4 Localization stale > 0.2 s	STOP	armed
T5 Autonomy command stale	STOP	armed
T6 Path follower aborted	ALERT	armed
T7 Collision monitor zone	ALERT	armed

MISSION

WP 1	25.0 m
GOAL (14.5, −12.3)	44.5 m
Driven so far	2.7 m

Home | Map | Sensors | Logs | Faults | Triggers

No active alerts

Home — stop trigger fired

Same playback at 11:46:06.2 CDT. Camera 2 has gone 158 ms without a frame.

CAVS Center for Advanced Vehicular Systems

Autonomous Vehicle Testing

LIVE · bag playback · autonomy_demo_0

LOCALIZATION	COMMS	SAFETY	
OK	0.1 s	STOP	11:46:06 Sep 11, 2026 CDT

STOP SENT · 11:46:06.2 T1 Camera frame gap: Camera 2, 265 ms (limit 158 ms). Vehicle halted, safety driver in control.


DRIVE STATUS

STOPPED
T1 camera frame gap
Safety driver in control

Speed	0.0 m/s
Turn rate (cmd)	0.0 °/s
Command source	none
Command age	stop latched


CAMERAS

Camera | LiDAR | Faults

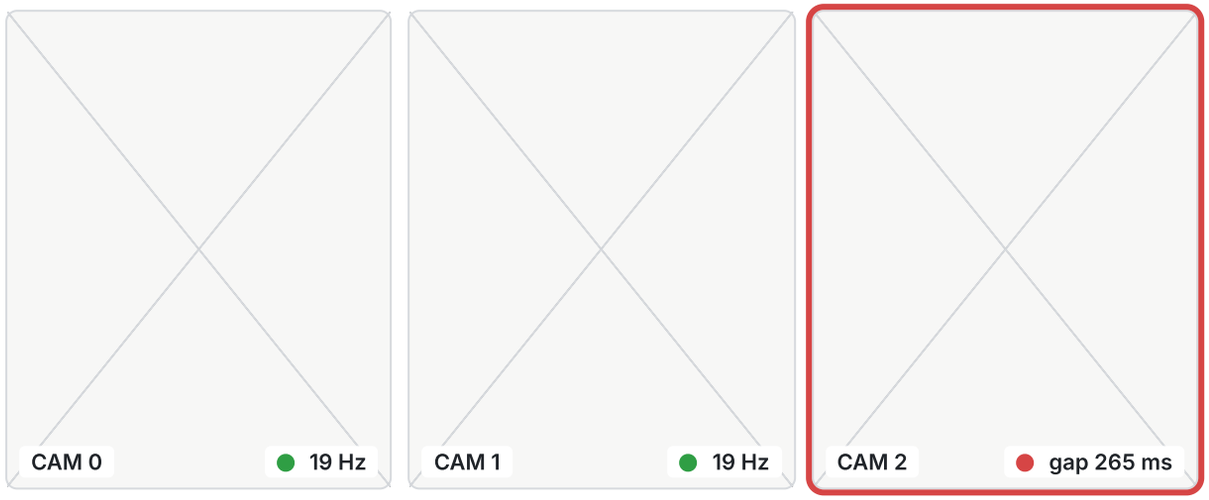

Previews refresh once per second · 320 × 240 JPEG

NAVIGATION

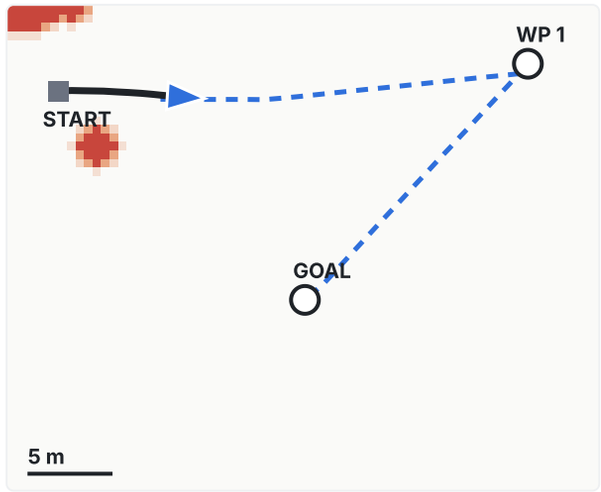


driven | planned | obstacle (global costmap)

SYSTEMS HEALTH

Localization	100 Hz · 0 ms
Cameras	Cam 2 gap 265 ms
LiDAR	10 Hz · 9 ms
Planning	planner alive
Control	aborted 11:46:03
Safety	STOP sent

LiDAR TOP VIEW + LOCAL PATH

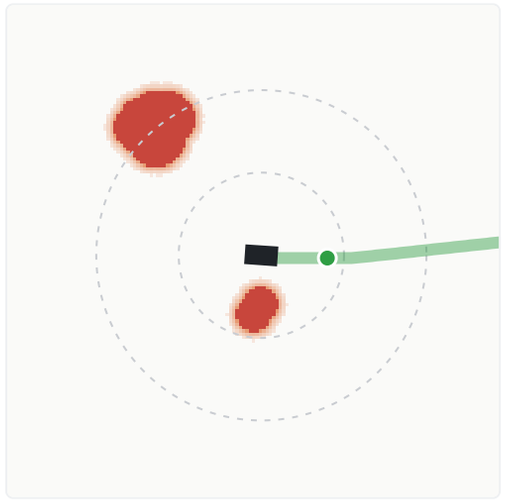

obstacle
near obstacle
local path
lookahead 4.0 m

rings 5 m / 10 m
grid 30 × 30 m
updated 1.7×/s

STOP TRIGGERS

T1 Camera frame gap > 158 ms	STOP	FIRED
T2 Camera rate < 15 Hz	STOP	armed
T3 Camera feed lost > 0.5 s	STOP	armed
T4 Localization stale > 0.2 s	STOP	armed
T5 Autonomy command stale	STOP	armed
T6 Path follower aborted	ALERT	11:46:03
T7 Collision monitor zone	ALERT	armed

MISSION

WP 1	20.7 m
GOAL (14.5, −12.3)	41.1 m
Driven so far	6.8 m

Home | Map | Sensors | Logs | Faults | Triggers

STOP · T1 Camera 2 frame gap · 11:46:06

Changes from the team sketch

Same layout and panel positions. Each change follows from the data in the bag or from system latency.

Header	GPS and Battery replaced by Localization and Safety (no GPS or battery data). Clock shows the bag's recorded time.
Drive status	Gear and Terrain mode removed (no data). Steering shown as commanded turn rate. Speed in m/s; this run peaks at 2.2 m/s.
Front camera	Obstacle boxes and drivable corridor removed (no calibration, no detection, latency). Replaced by 3 camera previews at 1 frame/s.
Navigation	Real global costmap, driven path and planned path. WP 1 is inferred from the turn in the planned path; only 2 waypoints exist. NO-GO zone removed (no data).
Systems health	Perception replaced by Cameras and LiDAR feed health. Each row shows its live value, not only OK.
LiDAR + planned path	Merged into one top-down panel: real occupancy grid with the controller's local path and lookahead point. Perspective path view removed (needs camera calibration).
Upcoming waypoints	Replaced by Mission: distance to WP 1 and to the goal in metres. km distances and terrain items removed.
New: Stop triggers	The client's main requirement. Shows each trigger's state; a fired trigger turns the screen into the STOPPED state (page 2).