Solar ESS Co. Ltd.
53 Moo 2 Tambon Nanglae, Amphoe Muang
Chiang Rai 57100, Thailand
Tel 063 151 6694, 089 632 5829
www.solaress.org · LINE: solaress1

SOLAR ESS MONTHLY REPORT · OCTOBER 2026 · SOLISCLOUD · PLANT REPORT


Healthy

Home S16, Krabi


98% solar · check kWp

10 kWp · 10 kW 1-phase hybrid inverter · battery

1183	4.93	98%	0.9	0	22.7
kWh solar	kWh/kWp/day	solar share of use	kWh/day bought	kWh exported	kWh/day from battery

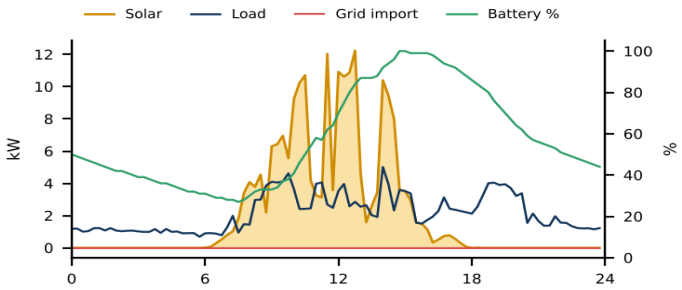

24 October, 5-minute data

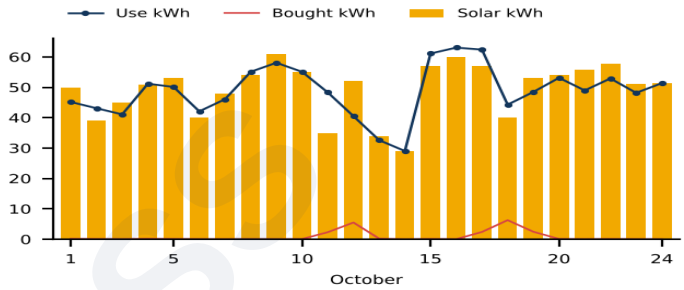

Daily totals, 1–24 October


What we found

- Runs almost fully on solar (98%); grid nearly unused.
- Peak 12.2 kW on '10 kWp' – the registered capacity is probably too low.

What to do

- Correct the PV capacity in SolisCloud. No other action.

How this plant compares with the other SolisCloud plants (kWh per kWp per day, 1–24 Oct)

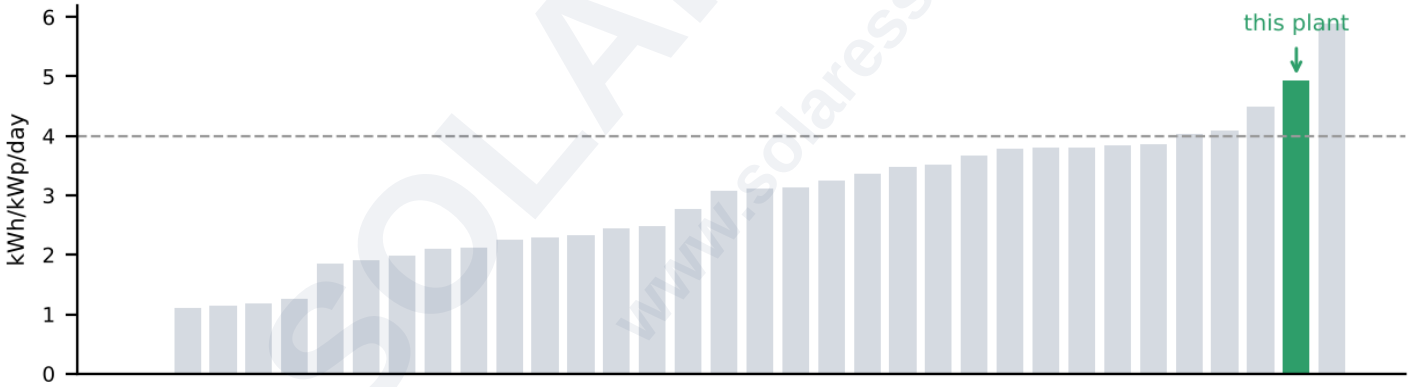

Rank 2 of 34 for yield per kWp. Dashed line ≈ 4.0, a typical clear month in the north and centre. A low yield is not always a fault – a full battery or little daytime load makes the inverter throttle the panels.

This plant report is part of the October 2026 SolisCloud fleet review on www.solaress.org (Technical → Monthly Report), which also lists the recommended standard settings. Figures are estimates from monitoring data; site name removed.