





INSPECTION STANDARD (HT LAB)

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)		26/07/21		
Part Name:- Sun Shaft, Right		Part No.:- 93632805		Inspection Standard Number		SIP/4091/170	
Customer :- TMTL		Change Level.:-00		Part Stage		HT Lab.	
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58-62 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measured To 550HV	*	0.6~0.9 mm	Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	Core Hardness at PCD	*	42 HRC Max	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Core Hardness at RCD	*	30 HRC Min	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
5.	Micro Case	*	Tempered Martensite + RA<12%, Carbide (Globular) Upto 2% Max.	Microscope	1Pc/Lot	HT Lab Report	A
6.	Core Micro	*	LCM+Bainitic Structure, Ferrite Upto 5% Max.	Microscope	1Pc/Lot	HT Lab Report	A
7.	IGO / NMTP	*	20 Micron Max.	Microscope	1Pc/Lot	HT Lab Report	A

Material- EN353

Alternate Material- SAE8620H

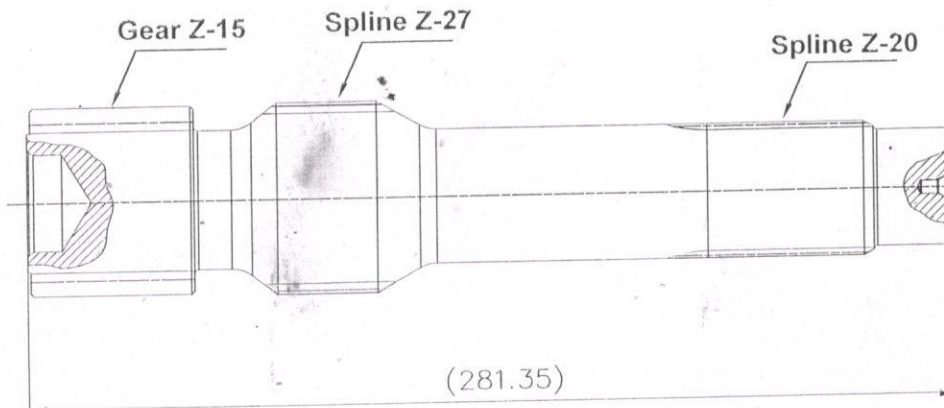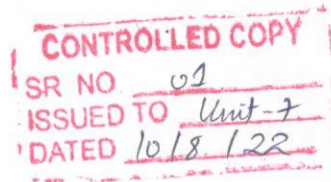

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ * Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change