

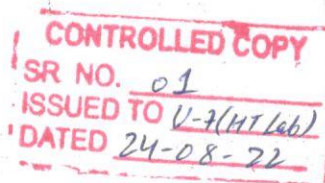
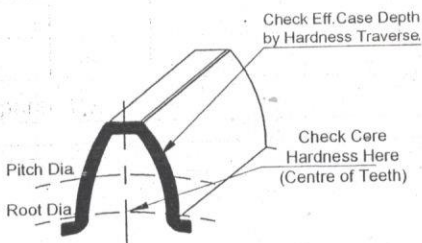


INSPECTION STANDARD (HT LAB)

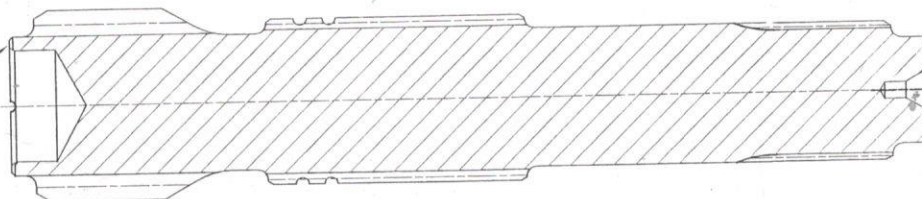
☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	04/12/2020
Part Name:- Shaft Sun Gear		Part No.:- 3210C31501	Inspection Standard Number SIP/P0001/190	
Customer :- TAFE		Change Level.:-00	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness On Spline Teeth	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measured To 526HV 0.5 / 516HV 1	*	1.0~1.3 mm	Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	Core Hardness	*	34~40 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Case Depth of Face F1	*	0.5 mm(Min.)	Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
5.	Case Depth of Face F2	*	0.5 mm(Min.)	Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
6.	Surface Carbon Content	*	0.8 to 1.1%	Microscope	1Pc/Lot	HT Lab Report	A
7.	Micro Case	*	Tempered Martensite+ RA<15%	Microscope	1Pc/Lot	HT Lab Report	A
8.	Core Micro	*	LCTM+Bainitic Structure	Microscope	1Pc/Lot	HT Lab Report	A

OPEN SKTCH

Material-En353

Face 'F1'



Face 'F2'

Reaction Plan: A-यदि Inspection करते समय कम्पोंनट खराब मिले तो खराब कम्पोंनट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में

Department के Incharge को बतायें ।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change