INSPECTION STANDARD (HT LAB)

MILESTONE

☐ Prototype ■ Pre-Launch ☐ Production		Date (Original)	11/01/19
Part Name:- Spur Pinion 1st Z-17	Part No.:- 93675592	Inspection Standard Number	SIP/4279/190
Customer :- TMTL	Change Level.:-00	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	►	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD Measured To 550HV	►	0.80~1.10 mm	Micro Vicker & Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Core Hardness at PCD	►	42 HRC (Max)	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Core Hardness at RCD	►	30 HRC (Min)	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Micro Case	*	Tempered Martensite + RA<12%, Carbide (Globular) Upto 2% Max.	Microscope	1Pc/Lot	FMT-HT-39	A
6.	Core Micro	*	LCM+Baintic Structure, Ferrite Upto 5% Max.	Microscope	1Pc/Lot	FMT-HT-39	A
7.	IGO / NMTP	*	20 Micron Max.	Microscope	1Pc/Lot	FMT-HT-39	A

Space For Sketch

Material- 20MnCr5

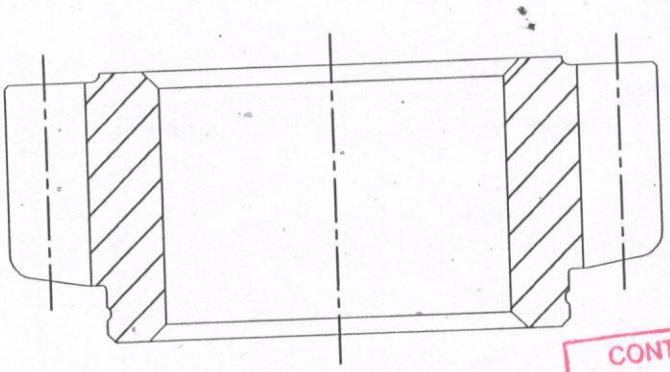

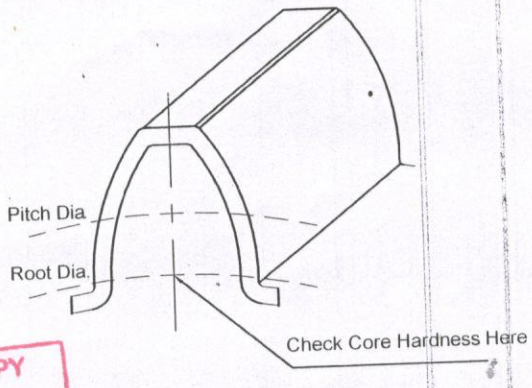

CONTROLLED COPY
SR NO. 01
ISSUED TO U-7 (HT lab)
DATE 04/06/22

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टेग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ► Special Characteristics as Per Drawing | * Special Characteristics For Process | ⚠ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change