





INSPECTION STANDARD (HT LAB)

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	18/03/2021
Part Name:- Main Shaft -PS760/PS900		Part No.:- 459/M5202	Inspection Standard Number	SIP/P0002/200
Customer :- JCB-UK		Change Level.:-00	Part Stage	HT Lab.


Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58-63 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD Measured 540HV At 2.5 Kg Load	*	0.50~0.75 mm	Micro Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Case Micro	*	Tempered Martensite+ RA<10%,	Microscope	1Pc/Lot	FMT-HT-39	A
4.	Core Micro	*	LCTM+Bainitic Structure	Microscope	1Pc/Lot	FMT-HT-39	A
5.	For more details refer JCB STD. 9995/0002						

OPEN SKETCH

Material- 20MnCr5

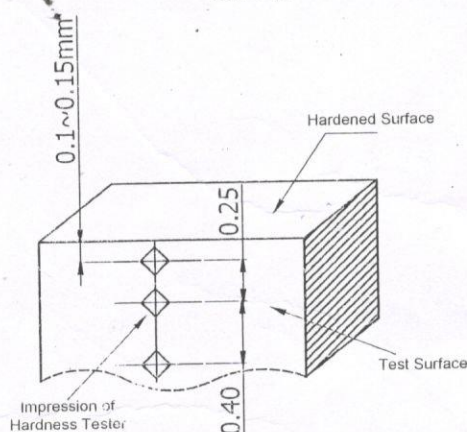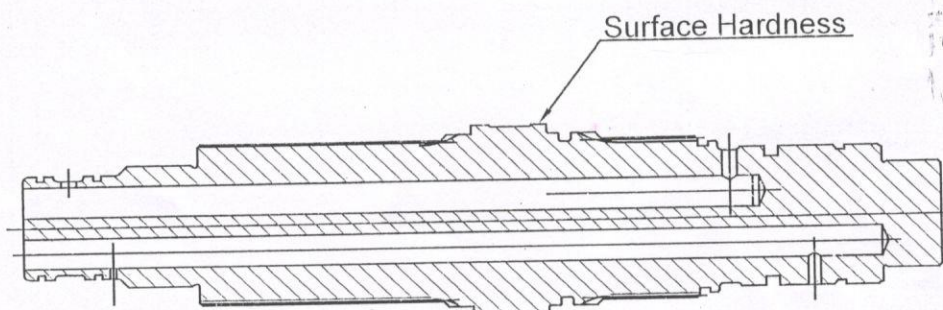

ECD Checking Pattern Details

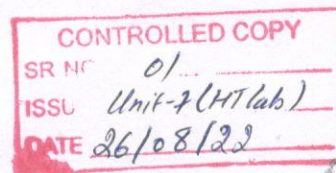

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Checked By:

Approved By: