



INSPECTION STANDARD (HT LAB)





Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	01/10/2010
Part Name:- Pinion Planetary Reduction		Part No.:- 0897018M01	Inspection Standard Number	SIP/4012/190
Customer :- TAFE		Change Level.:-00	Part Stage	HT Lab

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measured At 513HV1	*	0.90~1.15 mm	Micro Vicker / Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	Core Hardness	*	34~47 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Surface Carbon Content	*	0.8~1.1%	Microscope	1Pc/Lot	HT Lab Report	A
5.	Case Micro	*	Tempered Martensite + R.A.15%Max	Microscope	1Pc/Lot	HT Lab Report	A
6.	Core Micro	*	LCM+Bainitic Structure +Sorbite & Ferrite Free	Microscope	1Pc/Lot	HT Lab Report	A

Space For SKETCH:-

Material Grade:- 16 MnCr5

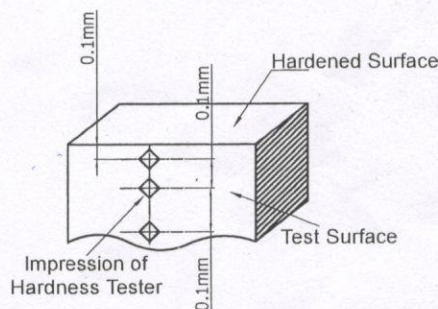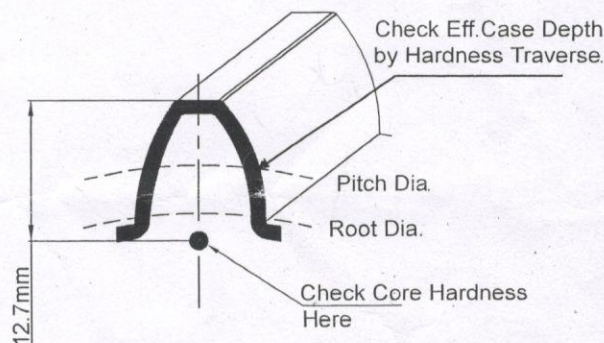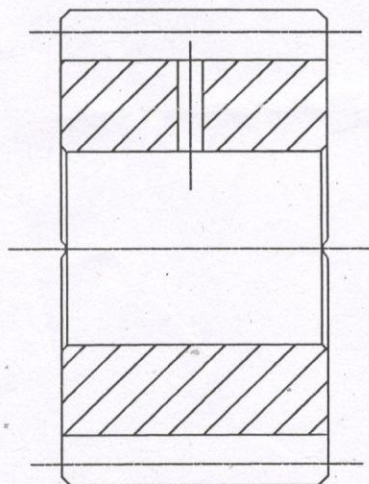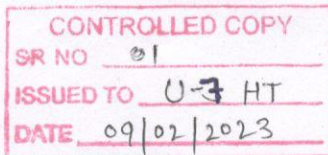

Transverse For Hardness Check
(Take Every Impression At a Distance Of 0.1mm)

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट का Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By: *Arshay*

Checked By: *[Signature]*

Approved By: *[Signature]*