

INSPECTION STANDARD (HT LAB)



☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	30/09/15
Part Name:- Shaft Pinion Rear Axle Z-14 (WET BRAKE)		Part No.:-D10383070	Inspection Standard Number	SIP/4147/120
Customer :- ESCORTS		Change Level.:-00	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness (On Spline Teeth)	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab	A
2.	Surface Hardness (On Ground Diameter)	*	54 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	HT Lab	A
3.	ECD At 513 HV (At Spline End)	*	1.0~1.3 mm (As per Communication)	Vicker Hardness Tester	1Pc/Lot	HT Lab	A
4.	ECD At 513 HV (At Gear PCD)	*	1.0~1.3 mm (As per Communication)	Vicker Hardness Tester	1Pc/Lot	HT Lab	A
5.	ECD At 513 HV (On Ground Surfaces)	*	0.8 mm Min. (As per Communication)	Vicker Hardness Tester	1Pc/Lot	HT Lab	A
6.	Core Hardness	*	32~41 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab	A
7.	Case Micro	*	Tempered Martensitec RA<20%	Microscope	1Pc/Lot	HT Lab	A
8.	Core Micro	*	LCTM + Bannite	Microscope	1Pc/Lot	HT Lab	A

OPEN SKTCH

Material -20Mn5Cr5-S

CONTROLLED COPY
 SR. NO. 01
 ISSUED TO Prod. (Unit 7)
 DATED 26/12/19


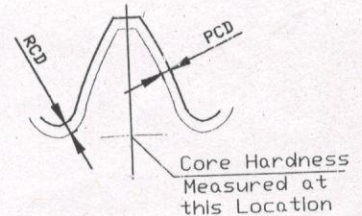


Figure 1- 1

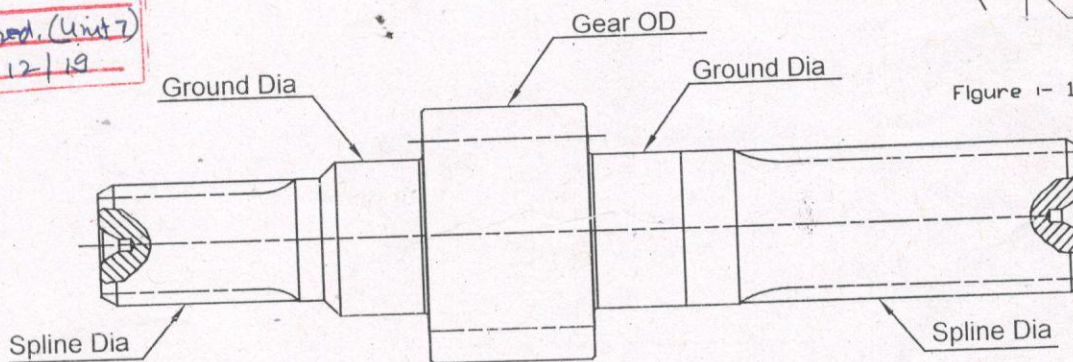

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing * Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Checked By:

Approved By: