





INSPECTION STANDARD (HT LAB)

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	09/01/2021		
Part Name:- CR Spline HUB G1		Part No.:- 93659537	Inspection Standard Number		SIP/4401/130	
Customer :- TMTL		Change Level.:-00	Part Stage		HT Lab.	

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	▶	60±2 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD Measured To 550HV5 at PCD	▶	0.8 To 1.1 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Core Hardness at PCD	▶	42 HRC Max.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Core Hardness at RCD	▶	30 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Case Micro	▶	Tempered Martensite + RA<15%, Carbide Size Not To Exceed 0.010 mm	Microscope	1Pc/Lot	FMT-HT-39	A
6.	Core Micro	▶	LCM+Bainitic Structure, Ferrite Upto 10% Max.	Microscope	1Pc/Lot	FMT-HT-39	A
7.	IGO / NMTP	*	20 Micron Max.	Microscope	1Pc/Lot	FMT-HT-39	A

OPEN SKTCH

Material- 20MnCr5

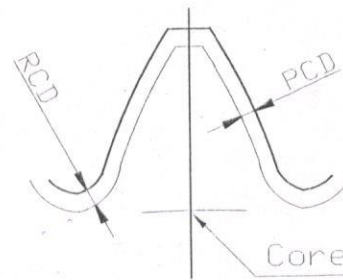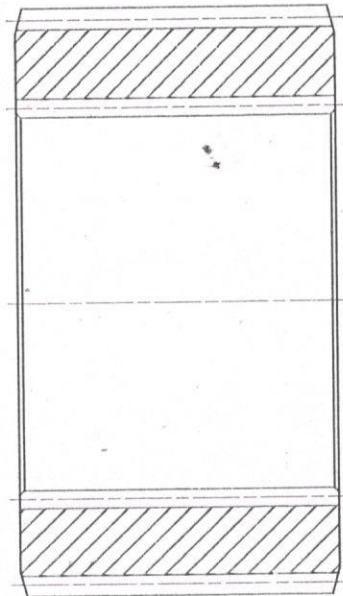

Core Hardness Measured at this Location

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ▶ Special Characteristics as Per Drawing * Special Characteristics For-Process ▲ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change