

INSPECTION STANDARD (HT LAB)



☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	10/08/15
Part Name:- Shaft Pinion Rear Axle-RH (Z-11)		Part No.:-D10208860	Inspection Standard Number	SIP/4150/120
Customer :- ESCORTS		Change Level.:-00	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness (On Spline Teeth)	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	Surface Hardness (On Ground Diameter)	*	54 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	ECD At 513 HV (At Spline End)	*	0.7~1.0 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	ECD At 513 HV (At Gear PCD)	*	0.7~1.0 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	ECD At 513 HV (On Ground Surfaces)	*	0.6 mm Min.	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
6.	Core Hardness	*	32~41 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
7.	Case Micro	*	Tempered Martensitec RA<20%	Microscope	1Pc/Lot	FMT-HT-39	A
8.	Core Micro	*	LCM + Bannite	Microscope	1Pc/Lot	FMT-HT-39	A

OPEN SKTCH

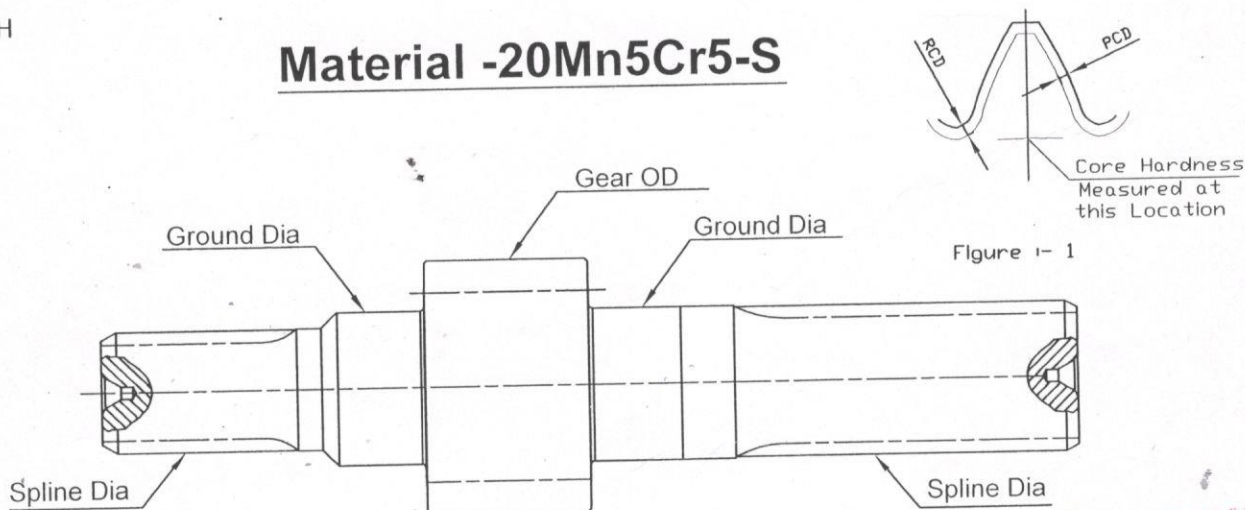
Material -20Mn5Cr5-S

Figure 1- 1

CONTROLLED COPY
 SR NO 61
 ISSUED TO WITF
 DATED 6/12/14

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Department of Incharge of Quality				Special Characteristics as Per Drawing				* Special Characteristics For Process				△ Special Characteristics For Safety			
Legends:															
Change Details															
Date		Rev. No.		Change		Reason for Change		Date		Rev. No.		Change		Reason for Change	

Approved By: