





INSPECTION STANDARD (HT LAB)

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)		15/06/12	
Part Name:- Bull Pinion Shaft RH		Part No.:- 10026085AH		Inspection Standard Number		SIP/4045/180
Customer :- ITL		Change Level.:-00		Part Stage		HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD 530 HV 1KG	*	1.15~1.35 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Core Hardness	*	30~39 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Case Micro	*	Tempered Martensite+ RA 15% Max.	Microscope	1Pc/Lot	FMT-HT-39	A
5.	Core Micro	*	Bainite / Sorbite Free Ferrite 10%	Microscope	1Pc/Lot	FMT-HT-39	A

OPEN SKTCH

MATERIAL :- SAE 8620H

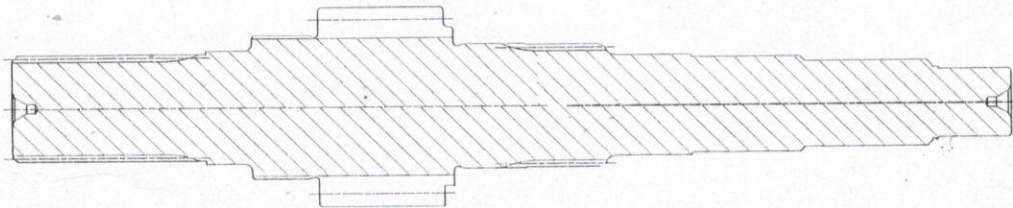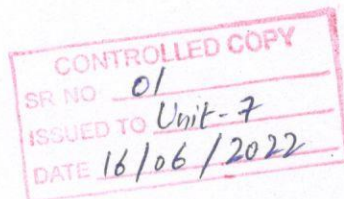

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ☒ Special Characteristics as Per Drawing * Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change