





INSPECTION STANDARD (HT LAB)

Page 01 of 01

☐ Prototype	☒ Pre-Launch	☒ Production	Date (Original)	12/12/17
Part Name:- Ring Gear Planetary Z-56		Part No.:- D10646140A	Inspection Standard Number	SIP/4241/110
Customer :- Escorts		Change Level.:-00	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness On Spline Teeth	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD Measured Up To 513 HV	*	0.70~1.0 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Core Hardness	*	32~41 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Micro Case	*	Tempered Martensite+ RA<15%	Microscope	1Pc/Lot	FMT-HT-39	A
5.	Core Micro	*	Bainite+Sorbide Free Ferrite	Microscope	1Pc/Lot	FMT-HT-39	A
6.	Material		20MnCr5-S				
7.	Process & Other Quality Requirements as per Escort6s Std No MS-4						

OPEN SKTCH

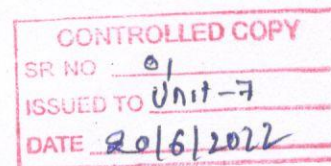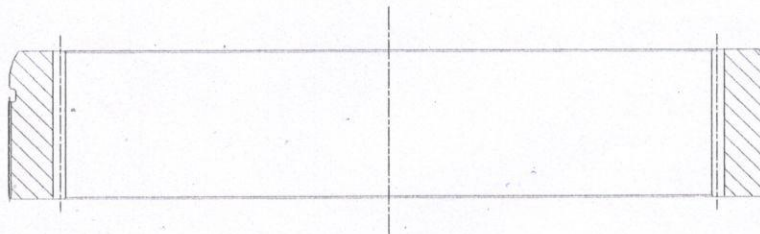

Reaction Plan: A-यदि Inspection करते समय कम्पोंनैट खराब मिले तो खराब कम्पोंनैट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By:

Checked By:

Approved By: