




INSPECTION STANDARD (HT LAB)

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)		24/06/2014		
Part Name:- Rear Axle 75HP (RH)		Part No.:-74693608		Inspection Standard Number		SIP/4067/180	
Customer :- CHN		Change Level.:-00		Part Stage		HT Lab.	
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58-60 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD At 513HV (50 HRC)	*	0.9~1.2 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Core Hardness at RCD	*	30-38 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Core Hardness at PCD	*	45 HRC Max.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Case Micro	*	Tempered Martensite RA ≤10%	Microscope	1Pc/Lot	FMT-HT-39	A
6.	Core Micro	*	LCTM+Bainitic	Microscope	1Pc/Lot	FMT-HT-39	A
7.	Intergranular Oxide (IGO)	*	0.020 Max.	Microscope	1Pc/Lot	FMT-HT-39	A
8.	NMTP	*	At tooth Half Height - Not allowed from the surface to a depth of 50% of the specified Min ECD	Microscope	1Pc/Lot	FMT-HT-39	A
9.	NMTP	*	At tooth Fillet - Trace Amount of NMTP are allowed from the surface to a depth of 30% of the require Min root fillit ECD	Microscope	1Pc/Lot	FMT-HT-39	A

OPEN SKTCH

Material -SAE-8620

CONTROLLED COPY
 SR. NO. 01
 ISSUED TO Prod. (Unit-7)
 DATED 07/06/14

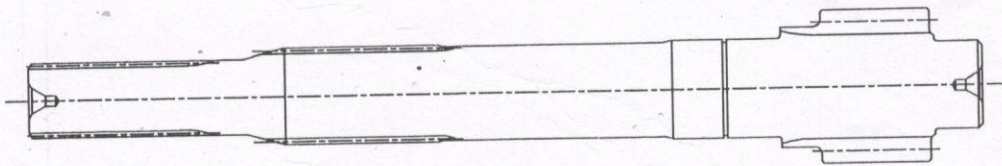

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing * Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Checked By:

Approved By: