



INSPECTION STANDARD (HT LAB)


Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	10/08/2024			
Part Name:- Bull Gear Z-56		Part No.:- 10009899BB		Inspection Standard Number		SIP/20011/210	
Customer :- ITL		Change Level.:-00		Part Stage		HT Lab.	



Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	60~64 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measured Up To 530 HV at 5 kg. Load at Gear PCD (Z-56)	*	1.15~1.35 mm	Micro Vicker/Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	Core Hardness check at Gear RCD (Z-56)	*	35~45 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Micro Case	*	Tempered Martensite+ RA<15% Retained Austenite No Carbide Network Required	Microscope	1Pc/Lot	HT Lab Report	A
5.	Micro Core	*	Bainite/Sorbite Free Ferrite <10%	Microscope	1Pc/Lot	HT Lab Report	A

SPACE FOR SKETCH:-

Material :- EN-355

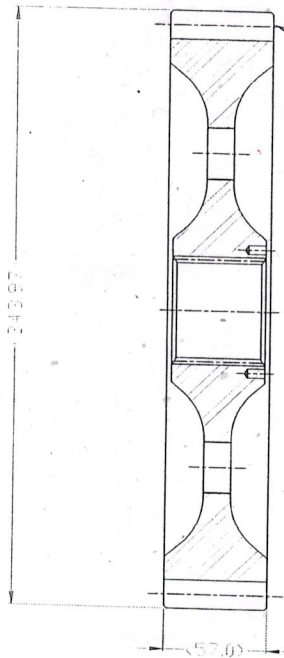

Gear (Z-56)

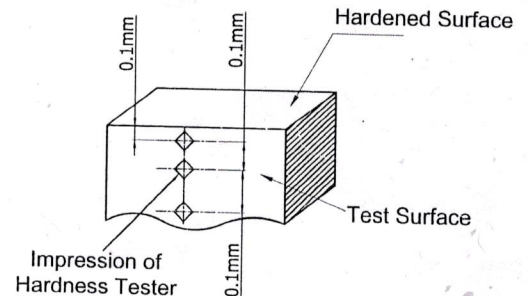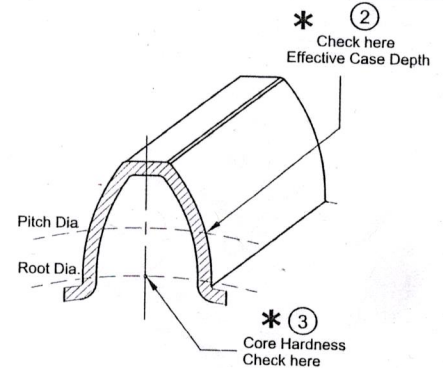

Transverse For Hardness Check

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By: 1