



INSPECTION STANDARD (HT LAB)





Page 01 of 0

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	29/12/2023
Part Name:- Second Gear 40T-SS670		Part No.:- 459-S6897	Inspection Standard Number	SIP/21011/160
Customer :- JCB (UK)		Change Level:-A	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	59-63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Check 540HV5 At Gear PCD (Z-40)	*	0.75~1.0 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	ECD Check 540HV5 At Bore Dia. (Ø50.0)	*	0.5 mm min.	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Core Hardness at Gear RCD (Z-40)	*	450vdh5 max. (45HRC)	Vicker Hardness Tester/ Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
5.	Micro Case	*	Tempered Martensite+ RA 10% Max.	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A
6.	Micro Core	*	LCM+Bainitic Structure,	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A

SPACE FOR SKETCH :-

Material- 20MnCr5

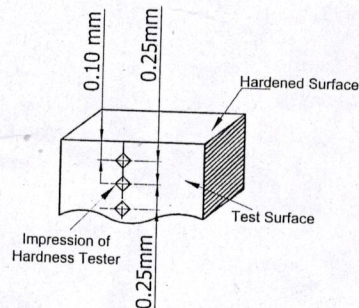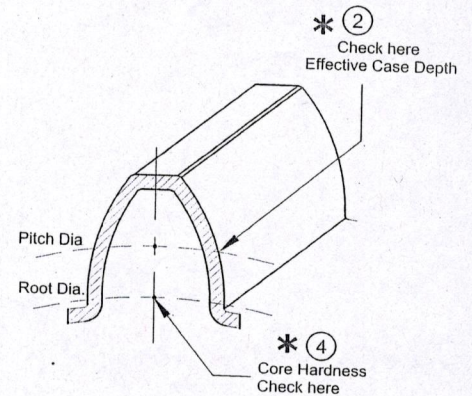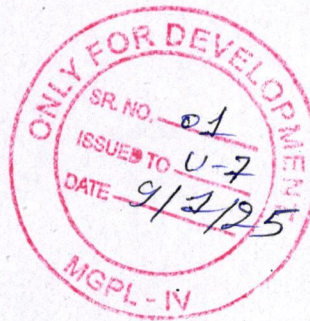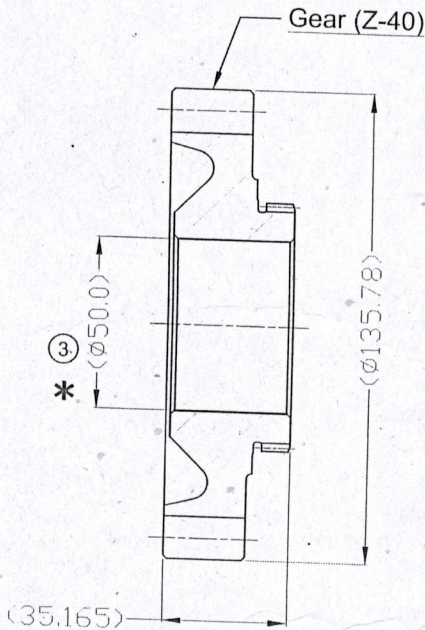

Transverse For Hardness Check

Reaction Plan: A-यदि Inspektion करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: Special Characteristics as Per Drawing * Special Characteristics For Process Special Characteristics For Safety

Change Details							
Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change
21/09/24	A	Customer Drawing Revised With Part No. 459/S6897 was 459/S6709 As Per ECN 77/24	New Customer Drawing Received				

Prepared By:

Checked By: