INSPECTION STANDARD (HT LAB)

☐ Prototype	■ Pre-Launch	☐ Production	Date (Original)	25/07/18
Part Name:- Assy Hub & Bush	Part No.:- 1549A03901		Inspection Standard Number	SIP/4261/130
Customer :- TAFE	Change Level.:-00		Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	**Surface Hardness**	*	**58~62 HRC**	**Rockwell Hardness Tester**	1Pc/Lot	HT Lab Report	A
2.	**ECD Measured Up To 550 HV external spline Z-26**	*	**0.75~1.15 mm**	**Vicker Hardness Tester**	1Pc/Lot	HT Lab Report	A
3.	**Core Hardness**	*	**27~41 HRC**	**Rockwell Hardness Tester**	1Pc/Lot	HT Lab Report	A
4.	**Surface Carbon Content**	*	**0.8/1.10%**	**Microscope**	1Pc/Lot	HT Lab Report	A
5.	**Micro Case**	*	**Tempered Martensitc+ RA<15%**	**Microscope**	1Pc/Lot	HT Lab Report	A
6.	**Core Micro**	*	**Baintic Structure + LCTM**	**Microscope**	1Pc/Lot	HT Lab Report	A

OPEN SKTCH:-

Material-20MnCr5

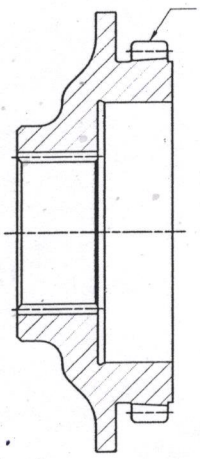

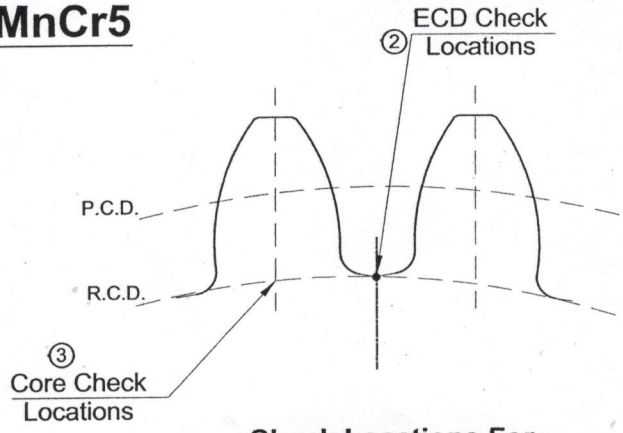

Check Locations For Spline Tooth

CONTROLLED COPY
SR NO. 01
ISSUED TO U-7
DATE 23/01/25

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टेग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends:	► Special Characteristics as Per Drawing	* Special Characteristics For Process	⚠ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change