

AIR POLLUTION CONTROL - FIELD INSPECTION WORK SHEET

Key Punch Data:		County	Source	Emission	Action		Date			Agency/
		Number	Number	Point #	Type		Mo	Day	Yr	Indiv. ID
L	1	01101	0220	000031	009	1997	12	08	21	001
		1	3	4	7	8	12	13	15	16
							18	52	54	59
										66
										68
										80

Compliance Status

Line 2 (Dup. cols. 1-15 from Line 1)

00151

11

RECEIVED

16 18

78

80

(NOTE: Columns not shown must be left blank)
(Do not punch Line 2 if column 78 is blank)

Company: Martin Marietta Cement

SIC: _____

Address: Lyons

County: Boulder

Person Contacted: Gerald Anderson, Dr. McCracken

Phone: _____

Inspected by: M. Parsons / J. Brower / B. Miron

Time: 2 AM/PM

1. Per semi annual insp and process change status check.
2. Plant operating - running about 80% of capacity, still problems with new system. Mr Anderson had talked to John Plog at the APCD engineering section and we agreed with this position that a "notice of startup" and the time table for startup need not begin until debugging & new systems operation reach 90-95% max capacity. This will assure the final approval insp sees a "normal" operation. This is expected in 30-60 days.
3. Problem areas remaining:
 - Spray tower dust emissions - from collection/knock out dump system. MM wasn't sure what firm or amount would be generated so weren't sure how to handle - system is putting out 1 to 1.5 lbs of v. fine material per hour. Is a fugitive emission; plan to convey the mat'l back into the system as it has value.

Problems - (cont)

ACTION TYPE - DESCRIPTION

- 12 - Inspection
- 22 - Source Test
- 23 - Opacity Observation
- 24 - Odor Observation

COMPLIANCE STATUS CODES

- 0 - Unknown
- 1 - Not in Compliance
- 2 - In Compliance by Source Test
- 3 - In Compliance by Inspection
- 4 - In Compliance by Certification
- 5 - In Compliance with Increments of Progress
- 6 - Not in Compliance with Increments of Progress
- 7 - Unknown Compliance with Increments of Progress
- 8 - No Applicable State Regulation
- 9 - In Compliance -- Closed Down

Process itself: now at 80-85% max production. Expect to change the burner (combustion chamber) configuration within 6-8 weeks, moving the burner & input feed points in the chamber. Now must use some oil to keep the coal going. Max production is 1250 tons of clinker per day. (24 hr.)

4. In stack emission analyzers will be installed south of the stack in a new bldg. HC unit at ~~the~~ site. Sox & NOx will be bought soon. Intake will be in dust work.


5. Coal supply is northern coal Co - Cragg. Analysis will be presented when stack test protocol set up.

6. A frame - bldg closed, under negative pressure. Only exit point under normal operation is "incline section" where the clinker comes up and out at the A frame - mid & east side of bldg. Conveyors have "in line" dust collectors at each of 6 points & keep the ally clear.

7. One coal mill new coal silo - see map.

RESEARCH

10

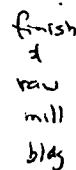

11. Answering :

"3rd ridge", "3rd inner ridge", "4th ridge"

~~very~~ varying HC & iron content. 4th ridge is high iron (good for type 2 cement) but also has elements sulfur deposits. won't be used.

B pt - high calcium shale - 45-50% of mixture for cement.

D pit - south along Hygiene road

21F pbs - south between Hygrade & St Union Roads.

(over)

1. Blasting - done ~3 days a week, usually during the noon hour to reduce neighbor complaints. M.M. has switched from primer cord to "tube gas" igniter - much quieter.

3 million lbs of mat'l blasted & moved each year.

13. Other materials used in quarry -

iron ore from Aspen area 12 000 tons / yr.

gypsum from Larimer County 30 000 tons / yr.

weathered shale - HC gas, used to blend & reduce HC "plume" in winter.

14. M-M estimates 37 more years of plant operation here until the deposits run out.

Emissions calculations, estimates. From permit application C-12,444

	Pt	SO ₂	NO _x	HC	CO
pre modifications	276	879	385	75	188
w/ modifications					
uncontrolled	121,973	3726	305	5	10
controlled	155	540	305	5	10
allowable - Reg 1, etc	306	851	568	—	—
Status	ok	ok	ok	ok	ok

AIR POLLUTION CONTROL - FIELD INSPECTION WORK SHEET

Key Punch Data:		County	Source	Emission	Action		Date			Agency/
		Number	Number	Point #	Type		Mo	Day	Yr	Indiv. ID
Line 1	101101	0220	00003	000	12	082180	1	1	1	1
	1 3 4 7 8 12 13 15 16 18 52 54 59 66 63 30									

Compliance Status

Line 2 (Dup. cols. 1-15 from Line 1)

101051	11	11
15 18 78 80		

(NOTE: Columns not shown must be left blank)
(Do not punch Line 2 if column 78 is blank)

Company: <u>Martin-Marietta</u>	SIC: _____
Address: <u>Lyons Colo.</u>	County: <u>Boulder</u>
Person Contacted: <u>Gerald Anderson</u>	Phone: _____
Inspected by: <u>Bill Miron, Mark Parsons, Jan</u>	Time: <u>2:00</u> AM/PM <u>PM</u>

Point 001

Cement kiln: Burning 100% coal at this time with a clear stack (opacity 0%). Running at approximately 80-85% capacity. Capacity is 1250 Tons/day (clinker product).

Point 002

crushers: Controlled by baghouse, 0% opacity

Point 003

handling system: Covered and controlled by mikro-pulse collector, 0% opacity

Point 004

A-frame storage: Totally enclosed, no fugitive emissions noted.

Point 005

Boiler: No opacity observed.

Point 006

APC-78 (Rev. 7-77-10) Coal unloading: No opacity observed and storage

Point 007

slate Pit Quarry: No fugitive emissions noted.

ACTION TYPE - DESCRIPTION

12 - Inspection
22 - Source Test
23 - Opacity Observation
24 - Odor Observation

COMPLIANCE STATUS CODES

0 - Unknown
1 - Not in Compliance
2 - In Compliance by Source Test
3 - In Compliance by Inspection
4 - In Compliance by Certification
5 - In Compliance with Increments of Progress
6 - Not in Compliance with Increments of Progress
7 - Unknown Compliance with Increments of Progress
8 - No Applicable State Regulation
9 - In Compliance -- Closed Down