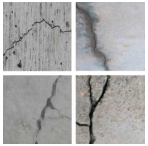
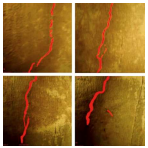
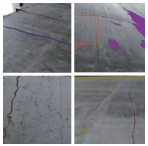
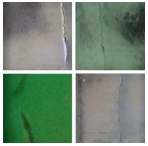
Task Description	Data				Model			
	Sample	Size	Annotations	Source	Algorithm	Architecture	Performance	Ref
Concrete Dam Structural Cracks Classification		50,476 patches 200 x 200 x 3 + 10,208 patches 200 x 200 x 3	2 Classes -Crack -Background	Partially Available [178]	Supervised DL	ResNet50	F1 = 79.36%	[179]
Dam Wall Crack Segmentation		14,268 images 224 x 224 x 3 + 855 images 768 x 576 x 3	Unspecified Annotated Pixels 1 Classes	Partially Available [180]	Supervised DL	LinkNet	mIoU = 89.24%	[181]
Dam Wall Surface Defects Segmentation		450 images 848 x 480 x 4	9.7% of Pixels Annotated 6 Classes	Cloud Available [182]	Supervised DL	U-Net	mIoU = 60.3%	[183]
Dam Wall Underwater Crack Images Generation and Detection		984 images 640 x 640 x 3 + 678 images 720 x 576 x 3	Unspecified B.Box Num. 2 Classes	Not Available	Supervised DL	YOLOx	mAP = 84.33%	[184]
Dam Wall Above-Water Crack Images Generation and Detection		450 images 256 x 256 x 3	Unspecified B.Box Num. 1 Class	Available Upon Request [185]	Supervised DL	YOLOv8s	mIoU = 84.1%	[185]