

CUSTOMER #: 1046

306057

SERVICE DEPARTMENT

NORTH SKY COMMUNICATIONS
16701 SE MCGILLIVRAY BLVD
VANCOUVER, WA 98683
AP@NORTHSKYCOMM.COM
HOME: 503-803-4173 CONT: 503-803-4173
BUS: CELL: SERVICE ADVISOR: 355 ABEL OBERBECK

INVOICE

PAGE 1



P.O. Box 55010
Portland, OR 97238-5010
6221 N.E. Columbia Blvd.
Portland, OR 97218
(503) 282-7777
(800) 622-6670
FAX (503) 282-8588
www.northsidetrucks.com

COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
	19	FORD F450		1FDTF4GT9KDA23948		76631/76638		T2923
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
20APR26 DD			15:30 20APR26			CHG	19MAY26	
R.O. OPENED		READY		OPTIONS: W-COMP:X ENG:6.7_Liter				
20APR26		19MAY26						

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL
A CUSTOMER STATES IN DERATE, BELIEVES IT NEEDS TURBO
CAUSE: .

MT212367A TSB 21-2367

725 WL4

1 HC4Z*6K682*C TURBOCHARGER ASY

CORE CHARGE W

1 BC3Z*6587*A GASKET

4 *W714639*S439 BOLT

1 FT4Z*6N652*B GASKET

2 BC3Z*9439*C GASKET - INTAKE MANIFOLD

1 BC3Z*9439*A GASKET - INTAKE MANIFOLD

1 BC3Z*9439*B GASKET - INTAKE MANIFOLD

1 BC3Z*8527*N RING - SEALING

2 BC3Z*8287*A CLAMP

1 FC3Z*8287*A CLAMP

2 *W718005*S900 BOLT

1 HC3Z*6C683*A FILTER ASY

1 HC3Z*6587*A GASKET

3 *W717004*S900 BOLT

1 EU2Z*14474*AB TERMINAL

1 BC3Z*8590*C SEAL

1 BC3Z*8590*H SEAL

1 BC3Z*8590*B SEAL

1 BC3Z*8590*A SEAL

1 FC3Z*6F089*A ACTUATOR ASY

-1 HC4Z*6K682*C CORE RETURN

12650DD EEC SYSTEM DIAGNOSIS - (QUICK TEST) - L

725 WL4

12650D45D EEC SYSTEM - DIAGNOSTIC PIN POINT TEST

- L

725 WL4

MTSMOKE ACTUAL TIME

725 WL4

12650D80D PID RECORDER/MONITOR TEST - L

* YOU MAY RECEIVE A SURVEY IN THE
* NEXT FEW DAYS. THE INFORMATION
* FROM THE SURVEY IS VERY IMPORTANT
* TO US. IF FOR ANY REASON YOU
* CANNOT RESPOND AS "COMPLETELY"
* SATISFIED PLEASE CONTACT SERVICE
* MANAGER AT (503) 282-7777 Ext. 109. *

www.northsidetrucks.com

EXCLUSION OF WARRANTIES "READ THIS"

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that Northside Ford Truck Sales, Inc. makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall Northside Ford Truck Sales, Inc. be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by Northside Ford Truck Sales, Inc., include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort. It is understood that purchaser is buying any used part (or parts) as listed in its present condition, "AS IS" including defects, without any representation or warranties, express or implied unless they are expressly set forth herein:

Customer Signature

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
EPA/HAZ.MAT.	
TOTAL CHARGES	
INS/DED/REW	
CORP-ACTIVITIES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER #: 1046

306057

SERVICE DEPARTMENT

NORTH SKY COMMUNICATIONS
16701 SE MCGILLIVRAY BLVD
VANCOUVER, WA 98683
AP@NORTHSKYCOMM.COM
HOME: 503-803-4173 CONT: 503-803-4173
BUS: CELL: SERVICE ADVISOR: 355 ABEL OBERBECK

INVOICE

PAGE 2



P.O. Box 55010
Portland, OR 97238-5010
6221 N.E. Columbia Blvd.
Portland, OR 97218
(503) 282-7777
(800) 622-6670
FAX (503) 282-8588
www.northsidetrucks.com

COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
	19	FORD F450		1FDTF4GT9KDA23948		76631/76638		T2923
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
20APR26 DD			15:30 20APR26			CHG	19MAY26	
R.O. OPENED		READY		OPTIONS: W-COMP:X ENG:6.7_Liter				
20APR26		19MAY26						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
							(N/C)
			725	WL4			
	9424AD	INTAKE MANIFOLD GASKETS - REPLACE					
		(9424/9433/9439/9441/9H486/9K461) - L					
		725	WL4				(N/C)
	MT9424A12	REPLACE TURBO					
		725	WL4				(N/C)
	MT6F089	MT TIME NO LABOR OP					
		725	WL4				(N/C)

FC: D50 42
PART#: HC4Z*6K682*C
COUNT:
CLAIM TYPE:
AUTH CODE:
725

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00

TSB 21-2367 AND TURBO CHARGER VERIFIED CHECK ENGINE LIGHT ON AND VEHICLE HAS INTERMITTENT LOW POWER AT TIMES. CHK FOR CODES AND FOUND P259F PRESENT IN MEMORY AND FOUND P027A PRESENT ON DEMAND FAULTED NOW AT THIS TIME. OASIS SHOWS PCM UPDATE IS AVAILABLE AS PER TSB 21-2367, . UPDATED PCM PROGRAMMING AND RETEST FOUND LOW POWER IS STILL PRESENT. FOUND P027A IS RELATED TO A CUSTOMER CONCERN NOT A WARRANTY CONCERN CONTINUED DIAGNOSTICS WITH P259F. PERFORMED PINPOINT TEST KA. KA1 CODE IS PRESENT ON SELF TEST, KA2 INSPECTED INTAKE, EXHAUST, SMOKE TEST, INSPECTED CAC TUBES REMOVED COLD AND AND HOT SIDE FOUND NO OBSTRUCTIONS, REINSTALLED FOR FURTHER TESTING, INSPECTED INTERNAL EGR SYSTEM AND FOUND OK AT THIS TIME. KA3 SMOKE TEST INTAKE AND EXHAUST AND PLUGGED INLET AND TAIL PIPE, ACCESS EGRT12 SENSOR FOR SMOKE PORT, ACCESS AND REMOVED MAP SENSOR FOR INTAKE SMOKE PORT, TEST PASS AT THIS TIME. REINSTALLED EGRT12 SENSOR AND MAP SENSOR FOR FURTHER TESTING. KA10 DATA LOGGER FOUND ALL PRESSURE SENSORS OK AND NOT BIASED AT THIS TIME, MAP, BARO, EBP SHOW 14.64PSI KOEO. KA11 PERFORMED TURBO CHARGER BOOST COMMAND TEST AND FOUND TURBO CHARGER IS NOT RESPONDING. KA12 INSPECTED TURBO CHARGER COMPRESSOR WHEEL, OK AT THIS TIME. REINSTALLED INTAKE PLENUM FOR ACCESS. KA13 TESTED VGT SOLENOID AND FOUND OK, HAD TO

* YOU MAY RECEIVE A SURVEY IN THE
* NEXT FEW DAYS. THE INFORMATION
* FROM THE SURVEY IS VERY IMPORTANT
* TO US. IF FOR ANY REASON YOU
* CANNOT RESPOND AS "COMPLETELY"
* SATISFIED PLEASE CONTACT SERVICE
* MANAGER AT (503) 282-7777 Ext. 109. *

www.northsidetrucks.com

EXCLUSION OF WARRANTIES

"READ THIS"

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that Northside Ford Truck Sales, Inc. makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall Northside Ford Truck Sales, Inc. be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by Northside Ford Truck Sales, Inc., include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort. It is understood that purchaser is buying any used part (or parts) as listed in its present condition, "AS IS" including defects, without any representation or warranties, express or implied unless they are expressly set forth herein:

Customer Signature

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
EPA/HAZ.MAT.	
TOTAL CHARGES	
INS/DED/REW	
CORP-ACTIVITIES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER #: 1046

306057

SERVICE DEPARTMENT

NORTH SKY COMMUNICATIONS
16701 SE MCGILLIVRAY BLVD
VANCOUVER, WA 98683
AP@NORTHSKYCOMM.COM
HOME: 503-803-4173 CONT: 503-803-4173
BUS: CELL: SERVICE ADVISOR: 355 ABEL OBERBECK

INVOICE

PAGE 3



P.O. Box 55010
Portland, OR 97238-5010
6221 N.E. Columbia Blvd.
Portland, OR 97218
(503) 282-7777
(800) 622-6670
FAX (503) 282-8588
www.northsidetrucks.com

COLOR	YEAR	MAKE/MODEL		VIN		LICENSE	MILEAGE IN/ OUT		TAG
	19	FORD F450		1FDTF4GT9KDA23948			76631/76638		T2923
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE	
20APR26 DD			15:30 20APR26				CHG	19MAY26	
R.O. OPENED		READY		OPTIONS: W-COMP:X ENG:6.7_Liter					
20APR26		19MAY26							

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL
REMOVE UPPER INTAKE MANIFOLD TO ACCESS VGT SOLENOID TO REMOVE FOR TEST.
KA14 CLEANED TURBO ACTUATOR, NO CHANGE, ACCESS AND REMOVED INTAKE
MANIFOLD AGAIN TO REPLACE VGT SOLENOID. KA15 FOUND TURBO STILL
UNRESPONSIVE. AT THIS TIME TURBO CHARGER BOOST CONTROL INTERNAL TO
TURBO CHARGER IS SEIZED AND IS NOT MOVING. ACCESS AND REMOVED INTAKE
MANIFOLD TO ACCESS TURBO FOR REPLACEMENT. REMOVED LOWER INTAKE, DOWN
PIPE, UP PIPE CLAMPS, TURBO CHARGER COOLANT LINE, COOLANT DRAINED,
FENDER LINER ACCESS FOR TURBO CHARGE DOWN PIPE, REPLACED TURBO,
REASSEMBLED, CHANGED ENGINE OIL AS PER WSM MANUAL PROCEDURES. CLEARED
CODES. CLEARED DATA TABLES. RETEST ALL OK AT THIS TIME. POWER RESTORED.
POST REPAIR ROAD TEST MILEAGE 76635.

B MULTI POINT INSPECTION GAS ENGINE

MPI MULTI POINT INSPECTION GAS ENGINE

725 CL8

0.00

0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00

2 BATTERY SERVICES, CORROSION HEAVY ON TERMINALS, FRONT BRAKES
3-4MM, REAR BRAKES, 6MM. FRONT COVER T JOINT ON PASSENGER SIDE IS
CAUSING A DRIP OIL LEAK, FRONT COVER NEEDS TO BE RESEALED, LOOKS LIKE
THE CCV BOX WAS DONE RECENTLY. POSSIBLE PREVIOUS HEAVY CRANKCASE
PRESSURE CAUSED THIS LEAK, ROOT CAUSE WAS REPAIRED BUT RESULTING LEAK
IS STILL PRESENT. PASSENGER LOWER TIE ROD IS CLUNKING AND HAS A LOT OF
MOVEMENT, SAFETY ISSUE, WILL NEED ALIGNMENT AFTER. ALL TIRES SHOW 11/32
AT THIS TIME. BATTERIES ARE TESTING GOOD BUT DO NEED TERMINAL SERVICE.
500 MILES LEFT ON OIL CHANGE AND OIL LIGHT IS ON FOR OIL CHANGE SOON,
FUEL FILTER LOOKS TO HAVE BEEN DONE RECENTLY. RECOMMEND 80K SERVICE
INTERVAL FOR FLUIDS, NO HISTORY ON FLUIDS, REAR DIFF FLUID, POWER
STEERING FLUID, BRAKE FLUSH WITH FRONT BRAKES, TRANSMISSION FLUSH, OIL
CHANGE WITH FRONT COVER RESEAL, PASSENGER LOWER TIE ROD AND ALIGNMENT,
BOTH BATTERY TERMINAL SERVICES RECOMMENDED.

C** RESEAL SEVERELY LEAKING FRONT COVER

CAUSE: .

6020AD GASKET OR CYLINDER FRONT COVER - REMOVE

	EXCLUSION OF WARRANTIES "READ THIS"	DESCRIPTION	TOTALS
		LABOR AMOUNT	
***** * YOU MAY RECEIVE A SURVEY IN THE * NEXT FEW DAYS. THE INFORMATION * FROM THE SURVEY IS VERY IMPORTANT * TO US. IF FOR ANY REASON YOU * CANNOT RESPOND AS "COMPLETELY" * SATISFIED PLEASE CONTACT SERVICE * MANAGER AT (503) 282-7777 Ext. 109. * *****	Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that Northside Ford Truck Sales, Inc. makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall Northside Ford Truck Sales, Inc. be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by Northside Ford Truck Sales, Inc., include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort. It is understood that purchaser is buying any used part (or parts) as listed in its present condition, "AS IS" including defects, without any representation or warranties, express or implied unless they are expressly set forth herein:	PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		EPA/HAZ.MAT.	
		TOTAL CHARGES	
		INS/DED/REW	
		CORP-ACTIVITIES TAX	
www.northsidetrucks.com	Customer Signature	PLEASE PAY THIS AMOUNT	


306057

SERVICE DEPARTMENT

NORTH SKY COMMUNICATIONS
16701 SE MCGILLIVRAY BLVD
VANCOUVER, WA 98683
AP@NORTHSKYCOMM.COM
HOME:503-803-4173 CONT:503-803-4173
BUS: CELL:

INVOICE

PAGE 4

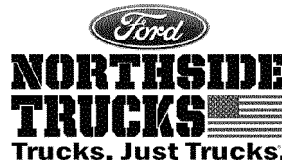

P.O. Box 55010
Portland, OR 97238-5010
6221 N.E. Columbia Blvd.
Portland, OR 97218
(503) 282-7777
(800) 622-6670
FAX (503) 282-8588
www.northsidetrucks.com

SERVICE ADVISOR: 355 ABEL OBERBECK

COLOR	YEAR	MAKE/MODEL		VIN		LICENSE	MILEAGE IN/ OUT		TAG
	19	FORD F450		1FDTF4GT9KDA23948			76631/76638		T2923
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE	
20APR26 DD			15:30 20APR26				CHG	19MAY26	
R.O. OPENED		READY		OPTIONS: W-COMP:X ENG:6.7_Liter					
20APR26		19MAY26							

LINE	OPCODE	TECH TYPE HOURS	LIST	NET	TOTAL
		AND INSTALL OR REPLACE (6019/6020/6608) - L			
		725 WL4			(N/C)
14	BC3Z*6379*C	BOLT - HEX.HEAD			(N/C)
8	F1HZ*4N272*A	BOLT			(N/C)
4	E4HZ*4A254*A	RETAINER			(N/C)
2	BC3Z*4N272*A	BOLT - HEX.HEAD			(N/C)
1	*W715131*S437	BOLT			(N/C)
4	*W710356*S439	BOLT			(N/C)
1	MU2Z*6731*C	KIT - ELEMENT & GASKET - OIL F			(N/C)
1	BC3Z*6020*F	GASKET			(N/C)
1	BC3Z*6020*BA	GASKET			(N/C)
1	BC3Z*6020*CA	GASKET			(N/C)
1	BC3Z*6020*DA	GASKET			(N/C)
1	BC3Z*6020*E	GASKET			(N/C)
1	DC3Z*6L621*A	GASKET			(N/C)
1	DC3Z*6L621*B	GASKET			(N/C)
1	DC3Z*6L621*C	GASKET			(N/C)
1	BC3Z*6840*A	GASKET			(N/C)
2	DC3Z*6710*A	GASKET - OIL PAN			(N/C)
1	DC3Z*6710*B	GASKET - OIL PAN			(N/C)
6	*W711336*S441	NUT			(N/C)
6	*W715618*S437	NUT			(N/C)
4	*W520515*S440	NUT			(N/C)
2	*W709771*S440	NUT - ADJUSTING SCREW			(N/C)
1	*391308*S102	SEAL			(N/C)
2	HC3Z*8527*B	SEAL			(N/C)
1	BC3Z*6695*B	PAN ASY - ENGINE OIL			(N/C)
1	BC3Z*6700*A	SEAL ASY - CRANKSHAFT OIL - FR			(N/C)
1	BC3Z*6310*A	SLINGER			(N/C)
1	DS7Z*19B596*A	KIT - AIR CONDITIONING SYSTEM			(N/C)
1	DL3Z*19B596*B	"O" RING			(N/C)
1	ZC*30*A	REMOVER - SILICONE			(N/C)
1	ZC*31*B	CLEANER - METAL SURFACE			(N/C)
1	ZC*20*	SHAMPOO - ENGINE			(N/C)

 * YOU MAY RECEIVE A SURVEY IN* THE
 * NEXT FEW DAYS. THE INFORMATION
 * FROM THE SURVEY IS VERY IMPORTANT
 * TO US. IF FOR ANY REASON* YOU
 * CANNOT RESPOND AS "COMPLETELY"
 * SATISFIED PLEASE CONTACT SERVICE
 * MANAGER AT (503) 282-7777 Ext. 109. *

www.northsidetrucks.com

EXCLUSION OF WARRANTIES
"READ THIS"

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that Northside Ford Truck Sales, Inc. makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall Northside Ford Truck Sales, Inc. be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by Northside Ford Truck Sales, Inc., include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort. It is understood that purchaser is buying any used part (or parts) as listed in its present condition, "AS IS" including defects, without any representation or warranties, express or implied unless they are expressly set forth herein:

Customer Signature

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
EPA/HAZ.MAT.	
TOTAL CHARGES	
INS/DED/REW	
CORP-ACTIVITIES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER #: 1046

306057

SERVICE DEPARTMENT

NORTH SKY COMMUNICATIONS
16701 SE MCGILLIVRAY BLVD
VANCOUVER, WA 98683
AP@NORTHSKYCOMM.COM
HOME: 503-803-4173 CONT: 503-803-4173
BUS: CELL: SERVICE ADVISOR: 355 ABEL OBERBECK

INVOICE

PAGE 5



P.O. Box 55010
Portland, OR 97238-5010
6221 N.E. Columbia Blvd.
Portland, OR 97218
(503) 282-7777
(800) 622-6670
FAX (503) 282-8588
www.northsidetrucks.com

COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
	19	FORD F450		1FDTF4GT9KDA23948		76631/76638		T2923
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
20APR26 DD			15:30 20APR26			CHG	19MAY26	
R.O. OPENED		READY		OPTIONS: W-COMP:X ENG:6.7_Liter				
20APR26		19MAY26						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	PM*4*A		BRAKE CLEANER				(N/C)
16	XO*10W30*Q	SDF	OIL - ENGINE				(N/C)
1	YN*12*D		OIL - COMPRESSOR - AIR CONDITI				(N/C)
1	TA*357*		SEALANT - SILICONE				(N/C)
1	XL*5*A		GREASE - CHASSIS LUBRICATION				(N/C)
2	XT*10*Q	LVC	OIL - AUTOMATIC TRANSMISSION				(N/C)
2	VC*13*G		ANTI-FREEZE				(N/C)
2			WATER DWATER				(N/C)
1	HC3Z*2A572*A		SEAL - PUMP				(N/C)
1	TP3100-0601		DIESEL/OIL/DYE				(N/C)
6007DD			ENGINE OIL LEAKS - DIAGNOSIS - L				
	725	WL4					(N/C)

FC: L65 D8

PART#: BC3Z*6020*BA

COUNT:

CLAIM TYPE:

AUTH CODE:

725

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE C: 0.00

6020 FRONT COVER SEALS VERIFIED ENGINE OIL LEAK. CLEANED ENGINE OFF AND ADDED ENGINE OIL DYE TO SYSTEM. FOUND OIL TO BE LEAKING FROM PASSENGER SIDE OF FRONT COVER BADLY. HAVE A DRIP FORMING ON THE UPPER OIL PAN FROM IT. OASIS PASS AT THIS TIME. SOMEONE HAS ALREADY REPLACED THE OIL BREATHER WITH THE PROPER PART AND IT IS NEW. NO EXCESSIVE CRANK CASE PRESSURE AT THIS TIME. JUST HAVE A LEAK, PRESUMABLY FROM PREVIOUS PRESSURE ON THE OLD PART OF THE OLD OIL SEPARATOR BEING ON THE ENGINE. ACCESS AND REMOVED TRANSMISSION, REMOVED UPPER OIL PAN, REMOVED FAN, SHROUDS, ACCESSORY DRIVE, REMOVED FRONT COVER. CLEANED SURFACES, PREPPED SURFACE WITH METAL WIPES WITH WSM PROCEDURE. RESEALED FRONT COVER AND UPPER OIL PAN. REASSEMBLED VEHICLE. RETEST ALL OK AT THIS TIME. MILEAGE 76635.

D** REPAIR LOOSE PINFIT AT BATTERY JUNCTION BOX
X99 NO APPROPRIATE CODE FOR THIS CONCERN

EXCLUSION OF WARRANTIES "READ THIS"		DESCRIPTION	TOTALS
***** * YOU MAY RECEIVE A SURVEY IN THE NEXT FEW DAYS. THE INFORMATION FROM THE SURVEY IS VERY IMPORTANT TO US. IF FOR ANY REASON YOU CANNOT RESPOND AS "COMPLETELY" SATISFIED PLEASE CONTACT SERVICE MANAGER AT (503) 282-7777 Ext. 109. * ***** www.northsidetrucks.com		LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		EPA/HAZ.MAT.	
		TOTAL CHARGES	
		INS/DED/REW	
		CORP-ACTIVITIES TAX	
		PLEASE PAY THIS AMOUNT	
Customer Signature			

CUSTOMER #: 1046

306057

SERVICE DEPARTMENT

NORTH SKY COMMUNICATIONS
16701 SE MCGILLIVRAY BLVD
VANCOUVER, WA 98683
AP@NORTHSKYCOMM.COM
HOME:503-803-4173 CONT:503-803-4173
BUS: CELL: SERVICE ADVISOR: 355 ABEL OBERBECK

INVOICE

PAGE 6



P.O. Box 55010
Portland, OR 97238-5010
6221 N.E. Columbia Blvd.
Portland, OR 97218
(503) 282-7777
(800) 622-6670
FAX (503) 282-8588
www.northsidetrucks.com

COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
	19	FORD F450		1FDTF4GT9KDA23948		76631/76638		T2923
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
20APR26 DD			15:30 20APR26			CHG	19MAY26	
R.O. OPENED		READY		OPTIONS: W-COMP:X ENG:6.7_Liter				
20APR26		19MAY26						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
		725	CL8			1350.00	1350.00
		4 M8	OBSLT	HARDWARE	4.80	1.80	7.20
PARTS:		7.20	LABOR:	1350.00	OTHER:	0.00	TOTAL LINE D: 1357.20
76631 COMPLETE..po 72027							

E** PER TSB, PERFORM UPDATE
X99 NO APPROPRIATE CODE FOR THIS CONCERN

	725	ILT					(N/C)
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE E:	0.00
76638 SELF TEST SHOWS P259F PRESENT. OASIS SHOWS PCM UPDATE IS AVAILABLE AS PER TSB 21-2367, . UPDATED PCM PROGRAMMING AND RETEST FOUND LOW POWER IS STILL PRESENT. CONTINUED WITH DIAGNOSTICS AND REPAIR ON LINE A (MOVED TO LINE A) KM							

F** PICK UP OR DELIVER

PDEL PICK UP OR DELIVER

9999 TECH,PHANTOM LIC#: 9999

	CL8					0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE F:	0.00

G** PICK UP OR DELIVER

PDEL PICK UP OR DELIVER

725 CL8

						0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE G:	0.00

* YOU MAY RECEIVE A SURVEY IN THE NEXT FEW DAYS. THE INFORMATION FROM THE SURVEY IS VERY IMPORTANT TO US. IF FOR ANY REASON YOU CANNOT RESPOND AS "COMPLETELY" SATISFIED PLEASE CONTACT SERVICE MANAGER AT (503) 282-7777 Ext. 109. *

www.northsidetrucks.com

EXCLUSION OF WARRANTIES

"READ THIS"

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that Northside Ford Truck Sales, Inc. makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall Northside Ford Truck Sales, Inc. be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by Northside Ford Truck Sales, Inc., include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort. It is understood that purchaser is buying any used part (or parts) as listed in its present condition, "AS IS" including defects, without any representation or warranties, express or implied unless they are expressly set forth herein:

Customer Signature

DESCRIPTION	TOTALS
LABOR AMOUNT	1350.00
PARTS AMOUNT	7.20
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
EPA/HAZ.MAT.	0.00
TOTAL CHARGES	1357.20
INS/DED/REW	0.00
CORP-ACTIVITIES TAX	5.43
PLEASE PAY THIS AMOUNT	1362.63