



Inspection report, Final: PO003632

KS103368-SIROCCO: VALENTINES TUT SHOULDER BAG



[Online report](#)

2nd inspection

Inspector	Nya Ni	Inspection Date	Sep 29, 2026
Sample Qty	125	Order Qty	1398
Location	29° 21' 12" N x 120° 3' 47" E	Checklist Name	Final
Planned Date	Sep 28, 2026	Sampling Method	AQL 2.5/4 Level II
Supplier Name	10 FASHION		

Inspector Conclusion	Pending	Large shipment, less shipment, 78 Pcs (Automatic translation)
Constanza Frías	Approved	Talked to Tanja short shipment approved

Status: **Approved**

SUMMARY

	PO003632:KS103368-SIROCCO
1 Factory details	
2 Quantity Check	
2.2 Production quantity match PO	1
3 Product	
4 On-site Test	
5 Pack and Packaging	

- 1
- Number of orders: 1398 pieces
Packing list: 1320 pieces
Missing items: 78 pieces (5%)

1398 orders

(Checked) is the packing list for this product.

	CRITICAL	MAJOR	MINOR
WX Other.	-	1	-
WX Other.	-	1	-
WX Other.	-	1	-
W1 Threads, untrimmed.	-	-	1
WX Other.	-	-	1
W1 Threads, untrimmed.	-	-	1
TOTAL	0	3	3
AQL MAX	0	7	10

DEFECTS: 6

1	WX Other. The heart-shaped bag is 4.5cm on top and 3.5cm on the bottom of the side, a deviation of 1cm, which affects its appearance. (Automatic translation)	MAJOR Items affected: 1
---	--	----------------------------



2	WX Other. Oil stains on cardboard boxes (Automatic translation)	MAJOR Items affected: 1
---	--	----------------------------



3	WX Other. The heart-shaped bag has a significant difference in size between the top and bottom sides (4.5 cm at the top and 3.7 cm at the bottom), affecting its appearance. (Automatic translation)	MAJOR Items affected: 1
---	---	----------------------------



4	W1 Threads, untrimmed. -	MINOR Items affected: 1
---	--------------------------	----------------------------



5	WX Other. Sequins have fallen off (minor). (Automatic translation)	MINOR Items affected: 1
---	---	----------------------------



6	W1 Threads, untrimmed. -	MINOR Items affected: 1
---	--------------------------	----------------------------



CHECKPOINTS: 27

1	Factory details	
---	-----------------	-------------

1.1	Factory name at the location for QC (not supplier name)	OK
-----	---	----

Factory Name:

义乌萌萱贸易有限公司

Factory Address:

浙江省义乌市柳青路 1565 号



Package

2	Quantity Check	
---	----------------	-------------

2.1	Warehouse / carton piled view	OK
	90% of the bulk cargo was successfully containerized. (Automatic translation)	




Stacked container photos




Box Photo

2.2	Production quantity match PO	Pending
	Number of orders: 1398 pieces Packing list: 1320 pieces Missing items: 78 pieces (5%) (Automatic translation)	



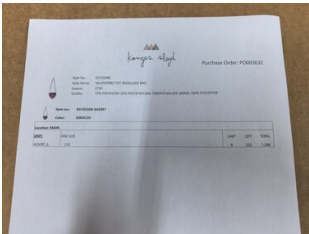


1398 orders

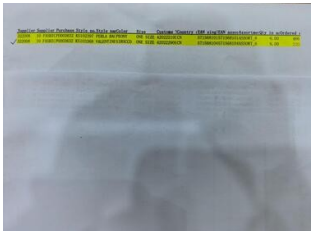

(Checked) is the packing list for this product.

3	Product	
3.1	Product compare against approved sample / color swatch/TECH file	OK
	The bulk order and the factory sample are confirmed to be OK. (Automatic translation)	

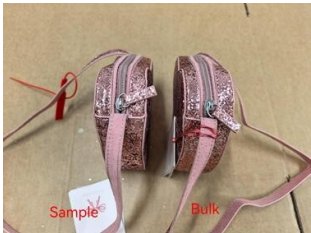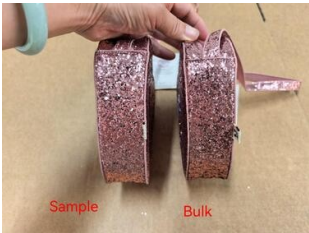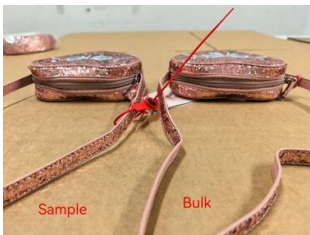

Factory confirmed sample

large cargo



large cargo

3.2	Labelling (hangtag, main label, size label, care label, tracking label)	OK
	Barcode scan and verification OK. (Automatic translation)	

OS: (1398)

Barcode can be scanned	OK
Scanned barcode	5715681048788
Barcode from order data	5715681048788
Scanned format	EAN_13

单件胶袋条形码

Barcode can be scanned	OK
Scanned barcode	5715681048795
Barcode from order data	
Scanned format	EAN_13

吊牌条形码

Barcode can be scanned	OK
Scanned barcode	5715681048795
Barcode from order data	
Scanned format	EAN_13



Hang tag 1



Hang tag 2 (with barcode sticker)



Hang tag 3



Hang tag 4



Tag 5



Hang tag 6



Cherry label front (right side)




The reverse side (right side) of the cherry label




The KS main label inside the bag (the care label inside the bag is difficult to photograph, so I used one that wasn't sewn properly by the factory; it has been verified).



Washing label 1.

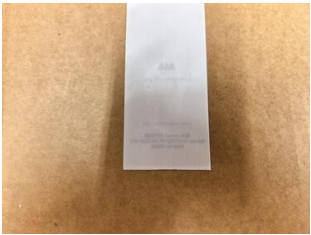

Wash label 2

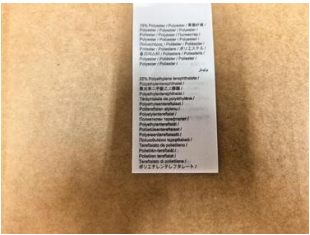

Wash label 3



Wash label 4




Wash label 5



Wash label 6



Wash label 7

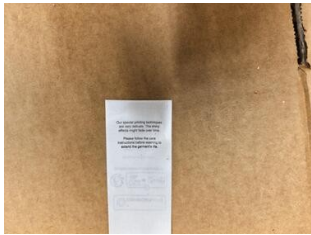

Wash label 8

3.3	Embroidery / Printing check	OK
	The cherry blossom embroidery and sequins on the bulk order are OK compared with the confirmed sample provided by the factory. (Automatic translation)	



Large quantity of cherry embroidery

3.4	Lace / Trimming / Accessories check	OK
	Bulk zipper test OK (Automatic translation)	



3.5	Workmanship
-----	-------------

3.6	Measurement	OK
	The dimensions of the bulk order are OK. (Automatic translation)	




Measurement-OS	Specification	Tolerance	Actual
A: WIDTH (cm)	15.00	-	15
B: DEPTH (cm)	4.50	-	4.3
C: STRAP LENGTH (cm)	74.00	-	74



4	On-site Test	
---	--------------	--

4.1	Metal detection
-----	-----------------

4.2	Pull test	OK
	The manual tensile test is OK. (Automatic translation)	

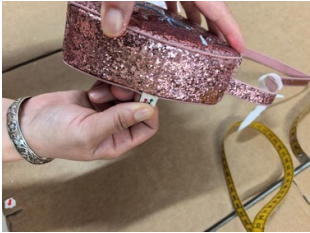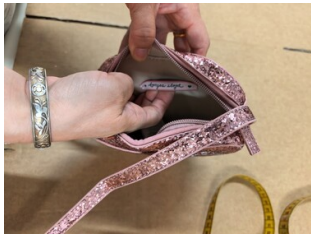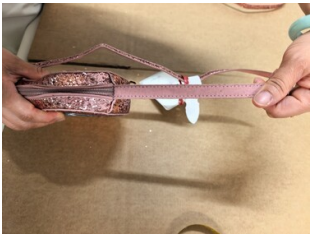


4.3	Smell check	OK
	The artificial olfactory odor test was OK; there was no pungent odor, which is acceptable. (Automatic translation)	



4.4	Humidity check	
-----	----------------	--

4.5	Garment weight (sweater only)	
-----	-------------------------------	--

4.6	Prove of color fastness test from supplier	OK
	The color fastness test on the bulk product showed no obvious color fading after rubbing and wiping with a wet wipe, which is acceptable. (Automatic translation)	

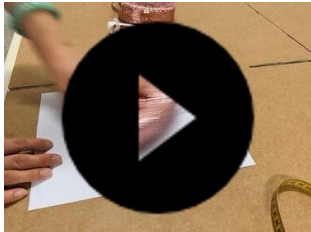

4.7	The product is packed in poly bag or carton. Supplier can't send products without packaging.	OK
	The bulk goods were packaged correctly in cartons and plastic bags. (Automatic translation)	



Outer box shape



The box was opened.



Inner packaging of the box




Each box contains 8 Colli (8 Colli * 6 pieces = 48 pieces)



Each Colli contains 6 items.

4.8	Sharp edges check	OK
	The workmanship and auxiliary materials of the bulk goods have no sharp corners or unevenness, which is acceptable. (Automatic translation)	

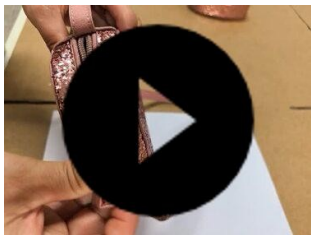

4.9	摔箱测试	OK
	After the large-volume drop test, the cartons and the goods inside showed no damage, which is acceptable. (Automatic translation)	



5	Pack and Packaging	
---	--------------------	------------------------


5.1	Approved sample/QA file available during inspection	OK
	There are confirmation samples, orders, and packing lists provided by the factory. (Automatic translation)	




front



On the other hand

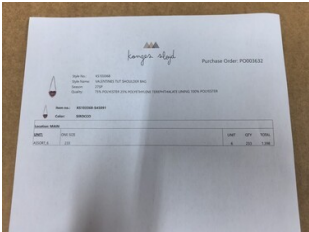

1398 orders

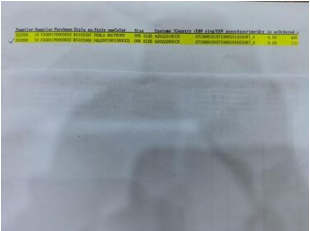


(Checked) is the packing list for this product.

5.2	Export carton (shipping mark, barcode)	OK
	There was no barcode sticker on the outer box. (Automatic translation)	


Barcode can be scanned	
Scanned barcode	
Barcode from order data	
Scanned format	



Outer box shape

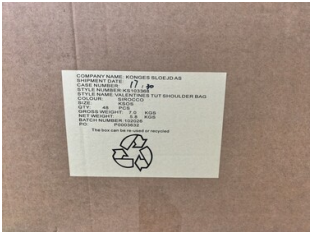

Front box label

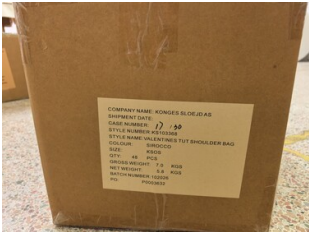

Side box markings

5.3	Export carton (dimension, weight)	OK
-----	-----------------------------------	----


	Specification	Tolerance	Actual
L	-	-	60.5
W	-	-	35.5
H	-	-	35
Gross Weight	-	-	7.2



Length 60.5



Width 35.5

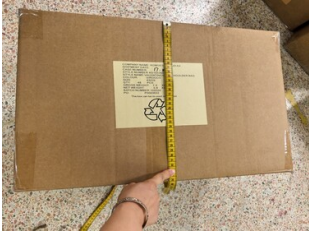


Height 35



Gross weight: 7.20KG

5.4	Carton Packing (quantity, ratio etc), 3 ply carton	OK
	The quantity per carton is based on the packing list provided by the factory; each carton contains 8 Collies, each Colly contains 6 pieces, so 8 * 6 pieces = 48 pieces. (Automatic translation)	

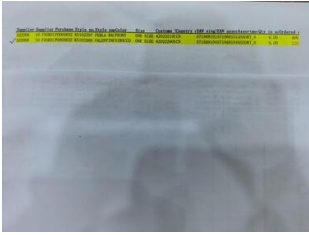

(Checked) is the packing list for this product.



Outer box shape



The box was opened.



Inner packaging of the box



Each box contains 8 Colli (8 Colli * 6 pieces = 48 pieces)



Each Colli contains 6 items.

5.5	Inner package (polybag, sticker, tissue paper, silica gel etc)	OK
	The plastic bags do not contain copy paper or desiccant; each box contains 8 Colli, and each Colli contains 6 items; the back of the plastic bags has warning statements and an environmental protection symbol; (Automatic translation)	



The box was opened.



Inner packaging of the box



bottom of the box



Each box contains 8 Colli (8 Colli * 6 pieces = 48 pieces)



Colli plastic bag front



The back of the Colli plastic bag contains warnings and an eco-friendly logo.



Each Colli contains 6 items.



front of individual plastic bag



Back of individual plastic bag



The bag contains wads of paper stuffing and strap securing strips.



Barcode sticker on Colli plastic bags



The barcode sticker on the individual plastic bag matches the hang tag sticker.



Colli bags and individual bags have warnings and eco-friendly logos on the back.

5.6	Hanger (quality, size etc)
-----	----------------------------

5.7	Header card
-----	-------------

5.8	FSC marking on the transportation boxes	OK
	The outer box does not have the FSC mark. (Automatic translation)	



Outer box shape

5.9	Products are in polybags	OK
	Correct packaging in plastic bags (Automatic translation)	



Inner packaging of the box



Each box contains 8 Colli (8 Colli * 6 pieces = 48 pieces)



Colli plastic bag front



The back of the Colli plastic bag contains warnings and an eco-friendly logo.



Each Colli contains 6 items.



front of individual plastic bag



Back of individual plastic bag

COMMENTS

Constanza Frías Conclusion set to approved Sep 29, 2026 13:38

Talked to Tanja short shipment approved

Nya Ni Inspector's conclusion Sep 29, 2026 09:18

Large shipment, less shipment, 78 Pcs