Inspection report

Final: PO002770

Online report

Inspector	Wing Xu	Inspection Date	-
Sample Qty	125	Order Qty	1536
Location	29° 21' 11" N x 120° 3' 47" E	Checklist Name	Final
Planned Date	Oct 09, 2025	Sampling Method	AQL 2.5/4 Level II
Supplier Name	10 FASHION		

Item No.	Name	Order qty/available
KS104808-CHERRY	FANS	504
KS104808-MARMELADE SUN	FANS	504
KS104808-VIENNA	FANS	528

Inspector Conclusion	Approved	The cherry-patterned fan canvas has edge defects in approximately 10% of the quantity. After factory rework selection, I conducted a re-inspection and confirmed they are acceptable.

Status: **Pending**

SUMMARY

	PO002770:KS104808-CHERRY	PO002770:KS104808-MARMELADE SUN	PO002770:KS104808-VIENNA
1 Factory details			
2 Quantity Check			
3 Product			
3.5 Workmanship	!	!	!
4 On-site Test			
5 Pack and Packaging			

	CRITICAL	MAJOR	MINOR
M5 Damaged fabric / material.	-	1	-
A8 Glue Marks.	-	1	-
M5 Damaged fabric / material.	-	1	-
M5 Damaged fabric / material.	-	-	1
M5 Damaged fabric / material.	-	-	1
M14 Wood Glitch/Hand feel.	-	-	1
M1 Soiling/stains.	-	-	1
M1 Soiling/stains.	-	-	1
M1 Soiling/stains.	-	-	1
M11 Scratch or cracks in surface.	-	-	1
M1 Soiling/stains.	-	-	1
M7 Printing/Paint problem.	-	-	1
M5 Damaged fabric / material.	-	-	1
TOTAL	**0**	**3**	**10**

AQL MAX	0	7	10

DEFECTS: 13

1	M5 Damaged fabric / material. bamboo cracked	MAJOR Items affected: 1

2	A8 Glue Marks. poor glue	MAJOR Items affected: 1

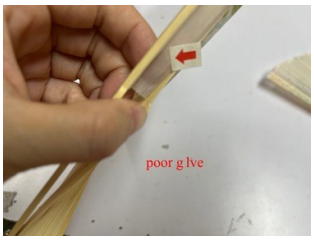

3	M5 Damaged fabric / material. exposed edge	MAJOR Items affected: 1

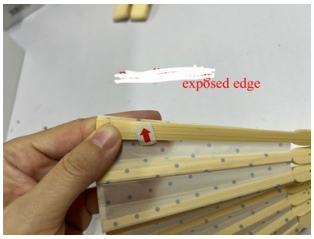

4	M5 Damaged fabric / material. exposed edge	MINOR Items affected: 1

5	**M5 Damaged fabric / material. exposed edge**	MINOR Items affected: 1

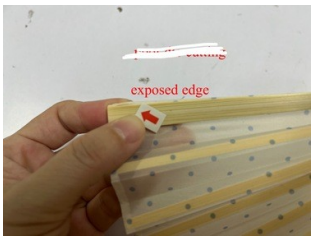

6	**M14 Wood Glitch/Hand feel. wooden knot**	MINOR Items affected: 1

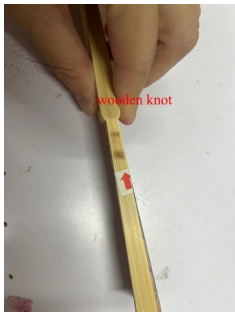

7	**M1 Soiling/stains. dirty stain**	MINOR Items affected: 1

8	**M1 Soiling/stains. dirty stain**	MINOR Items affected: 1

9	**M1 Soiling/stains. dirty stain**	MINOR Items affected: 1

10	M11 Scratch or cracks in surface. poor die cutting	MINOR Items affected: 1

11	M1 Soiling/stains. dirty stain	MINOR Items affected: 1

12	M7 Printing/Paint problem. wrinkle	MINOR Items affected: 1

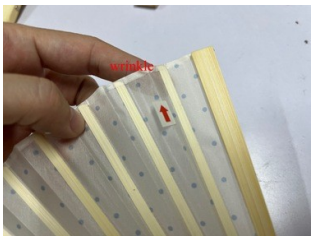

13	M5 Damaged fabric / material. exposed edge	MINOR Items affected: 1

CHECKPOINTS: 22

1	Factory details

1.1	Factory name at the location for QC (not supplier name)

Factory Name:

Factory Address:

2	Quantity Check

2.1	**Warehouse / carton piled view**

2.1.1	**PO002770 FANS: KS104808-CHERRY**	**OK**

2.1.2	**PO002770 FANS: KS104808-MARMELADE SUN**	**OK**

2.1.3	**PO002770 FANS: KS104808-VIENNA**	**OK**

2.2	**Production quantity match PO**

2.2.1	**PO002770 FANS: KS104808-CHERRY**	**OK**
	products finished 90%	

2.2.2	**PO002770 FANS: KS104808-MARMELADE SUN**	**OK**
	products finished 100%	

2.2.3	**PO002770 FANS: KS104808-VIENNA**	**OK**
	products finished 90%	

3	**Product**	

3.1	**Product compare against approved sample / color swatch/TECH file**	**OK**

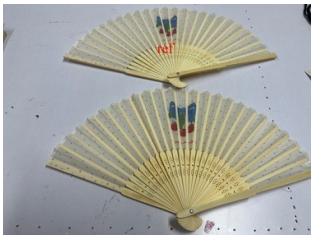

3.1.1	**PO002770 FANS: KS104808-CHERRY**	**OK**

3.1.2	**PO002770 FANS: KS104808-MARMELADE SUN**	**OK**

3.1.3	**PO002770 FANS: KS104808-VIENNA**	**OK**

3.2	Labelling (hangtag, main label, size label, care label, tracking label)

3.2.1	PO002770 FANS: KS104808-CHERRY	OK

OS: (504)

Barcode can be scanned	OK
Scanned barcode	5715681194805
Barcode from order data	5715681194805
Scanned format	EAN_13

product

Barcode can be scanned	OK
Scanned barcode	5715681194812
Barcode from order data	
Scanned format	EAN_13

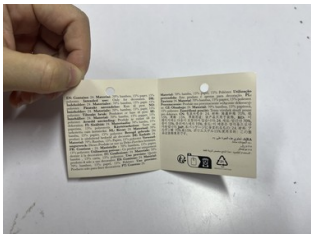

3.2.2	PO002770 FANS: KS104808-MARMELADE SUN	OK

OS: (504)

Barcode can be scanned	OK
Scanned barcode	5715681194829

Barcode from order data	5715681194829
Scanned format	EAN_13

product

Barcode can be scanned	OK
Scanned barcode	5715681194836
Barcode from order data	
Scanned format	EAN_13

3.2.3	**PO002770 FANS: KS104808-VIENNA**	**OK**

OS: (528)

Barcode can be scanned	OK
Scanned barcode	5715681194843
Barcode from order data	5715681194843
Scanned format	EAN_13

product

Barcode can be scanned	OK
Scanned barcode	5715681194850
Barcode from order data	
Scanned format	EAN_13

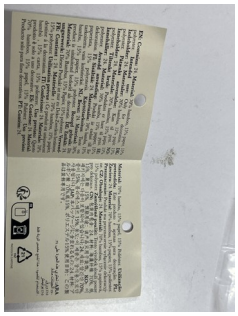

3.3	Embriodery / Printing check

3.4	Lace / Trimming / Accessories check

3.5	Workmanship	Not OK

DEFECT M1 Soiling/stains. dirty stain

MINOR
Items affected: 1

3.5.1	PO002770 FANS: KS104808-CHERRY	Not OK

DEFECT M5 Damaged fabric / material. exposed edge

MAJOR
Items affected: 1

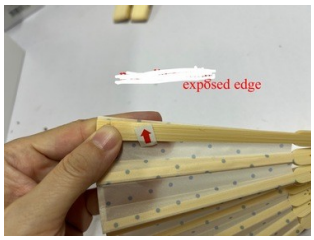

DEFECT M5 Damaged fabric / material. exposed edge

MINOR
Items affected: 1

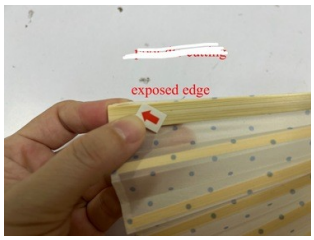

DEFECT M1 Soiling/stains. dirty stain

MINOR
Items affected: 1

DEFECT M1 Soiling/stains. dirty stain

MINOR
Items affected: 1

DEFECT M11 Scratch or cracks in surface. poor die cutting

MINOR
Items affected: 1

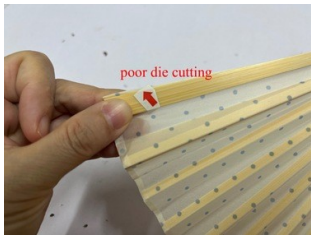

DEFECT M1 Soiling/stains. dirty stain

MINOR
Items affected: 1

DEFECT M7 Printing/Paint problem. wrinkle

MINOR
Items affected: 1

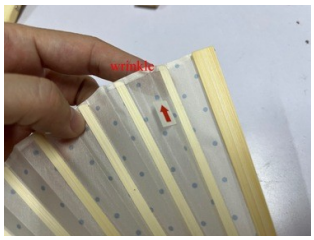

3.5.2	**PO002770 FANS: KS104808-MARMELADE SUN**	**Not OK**

DEFECT M5 Damaged fabric / material. bamboo cracked

MAJOR
Items affected: 1

DEFECT A8 Glue Marks. poor glue

MAJOR
Items affected: 1

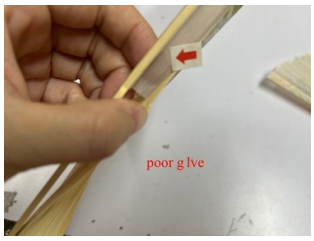

DEFECT M5 Damaged fabric / material. exposed edge

MINOR
Items affected: 1

3.5.3	**PO002770 FANS: KS104808-VIENNA**	**Not OK**

DEFECT M5 Damaged fabric / material. exposed edge

MINOR
Items affected: 1

DEFECT M14 Wood Glitch/Hand feel. wooden knot

MINOR
Items affected: 1

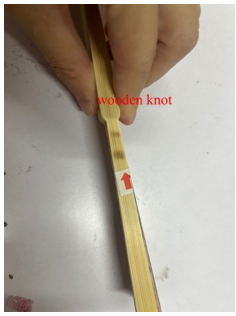

3.6	Measurement

	Specification	Tolerance	Actual
	-	-	

4	On-site Test

4.1	Metal detection

4.2	Pull test

4.3	Smell check

4.3.1	PO002770 FANS: KS104808-CHERRY	OK

4.3.2	PO002770 FANS: KS104808-MARMELADE SUN	OK

4.3.3	PO002770 FANS: KS104808-VIENNA	OK

4.4	**Humidity check**

4.4.1	**PO002770 FANS: KS104808-CHERRY**	**OK**

bamboo moisture 6.8%

4.4.2	**PO002770 FANS: KS104808-MARMELADE SUN**	**OK**

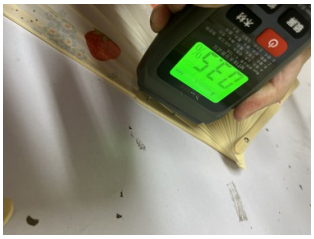

the bamboo moisture is 3.5%

4.4.3	**PO002770 FANS: KS104808-VIENNA**	**OK**

the bamboo moisture is 7.2%

4.5	**Garment weight (sweater only)**

4.6	**The product is packed in poly bag or carton. Supplier can't send products without packaging.**

4.6.1	**PO002770 FANS: KS104808-CHERRY**	**OK**

4.6.2	**PO002770 FANS: KS104808-MARMELADE SUN**	**OK**

4.6.3	**PO002770 FANS: KS104808-VIENNA**	**OK**

5	**Pack and Packaging**	

5.1	**Approved sample/QA file available during inspection**

5.2	**Export carton (shipping mark, barcode)**

Barcode can be scanned	
Scanned barcode	
Barcode from order data	
Scanned format	

5.2.1	**PO002770 FANS: KS104808-CHERRY**	**OK**

Barcode can be scanned	OK
Scanned barcode	
Barcode from order data	
Scanned format	

5.2.2	**PO002770 FANS: KS104808-MARMELADE SUN**	**OK**

Barcode can be scanned	OK
Scanned barcode	
Barcode from order data	
Scanned format	

5.2.3	**PO002770 FANS: KS104808-VIENNA**	**OK**

Barcode can be scanned	OK
Scanned barcode	
Barcode from order data	
Scanned format	

5.3	**Export carton (dimension, weight)**	**OK**

	Specification	Tolerance	Actual
L	-	-	50
W	-	-	25
H	-	-	25
Gross Weight	-	-	3.9

5.4	**Carton Packing (quantity, ratio etc), 3 ply carton**	**OK**

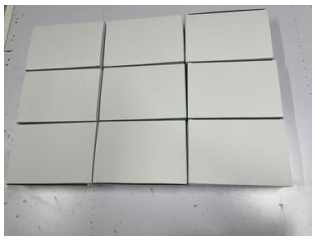

5.5	**Inner package (polybag, sticker, tissue paper, silica gel etc)**

5.5.1	**PO002770 FANS: KS104808-CHERRY**	**OK**

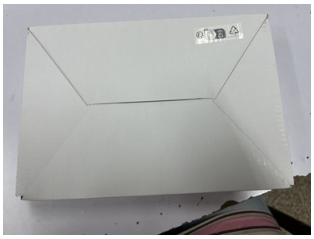

5.5.2	**PO002770 FANS: KS104808-MARMELADE SUN**	**OK**

5.5.3	**PO002770 FANS: KS104808-VIENNA**	**OK**

5.6	Hanger (quality, size etc)

5.7	Header card

COMMENTS

Wing Xu Inspector's conclusion Oct 10, 2025 06:45

The cherry-patterned fan canvas has edge defects in approximately 10% of the quantity. After factory rework selection, I conducted a re-inspection and confirmed they are acceptable.