Inspection report, Final: PO000806

KS103853-LADYBUG: LADYBUG BEADED BAG

Online report

Inspector	Wing Xu	Inspection Date	May 14, 2025
Sample Qty	80	Order Qty	504
Location	31° 53' 0" N x 120° 5' 5" E	Checklist Name	Final
Planned Date	May 11, 2025	Sampling Method	AQL 2.5/4 Level II
Supplier Name	10 FASHION		

Inspector Conclusion	**Pending**	the product need to add 1 pc small part warning lable

SUMMARY

	PO000806:KS103853-LADYBUG
1 Factory details	
2 Quantity Check	
3 Product	
3.5 Workmanship	
4 On-site Test	
5 Pack and Packaging	

	CRITICAL	MAJOR	MINOR
A1 Hand feel.	-	2	-
P1 Wet/ odorous articles.	-	1	-
A1 Hand feel.	-	1	-
A1 Hand feel.	-	1	-
A1 Hand feel.	-	-	6
W1 Threads, untrimmed.	-	-	1
TOTAL	**0**	**5**	**7**
AQL MAX	**0**	**5**	**7**

DEFECTS: 12

1	A1 Hand feel. the strap pull broken because the strap got caught in the zipper.	MAJOR Items affected: 2

2	P1 Wet/ odorous articles. the bead pull off because thread end were not handled pro pearly	MAJOR Items affected: 1

3	A1 Hand feel. the bead pull off because thread end were not handled pro pearly	MAJOR Items affected: 1

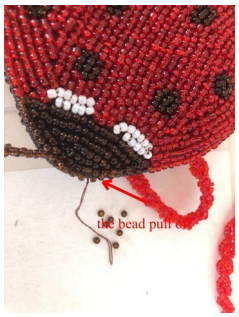

4	A1 Hand feel. the bead pull off because thread end were not handled pro pearly	MAJOR Items affected: 1

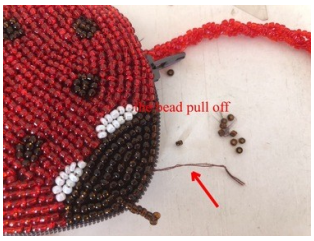

5	A1 Hand feel. the eye is not Match the approval sample	MINOR Items affected: 6

6	W1 Threads, untrimmed. thread end	MINOR Items affected: 1

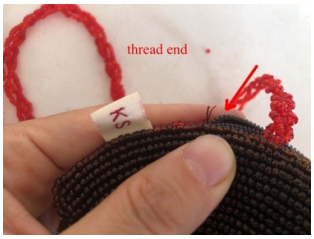

CHECKPOINTS: 23

1	Factory details	

1.1	Factory name at the location for QC (not supplier name)	OK

Factory Name:	义乌泰源皮具有限公司
Factory Address:	义乌市苏溪镇苏新街 29 号 1 号楼三楼

2	Quantity Check	

2.1	**Warehouse / carton piled view**	**OK**

2.2	**Production quantity match PO**	**OK**
	products finished 100%，package into the master carton 70%	

3	**Product**	

3.1	**Product compare against approved sample / color swatch/TECH file**	**OK**

3.2	**Labelling (hangtag, main label, size label, care label, tracking label)**	**OK**

polybag

Barcode can be scanned	OK
Scanned barcode	5715681115046
Barcode from order data	
Scanned format	EAN_13

product

Barcode can be scanned	OK
Scanned barcode	5715681115053
Barcode from order data	
Scanned format	EAN_13

3.3	Embriodery / Printing check	OK

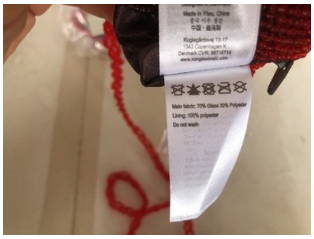

3.4	Lace / Trimming / Accessories check	OK

3.5	Workmanship	Not OK

DEFECT A1 Hand feel. the strap pull broken because the strap got caught in the zipper.

MAJOR
Items affected: 2

DEFECT P1 Wet/ odorous articles. the bead pull off because thread end were not handled pro pearly

MAJOR
Items affected: 1

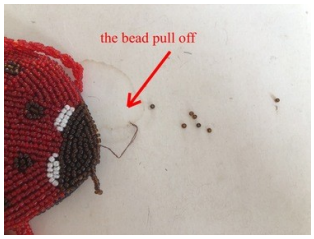

DEFECT A1 Hand feel. the bead pull off because thread end were not handled pro pearly

MAJOR
Items affected: 1

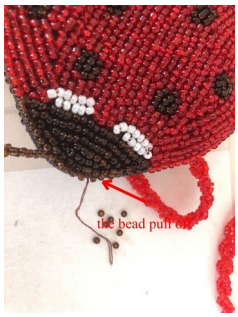

DEFECT A1 Hand feel. the bead pull off because thread end were not handled pro pearly

MAJOR
Items affected: 1

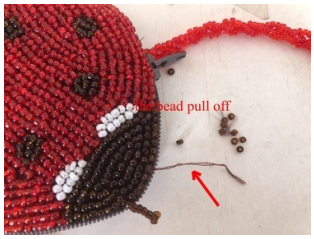

DEFECT W1 Threads, untrimmed. thread end

MINOR
Items affected: 1

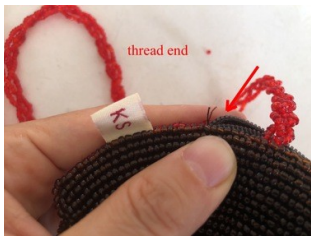

DEFECT A1 Hand feel. the eye is not Match the approval sample

MINOR
Items affected: 6

3.6	Measurement	OK

Measurement-OS	Specification	Tolerance	Actual
HEIGHT (cm)	8.50	-	8.5
strap length (cm)	85.00	-	82

4	On-site Test	

4.1	Metal detection

4.2	Pull test	OK

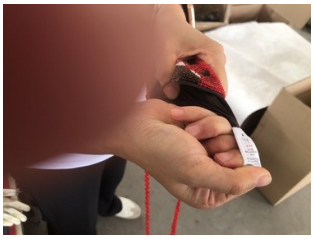

4.3	Smell check	OK

4.4	Humidity check

4.5	Garment weight (sweater only)

4.6	Prove of color fastness test from supplier	OK

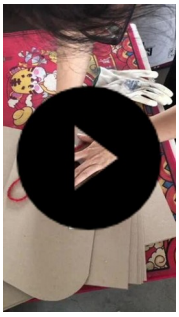

4.7	The product is packed in poly bag or carton. Supplier can't send products without packaging.	OK

5	Pack and Packaging	

5.1	Approved sample/QA file available during inspection	OK

5.2	Export carton (shipping mark, barcode)	OK

Barcode can be scanned	
Scanned barcode	
Barcode from order data	
Scanned format	

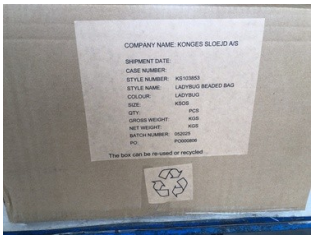

5.3	Export carton (dimension, weight)	OK

	Specification	Tolerance	Actual
L	-	-	45
W	-	-	30
H	-	-	29.5
Gross Weight	-	-	12.9

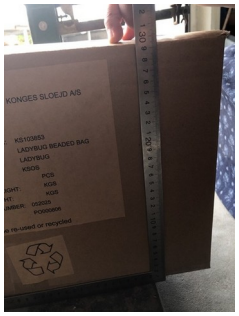

5.4	Carton Packing (quantity, ratio etc), 3 ply carton	OK

5.5	Inner package (polybag, sticker, tissue paper, silica gel etc)	OK

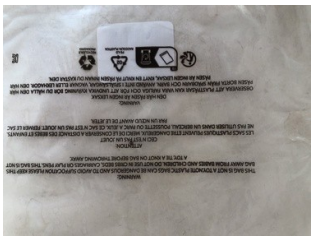
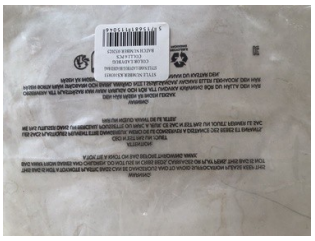

5.6	Hanger (quality, size etc)

5.7	Header card	OK

Report created with Qarma.

COMMENTS

Wing Xu Inspector's conclusion May 13, 2025 13:51

the product need to add 1 pc small part warning lable