Inspection report, Final: PO002709

KS105193-FRAPPE: TUT KITTY SHOULDER BAG

Online report

Inspector	Wing Xu	Inspection Date	Jul 31, 2025
Sample Qty	80	Order Qty	1200
Location	23° 28' 6" N x 113° 10' 31" E	Checklist Name	Final
Planned Date	Jul 30, 2025	Sampling Method	AQL 2.5/4 Level II
Supplier Name	10 FASHION		

Inspector Conclusion	Approved	

SUMMARY

	PO002709:KS105193-FRAPPE
1 Factory details	
2 Quantity Check	
3 Product	
3.5 Workmanship	
4 On-site Test	
5 Pack and Packaging	

	CRITICAL	MAJOR	MINOR
W3 Stitch, Broken or defect.	-	1	-
P7 Incorrect packaging.	-	1	-
P7 Incorrect packaging.	-	1	-
P7 Incorrect packaging.	-	-	1
A8 Glue Marks.	-	-	1
TOTAL	**0**	**3**	**2**
AQL MAX	**0**	**5**	**7**

DEFECTS: 5

1	**W3 Stitch, Broken or defect. seam broken**	MAJOR Items affected: 1

2	P7 Incorrect packaging. bow is not centered	MAJOR Items affected: 1

3	P7 Incorrect packaging. bow is not centered	MAJOR Items affected: 1

4	P7 Incorrect packaging. poor assemble	MINOR Items affected: 1

5	A8 Glue Marks. glue mark	MINOR Items affected: 1

CHECKPOINTS: 22

1	Factory details	

1.1	Factory name at the location for QC (not supplier name)	OK

Factory Name:	义乌天姿箱包有限公司广州分公司
Factory Address:	广东省广州市花都区狮岭镇金狮大道东 43 号团一大楼旁

2	Quantity Check	

2.1	Warehouse / carton piled view	OK

2.2	Production quantity match PO	OK
	products finished 90%	

3	Product	

3.1	Product compare against approved sample / color swatch/TECH file	OK

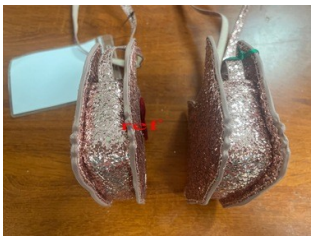

3.2	**Labelling (hangtag, main label, size label, care label, tracking label)**	**OK**

inner bag

Barcode can be scanned	OK
Scanned barcode	5715681176542
Barcode from order data	
Scanned format	EAN_13

product

Barcode can be scanned	OK
Scanned barcode	5715681176559
Barcode from order data	
Scanned format	EAN_13

colour card

Barcode can be scanned	OK
Scanned barcode	5715681176559
Barcode from order data	
Scanned format	EAN_13

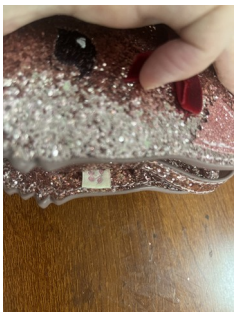

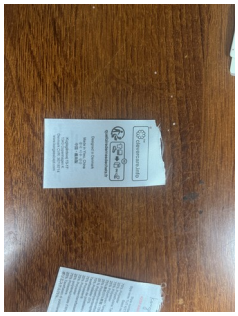

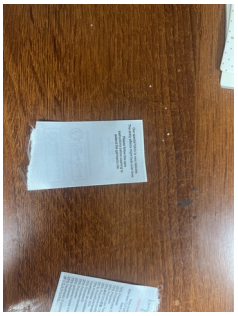

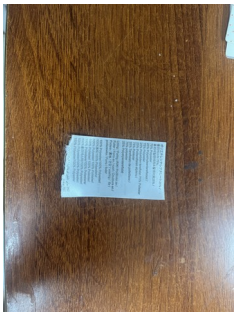

3.3	**Embriodery / Printing check**

3.4	**Lace / Trimming / Accessories check**

3.5	**Workmanship**	**Not OK**

DEFECT W3 Stitch, Broken or defect. seam broken

MAJOR
Items affected: 1

DEFECT P7 Incorrect packaging. bow is not centered

MAJOR
Items affected: 1

DEFECT P7 Incorrect packaging. bow is not centered

MAJOR
Items affected: 1

DEFECT P7 Incorrect packaging. poor assemble

MINOR
Items affected: 1

DEFECT A8 Glue Marks. glue mark

MINOR
Items affected: 1

3.6	**Measurement**	**OK**

Measurement-OS	Specification	Tolerance	Actual
A: WIDTH (of cat application) (cm)	16.00	-	16
A1: HEIGHT (of cat application) (cm)	13.68	-	13.68
B: BAG DEPTH (cm)	3.50	-	3.8
C: STRAP LENGTH (cm)	74.00	-	74

4	**On-site Test**	

4.1	**Pull test**	**OK**

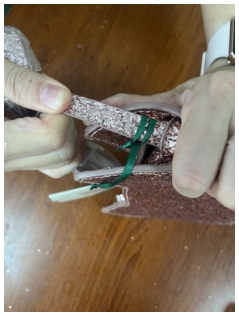

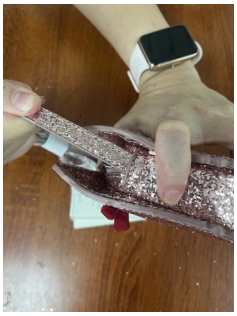

4.2	Smell check	OK

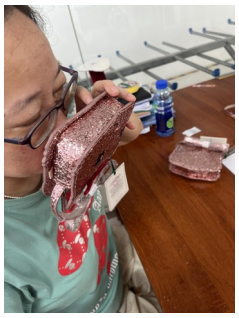

4.3	Humidity check

4.4	Garment weight (sweater only)

4.5	Prove of color fastness test from supplier	OK

4.6	The product is packed in poly bag or carton. Supplier can't send products without packaging.	OK

5	Pack and Packaging	

5.1	Approved sample/QA file available during inspection	OK

5.2	Export carton (shipping mark, barcode)	OK

Barcode can be scanned	
Scanned barcode	
Barcode from order data	
Scanned format	

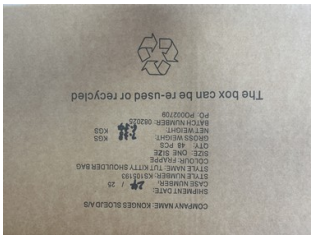

5.3	Export carton (dimension, weight)	OK

	Specification	Tolerance	Actual
L	-	-	60
W	-	-	35
H	-	-	31.5
Gross Weight	-	-	7.38

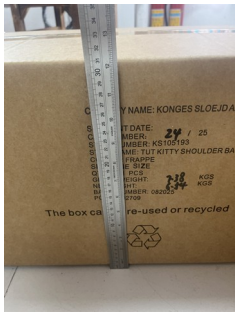

5.4	Carton Packing (quantity, ratio etc), 3 ply carton	OK

5.5	Inner package (polybag, sticker, tissue paper, silica gel etc)	OK

5.6	Hanger (quality, size etc)	

5.7	Header card	OK

CIAO MIAO

WARNING

WARNING
STRANGULATION HAZARD.
Long cord. Not suitable for children under 3 years.
0-3

MADE WITH LOVE
HANDLE WITH CARE