

2021

GENERAL CONTRACTOR PLAYBOOK



CONSTRUCTION HQ

LIDL US

6/17/2021

CONTENT

1. Overview
2. Bid Phase (Improve cost/schedule/efficiency)
 - a. RFI Question Period
 - b. Bid Submission and Bid Template
 - i. National Account Overview
 - ii. Payment Milestone Schedule
 - c. Technical and Commercial Meeting
 - d. Best and Final Award
 - e. Preconstruction
 - i. Understanding of work hours/duration
3. Construction
 - a. Mobilization
 - b. Milestone and Schedule
 - i. Manpower Distribution
 - ii. Construction Progress (Ground up Prototype Sample)
 - c. Change Order
 - i. Complete Change Order
 - d. Invoicing
 - i. Milestone Payment
 - ii. Easy Invoice Requirement
 - iii. Final Lien for final payment
 - e. Commissioning and IT Handover
 - i. Pre-FPT
 - ii. FPT
 - iii. IT Handover
 - iv. MEP Responsibility Matrix
 - f. Handover/Punchlist
 - i. Initial Punchlist
 - ii. Walk with Lidl Teams
 - g. Closeout
 - i. Project Completion Closeout
 - ii. Warranty Walk



1. OVERVIEW

WELCOME

Welcome to the General Contractor Guide for the bidding, construction and close out of the Lidl Store Development. This document will serve as your guide and companion in navigating the construction flow and best practice. The process highlighted in this playbook should provide a guideline to successfully complete the construction of Lidl stores.

AUDIENCE

The guide is intended for two audiences:

- New Lidl Employees - to function as a part of the on-boarding process.
- General Contractor – to serve as a handbook during the construction of various Lidl Store types.

This playbook is not a step-by- step guide, but rather a summary of key features during different phase of store bidding and constructions.

ORGANIZATION:

This playbook is divided into following Four (4) primary section

- Overview
- Bidding
- Construction
- Closeout

DEFINITIONS

PROTOTYPE/PROTOTYPICAL: Ground -up design based on Store Concept 2020, right-handed, with few to no visible modifications.

GROUND-UP: New Construction, based on a site-specific adaptation of prototypical drawings

NON-STANDARD/LEASE: Interior renovations (tenant fitout) of lease space.

SUPPLY CHAIN: The Lidl department that deals with FF&E. Supply chain provides final layouts for sales floor equipment for each stores.

REGIONAL CONSTRUCTION MANAGER: Construction Manager assigned to oversee the construction of the stores at the regional level.

PROJECTMATES: Software utilized to manage the bid and construction.

BID MANAGER: Lidl representative who is manages the bid process of the stores construction and point person for the bidding.

NATIONAL ACCOUNT: Preferred supplier or Vendor that has a binding contract with Lidl.

FM FIT OUT MANAGER: Lidl FM manager who oversees the fit out of the store. The fit out managers are responsible for the shelving, checkout lanes, Bakery display, décor etc.

FPT: Functional Performance Testing.

BMS-FPT: Building Management System – Functional Performance Testing

MEP: Mechanical Electrical Plumbing

Disclaimer: The General Contractor Playbook is a guide for standard process. The contract, construction documents, and construction manager's direction will supersede the general direction provided in this documents.



2. BIDDING

GENERAL CONTRACTOR PREQUALIFICATION

The bid invitation generally means the General Contractor is prequalified. The general contractor must full fill following criteria to be qualified to bid Lidl's project.

- Location: The General Contractor must be located or have presence in the state where the project is being constructed.
- Financial: The General Contractor must have stable financial standing. In order to ensure financial stability, General Contractor will have to submit independent audit of their firm. Additionally Lidl will complete D&B inquiry for historical information.
- Safety Rating: The General Contractor will have to submit EMRs for previous two years. Recommended rating is below 0.83
- Experience: The General Contractor are required to submit projects similar to Lidl constructions.
- Workforce Capacity: In order ensure required supervision, the General Contractor are require to submit total company work force.

The General Contractor must be qualified every year. In the event of last qualification of more than a year, the General Contractor must resubmit all the documents for prequalification.

BID INVITATION

The bid invitation are sent to the General Contract via Projectmates. The General Contractors are requested to submit form in order to gain access to Projectmates. The invitation usually contains following documents.

Site Specific Drawings	Invitation to Bid	Instruction to Bidder
Bid Breakdown Sheet	Closeout Documents	Schedule Overview
Bid Document List	Owners Form Agreement/Exhibits	Scope Clarification
Site Logistic Plan	Submittal Log	

RFI QUESTION AND RESPONSE PERIOD

The first two(2) weeks of the bid are allotted for the General Contractor and the Subcontractor to review the project and ask any project specific questions in the form of Requests For Information(RFI). At the end of this two weeks, all questions and answers will be distributed to all bidders. RFIs will be submitted via Projectmates for clarification on scope of work, prototype specifications, payment milestones, etc.

BID SUBMISSION

The General Contractor are to submit bids in the excel format in the Bid Breakdown Sheet as provided in the Bid Invitations. The lump sum should be broken out into specific line items. All the relevant line items must be populated to ensure no scopes are missed. The excel cells highlighted yellow are to be filled out by the General Contractor. Complete bid should include following

- Lidl Bid Breakdown
- Unit Rate/Labor Cost List
- Detailed Project Milestone Schedule (Including Lidl Milestone tasks)

- Redlined contract document
- Milestone Payment Schedule
- Scope Confirmation Document GC Bid Clarifications

NATIONAL ACCOUNT (NA)

The NA account prices enables Lidl to purchase material which is vetted for design, lead time, and cost. Lidl Head Office team has negotiated the contract with National Account Vendors. The General Contractor can request the contract between Lidl and the National The table below shows most of the National Account vendor which have been vetted by the National Account Team. The table below is to illustrate Lidl's transparent relationship with the National Vendors. The details on the latest information can vary. Please request this information with the Bid Manager during the bid phase, if needed.

NATIONAL ACCOUNTS LIST			
DESCRIPTION	SELECTED COMPANIES	CONTACT NAME	CONTACT INFORMATION
BRICK	GLENDENBY	AL HIGGINS	EMAIL: A.HIGGINS@GLENDENBY.COM PHONE: 703.931.7773
CURBILLS	OLDCARTLE	JOHN COOPER, JR. REGIONAL COMMERCIAL MANAGER	EMAIL: JCOOPER@OLDCARTLE.COM PHONE: 802.515.8882
ETHEL	VERDRAFT	STEFANIE R. SCHLOERER P.E. NATIONAL ACCOUNT MANAGER	EMAIL: VSCHLOER@VERDRAFT.COM PHONE: 715.552.2222
METAL ROOFING, CORRUGATED, AND DOWN PAGES	AT&B	DAVID HINES ARCHITECTURAL & DESIGN MANAGER	EMAIL: DHINES@AT&B.COM PHONE: 404.333.5429
BLUMING AUTOMATIC DOORS	BOO DR PAGE	CHARLES GUTMAN NATIONAL ACCOUNTS	EMAIL: CGUTMAN@BOODR.COM PHONE: 317.775.2222
CONCRETE DOOR	OVERHEAD DOOR	VERNADE NEGRA PROJECT MANAGER	EMAIL: VNEGRA@OVERHEADDOOR.COM PHONE: 888.338.8138
STONEFRONT AND WINDOWS	OVERHEAD DOOR	ALAN WELLS KEY ACCOUNT BUSINESS MANAGER	EMAIL: AWELLS@OVERHEADDOOR.COM PHONE: 888.338.8138
FLOOR COATINGS	BOO DR PAGE	EDITH WARD REGIONAL SALES MANAGER	EMAIL: EWARD@BOODR.COM PHONE: 317.775.2222
STONEFRONT ALUM PROTECTION / CHALLENGE	BOO DR PAGE	JOHN WARD REGIONAL SALES MANAGER	EMAIL: JWARD@BOODR.COM PHONE: 317.775.2222
WALL BUMPERS	ROSCOWING	DANIEL JACKSON	EMAIL: DJACKSON@ROSCOWING.COM PHONE: 848.342.4444
PLUMBING FITTINGS	BOO DR PAGE	JOHN WARD REGIONAL SALES MANAGER	EMAIL: JWARD@BOODR.COM PHONE: 317.775.2222
WINDOW TREATMENTS	RELLA-R-RODE	TATIANA HAYES PROJECT MANAGER	EMAIL: THAYES@RELLA-R-RODE.COM PHONE: 877.347.4773
WIRE	RELLA-R-RODE	BOB BRYAN NATIONAL ACCOUNTS	EMAIL: BBRYAN@RELLA-R-RODE.COM PHONE: 877.347.4773
LIGHTING	RELLA-R-RODE	BOB BRYAN NATIONAL ACCOUNTS	EMAIL: BBRYAN@RELLA-R-RODE.COM PHONE: 877.347.4773
GENERATOR	CHARTER DAY	DAVID DOWNS CFO ACCOUNT EXECUTIVE	EMAIL: DDOWNS@CHARTERDAY.COM PHONE: 415.361.7222
BATTERY HOOD	CAPTIVE AIR	MARK PROFFER ENGINEER	EMAIL: MPROFFER@CAPTIVEAIR.COM PHONE: 800.885.0881
EMS	EMERSON	TONY VENTURA	EMAIL: TVENTURA@EMERSON.COM PHONE: 203.261.0000
SECURITY	TELEAD	DAVID TESHKE	EMAIL: DTESHKE@TELEAD.COM PHONE: 714.333.1111
WALK-IN REFRIGERATION AND COOLERS	CHANCE BEAVER	CHANCE BEAVER	EMAIL: CBEAVER@CHANCEBEAVER.COM PHONE: 800.333.3333
REFRIGERATION EQUIPMENT	CHANCE BEAVER	CHANCE BEAVER	EMAIL: CBEAVER@CHANCEBEAVER.COM PHONE: 800.333.3333
WIRE	RELLA-R-RODE	TATIANA HAYES PROJECT MANAGER	EMAIL: THAYES@RELLA-R-RODE.COM PHONE: 877.347.4773
ELECTRICAL PANELS	RELLA-R-RODE	TATIANA HAYES PROJECT MANAGER	EMAIL: THAYES@RELLA-R-RODE.COM PHONE: 877.347.4773
BATTERY ARCHIVAL	RELLA-R-RODE	TATIANA HAYES PROJECT MANAGER	EMAIL: THAYES@RELLA-R-RODE.COM PHONE: 877.347.4773

Sample list of the National Account for SC2020 design. Inquire during the bid and bid document

PAYMENT MILESTONE

The General Contractors are paid with on the basis of completed work. The milestone payment schedule is established during the bidding phase. Only the portion of the work that has been completed will be compensated. The General Contractors are requested to review the default payment milestone schedule generated in the second table of the Bid Breakdown sheet.



BID MEETING

General Contractors are required to attend technical and Commercial meetings. During these meeting, scopes are clarified and the General Contractor are provided opportunity to provide additional information on the bids.

TECHNICAL MEETING

Lidl Construction Manager, Architect, Engineer, Site supervisor, and any other consultant deemed necessary by Lidl US will attend the Technical Meeting with General Contractor representative. The meetings can be recorded with the Technical meeting minutes template and signed by the representative of General Contractor and Lidl US. All finalized minutes will be part of the agreement between Lidl and the General Contractor.

During Technical Meeting, the scope deviations must be brought up by the General Contractors which enables to correctly allocate the values in different line items.

COMMERCIAL MEETING

Commercial Meetings can be held in the same sitting as the Technical Meetings. All contract terms, except for price and schedule, should be finalized prior to the financial meeting. Financial meetings are held as in-person negotiations (any subsequent negotiations have options to be conducted over the telephone and key points documented). The architect/engineer is not required and not recommended to participate in the financial negotiations.

These documents will be part of the contract document.

OWNER'S FORM CONTRACT

Lidl utilized owners form contract. The General Contractors should be providing any comments or desire for modification during the bidding phase. **Failure to provide acknowledgement of the contract may result in the disqualification from the bids.**

BEST AND FINAL

The General Contractor will be requested to provide Best and Final bid number if the bid submitted is competitive. This is the opportunity only arises if Lidl determines if the bidder is still "in the mix" based on the proposal submitted. Schedule, cost, previous performance, etc are taken into consideration while reaching out to the General Contractors for best and final submission. .



Standard Bid Timeline

BID BREAKDOWN							
				General Contractor:			
				Store Name:			
				Date:			
				Store Type:			
IMS Classification	WBS code	Division/ Section	Description	Quantity	Unit	Unit price	Total
1 General Conditions							\$0.00
		1.1 Administrative Requirements					
General Conditions	2-02-03	1.1.a	Communication & IT	0.00	EA	\$0.00	\$0.00
General Conditions	2-02-03	1.1.b	Management Personnel	0.00	EA	\$0.00	\$0.00
General Conditions	2-02-03	1.1.c	General Field Personnel	0.00	EA	\$0.00	\$0.00
General Conditions	2-02-03	1.1.d	Temporary Lodging	0.00	LS	\$0.00	\$0.00
		1.2 Temporary Utilities					
General Conditions	2-02-03	1.2.a	Temporary Power Supply	0.00	EA	\$0.00	\$0.00
General Conditions	2-02-03	1.2.b	Temporary Water Supply	0.00	EA	\$0.00	\$0.00
General Conditions	2-02-03	1.2.c	Temporary Heating and Cooling	0.00	EA	\$0.00	\$0.00
General Conditions	2-02-03	1.2.d	Temporary Enclosures/Partitions	0.00	EA	\$0.00	\$0.00
General Conditions	2-02-03	1.2.e	Temporary Fire Protection	0.00	EA	\$0.00	\$0.00
		1.3 Temporary Construction Facilities and Site Setup					
General Conditions	2-02-03	1.3.a	Field Office Set up	0.00	EA	\$0.00	\$0.00
General Conditions	2-02-03	1.3.b	Temporary Safety fences	0.00	LF	\$0.00	\$0.00
General Conditions	2-02-03	1.3.c	Storage and Warehousing	0.00	EA	\$0.00	\$0.00
General Conditions	2-02-03	1.3.d	Tools and Equipment	0.00	EA	\$0.00	\$0.00
		1.5 Permit Fees					
General Conditions	2-02-03	1.5.a	Building permits	0.00	EA	\$0.00	\$0.00
General Conditions	2-02-03	1.5.b	Site permits	0.00	EA	\$0.00	\$0.00
		1.6 Miscellaneous					
General Conditions	2-02-03	1.6.a	Cleaning work during construction	0.00	EA	\$0.00	\$0.00
General Conditions	2-02-03	1.6.b	2 full interior + exterior cleanings prior to handover and opening	0.00	EA	\$0.00	\$0.00
General Conditions	2-02-03	1.7 Warranty Bond		0.00	EA	\$0.00	\$0.00
2 Existing Conditions							\$0.00
Site	2-05-02	2.1 Building Demolition		0.00	SF	\$0.00	\$0.00
Site	2-05-02	2.2 Hazardous Building Material decontamination (asbestos)		0.00	CY	\$0.00	\$0.00
Site	2-05-02	2.3 Contaminated Soil Material Removal		0.00	CY	\$0.00	\$0.00

Screenshot of bid breakdown, GC to fill out cells in yellow only



3. CONSTRUCTION

MOBILIZATION

The clock starts ticking once the mobilization commences. The General Contractors are expected to setup following at the jobsite.

- Displays showing safety requirement to enter the construction site
- Latest set of plans
- Most latest schedule hung up for everybody's awareness
- Information about the medical facilities in case of emergency
- Security setup in order to ensure loss prevention of construction material
- Printed detailed schedule

Additionally, the shop drawings for the long lead items must be submitted for approval. Weekly Owners/Architect/Contractor meetings are to be scheduled by the time General Contractor has mobilized.

As part of the contract, the General Contractor should start compiling and submitting updated hourly rates based on the proposal received from the subcontractors.

MILESTONE AND SCHEDULE

Any changes to the schedules must be made aware to the Lidl Construction Managers. Should there be any delay on critical path, the General Contractor should come up with a recovery plan along with updated schedule. The updated schedule is only valid after it has been approved as a zero dollar change order within Project Mates.

Any changes to the milestone must be communicated to the Lidl in timely manner. This hold especially critical when the milestone triggers other Owner Designated subcontractors or internal Lidl department. Listed below are Lidl's critical milestones.

- IT Readiness
- FPT and BMS FPT
- Fit Out facilities management handover
- Sales handover
- Portfolio facilities management handover
- Certificate of Occupancy

MANPOWER DISTRIBUTION

The General Contractor must have all the resources to complete the project on schedule. Although Lidl does not dictate means and methods, the General Contractor must have minimum resource distribution as follows

SUPERVISION

If additional supervision is required during the peak construction phase, the General Contractor should provide without any additional cost. This is required when owner designated subcontractor is working, FM Fit Out crews are present etc.

DOCUMENTATION

Projectmates is Lidl designated software. All the documents and correspondence must be saved in Projectmates. This includes but not limited to Request for Information (RFI), submittals, meeting minutes, pictures etc.

PHOTOS

General Contractor are required to upload photos on Projectmates on the progress of the construction. It is recommended to provide at least 10 pictures a day to provide a vantage point, and detail ongoing during that phase.

MEETINGS

Owner/Architect/Contractor are held weekly. The meetings will be hosted by Lidl. Meeting minutes will be drafted by Lidl Construction Manager and saved within Projectmates.

FIELD TESTS AND VERIFICATION

The appendix "Field Test and Verification" shows lists all the test required. It is General Contractors responsibility to complete these test during the course of the project and send it back to the Lidl Construction Manager.

CHECKLIST

In order to efficiently record the handover and the progress of the project Lidl has implement multiple checklists. Checklists utilized during all the construction processes will be highlighted in the appendix section. The General Contractors are required fill and sign the checklist as required in the schedule. Eg: pre-FPT checklist needs to be completed before the commissioning agent schedules site visit for the FPT.





CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE) –



DAILY MANPOWER COUNT

Contractors/Week*	Week 1	Week 2	Week 3	Week 4	Week 5	Week 6	Week 7	Week 8	Week 9	Week 10	Week 11	Week 12	Week 13	Week 14	Week 15	Week 16	Week 17	Week 18	Week 19	Week 20	Week 21
GC Resources	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	3	3	3	3
Concrete	8	8								8											2
Mason	12	12	12	12	12	8	10	10	10												2
Plumbing	2	3	3	3							3	3	3				2				2
Electrical	2	3	1			3	3			3	8	8	8	8	8			4	2	2	2
Steel				10	10	10				4											
Damproofing/ Vapor Barrier				4	4				4	4											
Framing/Insulation/ Drywall						4	4	4			4		4		2						2
Roofer							10	10	10												
Slab								20	20												
Sprinkler										3	3	3									
Mechanical										4	4	3									2
Walk ins												4	4								2
Tile														2							
Painting														3							2
Polishing														8							2
IT cabling															3	3	3			2	
Security															2	2	2	2	2	2	2
BMS																2	2			2	2
Millwork																2					
ATAS Canopy																		4			
Sliding doors																			3		
IT Fit Out																					2
FM Fit Out															8	2			6	6	2
Storefront																		3			
Refrigeration														4	4	5	5	5	5	5	4
Daily Average**	25	27	17	30	27	26	28	45	45	27	23	22	20	26	28	17	15	21	21	22	33


*Weekly count starting after the pad ready

**The total number denotes number of manpower to be expected for each trades in that particular week. Eg on week 17, The General Contractor are expected to have at least 15 people onsite on a daily for that week



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building Pad Ready: Week 1

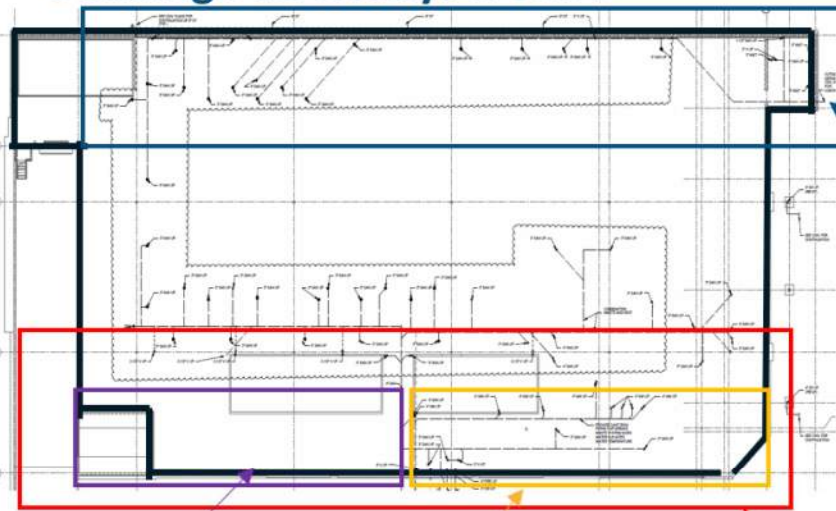

Plumbing Start
North Elevation
Day 1



Electrical Day 3
South Elevation

Mason Day 3
South Elevation

Concrete Footings
South Elevation Start
Day 1


Contractors	Resources	Days
Concrete	8	5
Plumbing	2	4
Electrical	2	2
Mason	12	2

Path to Growth.
adapt. perform. succeed.



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 2

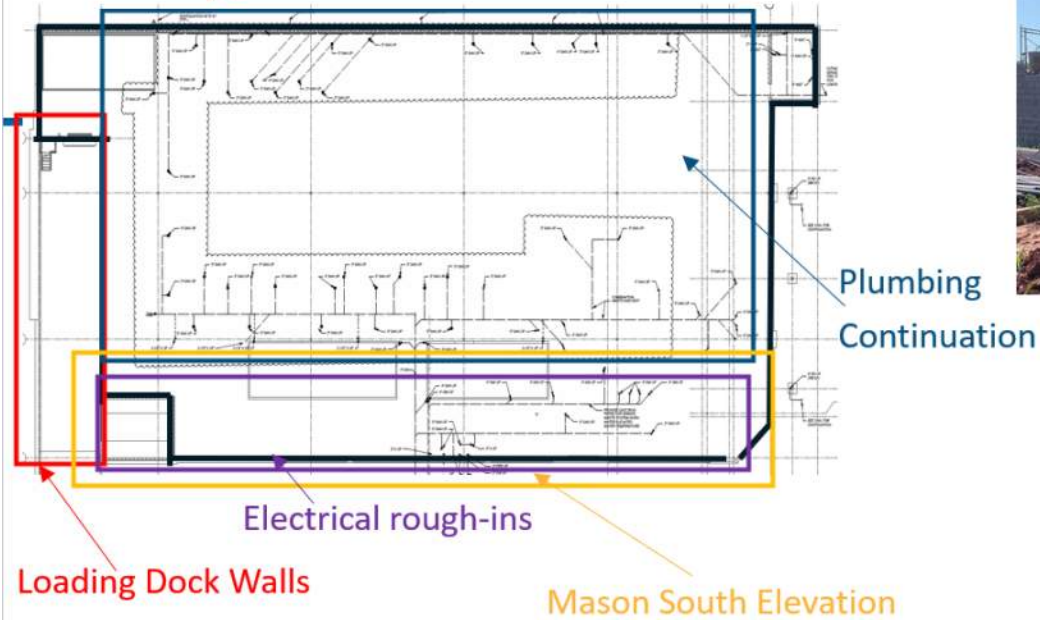

Contractors	Resources	Days
Concrete	8	2
Plumbing	3	5
Electrical	3	4
Mason	12	5

Path to Growth.
adapt. perform. succeed.



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 3

Electrical
rough-insPlumbing
Continuation

Mason Continuation

Contractors	Resources	Days
Concrete	0	0
Plumbing	3	3
Electrical	1	3
Mason	12	5



Path to Growth.
adapt. perform. succeed.



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 4

Mason North
ElevationSteel Columns
StartDump Proof/ Vapor Barrier
Start

Contractors	Resources	Days
Steel	10	2
Plumbing	3	5
Damproofing/ Vapor Barrier	4	4
Mason	12	5



Path to Growth.
adapt. perform. succeed.




CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 5

Mason North
Elevation

Damproofing/
Vapor Barrier Start

Steel Joist & Decking
Start

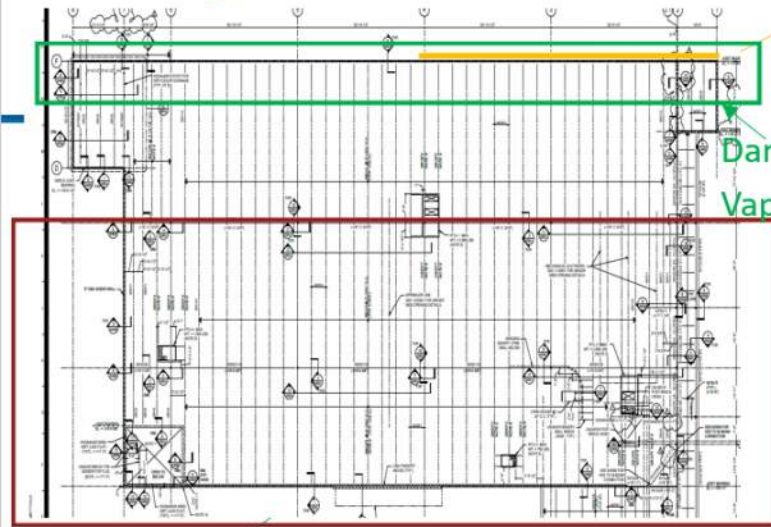

Contractors	Resources	Days
Steel	10	5
Plumbing	0	0
Damproofing/ Vapor Barrier	4	4
Mason	12	2




Path to Growth.
adapt. perform. succeed.




CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 6

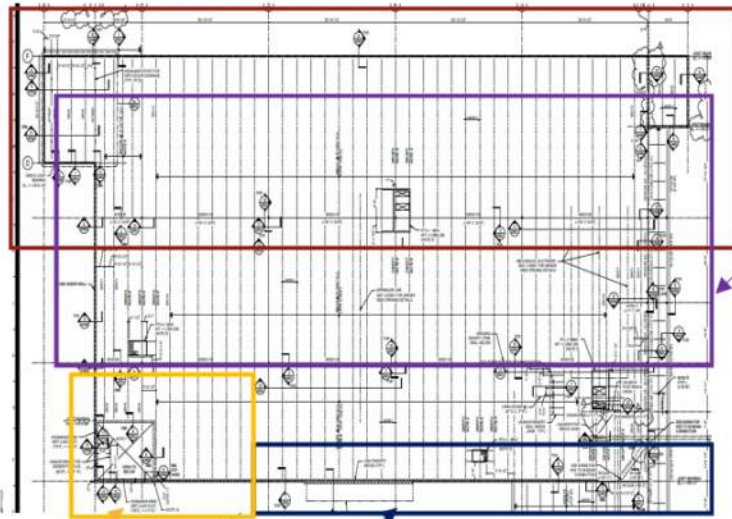

Steel Joist &
Decking Continue
Electrical Temp
Lighting &
rough-ins

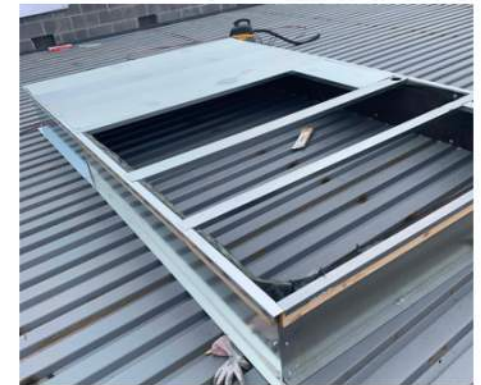


Mason Brick Framing /Insulation

Contractors	Resources	Days
Steel	10	5
Framing /Insulation	4	5
Electrical	3	3
Mason	8	5



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 7

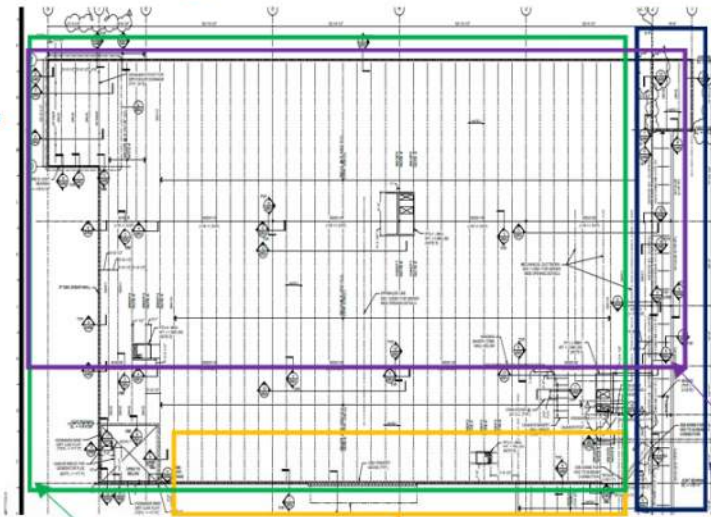

Roofer

Mason Brick

Electrical rough-ins

Framing /Insulation



Contractors	Resources	Days
Electrical	3	3
Framing /Insulation	4	5
Roofer	10	5
Mason	10	5




Path to Growth.
adapt. perform. succeed.



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 8

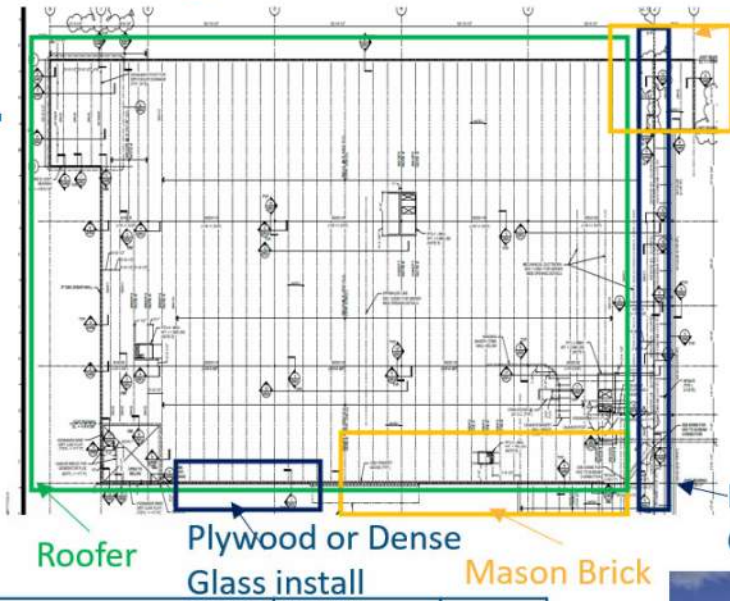

Mason Brick



Plywood or Dense Glass install

Mason Brick






Contractors	Resources	Days
Slab Prep	20	5
Plywood or Dense Glass install	4	3
Roofer	10	2
Mason	10	3



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 8

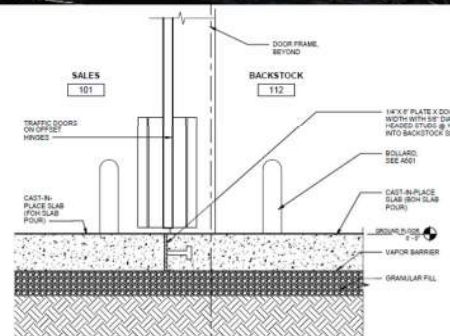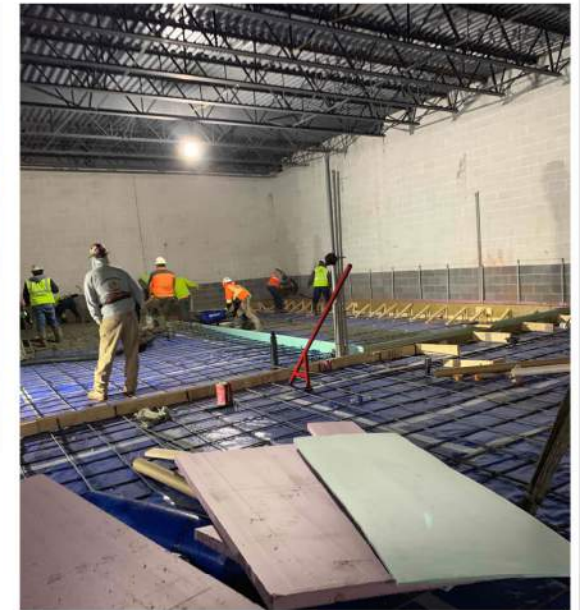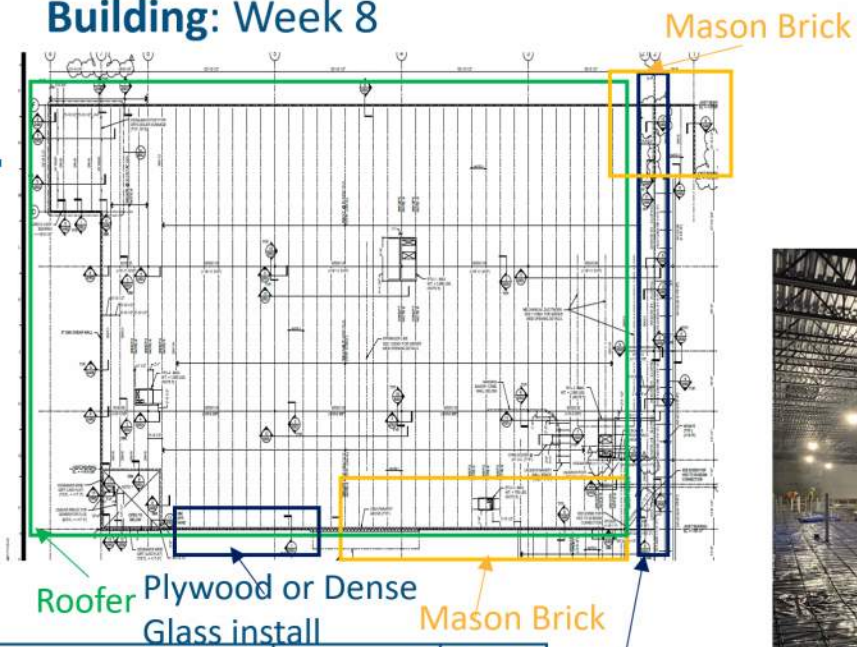

Contractors	Resources	Days
Slab Prep	20	5
Plywood or Dense Glass install	4	3
Roofer	10	2
Mason	10	3


Plywood or Dense Glass install

Path to Growth.
adapt. perform. succeed.



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 9

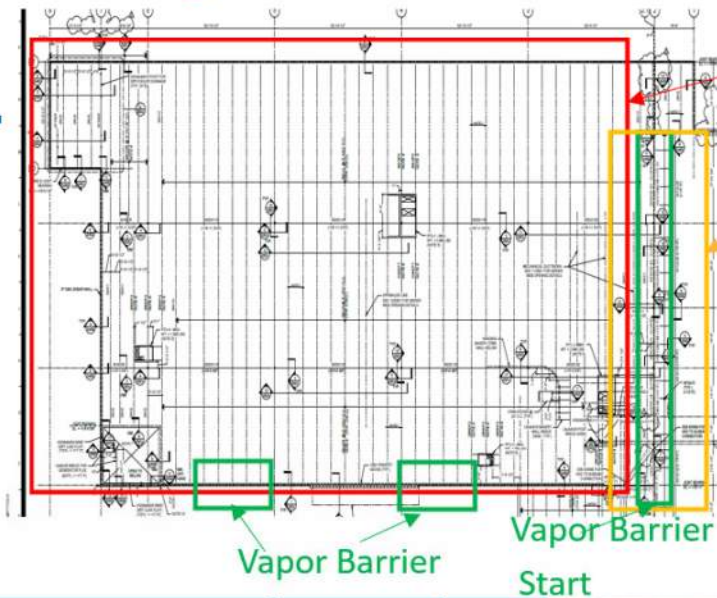


Contractors	Resources	Days
Slab Pure	20	5
Vapor Barrier	4	2
Mason	10	3



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 9

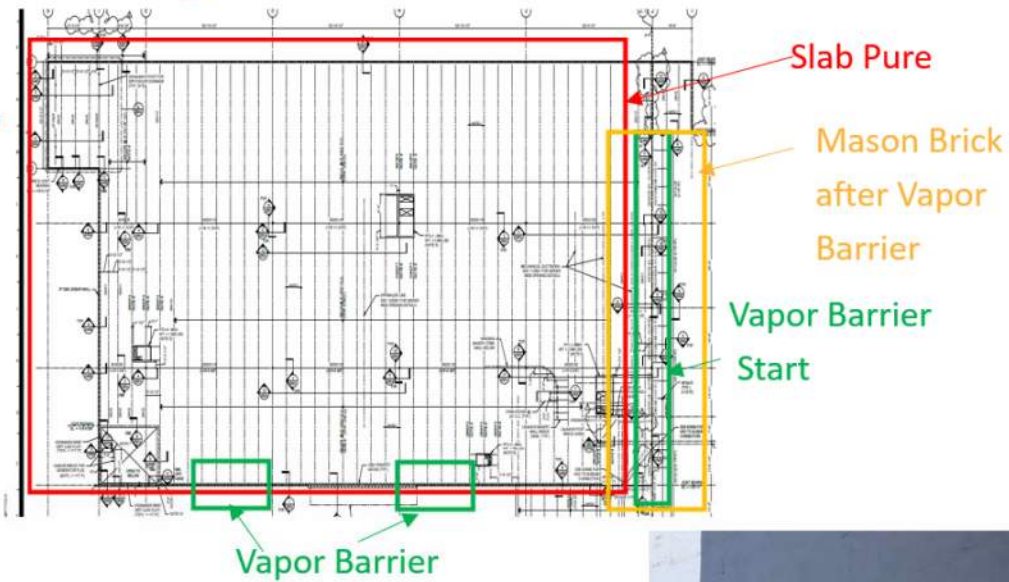


Contractors	Resources	Days
Slab Pure	20	5
Vapor Barrier	4	2
Mason	10	3




Path to Growth.
adapt. perform. succeed.



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

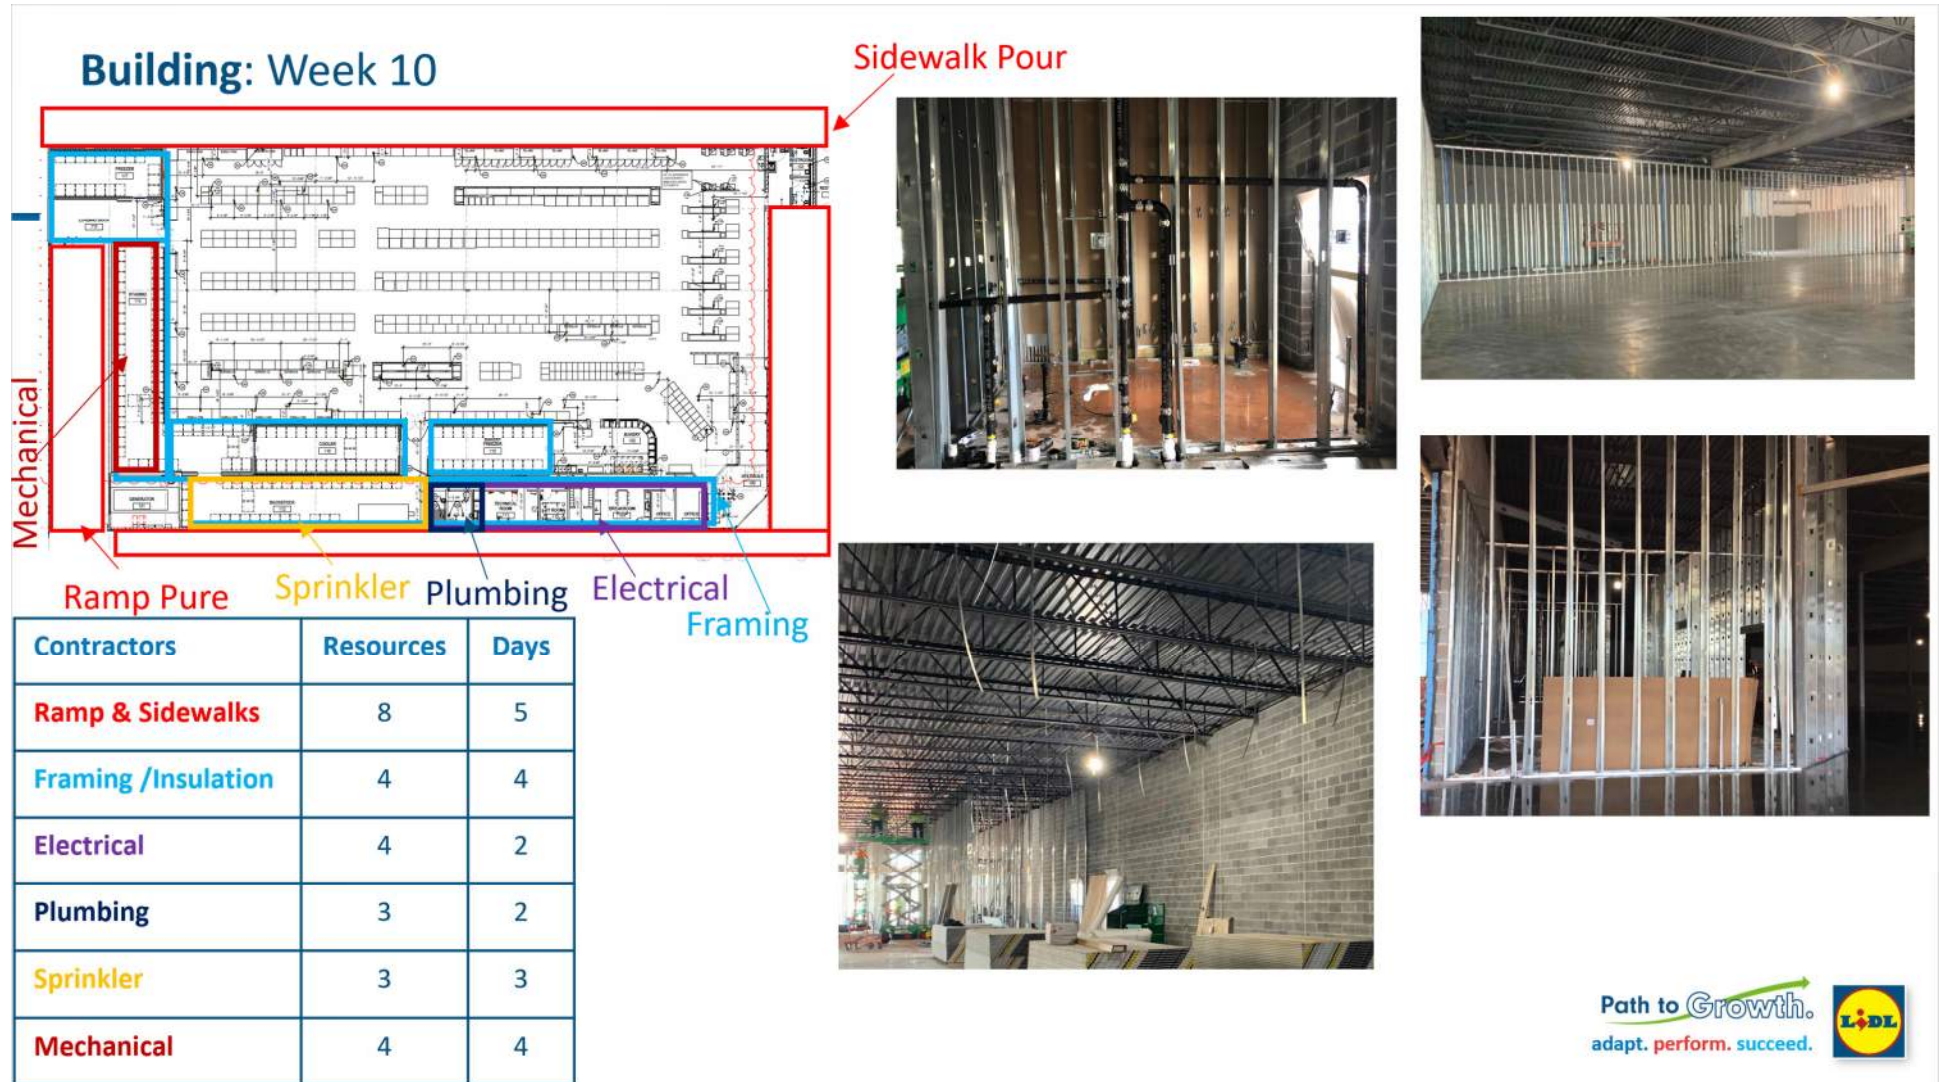


CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

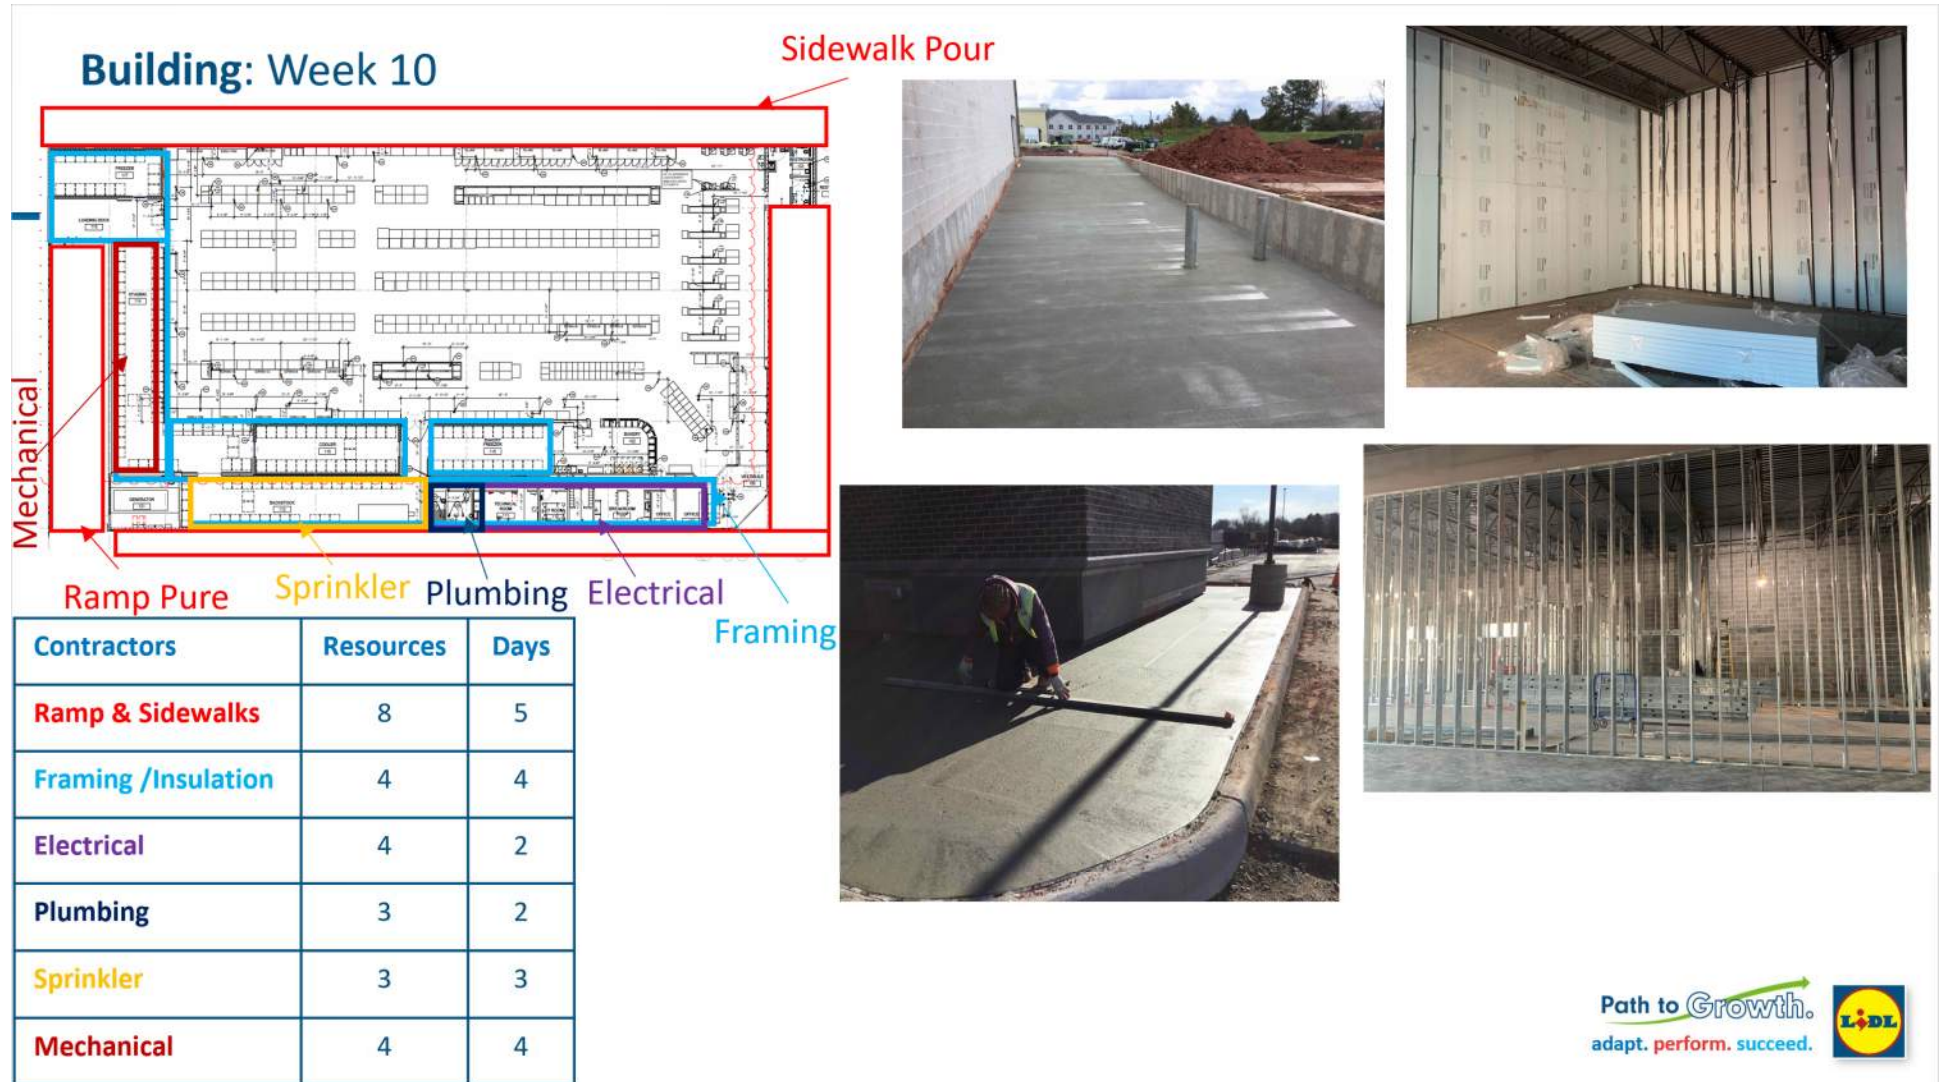

CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 11

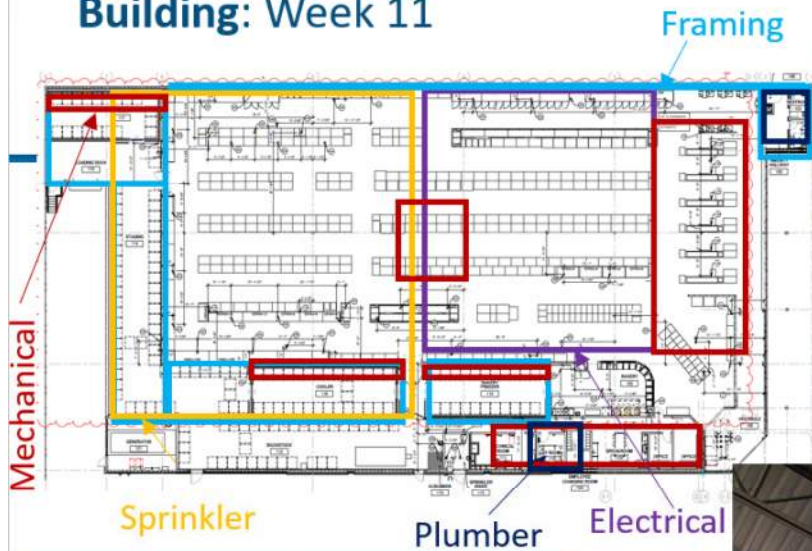

Contractors	Resources	Days
Framing /Insulation	4	3
Electrical	8	5
Plumbing	3	4
Sprinkler	3	5
Mechanical	4	5



Path to Growth.
adapt. perform. succeed.



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 11

Framing

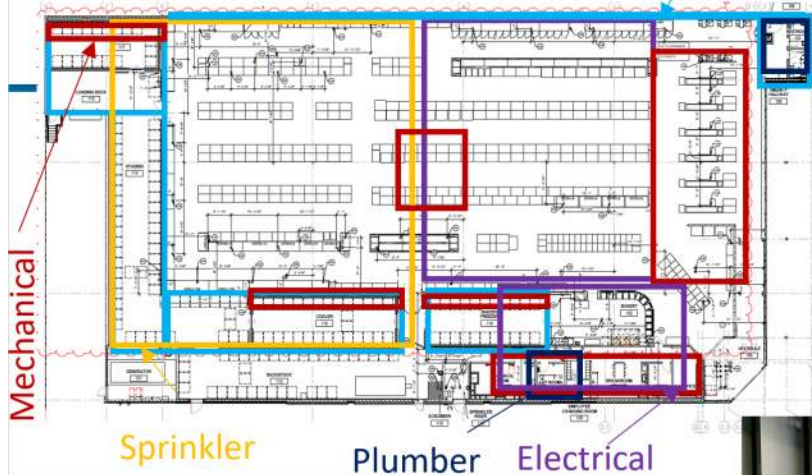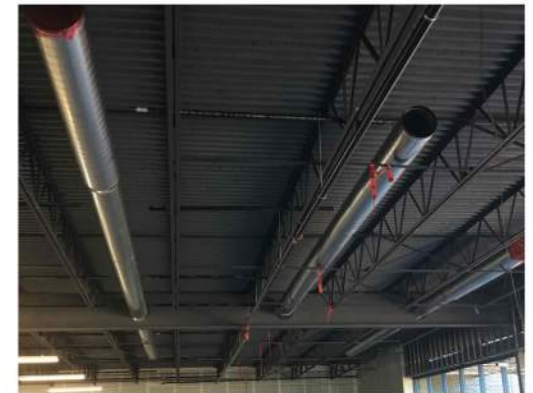


Contractors	Resources	Days
Framing /Insulation	4	3
Electrical	8	5
Plumbing	3	4
Sprinkler	3	5
Mechanical	4	5

Path to Growth.
adapt. perform. succeed.



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 12

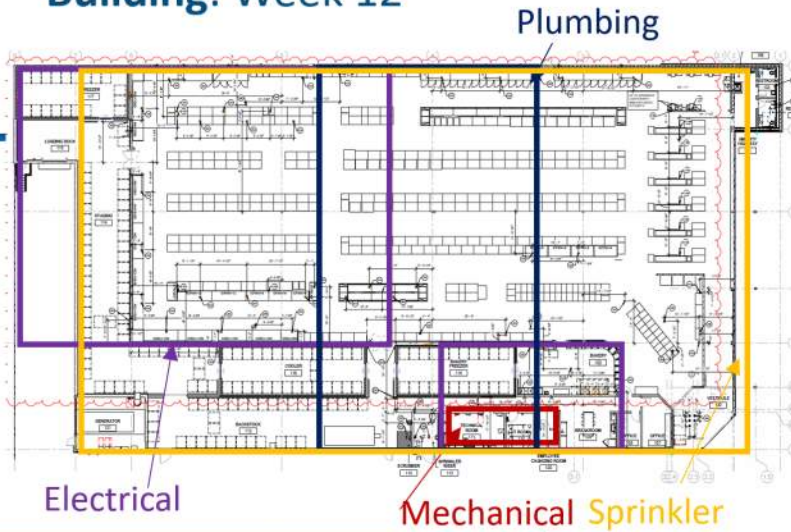

Contractors	Resources	Days
Electrical	8	5
Plumbing	3	3
Sprinkler	2	2
Mechanical	2	3
Framing /Insulation	3	3




Path to Growth.
adapt. perform. succeed.



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)


Building: Week 13

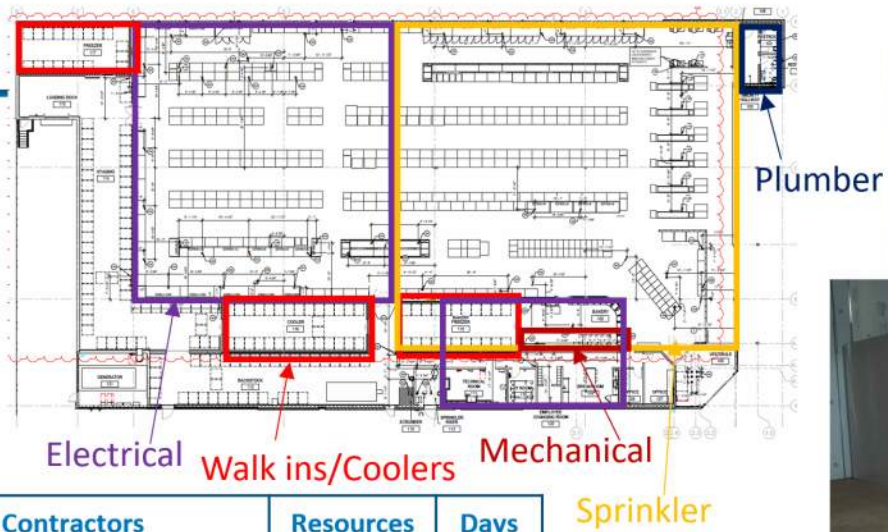

Contractors	Resources	Days
Walk-ins/coolers	4	5
Electrical	8	5
Plumbing	3	3
Sprinkler	3	5
Mechanical	3	2

CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 14

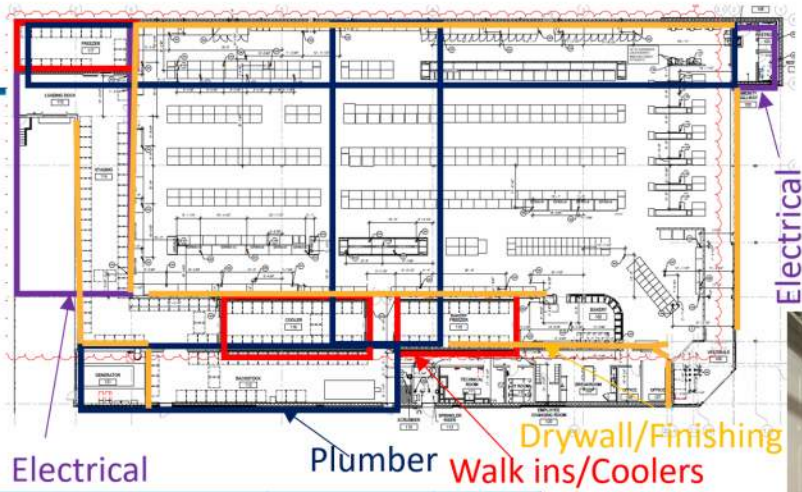

Contractors	Resources	Days
Walk-ins/coolers	4	5
Electrical	8	5
Plumbing inside/gas line	3	4
Drywall/ Finishing	4	5




Path to Growth.
adapt. perform. succeed.



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 15

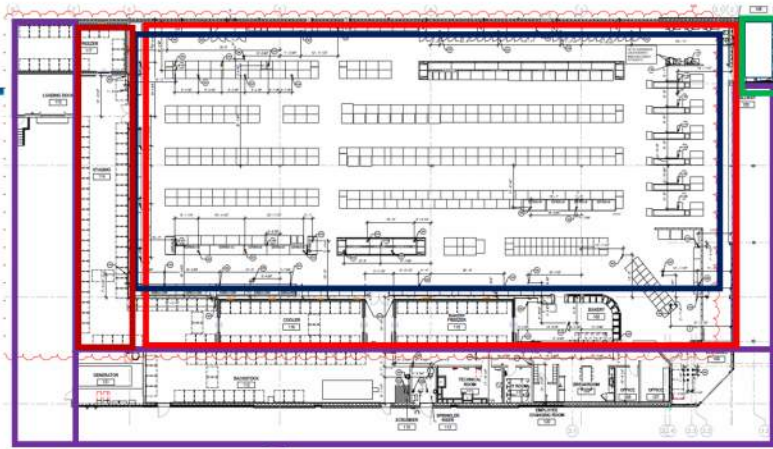


Electrical



Contractors	Resources	Days
Painting Ceiling/Walls	3	5
Electrical inside & Outside Work	8	5
Polishing	8	4
Tile	2	2
Refrigeration	4	5

CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 15

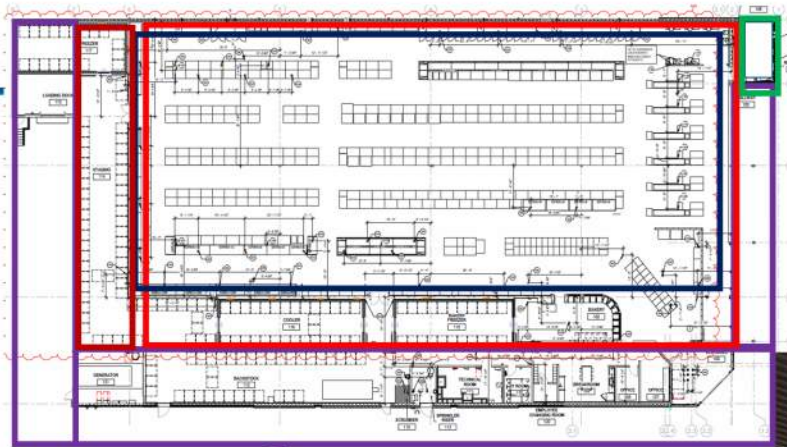

Electrical

Contractors	Resources	Days
Painting Ceiling/Walls	3	5
Electrical inside & Outside Work	8	5
Polishing	8	4
Tile	2	2
Refrigeration	4	5



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 16 Finishing/Ceiling Grid Security

IT Cabling
Electrical


Refrigeration FM Décor/Bakery Millwork

Contractors	Resources	Days
Security	2	5
Electrical Wire pooling	8	5
FM Décor/Bakery Millwork	8	4
Finishing/Ceiling Grid	2	2
IT Cabling	3	5
Refrigeration	4	5

Path to Growth.
adapt. perform. succeed.

CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 17

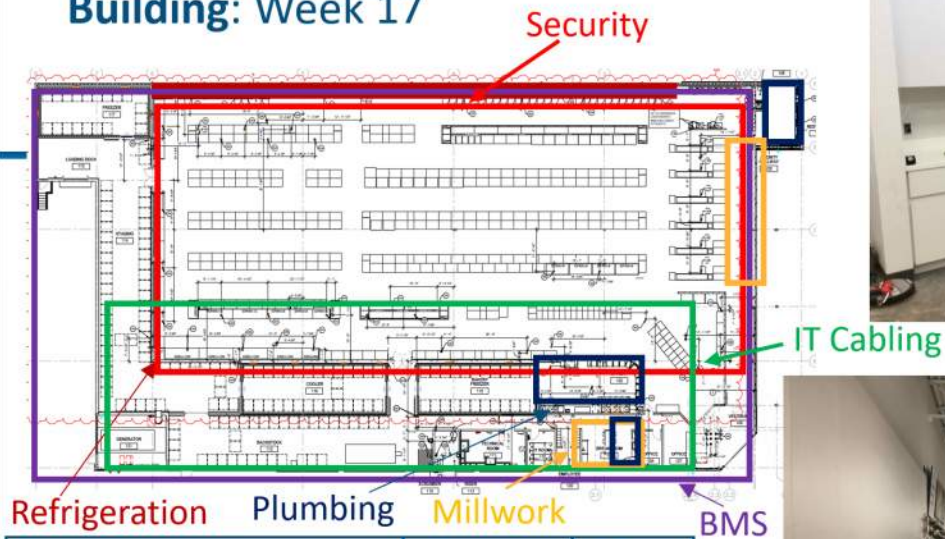

Contractors	Resources	Days
Security	2	5
BMS	2	5
IT Cabling	3	5
Plumbing	2	2
Refrigeration	5	5
Breakroom Millwork/ Packing Bench	2	2




Path to Growth.
adapt. perform. succeed.




CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 18

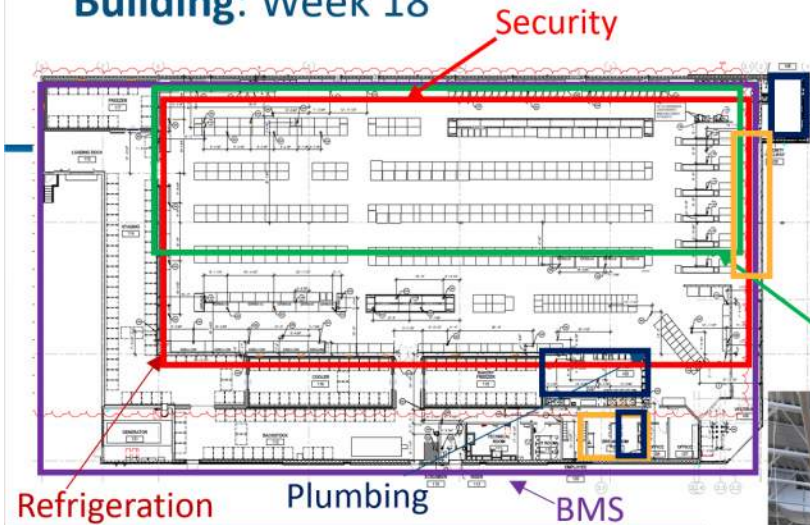

Contractors	Resources	Days
Security	2	5
BMS	2	5
IT Cabling	3	5
Plumbing	2	2
Refrigeration	5	5

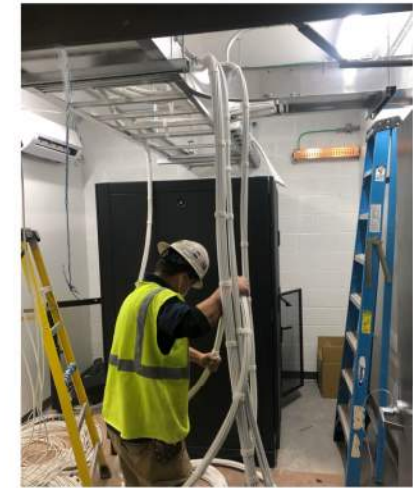


Path to Growth.
adapt. perform. succeed.



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 19

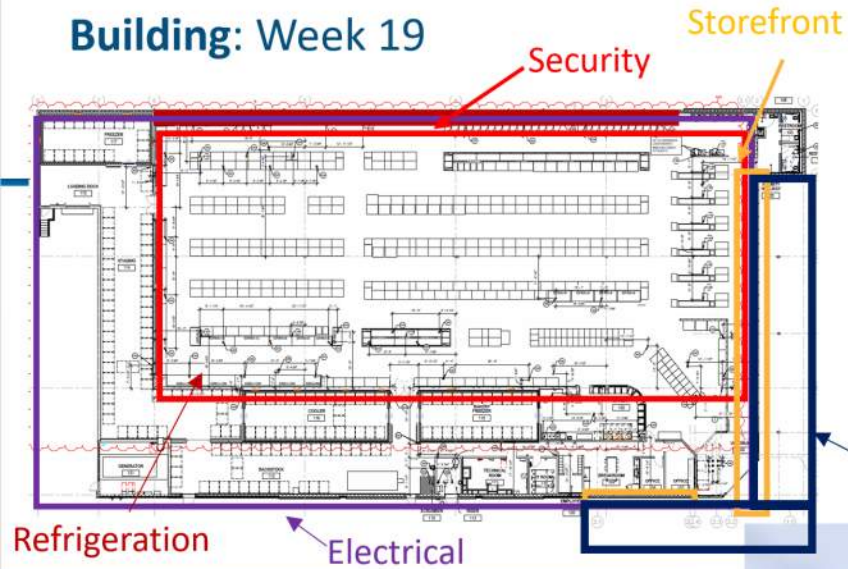

ATAS Canopy




Contractors	Resources	Days
Security	2	5
Electrical	4	3
Refrigeration	5	5
ATAS Canopy siding	4	4
Storefront / Windows	3	5




CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 20

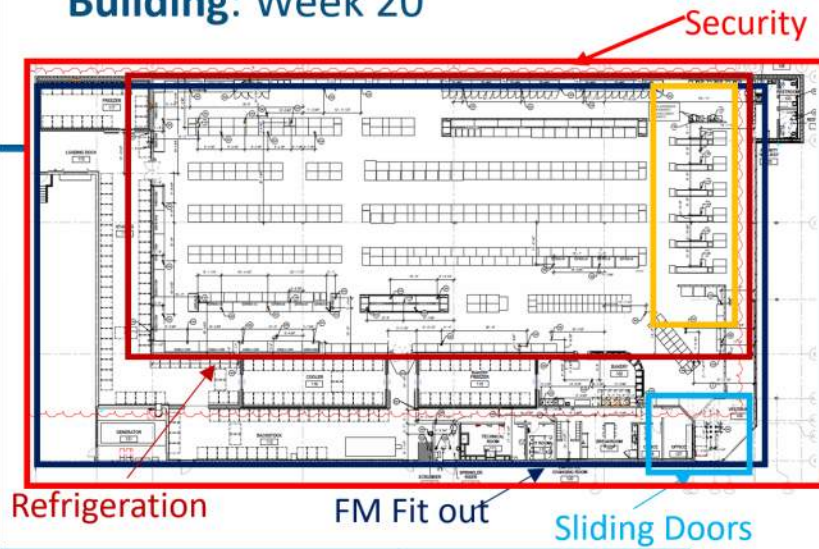

Contractors	Resources	Days
Security	2	5
Sliding doors	3	2
FM Fit Out	6	5
Refrigeration	4	5
Electrician	2	2

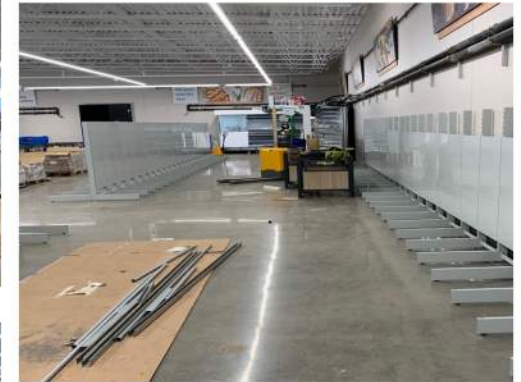


Path to Growth.
adapt. perform. succeed.



CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)


Building: Week 21

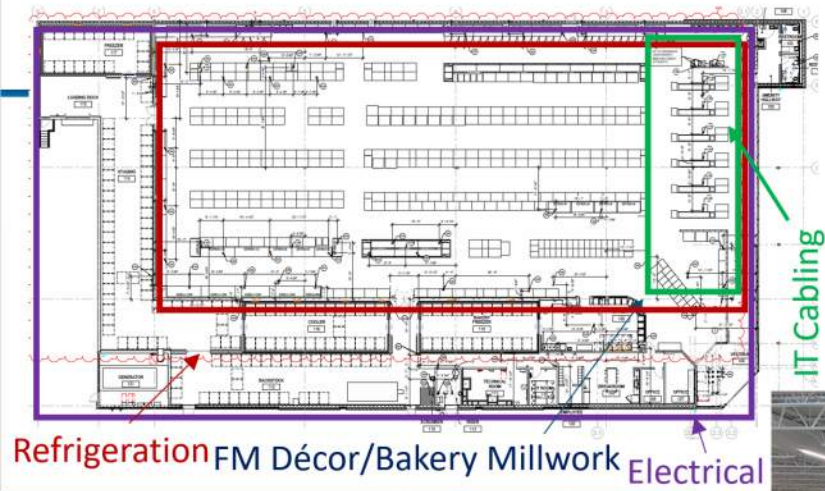

Contractors	Resources	Days
Mechanical/BMS	2	2
Electrician	2	3
IT Cabling	2	2
FM Fit Out	6	5
Refrigeration	2	3
Finishers	2	4

CONSTRUCTION PROGRESS (GROUND UP PROTOTYPE SAMPLE)

Building: Week 22

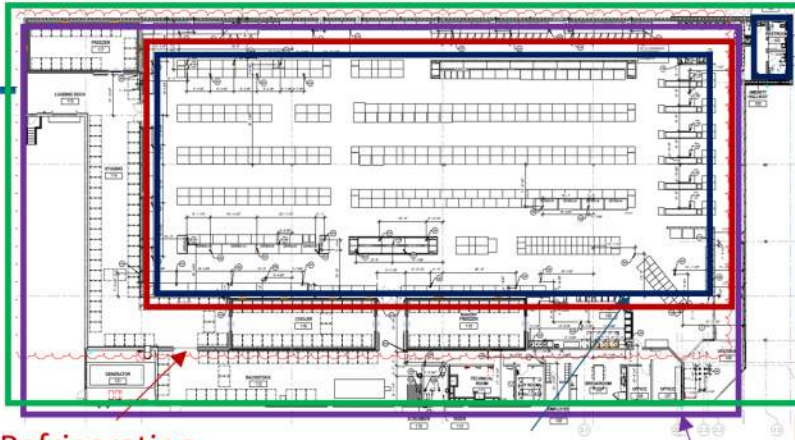

Refrigeration

IT Fit out

Contractors	Resources	Days
IT Fit Out	2	3
GC Final Terminations/ Final inspections/ Final Clean/ Punch work	4-10	4
FM Fit Out	3	3
Refrigeration	4	3



CHANGE ORDER


Change orders submitted to Lidl must be comprehensive as provided in the contract. The change orders should have following.

- Complete and signed change order Exhibit F
- General Contractor change order memo
- Change order payment milestone update, if applicable.
- Revised Drawings compared with the bid drawings.
- Subcontractor backup with breakdown of labor (labor type and hours) and material (material quotes)
- Direction to proceed from the owner with supporting document such as AHJ requested changes, drawing updates, consultant changes etc.
- Pictures and markup of the location on the plan.
- Sheet with contractually agreed unit price.
- Credits
- Any correspondence to justify the change order

Complete change orders with all the backup will have less changes or back and forth.

A sample of a complete change order is provided on the appendix.

The change order can only be billed once it is approved 100% in Projectmates.

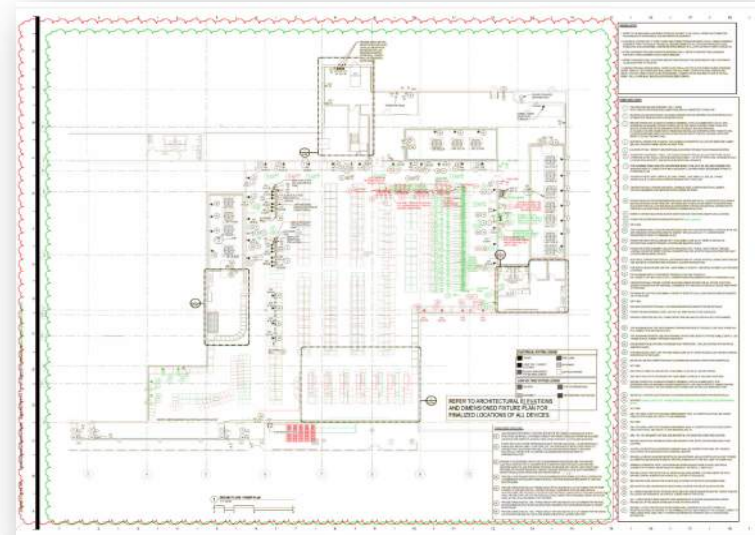

Change order backup showing overlay of changes (red old, green new)

EXHIBIT F
Change Order

PROJECT NAME: _____ DATE OF AGREEMENT: _____

OWNER: _____ CONTRACTOR: _____

DATE OF THIS CHANGE ORDER: _____ CHANGE ORDER NUMBER: _____

The Agreement between Owner and Contractor (the "Agreement") is changed as follows (include a specific and detailed description of the change in the Agreement, including, where applicable, references to relevant paragraphs in the original Agreement, specific pages of the Contract Documents, or relevant sections of the Drawings and Specifications):

The Contract Time is hereby [increased] [decreased] by the following number of calendar days: _____

The Contractor hereby waives and releases any claim it may have against the Owner for any adjustment in the Contract Time resulting from, or related to, the change reflected in this Change Order, except as agreed to above.

The Contract Sum is hereby [increased] [decreased] by \$: _____

The Contractor hereby waives and releases any claim it may have against the Owner for any adjustment in the Contract Sum arising out of, or related to, the changes reflected in this Change Order, including, but not limited to, any claim for damages due to delay, disruption, hindrance, impact, interference, inefficiencies or extra work arising out of, resulting from, or related to, the change reflected in this Change Order, except as agreed to above.

Original Contract Sum: _____

Net Change by Previous Change Orders: _____

Contract Sum before this Change Order: _____

[Increase] [Decrease] in this Change Order: _____

Contract Sum, as adjusted by this Change Order: _____

Substantial Completion Date, as adjusted previously: _____

[Increase] [Decrease] in Contract Time: _____

New Substantial Completion Date: _____

Upon execution of this Change Order by Owner and Contractor, the above-referenced change shall become a valid and binding part of the original Agreement without exception, unless noted in this Change Order. Any language in proposals or other documents attached hereto that conflict with the terms contained herein is null and void.

Owner: _____ Contractor: _____

By: _____ By: _____ By: _____

Name: _____ Name: _____ Name: _____

Title: _____ Title: _____ Title: _____

Sample of change order exhibit sheet



Once the General Contractor is ready to invoice for the completed work, there are two steps to submit for the payment.

1. **Projectmates Approval:** Projectmates pay application tab is filled out along with line items that make up the milestone total. Once completed, the General Contractor initiates the workflow to begin the invoice approval.

The construction managers might have some question or discrepancy on the milestone billed. After the Construction Mangers are satisfied with the package, the pay application is will be approved in Projectmates.

2. Easy Invoices: The Projectmates Pay Application approval is utilized to submit invoice package at ***invoices-us@lidl.us***. Following documentation is required to ensure complete requisition packet.
 - a. Projectmates Invoice Approval showing JTD payment, total contract value
 - b. Payment Milestone
 - c. Pages from the contract agreement
 - d. Pictures of milestone billing
 - e. Lien Waiver (Exhibit C)
 - f. General Contractor Affidavit (Exhibit E)
 - g. Any information pertinent milestone payment draw.

FINAL LIENS FOR PAYMENT

In addition to the closeout document, which will be discussed later, the General Contractors must submit release of liens (ROL) with each pay application. Lien Waiver is part of Exhibit C. For the final invoice and retention release, General Contractor must submit final release of lien.

EXHIBIT C Interim Lien Waiver WAIVER AND RELEASE OF LIENS UPON PROGRESS PAYMENT	
OWNER: _____ GENERAL CONTRACTOR: _____ PROJECT NAME: _____	
STATE OF _____ COUNTY OF _____	
The undersigned, in consideration of the sum of \$ _____, lawfully waives and releases its time and right to claim a lien for labor, services, or materials furnished through _____ (date of this waiver) to _____ on the job of _____ to the following property: _____ (Name and Address of Property). This waiver and release does not provide any retention in labor, services or materials furnished after the date specified. Any and all contracts, subcontractors, leases, covenants and restrictions that have not provided labor, material or services to the undersigned for use or incorporation into the construction of the improvements to the Property have been paid and satisfied in full, and there are no outstanding claims of any character arising out of, or related to, the undersigned's activities on, or improvements to, the Property. This Waiver constitutes a representation by the undersigned signatory, for and on behalf of the first or company listed below, that the payment referenced above, once received, constitutes full and complete payment for all work performed, and all sums or expenses incurred (including, but not limited to, costs of the superintendent, field office overhead, home office overhead, interest on capital, profit, and general conditions costs) relative to the work or improvements at the Property, as of the date of this Waiver, except for the payment of retainage. The undersigned hereby specifically waives, quitsclaims and releases any claim for damages due to delay, indeliberate, interference, noncompletion, insufficiency or omissions, or any other claims of any kind it may have against the Owner and its lender, the Owner's project and/or development manager (if any), the General Contractor (if this Waiver is signed by a subcontractor or supplier), or any other person or entity with a legal or equitable interest in the Property, as of the date of this Waiver, except as follows: _____ This Waiver is specifically made for the benefit of the Owner and the Owner's lender; and any other person or entity with a legal or equitable interest in the Property. The amount of money now being due and owing in the immediately preceding Waiver dated _____, 20____, has been received, and is deemed paid in full. (SIGNATURE ON NEXT PAGE)	
C-3	

Sample of Interim Lien waiver

[illegible]

Sample of General Contractor Affidavit

COMMISSIONING

Commissioning is process under which all of the installed equipment in the facility performs under Lidl's operational need.

Following areas are covered under commissioning

- HVAC systems
- Controls system & BMS
- Lighting
- Metering
- Generator.

During the (FPT and BMS FPT) commissioning it is mandatory for following subcontractor to be present for full 2 days. The commissioning is recommended to start at the earliest hour possible for other subcontractors to complete any deficiency.

- Mechanical
- Electrical
- Controls
- Emerson
- Commissioning Agent

The General Contractor are required to schedule commissioning with Lidl designated commissioning agent. Currently, Melink represents Lidl to conduct commissioning. Service offered under Melink are as followings


- 1 Pre-FPT Call
- 1 FPT Site Visit
- 1 Pre-BMS FPT Call
- 1 BMS FPT Site Visit.

Scheduling of the site visit with Emerson and Melink must happen with 7 days advance notice. Site not ready or short notice cancellation might incur fees and additional charges. General Contractor should reach out to Lidl Construction manager and Melink @ lidl@melinkcorp.com to schedule the commissioning.



Examples of issues discovered during commissioning

- Incorrect leaving air temperature set points (11)
- Valve commands being wrong 0% or 100% (9)
- Outside air Damper commands (15)
- Controlling sensors like RH and CO2 (12)
- Fan status/commands (5)
- Space temperatures
- Heating/Cooling Modes (14)
- Input Values (14)
- Device operation
- Service access restricted (9)

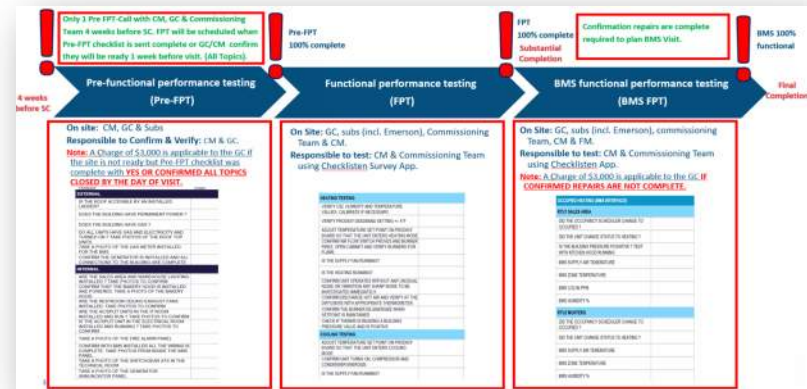

Commissioning process overview

Pre-FPT

Pre-Function Performance Test is a step in commissioning where the commissioning agents, General Contractor, MEP subs, and Controls sub get on a call to verify and ensure everything is ready for the FPT. Below is screen shot of sample pre-FPT call checklist.

Melink
Energy solutions for a brighter tomorrow™

Melink FPT Commissioning Quick Checklist

TO: Capitol Plumbing & Heating, Inc. EMAIL: capitol@melinkcorp.net
 FROM: lidl@melinkcorp.com DATE: 05-10-21
 JOB NAME: 1489 Merrifield ADDRESS: 2901 Galloway Road
 SCHEDULED DATE FOR COMMISSIONING: FPT 5/17-5/18

Commissioning should not be scheduled until all items can be check complete and active. All items should be running 48 hours before CX.

1. The site has permanent utility power.	✓ YES	Completed Date
2. The site has permanent utility gas.	✓ YES	Completed Date
3. All HVAC Roof Top Units are installed and running with power and gas.	✓ YES	Completed Date
4. All HVAC split units are installed and running with power.	✓ YES	Completed Date
5. The Kitchen Exhaust Fan is installed and powered.	✓ YES	Completed Date
6. Centrifugal Ventilation Fan's above walk-ins are installed, ducted and powered.	✓ YES	Completed Date
7. Restroom/Janitor Exhaust Fans are installed and powered.	✓ YES	Completed Date
8. The Emerson BMS panel is installed with power.	✓ YES	Completed Date
9. The Generator is installed and Startup completed.	✓ YES	NA
10. The Electrical Consumption Meter is installed.	✓ YES	Completed Date
11. The Gas Consumption Meter is installed.	✓ YES	Completed Date
12. The IT UPS is installed with power.	✓ YES	Completed Date
13. The Hot Water Heater is installed with power.	✓ YES	5/7/2021
14. All Electrical panels and contactors are installed.	✓ YES	Completed Date
15. All lighting is installed with power.	✓ YES	Completed Date

BY SIGNING, I AUTHORIZE MELINK TO PERFORM THE COMMISSIONING ON THE SCHEDULED DATE ABOVE. PLEASE RETURN THE COMPLETED CHECKLIST TO MELINK CORPORATION: FAX (515) 985-7554 EMAIL: lidl@melinkcorp.com. THIS REQUEST FOR WORK WILL ONLY BE SCHEDULED UPON RECEIPT OF COMPLETED CHECKLIST INDICATING THE SITE IS READY. IF THE SITE IS NOT 100% READY BUT THE SCHEDULED DATE IS STILL DESIRED, PLEASE CONTACT MELINK CORPORATION TO DISCUSS ALTERNATIVES.

Supt or PM Signature: Brian Abel Date: 5.6.2021

NOTE: This checklist must be returned to Melink by the due date requested to prevent a \$500 surcharge for insufficient notice. In the event that the commissioning cannot be completed within the scheduled timeframe due to site conditions or issues with the installed systems, a request to complete the work will be required and additional charges will apply.

FPT- SITE TEST

Following the Pre-FPT, the General Contractor confirm that FPT can take place. All the items discussed during the Pre-FPT must be addressed or have completion date before the commissioning agent schedules the site visit. Failure to not complete the items discussed during the Pre-FPT call might result into rescheduling. Depending on when the notification was provided, there might be additional cost for rescheduling.

A sample FPT form is available in the appendix.

Pre-BMS FPT

Similar to Pre-FPT, the Lidl Construction Manager will schedule calls for the Pre-BMS FPT. During this call, the General Contractor must ensure the all the items are ready and function to complete the BMS FPT.

BMS-FPT SITE TEST

The BMS FPT is 2 day onsite meet where the commissioning agent, and the subcontractor go through the list of the items on the commissioning to ensure everything is functioning as it should.

The site typically happens on the week of final completion.

DEFECTS REMEDIATION:

The deficiency list created by the commissioning agents must be addressed and initialed by the General Contractor or Construction Manager depending on the responsible parties.

HANDOVER

FM- Fit Out Handover:

After the completion of this handover, the fit out team will start the mobilization. The general contractor are reminded it is absolutely necessary to have sales floor polished, and ceilings and walls painted before the mobilization of the fit out team.

IT Handover:

The General Contractor will be handing over to the IT department after completion of the IT cabling. During this process the general contractor will fill out IT handover checklist. IT cabling must be installed by the preferred Lidl IT vendors.

Refrigeration Handover:

After the installation of the refrigeration, the handover to portfolio and sales will be completed using the checklist developed by Procurement department. At the time of this publication, the checklist is still in the works. It will be released as soon as it is published.

Sales and FM- Portfolio Handover:

During the Handover day scheduled by Lidl Construction Manager, there will be multiple walks throughout the course of the day to handover the completion of the store. During this time, the keys of the stores will be handed over to the Facilities Management and Sales by the Construction Team. The punch list items created during these walks must be complete prior to store opening.



PROJECT CLOSEOUT

The General Contractor is to compile accurate documents at the completion of the project as required by the General Contractor Closeout Documents Template. All documents should be handed over to Lidl at the time of Substantial Completion. Any missing information is to be provided by the GC no later than two weeks after construction completion.

Lidl US requires all digital information to be uploaded to Projectmates through the path Documents > Construction > Handover > Closeout Documents. Folders are provided to align with the table of contents.

GC Handover Documents

The documents requested within the General Contractor Closeout Document include but are not limited to warranties, checklists, O&M manuals and as-builts:

Warranty

Warranties are to be provided by the General Contractor, as well as the warranty bond. The warranty bond is required at handover in digital and hard copy. All subcontractors are contractually obligated to provide warranty letters as well.

Checklists

The closeout package ensures that all of the checklists have been completed and documentation provided to the owner. This information is vital for the handover to the portfolio manager; it provides the history of the project in order to manage each store individually. The Final Acceptance Checklist is the final checklist required within the General Contractor Closeout Package. It provides a list of components within the building that are to be signed off by the CM via Projectmates to reflect acceptance of quality.

Operation and Maintenance (O&M) Manuals

O&M Manuals are to be provided for each required piece of equipment. The list of required O&M manuals are included within the prototypical specifications, thus the GC is contractually obligated to provide all documents at time of construction completion. As-builts are to be provided by all trades and the GC is to supply redlined architectural as-built plans.



FINAL ACCEPTANCE PROTOCOL

Store Number, Location

Contact Information

Region	AAA
Development Manager	First Last (###-###-####)
Facility Manager	First Last (###-###-####)
General Contractor	Name Corporation
Project Manager	First Last (###-###-####)

Designers of Record

General Planner	Name Corporation
Architect	First Last (###-###-####)
Mechanical Engineer	First Last (###-###-####)
Electrical Engineer	First Last (###-###-####)
Civil Engineer	Name Corporation
Civil Engineer	First Last (###-###-####)

AHJ

Local Building Inspector	First Last (###-###-####)
Fire Marshall	First Last (###-###-####)



THIS PAGE WAS LEFT INTENTIONALLY BLANK



GENERAL CONTRACTOR PREQUALIFICATION SELF ASSESSMENT

General Contractors Self Assessment PreQualification Form

Date: Company Name: Company Address Website: Primary Contact Name: Primary Contact Phone & Email:	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td style="text-align: center;"><GC to fill></td></tr> <tr><td style="text-align: center;"><GC to fill></td></tr> <tr><td style="text-align: center;"><GC to fill></td></tr> <tr><td style="text-align: center;"><GC to fill></td></tr> <tr><td style="text-align: center;"><GC to fill></td></tr> <tr> <td style="text-align: center;"><GC email></td> <td style="text-align: center;"><GC Phone></td> </tr> </table>	<GC to fill>	<GC to fill>	<GC to fill>	<GC to fill>	<GC to fill>	<GC email>	<GC Phone>																																	
<GC to fill>																																									
<GC to fill>																																									
<GC to fill>																																									
<GC to fill>																																									
<GC to fill>																																									
<GC email>	<GC Phone>																																								
Geographical Location Covered	States Covered <table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr> <tr><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr> </table> Offices <table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr> <tr><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr> </table>																																								
Financials	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 35%;">Revenue in 2019</td> <td style="width: 30%; text-align: center;"><GC to fill></td> <td style="width: 35%; font-size: small;">Lidl requires annual revenue of \$30,000,000 to prequalify</td> </tr> <tr> <td>Projected revenue in 2020</td> <td style="text-align: center;"><GC to fill></td> <td style="font-size: small;">Lidl requires projected revenue of \$30,000,000 to prequalify</td> </tr> <tr> <td>Bonding Capacity (one project)</td> <td style="text-align: center;"><GC to fill></td> <td></td> </tr> <tr> <td>Bonding Capacity (total)</td> <td style="text-align: center;"><GC to fill></td> <td></td> </tr> <tr> <td colspan="3">D&B rating with D&B number </td> </tr> <tr> <td colspan="3">Provide all of the following as a proof for financial standing</td> </tr> <tr> <td colspan="3"> ☐ Third party Audit ☐ Future Pipeline ☐ A305 </td> </tr> </table>	Revenue in 2019	<GC to fill>	Lidl requires annual revenue of \$30,000,000 to prequalify	Projected revenue in 2020	<GC to fill>	Lidl requires projected revenue of \$30,000,000 to prequalify	Bonding Capacity (one project)	<GC to fill>		Bonding Capacity (total)	<GC to fill>		D&B rating with D&B number 			Provide all of the following as a proof for financial standing			☐ Third party Audit ☐ Future Pipeline ☐ A305																					
Revenue in 2019	<GC to fill>	Lidl requires annual revenue of \$30,000,000 to prequalify																																							
Projected revenue in 2020	<GC to fill>	Lidl requires projected revenue of \$30,000,000 to prequalify																																							
Bonding Capacity (one project)	<GC to fill>																																								
Bonding Capacity (total)	<GC to fill>																																								
D&B rating with D&B number 																																									
Provide all of the following as a proof for financial standing																																									
☐ Third party Audit ☐ Future Pipeline ☐ A305																																									
Capacity	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 35%;">Company workforce</td> <td style="width: 30%; text-align: center;"><GC to fill></td> <td style="width: 35%; font-size: small;">Please provide the total number of employees</td> </tr> <tr> <td>Project managers</td> <td style="text-align: center;"><GC to fill></td> <td style="font-size: small;">Please provide the total number of project managers</td> </tr> <tr> <td>Superintendents</td> <td style="text-align: center;"><GC to fill></td> <td style="font-size: small;">Please provide the total number of superintendents</td> </tr> <tr> <td colspan="3">Based on the financials and capacity, do you have ability to work on 5 stores concurrently?</td> </tr> <tr> <td colspan="3"> ☐ Yes ☐ No </td> </tr> </table>	Company workforce	<GC to fill>	Please provide the total number of employees	Project managers	<GC to fill>	Please provide the total number of project managers	Superintendents	<GC to fill>	Please provide the total number of superintendents	Based on the financials and capacity, do you have ability to work on 5 stores concurrently?			☐ Yes ☐ No																											
Company workforce	<GC to fill>	Please provide the total number of employees																																							
Project managers	<GC to fill>	Please provide the total number of project managers																																							
Superintendents	<GC to fill>	Please provide the total number of superintendents																																							
Based on the financials and capacity, do you have ability to work on 5 stores concurrently?																																									
☐ Yes ☐ No																																									
Safety	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 35%;">EMR rate in 2018</td> <td style="width: 30%; text-align: center;"><GC to fill></td> <td style="width: 35%; font-size: small;">Lidl requires EMR to be lower the .83 to qualify</td> </tr> <tr> <td>EMR rate in 2019</td> <td style="text-align: center;"><GC to fill></td> <td style="font-size: small;">Lidl requires EMR to be lower the .83 to qualify</td> </tr> <tr> <td colspan="3">Provide following as a proof for safety record</td> </tr> <tr> <td colspan="3"> ☐ Letter from insurance showing history of EMRs </td> </tr> </table>	EMR rate in 2018	<GC to fill>	Lidl requires EMR to be lower the .83 to qualify	EMR rate in 2019	<GC to fill>	Lidl requires EMR to be lower the .83 to qualify	Provide following as a proof for safety record			☐ Letter from insurance showing history of EMRs																														
EMR rate in 2018	<GC to fill>	Lidl requires EMR to be lower the .83 to qualify																																							
EMR rate in 2019	<GC to fill>	Lidl requires EMR to be lower the .83 to qualify																																							
Provide following as a proof for safety record																																									
☐ Letter from insurance showing history of EMRs																																									
Experience	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 35%;">Retail Experience</td> <td style="width: 30%;"> ☐ YES ☐ NO </td> <td style="width: 35%;"></td> </tr> <tr> <td>In roll out</td> <td> ☐ YES ☐ NO </td> <td></td> </tr> <tr> <td colspan="3">Provide following as a proof Experience</td> </tr> <tr> <td colspan="3"> ☐ Pictures of grocery stores under construction ☐ List of Grocery stores construction in last 5 years </td> </tr> </table>	Retail Experience	☐ YES ☐ NO		In roll out	☐ YES ☐ NO		Provide following as a proof Experience			☐ Pictures of grocery stores under construction ☐ List of Grocery stores construction in last 5 years																														
Retail Experience	☐ YES ☐ NO																																								
In roll out	☐ YES ☐ NO																																								
Provide following as a proof Experience																																									
☐ Pictures of grocery stores under construction ☐ List of Grocery stores construction in last 5 years																																									

BID BREAKDOWN AND MILESTONE PAYMENT

		BID BREAKDOWN						
				General Contractor:				
				Store Name:				
				Date:				
				Store Type:				
IMS Classification	WBS code	Division/ Section	Description	Quantity	Unit	Unit price	Total	
1			General Conditions				\$0.00	
		1.1	Administrative Requirements				\$0.00	
Building	2-2-01	1.1.a	Communication & IT	1.00	LS	\$0.00	\$0.00	
Building	2-2-01	1.1.b	Management Personnel	1.00	HR	\$0.00	\$0.00	
Building	2-2-01	1.1.c	General Field Personnel	1.00	HR	\$0.00	\$0.00	
Building	2-2-01	1.1.d	Temporary Lodging	1.00	LS	\$0.00	\$0.00	
		1.2	Temporary Utilities				\$0.00	
Building	2-2-01	1.2.a	Temporary Power Supply	1.00	LS	\$0.00	\$0.00	
Building	2-2-01	1.2.b	Temporary Water Supply	1.00	LS	\$0.00	\$0.00	
Building	2-2-01	1.2.c	Temporary Heating and Cooling	1.00	LS	\$0.00	\$0.00	
Building	2-2-01	1.2.d	Temporary Enclosures/Partitions	1.00	LS	\$0.00	\$0.00	
Building	2-2-01	1.2.e	Temporary Fire Protection	1.00	LS	\$0.00	\$0.00	
		1.3	Temporary Construction Facilities and Site Setup				\$0.00	
Building	2-2-01	1.3.a	Field Office Set-up	1.00	LS	\$0.00	\$0.00	
Building	2-2-01	1.3.b	Temporary Safety fences	1.00	LF	\$0.00	\$0.00	
Building	2-2-01	1.3.c	Storage and Warehousing	1.00	LS	\$0.00	\$0.00	
Building	2-2-01	1.3.d	Tools and Equipment	1.00	LS	\$0.00	\$0.00	
		1.6	Miscellaneous				\$0.00	
Building	2-2-01	1.6.a	Cleaning work during construction	1.00	EA	\$0.00	\$0.00	
Building	2-2-01	1.6.b	2 run interior + exterior cleanings prior to handover and opening	1.00	EA	\$0.00	\$0.00	
Building	2-2-01	1.7	Warranty Bond	1.00	EA	\$0.00	\$0.00	
2			Existing Conditions				\$0.00	
Site	1-7-01	2.1	Building and Site Demolition	1.00	SF	\$0.00	\$0.00	
Site	1-7-02	2.2	Hazardous Building Material decontamination	1.00	CY	\$0.00	\$0.00	
Site	1-7-03	2.3	Contaminated Soil Material Removal	1.00	CY	\$0.00	\$0.00	
Building	2-2-15	2.4	Demolition to renovate	1.00	LS	\$0.00	\$0.00	
3			Concrete				\$0.00	
		3.1	Cast-in-Place Structural Concrete				\$0.00	
Building	2-2-02	3.1.a	Cast-in-Place Structural Concrete: footings	1.00	CY	\$0.00	\$0.00	
Building	2-2-02	3.1.b	Cast-in-Place Structural Concrete: foundation walls / stem walls	1.00	CY	\$0.00	\$0.00	
		3.2	Slab on Grade				\$0.00	
Building	2-2-02	3.2.a	Concrete supply and place	1.00	SF	\$0.00	\$0.00	
Building	2-2-02	3.2.b	Insulation supply and place	1.00	SF	\$0.00	\$0.00	
Building	2-2-02	3.2.c	Concrete Finishing/Polishing	1.00	SF	\$0.00	\$0.00	
Building	2-2-02	3.2.d	Sawcutting	1.00	LF	\$0.00	\$0.00	
Building - Survey	2-4-01	3.4	Surveys (Field Engineering/Layout/Existing conditions)	1.00	LS	\$0.00	\$0.00	
4			Masonry				\$0.00	
		4.1	Concrete Unit Masonry				\$0.00	
Building	2-2-03	4.1.a	CMU Exterior Walls	1.00	SF	\$0.00	\$0.00	
Building	2-2-03	4.1.b	CMU Interior Wall	1.00	SF	\$0.00	\$0.00	
Building	2-2-03	4.1.c	left blank do not use				\$0.00	
		4.2	Masonry brick veneer				\$0.00	
Building	2-2-03	4.2.a	Supply of bricks	1.00	SF	\$0.00	\$0.00	
Building	2-2-03	4.2.b	Supply of faux stone	1.00	SF	\$0.00	\$0.00	
Building	2-2-03	4.2.c	Related installation costs	1.00	SF	\$0.00	\$0.00	
Building	2-2-03	4.2.d	left blank do not use				\$0.00	
Building	2-2-03	4.2.e	left blank do not use				\$0.00	
Building	2-2-03	4.3	left blank do not use	1.00	SF	\$0.00	\$0.00	
5			Metals				\$0.00	
		5.1	Structural Steel				\$0.00	
Building	2-2-04	5.1.a	Structural Beams and Columns	1.00	TN	\$0.00	\$0.00	
Building	2-2-04	5.1.b	Miscellaneous Structural Steel	1.00	TN	\$0.00	\$0.00	
		5.2	Roof Decking				\$0.00	
Building	2-2-04	5.2.a	Metal joists and Deck	1.00	LS	\$0.00	\$0.00	
Building	2-2-04	5.2.b	Labor for the roof decking installation	1.00	LS	\$0.00	\$0.00	
		5.3	Miscellaneous Metals				\$0.00	
Building	2-2-04	5.3.a	Handrails	1.00	LF	\$0.00	\$0.00	
Building	2-2-04	5.3.b	Interior bollards (types galvanized and stainless steel)	1.00	EA	\$0.00	\$0.00	
Building	2-2-04	5.3.c	Exterior bollards	1.00	EA	\$0.00	\$0.00	
Building	2-2-04	5.3.d	Roof ladder	1.00	EA	\$0.00	\$0.00	

Building	2-2-04	5.3.e	Cart rails	1.00	LF	\$0.00	\$0.00
Building	2-2-04	5.3.f	Security Fence	1.00	LF	\$0.00	\$0.00
Building	2-2-04	5.3.g	Ram protection	1.00	LF	\$0.00	\$0.00
Building	2-2-04	5.3.h	Stonewood finish (Supply and Install)	1.00	EA	\$0.00	\$0.00
6			Woods, plastics and composites				\$0.00
		6.1	Millwork				\$0.00
Building	2-2-05	6.1.a	Break room and office furniture	1.00	EA	\$0.00	\$0.00
Building	2-2-05	6.1.b	Other furniture	1.00	LS	\$0.00	\$0.00
Building	2-2-05	6.1.c	Restroom Partition	1.00	SF	\$0.00	\$0.00
		6.2	Rough Carpentry				\$0.00
Building	2-2-05	6.2.a	Miscellaneous	1.00	LS	\$0.00	\$0.00
7			Thermal and Moisture Protection				\$0.00
		7.1	Roofing				\$0.00
Building	2-2-06	7.1.a	Insulation, TPO membrane, and Vapor barrier	1.00	SF	\$0.00	\$0.00
Building	2-2-06	7.1.b	Gutters/drains/downspouts	1.00	LF	\$0.00	\$0.00
Building	2-2-06	7.1.c	Soffits/canopies	1.00	SF	\$0.00	\$0.00
Building	2-2-06	7.1.d	Roof parapet system	1.00	SF	\$0.00	\$0.00
8			Openings				\$0.00
		8.1	Aluminum Systems				\$0.00
Building	2-2-07	8.1.a	Supply of Aluminum Curtainwall system	1.00	SF	\$0.00	\$0.00
Building	2-2-07	8.1.b	Supply of Aluminum Storefront	1.00	SF	\$0.00	\$0.00
Building	2-2-07	8.1.c	Supply of Aluminum Window	1.00	LS	\$0.00	\$0.00
Building	2-2-07	8.1.d	All related installation costs	1.00	LS	\$0.00	\$0.00
		8.2	Doors				\$0.00
Building	2-2-07	8.2.a	Doors + frames + hardware	1.00	LS	\$0.00	\$0.00
Building	2-2-07	8.2.b	Overhead loading zone delivery doors	1.00	EA	\$0.00	\$0.00
Building	2-2-07	8.2.c	Vestibule Glass Doors	1.00	EA	\$0.00	\$0.00
9			Finishes				\$0.00
Building	2-2-08	9.1	Plaster and Gypsum Board	1.00	SF	\$0.00	\$0.00
		9.2	Tiling				\$0.00
Building	2-2-08	9.2.a	Floor and wall tiling	1.00	SF	\$0.00	\$0.00
Building	2-2-08	9.2.b	FRP Tiles	1.00	SF	\$0.00	\$0.00
		9.3	Acoustic ceilings				\$0.00
Building	2-2-08	9.3.a	Bakery	1.00	SF	\$0.00	\$0.00
Building	2-2-08	9.3.b	Employees area	1.00	SF	\$0.00	\$0.00
Building	2-2-08	9.4	Painting and Coating	1.00	SF	\$0.00	\$0.00
Building	2-2-08	9.5	Flooring epoxy	1.00	SF	\$0.00	\$0.00
10			Specialties				\$0.00
Procurement	3-3-02	10.1	Bathroom accessories	1.00	EA	\$0.00	\$0.00
Procurement	3-3-02	10.2	Fire extinguishers and code required signages	1.00	LS	\$0.00	\$0.00
Procurement	3-3-02	10.3	Loading dock equipment (leveler, shelter)	1.00	LS	\$0.00	\$0.00
		10.4	left blank do not use	0.00	SF	\$0.00	\$0.00
11			Equipments				\$1,000.00
		11.1	Refrigeration				\$1,000.00
Procurement	3-3-05	11.1.a	Furnish and Install Cold Room and Freezers	1.00	LS	\$1,000.00	\$1,000.00
Procurement	3-3-05	11.1.b	Furnish and Install Sales area Refrigeration	1.00	LS	\$0.00	\$0.00
		11.1.c	left blank do not use	0.00	SF	\$0.00	\$0.00
			left blank do not use				\$0.00
			left blank do not use				\$0.00
			left blank do not use	0.00	SF	\$0.00	\$0.00
14			Conveying Systems				\$0.00
Building	2-2-09	14.1	Elevators	1.00	EA	\$0.00	\$0.00
Building	2-2-09	14.2	Escalators	1.00	EA	\$0.00	\$0.00
21			Fire protection				\$0.00
Building	2-2-10	21.1	Sprinkler piping and heads	1.00	LF	\$0.00	\$0.00
Building	2-2-10	21.2	Fire Pumps	1.00	EA	\$0.00	\$0.00
22			Plumbing				\$0.00
Building	2-2-11	22.1	Domestic Water Piping	1.00	LF	\$0.00	\$0.00
Building	2-2-11	22.2	Sanitary Waste and Vent Piping	1.00	LF	\$0.00	\$0.00
Building	2-2-11	22.3	Plumbing Equipment and Fixtures	1.00	LS	\$0.00	\$0.00
23			Mechanical				\$0.00
Building	2-2-12	23.1	Bakery Hood	1.00	EA	\$0.00	\$0.00
Building	2-2-12	23.2	Rooftop Units and AC Units	1.00	LS	\$0.00	\$0.00
Building	2-2-12	23.3	Air distribution and accessories	1.00	EA	\$0.00	\$0.00
Building	2-2-12	23.4	Testing and Commissioning	1.00	EA	\$0.00	\$0.00

26			Electrical				\$1,100.00
		26.1	Main Distribution				\$0.00
Building	2-2-13	26.1.a	Power Feed	1.00	LS	\$0.00	\$0.00
Building	2-2-13	26.1.b	Modular Panels	1.00	EA	\$0.00	\$0.00
		26.2	Branch distribution				\$0.00
Building	2-2-13	26.2.a	Infrastructure	1.00	LS	\$0.00	\$0.00
Building	2-2-13	26.2.b	Cabling	1.00	LF	\$0.00	\$0.00
Building	2-2-13	26.4	BMS	1.00	EA	\$0.00	\$0.00
		26.5	Interior/Building Light Fixtures				\$0.00
Building	2-2-13	26.5.a	Supply of Interior/Building lighting package	1.00	LS	\$0.00	\$0.00
Building	2-2-13	26.5.b	All related installation labor costs	1.00	LS	\$0.00	\$0.00
		26.6	Security				\$1,000.00
Procurement	3-3-01	26.6.a	CCTV	1.00	EA	\$1,000.00	\$1,000.00
Procurement	3-3-01	26.6.b	Access Control & Intruder System	0.00	EA	\$0.00	\$0.00
Building	2-2-13	26.7	Testing and Commissioning	1.00	EA	\$0.00	\$0.00
Building	2-2-13	26.8	Sunshades	1.00	EA	\$0.00	\$0.00
		26.9	Generator				\$0.00
Procurement	3-3-03	26.9.a	supply of Generator	1.00	EA	\$0.00	\$0.00
Procurement	3-3-03	26.9.b	All related installation labor costs	1.00	EA	\$0.00	\$0.00
		26.10	IT Cabling				\$100.00
Procurement	3-3-01	26.10.a	IT Cabling Install	1.00	EA	\$100.00	\$100.00
Procurement	3-3-01	26.10.b	IT Cabling Procurement	1.00	EA	\$0.00	\$0.00
28			Fire Alarm				\$0.00
Building	2-2-14	28.1	Fire Alarm Panels	1.00	LS	\$0.00	\$0.00
31			Earthwork				\$0.00
Site	1-7-04	31.1	Clearing and Grubbing	1.00	AC	\$0.00	\$0.00
Externals - Other	7-3-01	31.2	Erosion and Sediment control	1.00	LS	\$0.00	\$0.00
Externals - Other	7-3-01	31.3	Grading	1.00	CY	\$0.00	\$0.00
Externals - Other	7-3-01	31.4	Soil Import/Fill	1.00	CY	\$0.00	\$0.00
Externals - Other	7-3-01	31.6	Soil Export	1.00	CY	\$0.00	\$0.00
Externals - Other	7-3-01	31.5	Special foundations	1.00	LS	\$0.00	\$0.00
Externals - Other	7-3-01	31.7	Unsuitable Soil	1.00	CY	\$0.00	\$0.00
Externals - Other	7-3-01	32.5	Retaining Walls	1.00	SF	\$0.00	\$0.00
32			Exterior Improvements				\$0.00
		32.1	Asphalt Paving				\$0.00
Externals - Paved	7-1-01	32.1.a	Aggregate base	1.00	SY	\$0.00	\$0.00
Externals - Paved	7-1-01	32.1.b	Base Layer	1.00	SY	\$0.00	\$0.00
Externals - Paved	7-1-01	32.1.c	Surface Layer	1.00	SY	\$0.00	\$0.00
		32.2	Cast-in Place Exterior Concrete				\$0.00
Externals - Paved	7-1-02	32.2.a	Concrete supply and place: Ramp + dedicated retaining wall	1.00	CY	\$0.00	\$0.00
Externals - Paved	7-1-02	32.2.b	Concrete supply and place: Exterior Sidewalks	1.00	SF	\$0.00	\$0.00
Externals - Paved	7-1-02	32.2.c	Curbs and gutters	1.00	SF	\$0.00	\$0.00
Externals - Landscape	7-2-02	32.4	Fences	1.00	LF	\$0.00	\$0.00
Externals - Landscape	7-2-01	32.6	Plantings	1.00	SF	\$0.00	\$0.00
		32.7	Asphalt Stripping				\$0.00
Externals - Paved	7-1-03	32.7.a	Stripping	1.00	LF	\$0.00	\$0.00
Externals - Paved	7-1-03	32.7.b	Signage	1.00	EA	\$0.00	\$0.00
		32.8	Monument Signage (installed on building and Entrance)				\$0.00
Procurement	3-3-04	32.8.a	Monument Signage (installed on building and Entrance)	1.00	EA	\$0.00	\$0.00
Externals - Paved	7-1-04	32.8.b	Monument Signage	1.00	EA	\$0.00	\$0.00
		32.9	Exterior/Parking Light Fixtures				\$0.00
Externals - Paved	7-1-05	32.9.a	supply of Light poles and fixtures	1.00	EA	\$0.00	\$0.00
Externals - Paved	7-1-05	32.9.b	All related installation labor costs	1.00	EA	\$0.00	\$0.00
33							\$0.00
		33.1	Water Utilities				\$0.00
Externals - Other	7-3-02	33.1.a	Water main piping, including fittings	1.00	LF	\$0.00	\$0.00
Externals - Other	7-3-02	33.1.b	Fire hydrant	1.00	EA	\$0.00	\$0.00
Externals - Other	7-3-02	33.1.c	Connection to existing water main, including restoration	1.00	EA	\$0.00	\$0.00
		33.2	Sanitary Sewer Utilities				\$0.00
Externals - Other	7-3-02	33.2.a	piping, including fittings	1.00	LF	\$0.00	\$0.00
Externals - Other	7-3-02	33.2.b	manhole and cleanouts	1.00	EA	\$0.00	\$0.00
Externals - Other	7-3-02	33.2.c	Pump station	1.00	EA	\$0.00	\$0.00
Externals - Other	7-3-02	33.2.d	Connection to existing system	1.00	EA	\$0.00	\$0.00
		33.3	Storm Sewer Utilities				\$0.00
Externals - Other	7-3-03	33.3.a	Storm sewer	1.00	LF	\$0.00	\$0.00
Externals - Other	7-3-03	33.3.b	Manhole and cleanouts	1.00	EA	\$0.00	\$0.00
Externals - Other	7-3-03	33.4	Storm water management Tanks/Retention/Facilities	1.00	EA	\$0.00	\$0.00

SCOPE CLARIFICATION

SCOPE CONFIRMATION



Store Name: _____
 Regional Office: _____
 Construction Manager: _____

Description	Included	Notes
1.0 General Conditions		
Regular cleaning during construction including dumpsters.		
2 full interior + exterior cleanings prior to CO/handover to FM and Grand Opening.		
Temporary construction safety fence.		
Printing of project plans/exhibits.		
Temporary heating/cooling in order to ensure proper temperature for slab curing. (if applicable)		
Temporary enclosures in conjunction with heating/cooling to ensure a proper slab curing.		
Warranty Bond per contractual requirements.		
Has staging/storage of materials been contemplated? No replacement/reimbursement due to thefts and/or negligence will be provided.		
Has union labor rates to be considered? (If applicable)		
Has all Lidl checklists (see bid document list) been reviewed and understood? These are Important coordination and documentation tools that will be discussed with Lidl DM throughout construction.		
Uploading of weekly progress pictures to internal project management platform (Projectmates).		
2.0 Existing Conditions		
Has existing site conditions been contemplated in bid?		
3.0 Concrete		
Pre-pour meeting with Lidl DM on site is mandatory in order to validate methodology and agenda at least 4 weeks prior to slab pour (sequence of pouring, building enclosure status, saw cuts/cracks location, polishing process, quality expectations, cure time etc.)		
Does the concrete subcontractor have previous experience with Lidl?		
4.0 Masonry		
Pricing solicited from Lidl national account vendor?		
5.0 Metals		
Pricing solicited from Lidl national account vendor?		
6.0 Woods, plastics and composites		
7.0 Thermal and Moisture Protection		
Roof membrane glued versus mechanically fastened. Does installation agree with manufacturer warranties?		
8.0 Openings		
Pricing for storefront components solicited from Lidl national account vendor?		

Pre-painted door frames.		
9.0 Finishes		
Soffit material pricing solicited from Lidl national account vendor?		
10.0 Specialties		
21.0 Fire protection		
22.0 Plumbing		
Two cameras reports to be provided (one prior to pouring the slab, one before handover).		
23.0 Mechanical		
Has all components of BMS system been contemplated?		
26.0 Electrical		
Positioning of external light poles to be adjusted/centered in the landscape isles. (if applicable)		
Supply costs of referenced BMS solicited from national account vendor.		
Supply costs of referenced interior lighting package solicited from national account vendor.		
Supply costs of referenced exterior lighting package and solicited from national account vendor.		
Sunshades to be exclude if building oriented to the North.		
Supply costs solicited from national account vendor.		
28.0 Fire Alarm		
31.0 Earthwork		
Add-alternate for unclassified earthwork provided.		
32.0 Exterior Improvements		
Monument Sign package is included?		
Seed/Sod scheduled so that lawn is fully vegetated and healthy at time of handover.		
Add alternate pricing to include Irrigation as a design and built option Provided.		
33.0 Utilities		
99.0 Offsite Improvements		

TECHNICAL MEETING TEMPLATE



Document type	Meeting minute
Subject	
Company	
Date	
Place of meeting	3500 S Clark St, Arlington, VA, 22202
Referral docs	
Store #	
Store address	
Regional office	

General Contractor (GC) award for the \$_____ construction store in:

Between the company: LIDL US, LLC

- hereinafter referred to as **Client** -

and the contractor: _____

- hereinafter referred to as **Contractor** -

Participant Name	Company
	LIDL US, LLC
	LIDL US, LLC

Attachments:

Contractor's bid date: _____

Client's updated plans (*mention sheet number and detail if necessary*):

The significant aspects of the updated Plans and Specifications have been presented to the Contractor, and the updated Plans and Specifications dated _____ have been submitted to the Contractor, in their entirety, for the purpose if revisiting the bid.

[illegible]

Contractor's RFI send to Client on:	
Client's answers send to RFI send to Contractor on:	

[illegible]

2



1.3 Client's queries regarding the Contractor's bid

Remarks:

1.4 Other agreements:

1.4.1 The Contractor hereby states that they shall revise their bid dated _____ with due regard to the statements and agreements stipulated in the present minutes of negotiations, the updated Plans and Specifications dated _____ and the documents submitted. Resubmission of bid should make by _____

1.4.2 In a further round of negotiations, the parties will negotiate in good faith to reach agreement on any open financial points.

Other remarks:

In the event that the contract award is issued the General Contractor, the present minutes of negotiations, including the documents submitted and annexes _____ will become part of the construction contract; provided, that, these minutes of negotiations do not constitute different or additional terms to the contract unless specifically incorporated into the contract in accordance with its terms.

Client's Representative name:	Date	Contractor's Representative name:	Date
Full Name:		Full Name:	
Signature:		Signature:	

COMMERCIAL MEETING TEMPLATE



Document type	Meeting minute
Subject	Commercial meeting
Company	
Date	
Place of meeting	3500 S Clark St, Arlington, VA, 22202
Referral docs	
Store #	
Store address	
Regional office	

General Contractor (GC) award for the \$_____ construction store in:

Between the company: LIDL US, LLC

- hereinafter referred to as **Client** -

and the contractor: _____

- hereinafter referred to as **Contractor** -

Participant Name	Company
	LIDL US, LLC
	LIDL US, LLC

The following form the basis of the minutes of negotiations:

Contractor's revised bid dates:	
Technical meeting dated:	
AIA contract including annexes ("the Contract")	

Client's updated plans (*mention sheet number and detail if necessary*):

Remarks:

[illegible]

Remarks:

This image shows a single sheet of white paper with horizontal blue or grey ruling lines. The lines are evenly spaced and run across the width of the page. There are no margins, text, or other markings on the paper.



1.3 Clarification of the basic financial conditions

1.3.1 Scope of work

Scope of work pursuant to the Plans and Specifications of: _____

Supplemented by:

Established prices:

Contaminated soil with _____ agents	Quantity less then _____ CY	Price \$/CY _____
Contaminated soil with _____ agents	Quantity more then _____ CY	Price \$/CY _____

Contaminated soil with other agents	Quantity less then _____ CY	GC mark up over subcontractor's price _____ %
Contaminated soil with other agents	Quantity more then _____ CY	GC mark up over subcontractor's price _____ %

National Account (NA) Prices:

The National Account prices are either ratified agreement or based on the quote provided by the vendors working towards ratified agreement. (CM: Please contact HQ for the latest list of the National Account, Ziga Vovk @571-457-6918 or Rosemond Ahiawordor @703-408-1495)

Vendor	Product	Installation included	Price Range/Store		Confirm NA Price
			T-14	T-17	
Insolroll	Blinds	Yes			
Emerson	BMS	No, just startup & Cx			
Captive-Aire	Bakery Hood	Yes			
Trilux	Building lights	No			
Rite-Hite	Loading dock equipment	Yes			
Lennox	RTU 1-6 (no #2), ACs	No, just startup			
Munters	RTU 2	No, just startup			
Schneider	Prefab electrical panels	No, just testing			
TelaId	CCTV, Access Control & Intruder System	Yes			
Caterpillar	Generator	No, just startup			



Bidding documentation

Schuco	Storefront	Yes			
Assa Abloy	Sliding Doors	Yes			
Cook & Boardman	Interior doors (no sliding or loading dock doors)	No			

Additional works (*specify if included/excluded in the Contract Sum*)

Cancelled work (*specify if included/excluded in the Contract Sum*)

The Contractor declares that it has reviewed the bid and has no further misgivings about or objections to the implementation/location of the construction project. The Contractor is well-informed about the local conditions in and around the Site, as contemplated in the contract.

1.3.2 Contractual deadlines and delay liquidated damages, if different from contractual deadlines provided in the Contract

The Contractor agrees to submit a construction schedule (the "Schedule" as defined in the Contract) agreed with the Client's architectural/planning firm by not later then: _____

The deadlines listed below must be included in the Schedule:

Works	Deadline
Start of construction	
Steel erection	
Curtain wall	
Polished concrete	
Substantial completion	
Final Completion	
(Add more as required)	



The aforementioned contractual deadlines are decisive for, and shall form the basis of, the calculation of delay liquidated damages and related time periods in the Contract

1.3.3 Remuneration

The subject of the negotiations is the bid dated _____ and the revised bid dated _____, tender no.: _____.

Checked bid sum, net: \$ _____

Discount: _____ % \$ _____

Amended tender sum, net: \$ _____

Allowances & Additional works	Sum (\$)

Total additional works: \$ _____

Reduced works	Sum (\$)

Total reduced works: : \$ _____

Total: \$ _____



Amended bid sum, net: \$ _____

Discount: _____ % \$ _____

Tender sum, net: \$ _____

Lump sum (Contract Sum): \$ _____

This tender sum (Contract Sum) is unchangeable as a fixed lump sum until Final Completion of the construction project.

A payment plan will be scheduled, according to which lump sums for each construction phase will be agreed (pursuant to the Contract).

The following percentage is agreed as the Contractor mark-up: _____ %

1.3.4 Bidding period

The Contractor hereby declares that its tender dated _____, as revised by these minutes of negotiations with an extended commitment period, is valid until _____

A contract award shall be deemed to be accepted if delivered by Client in writing within the agreed binding period set forth immediately above.

1.3.5 Subcontractor List:

Subcontractor	Trade	Lidl Approval



1.3.6 Other agreements:

Remarks:

In the event that the contract award is issued the General Contractor, the present minutes of negotiations, including the documents submitted and annexes _____ will become part of the Agreement; provided, that, these minutes of negotiations do not constitute different or additional terms to the Agreement unless specifically incorporated into the Agreement in accordance with its terms.

Client's Representative name:	Date	Contractor's Representative name:	Date
Full Name: Signature:		Full Name: Signature:	

PRE-FPT CHECKLIST



Melink FPT Commissioning Quick Checklist

TO: EMAIL:
FROM: lidl@melinkcorp.com DATE:
JOB NAME: ADDRESS:
SCHEDULED DATE FOR COMMISSIONING:

Commissioning should not be scheduled until all items can be check complete and active. All items should be running 48 hours before CX.

1. The site has permanent utility power.	☐	YES		Completed Date
2. The site has permanent utility gas.	☐	YES		Completed Date
3. All HVAC Roof Top Units are installed and running with power and gas.	☐	YES		Completed Date
4. All HVAC split units are installed and running with power.	☐	YES		Completed Date
5. The Kitchen Exhaust Fan is installed and powered.	☐	YES		Completed Date
6. Centrifugal Ventilation Fan's above walk-ins are installed, ducted and powered	☐	YES		Completed Date
7. Restroom/Janitor Exhaust Fans are installed and powered.	☐	YES		Completed Date
8. The Emerson BMS panel is installed with power.	☐	YES		Completed Date
9. The Generator is installed and Startup completed.	☐	YES		Completed Date
10. The Electrical Consumption Meter is installed.	☐	YES		Completed Date
11. The Gas Consumption Meter is installed.	☐	YES		Completed Date
12. The IT UPS is installed with power.	☐	YES		Completed Date
13. The Hot Water Heater is installed with power.	☐	YES		Completed Date
14. All Electrical panels and contactors are installed.	☐	YES		Completed Date
15. All lighting is installed with power.	☐	YES		Completed Date

BY SIGNING, I AUTHORIZE MELINK TO PERFORM THE COMMISSIONING ON THE SCHEDULED DATE ABOVE. PLEASE RETURN THE COMPLETED CHECKLIST TO MELINK CORPORATION: FAX (513) 965-7354 EMAIL: logistics@melinkcorp.com. THIS REQUEST FOR WORK WILL ONLY BE SCHEDULED UPON RECEIPT OF COMPLETED CHECKLIST INDICATING THE SITE IS READY. IF THE SITE IS NOT 100% READY BUT THE SCHEDULED DATE IS STILL DESIRED; PLEASE CONTACT MELINK CORPORATION TO DISCUSS ALTERNATIVES.

Supt or PM Signature:

Date:

NOTE: This checklist must be returned to Melink by the due date requested to prevent a **\$500 surcharge** for insufficient notice. In the event that the commissioning cannot be completed within the scheduled timeframe due to site conditions or issues with the installed systems, a revisit to complete the work will be required and additional charges will apply.



LiDL Proto 4 GC Startup Checklist

Please confirm all items on pages 1 through 4 are complete prior to signing and returning this form to:

gary.bishop@emerson.com

darren.ritch@emerson.com

LiDL Store #: _____

Store Address: _____

Once the BMS panel, sensors, I/O boards, network wiring and terminations are complete; and all RTU and DH units have been started up by their respective factory representatives, Emerson will schedule field service to arrive at the LiDL site for FPT/BMS FPT.

The controls contractor, as hired by the General Contractor (GC) to install the BMS System, must complete the following tasks and responsibilities prior to startup. Refer to the BMS drawings provided by LiDL for details.

Install Control Panels:

☐ Install the main control panel (Part Number 851-4393) containing the following components:

- 318-9014 Generic iPro IPG215D BACnet/Modbus (Qty 1)
- 860-1245 Bxe with Display, Site Supervisor (Qty 1)
- 810-3065 Multiflex 168AO – 16 Input, 8 Relay Out, 4AO (Qty 2)

☐ Connect wires from specified circuit breaker but ****DO NOT ENERGIZE BREAKER IN PANEL.**

☐ Properly ground the main panel.

Install Sensors & Wiring:

☐ Install sensors and transducers at their respective locations as indicated in the BMS drawing package.

- ☐ Install IO wire/cabling between control panels and sensors, transducers and actuators as indicated in the BMS drawing package. Label each IO cable at both ends.
- ☐ Install IO wire/cabling between control panels and alarm terminations for security and fire alarm panels.
- ☐ Terminate sensor, transducer, and actuator IO wiring/cabling at the terminal blocks as indicated in the BMS drawing package.
- ☐ Install IO wire/cabling between condensate pump & leak detection panel as shown in the BMS drawing package.

Install RTU Network Wiring/Cabling

- ☐ Install HVAC RS-485 network cable in a daisy chain fashion between the main control panel and each of the HVAC controllers as indicated in the BMS drawing package.
- ☐ Install and terminate MF88AO board in the unit for Outside Air Control and run network cabling back to Emerson panel. Terminate CO₂, Static, Exhaust Proof, and Outdoor RH sensors.
- ☐ Terminate the HVAC Unit RS-485 cable at the terminal block in the main control panel at one end and at each of the HVAC Units.

Install Mini Splits Controller Network Wiring:

- ☐ Install Mini Split Ethernet network cables between the main control panel and the Mini Split system controller.
- ☐ Connect the Mini Split Ethernet network cables to the BMS network router/switch.

Install Lighting Contactor Panel

- ☐ Install Lighting Contactor Panel and ensure control wiring from the Emerson panel is connected properly. This will be the wire from the Emerson panel lighting relays.

Install Alarm System Status Input Wiring

- ☐ Install IO cable between the control panel and the burglar alarm system and the control panel and the fire alarm system. Label each end of each cable.
- ☐ The fire alarm system should provide a dry contact output to the EMS panel.
- ☐ The burglar alarm system should provide a dry contact for the armed/disarmed status of the burglar alarm.

☐ The alarm system terminations should be performed by the respective installer and the control system terminations should be installed by the EMS contractor.

Install Energy and Utility Monitoring Meters:

☐ Install power meter as described in the BMS drawing, connecting it to the correct reference voltages from the power panel.

☐ Install CT's on the main power feed as described in the BMS drawing and power monitoring instructions.

☐ Terminate the CT's at their respective points on the power meter in accordance with the BMS drawings.

☐ Install the Modbus network wiring in series between the energy meters, and an additional Modbus network cable from the first energy meter to the main iPro control panel.

☐ Install Gas Meter –power device and connect Modbus wiring back the Emerson panel.

Install Kitchen Hood & Oven I/O Wiring:

☐ Install current sensing switch CT's on Phase A for each kitchen oven circuit in the electrical room and run input wires to the Emerson control system.

☐ Install IO cable between the EMS panel and the kitchen hood control panel. Label each end of the cable, terminating each at their respective terminal blocks.

Site Conditions:

☐ Permanent power is available

☐ Mechanical equipment startup is complete and operational

☐ Blower motors have been checked for rotation

☐ Mini Split and Controller Type Manufacturer: _____

☐ RTU Manufacturer(s) and Controller Detail: _____

☐ Utility Meter Detail - Gas: _____

☐ Utility Meter Detail - Electric: _____

Warning: Do Not Turn On Power To The BMS Panel Prior To The Arrival Of The Emerson

Field Checkout Team At The Site.

REQUIREMENT TO SCHEDULE: GC MUST FURNISH PICTURES OF ALL LV WIRING RUNS, EMERSON PANEL SHOWING ALL LV WIRING TERMINATIONS, ALL INSTALLED SENSORS, AND LIGHTING CONTACTOR PANEL INTEGRATION.

General Contractor Company:

General Contractor Site Contact Name:

Contact Phone No.: () -

Requested Start-Up Date: ____/____/____

General Contractor Signature: Date: ____/____/____

NOTE: This signed document must be emailed to Emerson at least seven (7) days prior to the requested BMS start-up date. There will be a \$2,250.00 per day surcharge if any listed item is not fully completed and/or an additional startup visit must be made. Surcharges will be submitted to the General Contractor.

X

General Contractor

START-UP FORM FOR ELECTRIC WATER HEATERS



A Start-up Form must be completed for each unit installed on site. All completed Start-Up Forms must be returned to the General Contractor or Lidl Construction Manager to complete site Commissioning. Start-up must be performed by qualified personnel.

Date:		Report Type:	Original Start-Up ☒	Service Call ☐
Model Number:			Serial Number:	
Installation Job Name:				
Installation Address:				
Installation Type:	New ☒	Replacement ☐		

PRE START-UP CHECKLIST

Inspect the unit for the following points as applicable and refer to the product Installation & Maintenance Manual prior to Start-Up. Note any deficiencies in the space provided at the end of the report.

GENERAL	(Y / N / NA)
Are system utilities adequate to meet the requirements on the water heater's rating decal?	NO
Is the unit damaged or are there any missing parts?	NO
Is there adequate clearance for proper operation & maintenance?	NO
Shut-off valves installed on the inlet and outlet water piping for servicing?	NO
Are all piping complete, connections tight, leak free and damage free?	NO

ELECTRICAL & CONTROL REQUIREMENTS												(Y / N / NA)
Does the main power supply comply with the unit's nameplate specifications?												NO
Is the unit properly wired to an electrical disconnect or breaker?												NO
Are terminal screws and wires connected and are tight?												NO
Checked resistance to ground between all element terminals and the element mounting flange												NO
Number and size of incoming power cables:				Power cables are: ☒ Copper ☐ Aluminum								
Control circuit transformer		/		Volts		Primary transformer fuse size		Volts		Amps		
Nameplate voltage	V:	Ø:		Hz:		Amps:						
Measured voltage (unit off)	V:	Ø:		Hz:		Amps:						
Measured voltage (unit on)	V:	Ø:		Hz:		Amps:		Amps per leg:				
Total number of contactors:		Size (amps):		Contactor fuse size (amps):								
Total number of contactors:		Size (amps):		Contactor fuse size (amps):								
Total number of electric heating elements:		Ea.		Kw								
Total number of electric heating elements:		Ea.		Kw								

DOMESTIC WATER SYSTEM	(Y / N / NA)
Temperature & Pressure relief valve(s) piped to a suitable floor drain?	NO
Is the tank drain pan drain fitting installed and in an easily accessible location?	NO
Is there an expansion tank/relief in the cold water supply?	NO
Is there a water softener installed on the cold water supply?	NO
Is there a mixing valve on the hot water supply?	NO
Is there a building recirculation loop piped to the water heater?	NO

OPERATION		
Operating Set Point (°F):	Upper Operating Set Point (°F):	High-Limit Set Point (°F):
Secondary Operating Set Point (°F):	Cold Water Inlet Temperature:	Hot Water Outlet Temperature (°F):

START-UP FORM FOR ELECTRIC WATER HEATERS (cont.)

Note: The information on this form verifies operation of the water heater product only. This does not imply other system components or overall system operation is certified. Ancillary equipment component and system verification should be performed by the designated commissioning agent or installing contractor.

COMMENTS

Start-up Performed By					
Company:					
Address:					
City:		State:		Zip:	
Email:		Phone:			
Name:					

Start-up Accepted By					
Company:					
Address:					
City:		State:		Zip:	
Email:		Phone:			
Name:					

FPT



FPT Cx REPORT

PROJECT: Lidl Sample FPT Report

LOCATION: City, State

ARCHITECT: _____

MECH. ENGINEER: _____

ELECT. ENGINEER: _____

PROJECT NUMBER: _____

"THE DATA PRESENTED IN THIS REPORT IS A RECORD OF SYSTEM FUNCTIONALITY. ANY VARIANCES FROM DESIGN DOCUMENTS ARE NOTED IN THE REPORT."

Date Completed: 4/21/2021

COMMISSIONING CONTACT INFORMATION

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Lidl Construction Manager: _____

Phone: _____

E-mail: _____

Commissioning Authority: _____

Commissioning Agent: _____

Phone: _____

Email: _____

General Contractor: _____

Superintendent: _____

Phone: _____

Email: _____

Mechanical Contractor: _____

Technician: _____

Phone: _____

Email: _____

Electrical Contractor: _____

Technician: _____

Phone: _____

Email: _____

Plumbing Contractor: _____

Technician: _____

Phone: _____

Email: _____

Controls Contractor: _____

Technician: _____

Phone: _____

Email: _____

Emerson Contractor: _____

Technician: _____

Phone: _____

Email: _____

COMMISSIONING NOTES & RECOMMENDATIONS

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Items found in the list below are notes or recommendations for the site. These items are not in the current design, but they are noteworthy items to improve comfort and energy efficiency.

Item	Equip Tag	Ref#	Description
1			
2			
3			
4			
5			
6			
7			
8			
9			
10			
11			
12			
13			
14			
15			

COMMISSIONING DEFICIENCY LOG

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Items found in the deficiency log below, have been marked as "Fail" or "No" in the installation verification and/or performance tests on the following pages. The "Tag" is the equipment it is referring to, and the "Ref #" corresponds to equipment reference numbers on the following pages.

The blank columns to the right are intended for use of the repairing contractors

[illegible]

PHOTOS

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Equip. Tag:
1:

Equip. Tag:
2:

Equip. Tag:
3:

Equip. Tag:
4:

Equip. Tag:
5:

Equip. Tag:
6:

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (RTU)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	As Installed
1	Manufacturer	
2	Model #	
3	Serial #	

System:	RTU-1
----------------	-------

Area Served:	Sales Floor (Middle)
---------------------	----------------------

All function tests should be performed with BACnet disconnected and units in stand-alone

Ref#	Function	Items to Check	Melink
4	General	Picture of RTU data tag captured for reference	
5	General	Verify CO2, humidity and temperature values are reading on prodigy	
6	General	Verify prodigy Auto Changeover deadband setting 4 °F (Par. 152)	
7	General	Unit enters heating mode when temp set point is increased on prodigy board	
8	Heating	Confirm air flow switch proves, draft induce motor blows and burner fires, open cabinet and verify burners for flame	
9	Heating	When heating, unit supply / blower fan is running	
10	Heating	Confirm heating mode is running	
11	Heating	No unusual noise or vibration while heating, noise investigated immediately	
12	Heating	Unit discharges hot air, verified at discharge cabinet with appropriate thermometer	
13	Heating	The burner de-energizes and unit economizes when setpoint is maintained	
14	Cooling	Unit enters cooling mode when temp set point is decreased on prodigy board	
15	Cooling	Unit turns on, compressor and condenser energize	
16	Cooling	When cooling, unit supply / blower fan is running	
17	Cooling	No unusual noise or vibration while cooling, if so, investigate immediately	
18	Cooling	Unit discharges cold air, verified at discharge cabinet with appropriate thermometer	
19	Cooling	Compressor & condenser de-energizes, economizes when setpoint maintains	
20	Econ/CO	Free cooling (economizer) operates when O/A set point adjusted on prodigy	
21	Econ/CO	Compressor or heating is off when unit is operating in free cooling	
22	Econ/CO	No unusual noise or vibration while free cooling, if so, investigate immediately	
23	Econ/CO	CO2 sensor on prodigy board input set for 50 PPM & 1950 PPM max 100% open	
24	Econ/CO	Dehumidification mode entered upon adjusting relative humidity (RH) setpoint	
25	Econ/CO	Hot gas refrigerant reheat coil engages to reheat air	
26	Econ/CO	Compressor energizes in dehumidification mode	
27	Econ/CO	When zone RH is less than RH setpoint, that cooling/economizer mode resumes	
28	Econ/CO	Verify RH setpoint on prodigy board is 55% RH	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (RTU)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	As Installed
1	Manufacturer	
2	Model #	
3	Serial #	
4	Job # Label	

System: RTU-2

Area Served: Sales Floor (DOAS)

****All function tests should be performed with BACnet disconnected and units in stand-alone****

Ref#	Items to Check	Melink
5	Confirm with BMS if BACnet can see unit address.	
6	Bacnet wiring matches the photo, if not, needs to be modified	
7	Verify outdoor air (OA) temperature is accurate, if not, calibrate on ALC controller	
8	Relative humidity (RH) setpoint on ALC controller set to 55% at 58 deg F	
9	OA temperature reading is accurate, if not, caibrate on ALC controller	
10	Desiccant wheel rotates when selecting the dehumidification mode using the simulation mode from the main menu	
For items (17-21), select cooling from the simulation mode on the main menu		
11	Confirm air flow switch proves, burner fires, and exhaust air from unit is hot	
12	The supply / blower fan is running	
13	The heating is running	
14	No unusual noise or vibration while heating, if so, investigate immediately	
15	Unit discharges hot air, verified at discharge cabinet with appropriate thermometer	
16	Burner de-energizes when setpoint is maintained, then combustion fan runs for approx. 1-2 minutes after de-energizing	
For items (17-21), select cooling from the simulation mode on the main menu		
17	Confirm unit turns on, compressor and condensers energize	
18	The supply / blower fan is running	
19	No unusual noise or vibration while cooling, if so, investigate immediately	
20	Unit discharges cold air, verified at discharge cabinet with appropriate thermometer	
21	Compressor and condenser de-energize, fan turns off when setpoint maintained	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (RTU)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	As Installed
1	Manufacturer	
2	Model #	
3	Serial #	

System: RTU-2

Area Served: Sales Floor (Front)

All function tests should be performed with BACnet disconnected and units in stand-alone

Ref#	Function	Items to Check	Melink
4	General	Picture of RTU data tag captured for reference	
5	General	Verify CO2, humidity and temperature values are reading on prodigy	
6	General	Verify prodigy Auto Changeover deadband setting 4 °F (Par. 152)	
7	General	Unit enters heating mode when temp set point is increased on prodigy board	
8	Heating	Confirm air flow switch proves, draft induce motor blows and burner fires, open cabinet and verify burners for flame	
9	Heating	When heating, unit supply / blower fan is running	
10	Heating	Confirm heating mode is running	
11	Heating	No unusual noise or vibration while heating, noise investigated immediately	
12	Heating	Unit discharges hot air, verified at the discharge cabinet with appropriate thermometer	
13	Heating	The burner de-energizes and unit economizes when setpoint is maintained	
14	Cooling	Unit enters cooling mode when temp set point is decreased on prodigy board	
15	Cooling	Unit turns on, compressor and condenser energize	
16	Cooling	When cooling, unit supply / blower fan is running	
17	Cooling	No unusual noise or vibration while cooling, if so, investigate immediately	
18	Cooling	Unit discharges cold air, verified at the discharge cabinet with appropriate thermometer	
19	Cooling	Compressor & condenser de-energizes, economizes when setpoint maintains	
20	Econ/CO	Free cooling (economizer) operates when O/A set point adjusted on prodigy	
21	Econ/CO	Compressor or heating is off when unit is operating in free cooling	
22	Econ/CO	No unusual noise or vibration while free cooling, if so, investigate immediately	
23	Econ/CO	CO2 sensor on prodigy board set for 700 PPM & 1200 PPM max open per design	
24	Econ/CO	Heating Staging option selected	
25	Econ/CO	Discharge Air Control setting is 82 Degrees	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (RTU)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	As Installed
1	Manufacturer	
2	Model #	
3	Serial #	

System:	RTU-3
----------------	-------

Area Served:	Sales Floor (Front)
---------------------	---------------------

All function tests should be performed with BACnet disconnected and units in stand-alone

Ref#	Function	Items to Check	Melink
4	General	Picture of RTU data tag captured for reference	
5	General	Verify CO2, humidity and temperature values are reading on prodigy	
6	General	Verify prodigy Auto Changeover deadband setting 4 °F (Par. 152)	
7	General	Unit enters heating mode when temp set point is increased on prodigy board	
8	Heating	Confirm air flow switch proves, draft induce motor blows and burner fires, open cabinet and verify burners for flame	
9	Heating	When heating, unit supply / blower fan is running	
10	Heating	Confirm heating mode is running	
11	Heating	No unusual noise or vibration while heating, noise investigated immediately	
12	Heating	Unit discharges hot air, verified at the discharge cabinet with appropriate thermometer	
13	Heating	The burner de-energizes and unit economizes when setpoint is maintained	
14	Cooling	Unit enters cooling mode when temp set point is decreased on prodigy board	
15	Cooling	Unit turns on, compressor and condenser energize	
16	Cooling	When cooling, unit supply / blower fan is running	
17	Cooling	No unusual noise or vibration while cooling, if so, investigate immediately	
18	Cooling	Unit discharges cold air, verified at the discharge cabinet with appropriate thermometer	
19	Cooling	Compressor & condenser de-energizes, economizes when setpoint maintains	
20	Econ/CO	Free cooling (economizer) operates when O/A set point adjusted on prodigy	
21	Econ/CO	Compressor or heating is off when unit is operating in free cooling	
22	Econ/CO	No unusual noise or vibration while free cooling, if so, investigate immediately	
23	Econ/CO	CO2 sensor on prodigy board set for 700 PPM & 1200 PPM max open per design	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (RTU)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	As Installed
1	Manufacturer	
2	Model #	
3	Serial #	

System: RTU-4

Area Served: Bakery

All function tests should be performed with BACnet disconnected and units in stand-alone

Ref#	Function	Items to Check	Melink
4	General	Picture of RTU data tag captured for reference	
5	General	Verify temperature sensor and calibrate if necessary	
6	General	Verify prodigy Auto Changeover deadband setting 4 °F (Par. 152)	
7	General	Unit enters heating mode when temp set point is increased on prodigy board	
8	Heating	Confirm air flow switch proves, draft induce motor blows and burner fires, open cabinet and verify burners for flame	
9	Heating	When heating, unit supply / blower fan is running	
10	Heating	Confirm heating mode is running	
11	Heating	No unusual noise or vibration while heating, noise investigated immediately	
12	Heating	Unit discharges hot air, verified at discharge cabinet with appropriate thermometer	
13	Heating	The burner de-energizes and unit economizes when setpoint is maintained	
14	Cooling	Unit enters cooling mode when temp set point is decreased on prodigy board	
15	Cooling	Unit turns on, compressor and condenser energize	
16	Cooling	When cooling, unit supply / blower fan is running	
17	Cooling	No unusual noise or vibration while cooling, if so, investigate immediately	
18	Cooling	Unit discharges cold air, verified at the discharge cabinet with appropriate thermometer	
19	Cooling	Compressor & condenser de-energizes, economizes when setpoint maintains	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (RTU)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	As Installed
1	Manufacturer	
2	Model #	
3	Serial #	

System: RTU-5

Area Served: Wharehouse

All function tests should be performed with BACnet disconnected and units in stand-alone

Ref#	Function	Items to Check	Melink
4	General	Picture of RTU data tag captured for reference	
5	General	Verify C02, humidity and temperature values are reading on prodigy	
6	General	Verify prodigy Auto Changeover deadband setting 4 °F (Par. 152)	
7	General	Unit enters heating mode when temp set point is increased on prodigy board	
8	Heating	Confirm air flow switch proves, draft induce motor blows and burner fires, open cabinet and verify burners for flame	
9	Heating	When heating, unit supply / blower fan is running	
10	Heating	Confirm heating mode is running	
11	Heating	No unusual noise or vibration while heating, noise investigated immediately	
12	Heating	Unit discharges hot air, verified at the discharge cabinet with appropriate thermometer	
13	Heating	The burner de-energizes and unit economizes when setpoint is maintained	
14	Cooling	Unit enters cooling mode when temp set point is decreased on prodigy board	
15	Cooling	Unit turns on, compressor and condenser energize	
16	Cooling	When cooling, unit supply / blower fan is running	
17	Cooling	No unusual noise or vibration while cooling, if so, investigate immediately	
18	Cooling	Unit discharges cold air, verified at the discharge cabinet with appropriate thermometer	
19	Cooling	Compressor & condenser de-energizes, economizes when setpoint maintains	
20	Econ/CO	Free cooling (economizer) operates when O/A set point adjusted on prodigy	
21	Econ/CO	Compressor or heating is off when unit is operating in free cooling	
22	Econ/CO	No unusual noise or vibration while free cooling, if so, investigate immediately	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (RTU)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	As Installed
1	Manufacturer	
2	Model #	
3	Serial #	

System: RTU-6

Area Served: Breakroom / Office

All function tests should be performed with BACnet disconnected and units in stand-alone

Ref#	Function	Items to Check	Melink
4	General	Picture of RTU data tag captured for reference	
5	General	Verify CO2, humidity and temperature values are reading on prodigy	
6	General	Verify prodigy Auto Changeover deadband setting 4 °F (Par. 152)	
7	General	Unit enters heating mode when temp set point is increased on prodigy board	
8	Heating	Confirm air flow switch proves, draft induce motor blows and burner fires, open cabinet and verify burners for flame	
9	Heating	When heating, unit supply / blower fan is running	
10	Heating	Confirm heating mode is running	
11	Heating	No unusual noise or vibration while heating, noise investigated immediately	
12	Heating	Unit discharges hot air, verified at the discharge cabinet with appropriate thermometer	
13	Heating	The burner de-energizes and unit economizes when setpoint is maintained	
14	Cooling	Unit enters cooling mode when temp set point is decreased on prodigy board	
15	Cooling	Unit turns on, compressor and condenser energize	
16	Cooling	When cooling, unit supply / blower fan is running	
17	Cooling	No unusual noise or vibration while cooling, if so, investigate immediately	
18	Cooling	Unit discharges cold air, verified at the discharge cabinet with appropriate thermometer	
19	Cooling	Compressor & condenser de-energizes, economizes when setpoint maintains	
20	Econ/CO	Free cooling (economizer) operates when O/A set point adjusted on prodigy	
21	Econ/CO	Compressor or heating is off when unit is operating in free cooling	
22	Econ/CO	No unusual noise or vibration while free cooling, if so, investigate immediately	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (AC & CU)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	(AC) As Installed
1	Manufacturer	
2	Model #	
3	Serial #	

System:	AC & CU-1
----------------	-----------

Area Served:	IT-Room
---------------------	---------

Ref#	Data Point	(CU) As Installed
4	Manufacturer	
5	Model #	
6	Serial #	

[illegible]

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (AC & CU)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	(AC) As Installed
1	Manufacturer	
2	Model #	
3	Serial #	

System:	AC & CU-2
----------------	-----------

Area Served:	IT-Room
--------------	---------

Ref#	Data Point	(CU) As Installed
4	Manufacturer	
5	Model #	
6	Serial #	

[illegible]

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (AC & CU)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	(AC) As Installed
1	Manufacturer	
2	Model #	
3	Serial #	

System:	AC & CU-3
----------------	-----------

Area Served:	IT-Room
---------------------	---------

Ref#	Data Point	(CU) As Installed
4	Manufacturer	
5	Model #	
6	Serial #	

[illegible]

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (CVF & KEF)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point				(CVF-1) As Installed
1	Manufacturer				
2	Model #				
3	Serial #				

System: CVF-1

Area Served: Above Cooler

Ref#	Data Point				(CVF-2) As Installed
4	Manufacturer				
5	Model #				
6	Serial #				

System: CVF-2

Area Served: Above Bakery Freezer

Ref#	Data Point				(KEF-1) As Installed
7	Manufacturer				
8	Model #				
9	Serial #				

System: KEF-1

Area Served: Bakery Kitchen Hood

Ref#	Items to Check	Melink
10	Pictures of CVF-1 data tags captured for reference	
11	Upon turning on CVF-1, fan is running	
12	CVF-1 has correct fan rotation	
13	Pictures of CVF-2 data tags captured for reference	
14	Upon turning on CVF-2, fan is running	
15	CVF-2 has correct fan rotation	
16	Pictures of KEF-1 data tags captured for reference	
17	Upon turning on KEF-1, fan is running	
18	KEF-1 has correct fan rotation	
19	KEF-1's lights are all operable	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (TEF)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	(TEF-1) As Installed
1	Manufacturer	
2	Model #	
3	Serial #	

System: TEF-1

Area Served: Bathroom

Ref#	Data Point	(TEF-2) As Installed
4	Manufacturer	
5	Model #	
6	Serial #	

System: TEF-2

Area Served: Bathroom

Ref#	Data Point	(TEF-3) As Installed
7	Manufacturer	
8	Model #	
9	Serial #	

System: TEF-3

Area Served: Janitor Closet

Ref#	Items to Check	Melink
10	Pictures of TEF-1 data tags captured for reference	
11	Upon turning on TEF-1, fan is running	
12	TEF-1 has correct fan rotation	
13	Pictures of TEF-2 data tags captured for reference	
14	Upon turning on TEF-2, fan is running	
15	TEF-2 has correct fan rotation	
16	Pictures of TEF-3 data tags captured for reference	
17	Upon turning on TEF-3, fan is running	
18	TEF-3 has correct fan rotation	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (LIGHTING)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

System:	LIGHTING
Panel Manufacturer:	

Area/Zone:	GENERAL
-------------------	----------------

Ref#	Items to Check	Melink
1	Picture of lighting panel captured for reference	
2	All lights are turning on. Photo verification necessary	
3	Lights have Lux / FC level per design documents (look for dark spots)	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (PLUMBING)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	As Installed
1	Manufacturer	
2	Model #	
3	Serial #	
4	Capacity	

System: Plumbing

Area Served: General

Ref#	Items to Check	Melink
5	Picture of water heater captured for reference	
6	Manufacturer startup complete, report provided to Melink and CM	
7	Start-up report completed and copy provided to CxA from Plumber	
8	Water heater temperature set to 140 deg F	
9	Water pressure valve successfully tested	
10	Water pressure tested at faucet (verify good flow, no water hammer or insufficient flow)	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (GENERATOR)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	As Installed
1	Manufacturer	
2	Model #	
3	Serial #	

System: Generator

Area Served: General

Ref#	Items to Check	Melink
4	Picture of generator captured for reference	
5	Start up of generator successful upon call for power generation	
6	Batteries have back-up power	
7	No unusual sounds or vibrations noticable, noises investigated immediately	
8	Generator fuel tank is nearly full	
9	Oil cap has been tightly secured	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (BMS)

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

Ref#	Data Point	As Installed
1	Manufacturer	
2	Model #	
3	Serial #	

System:	BMS
----------------	-----

Area Served:	General
---------------------	---------

Ref#	Items to Check	Melink
4	Picture of Emerson BMS panel captured for reference	
5	Permanent power is available	
6	Mechanical equipment startup is complete and operational	
7	Blower motors have been checked for rotation	
8	Split Units connection confirmed at Gateway	
9	RTUs connection confirmed	
10	Gas Consumption Meter Connection Confirmed	
11	Electric Consumption Meter Connection Confirmed	
12	Generator connection confirmed	
13	Telaid connection confirmed	
14	Current monitoring/CT confirmed (all fans)	
15	The generator startup report has been received	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

SIGNATURE - FUNCTIONAL CHECKLIST

PROJECT: Lidl Sample FPT Report

DATE: 4/21/2021

LOCATION: City, State

CHECKER/TESTER SIGNATURE:

General Contractor

Date

Signature

Mechanical Contractor

Date

Signature

Electrical Contractor

Date

Signature

Plumbing Contractor

Date

Signature

Controls Contractor

Date

Signature

Melink Technician

Date

Signature

****All Deficiency Items have been Corrected**

Lidl Construction Manager

Date

Signature

PRE-BMS FPT CHECKLIST



Melink BMS FPT Commissioning Quick Checklist

TO: EMAIL:
FROM: lidl@melinkcorp.com DATE:
JOB NAME: ADDRESS:
SCHEDULED DATE FOR COMMISSIONING:

Commissioning should not be scheduled until all items can be check complete and active. All items should be running 48 hours before CX. All installation and repairs should be completed before CX, not being completed day of.

- | | | | | |
|--|--------------------------|-----|----------------------|----------------|
| 1. All HVAC Roof Top Units are connected and communicating with Emerson. | ☐ | YES | <input type="text"/> | Completed Date |
| 2. All HVAC split units are connected and communicating with Emerson. | ☐ | YES | <input type="text"/> | Completed Date |
| 3. Power Exhaust and Building Pressure Sensor has been installed and tested. | ☐ | YES | <input type="text"/> | Completed Date |
| 4. All lighting circuits have been tested for 1/3rd and 2/3rd functionality. | ☐ | YES | <input type="text"/> | Completed Date |
| 5. Kitchen Exhaust Fan is connected and communicating with Emerson BMS. | ☐ | YES | <input type="text"/> | Completed Date |
| 6. Centrifugal Ventilation Fans above walk-ins are connected and communicating with Emerson BMS. | ☐ | YES | <input type="text"/> | Completed Date |
| 7. Restroom/Janitor Exhaust Fans are connected and communicating with Emerson BMS. | ☐ | YES | <input type="text"/> | Completed Date |
| 8. Generator startup been completed and tested with Transfer Switch and Emerson BMS. | ☐ | YES | <input type="text"/> | Completed Date |
| 9. Electrical Consumption Meter is connected and communicating with Emerson BMS. | ☐ | YES | <input type="text"/> | Completed Date |
| 10. Gas Consumption Meter is connected and communicating with Emerson BMS. | ☐ | YES | <input type="text"/> | Completed Date |
| 11. The IT network has been installed. | ☐ | YES | <input type="text"/> | Completed Date |
| 12. The Fire Panel has been installed. | ☐ | YES | <input type="text"/> | Completed Date |
| 13. Telaid has been installed. | ☐ | YES | <input type="text"/> | Completed Date |
| 14. AHT/Hussman installation has been completed and communicating with Emerson BMS. | ☐ | YES | <input type="text"/> | Completed Date |
| 15. Checkout lanes and associated lighting have been installed. | ☐ | YES | <input type="text"/> | Completed Date |

BY SIGNING, I AUTHORIZE MELINK TO PERFORM THE COMMISSIONING ON THE SCHEDULED DATE ABOVE. PLEASE RETURN THE COMPLETED CHECKLIST TO MELINK CORPORATION: FAX (513) 965-7354 EMAIL: logistics@melinkcorp.com. THIS REQUEST FOR WORK WILL ONLY BE SCHEDULED UPON RECEIPT OF COMPLETED CHECKLIST INDICATING THE SITE IS READY. IF THE SITE IS NOT 100% READY BUT THE SCHEDULED DATE IS STILL DESIRED; PLEASE CONTACT MELINK CORPORATION TO DISCUSS ALTERNATIVES.

Supt or PM Signature:

Date:

NOTE: This checklist must be returned to Melink by the due date requested to prevent a **\$500 surcharge** for insufficient notice. In the event that the commissioning cannot be completed within the scheduled timeframe due to site conditions or issues with the installed systems, a revisit to complete the work will be required and additional charges will apply.

BMS



BMS FPT Cx REPORT

PROJECT: Lidl Sample BMS Report

LOCATION: City, State

ARCHITECT: _____

MECH. ENGINEER: _____

ELECT. ENGINEER: _____

PROJECT NUMBER: _____

"THE DATA PRESENTED IN THIS REPORT IS A RECORD OF SYSTEM FUNCTIONALITY. ANY VARIANCES FROM DESIGN DOCUMENTS ARE NOTED IN THE REPORT."

Date Completed: 4/21/2021

COMMISSIONING CONTACT INFORMATION

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Lidl Facilities Manager: _____
Phone: _____
E-mail: _____

Lidl Construction Manager: _____
Phone: _____
E-mail: _____

Commissioning Authority: _____
Commissioning Agent: _____
Phone: _____
Email: _____

General Contractor: _____
Superintendent: _____
Phone: _____
Email: _____

Mechanical Contractor: _____
Technician: _____
Phone: _____
Email: _____

Electrical Contractor: _____
Technician: _____
Phone: _____
Email: _____

Plumbing Contractor: _____
Technician: _____
Phone: _____
Email: _____

Controls Contractor: _____
Technician: _____
Phone: _____
Email: _____

Emerson Contractor _____
Technician: _____
Phone: _____
Email: _____

COMMISSIONING NOTES & RECOMMENDATIONS

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Items found in the list below are notes or recommendations for the site. These items are not in the current design, but they are noteworthy items to improve comfort and energy efficiency.

Item	Equip Tag	Ref#	Description
1			
2			
3			
4			
5			
6			
7			
8			
9			
10			
11			
12			
13			
14			
15			

COMMISSIONING DEFICIENCY LOG

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Items found in the deficiency log below, have been marked as "Fail" or "No" in the installation verification and/or performance tests on the following pages. The "Tag" is the equipment it is referring to, and the "Ref #" corresponds to equipment reference numbers on the following pages. The blank columns to the right are intended for use of the repairing contractors

[illegible]

PHOTOS

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Equip. Tag:
1:

Equip. Tag:
2:

Equip. Tag:
3:

Equip. Tag:
4:

Equip. Tag:
5:

Equip. Tag:
6:

MECHANICAL - OCCUPIED HEATING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Have all units forced into occupied heating via BMS. List any other misc. BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
1	BMS	RTU-1	The occupancy scheduler changed to occupied	
2	BMS	RTU-1	The unit status changed to heating	
3	BMS	RTU-1	Building pressure is positive, even with KH running	
4	BMS	RTU-1	BMS supply air temperature:	
5	BMS	RTU-1	BMS zone temperature:	
6	BMS	RTU-1	BMS C02 in PPM:	
7	BMS	RTU-1	BMS Relative Humidity %:	
8	BMS	RTU-2	Occupancy schedule changed to occupied	
9	BMS	RTU-2	The unit status changed to heating	
10	BMS	RTU-2	BMS supply air temperature:	
11	BMS	RTU-2	BMS zone temperature:	
12	BMS	RTU-2	BMS Relative Humidity %:	
13	BMS	RTU-3	Occupancy schedule changed to occupied	
14	BMS	RTU-3	The unit status changed to heating	
15	BMS	RTU-3	BMS supply air temperature:	
16	BMS	RTU-3	BMS zone temperature:	
17	BMS	RTU-3	BMS C02 in PPM:	
18	BMS	RTU-4	Occupancy schedule changed to occupied	
19	BMS	RTU-4	The unit status changed to heating	
20	BMS	RTU-4	BMS supply air temperature:	
21	BMS	RTU-4	BMS zone temperature:	
22	BMS	RTU-5	Occupancy schedule changed to occupied	
23	BMS	RTU-5	The unit status changed to heating	
24	BMS	RTU-5	BMS supply air temperature:	
25	BMS	RTU-5	BMS zone temperature:	
26	BMS	RTU-6	Occupancy schedule changed to occupied	
27	BMS	RTU-6	The unit status changed to heating	
28	BMS	RTU-6	BMS supply air temperature:	
29	BMS	RTU-6	BMS zone temperature:	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - OCCUPIED HEATING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Have all units forced into occupied heating via BMS. List any other misc. BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
30	Prodigy	RTU-1	Prodigy board in occupied mode	
31	Prodigy	RTU-1	Prodigy supply air temperature:	
32	Prodigy	RTU-1	Supply air temperature measuring tool comparison:	
33	Prodigy	RTU-1	Prodigy humidity %:	
34	Prodigy	RTU-1	Humidity % per measuring tool:	
35	Prodigy	RTU-1	No alarms or issues on prodigy board, if present, note	
36	Prodigy	RTU-1	Air flow switch proves and burner fires	
37	Prodigy	RTU-1	Zone temperature and BMS set point match BMS values	
38	Prodigy	RTU-1	C02 is set to 1100 PPM	
39	Prodigy	RTU-1	C02 BMS value match the measured value	
40	Prodigy	RTU-1	Unit operating without unusual noise or vibration	
41	Prodigy	RTU-1	OA damper successfully closes 0-10%	
42	Prodigy	RTU-1	OA damper successfully opens 100%	
43	Prodigy	RTU-1	Burner turns off when setpoint is met	
44	Prodigy	RTU-1	Gas alarm received when gas is cut	
45	ALC	RTU-2 (Munt.)	The ALC board is in occupied mode	
46	ALC	RTU-2 (Munt.)	ALC supply air temperature:	
47	ALC	RTU-2 (Munt.)	Supply air temperature measuring tool comparison:	
48	ALC	RTU-2 (Munt.)	ALC Humidity %:	
49	ALC	RTU-2 (Munt.)	Humidity % measuring tool:	
50	ALC	RTU-2 (Munt.)	No alarms or issues on ALC board, if present, note	
51	ALC	RTU-2 (Munt.)	Air flow switch proves and burner fires	
52	ALC	RTU-2 (Munt.)	Zone temperature and BMS set point match BMS values	
53	ALC	RTU-2 (Munt.)	Unit operating without unusual noise or vibration	
54	ALC	RTU-2 (Munt.)	Burner turns off when setpoint is met	
55	ALC	RTU-2 (Munt.)	Gas alarm received when gas is cut	
56	Prodigy	RTU-3	Prodigy board in occupied mode	
57	Prodigy	RTU-3	Prodigy supply air temperature:	
58	Prodigy	RTU-3	Supply air temperature measuring tool comparison:	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - OCCUPIED HEATING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Have all units forced into occupied heating via BMS. List any other misc. BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
59	Prodigy	RTU-3	No alarms or issues on prodigy board, if present, note	
60	Prodigy	RTU-3	Air flow switch proves and burner fires	
61	Prodigy	RTU-3	Zone temperature and BMS set point match BMS values	
62	Prodigy	RTU-3	C02 is set to 700 min and 1200 max (factory default)	
63	Prodigy	RTU-3	C02 BMS value match the measured value	
64	Prodigy	RTU-3	Unit operating without unusual noise or vibration	
65	Prodigy	RTU-3	OA damper successfully closes 0-10%	
66	Prodigy	RTU-3	OA damper successfully opens 100%	
67	Prodigy	RTU-3	Burner turns off when setpoint is met	
68	Prodigy	RTU-3	Gas alarm received when gas is cut	
69	Prodigy	RTU-4	Prodigy board in occupied mode	
70	Prodigy	RTU-4	Prodigy supply air temperature:	
71	Prodigy	RTU-4	Supply air temperature measuring tool comparison:	
72	Prodigy	RTU-4	No alarms or issues on prodigy board, if present, note	
73	Prodigy	RTU-4	Air flow switch proves and burner fires	
74	Prodigy	RTU-4	Zone temperature and BMS set point match BMS values	
75	Prodigy	RTU-4	Unit operating without unusual noise or vibration	
76	Prodigy	RTU-4	Burner turns off when setpoint is met	
77	Prodigy	RTU-4	Gas alarm received when gas is cut	
78	Prodigy	RTU-5	Prodigy board in occupied mode	
79	Prodigy	RTU-5	Prodigy supply air temperature:	
80	Prodigy	RTU-5	Supply air temperature measuring tool comparison:	
81	Prodigy	RTU-5	No alarms or issues on prodigy board, if present, note	
82	Prodigy	RTU-5	Air flow switch proves and burner fires	
83	Prodigy	RTU-5	Zone temperature and BMS set point match BMS values	
84	Prodigy	RTU-5	Unit operating without unusual noise or vibration	
85	Prodigy	RTU-5	OA damper successfully closes 0-10%	
86	Prodigy	RTU-5	OA damper successfully opens 100%	
87	Prodigy	RTU-5	Burner turns off when setpoint is met	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - OCCUPIED HEATING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Have all units forced into occupied heating via BMS. List any other misc. BMS instructions here.

[illegible]

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - FUNCTIONAL PERFORMANCE TESTING (RTU)

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Instructions regarding the BMS typically here.

Ref.#	Location	Equipment	Measurement	BMS (°F)	Measuring Tool (°F)	Offset (°F)
1	Outside	N/A	Temperature			
2	Outside	N/A	Humidity %			
3	Sales Area	RTU-1	Temperature			
4	Sales Area	RTU-2	Temperature			
5	Checkouts	RTU-3	Temperature			
6	Bakery	RTU-4	Temperature			
7	Warehouse	RTU-5	Temperature			
8	Brk. R./Office	RTU-6	Temperature			
9	IT Room	AC-1	Temperature			
10	IT Room	AC-2	Temperature			
11	Tech Room	AC-3	Temperature			
12	All	All	Manufacturer startup report complete and uploaded			
13	All	All	Balancing report uploaded and ready to be reviewed			
14	All	All	Have all offsets been programed?			

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - UNOCCUPIED HEATING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Have all units forced into unoccupied heating via BMS. List any other misc. BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
1	BMS	RTU-1	Occupancy scheduler changed to unoccupied	
2	BMS	RTU-1	Unit change status to heating	
3	BMS	RTU-2 (Munt.)	Occupancy scheduler changed to unoccupied	
4	BMS	RTU-2 (Munt.)	Unit change status to heating	
5	BMS	RTU-3	Occupancy scheduler changed to unoccupied	
6	BMS	RTU-3	Unit change status to heating	
7	BMS	RTU-4	Occupancy scheduler changed to unoccupied	
8	BMS	RTU-4	Unit change status to heating	
9	BMS	RTU-5	Occupancy scheduler changed to unoccupied	
10	BMS	RTU-5	Unit change status to heating	
11	BMS	RTU-6	Occupancy scheduler changed to unoccupied	
12	BMS	RTU-6	Unit change status to heating	
13	Prodigy	RTU-1	Prodigy board in unoccupied mode	
14	Prodigy	RTU-1	Zone temperature & BMS setpoint matches BMS values	
15	Prodigy	RTU-1	Burner turns off and fan turns off when setpoint is met	
16	ALC	RTU-2 (Munt.)	The ALC board in unoccupied mode	
17	ALC	RTU-2 (Munt.)	Zone temperature & BMS setpoint matches BMS values	
18	ALC	RTU-2 (Munt.)	Burner turns off and fan turns off when setpoint is met	
19	Prodigy	RTU-3	Prodigy board in unoccupied mode	
20	Prodigy	RTU-3	Zone temperature & BMS setpoint matches BMS values	
21	Prodigy	RTU-3	Burner turns off and fan turns off when setpoint is met	
22	Prodigy	RTU-4	Prodigy board in unoccupied mode	
23	Prodigy	RTU-4	Zone temperature & BMS setpoint matches BMS values	
24	Prodigy	RTU-4	Burner turns off and fan turns off when setpoint is met	
25	Prodigy	RTU-5	Prodigy board in unoccupied mode	
26	Prodigy	RTU-5	Zone temperature & BMS setpoint matches BMS values	
27	Prodigy	RTU-5	Burner turns off and fan turns off when setpoint is met	
28	Prodigy	RTU-6	Prodigy board in unoccupied mode	
29	Prodigy	RTU-6	Zone temperature & BMS setpoint matches BMS values	
30	Prodigy	RTU-6	Burner turns off and fan turns off when setpoint is met	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - OCCUPIED COOLING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Have all units forced into occupied cooling via BMS. List any other misc. BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
1	BMS	RTU-1	The occupancy scheduler changed to occupied	
2	BMS	RTU-1	The unit status changed to cooling	
3	BMS	RTU-1	BMS supply air temperature:	
4	BMS	RTU-1	BMS zone temperature:	
5	BMS	RTU-2 (Munt.)	Occupancy schedule changed to occupied	
6	BMS	RTU-2 (Munt.)	The unit status changed to cooling	
7	BMS	RTU-2 (Munt.)	BMS supply air temperature:	
8	BMS	RTU-2 (Munt.)	BMS zone temperature:	
9	BMS	RTU-3	Occupancy schedule changed to occupied	
10	BMS	RTU-3	The unit status changed to cooling	
11	BMS	RTU-3	BMS supply air temperature:	
12	BMS	RTU-3	BMS zone temperature:	
13	BMS	RTU-4	Occupancy schedule changed to occupied	
14	BMS	RTU-4	The unit status changed to cooling	
15	BMS	RTU-4	BMS supply air temperature:	
16	BMS	RTU-4	BMS zone temperature:	
17	BMS	RTU-5	Occupancy schedule changed to occupied	
18	BMS	RTU-5	The unit status changed to cooling	
19	BMS	RTU-5	BMS supply air temperature:	
20	BMS	RTU-5	BMS zone temperature:	
21	BMS	RTU-6	Occupancy schedule changed to occupied	
22	BMS	RTU-6	The unit status changed to cooling	
23	BMS	RTU-6	BMS supply air temperature:	
24	BMS	RTU-6	BMS zone temperature:	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - OCCUPIED COOLING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Have all units forced into occupied cooling via BMS. List any other misc. BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
30	Prodigy	RTU-1	Prodigy board in occupied mode	
31	Prodigy	RTU-1	Zone temperature & BMS setpoint match BMS values	
32	Prodigy	RTU-1	Unit operating without any unusual noise or vibration	
33	Prodigy	RTU-1	No alarms or issues on prodigy board, if present, note	
34	Prodigy	RTU-1	Compressor and condenser deactivate when set point is met and only the fans run	
35	Prodigy	RTU-2 (Munt.)	Prodigy board in occupied mode	
36	Prodigy	RTU-2 (Munt.)	Zone temperature & BMS setpoint match BMS values	
37	Prodigy	RTU-2 (Munt.)	Unit operating without any unusual noise or vibration	
38	Prodigy	RTU-2 (Munt.)	No alarms or issues on prodigy board, if present, note	
39	Prodigy	RTU-2 (Munt.)	Compressor and condenser deactivate when set point is met and only the fans run	
40	Prodigy	RTU-3	Prodigy board in occupied mode	
41	Prodigy	RTU-3	Zone temperature & BMS setpoint match BMS values	
42	Prodigy	RTU-3	Unit operating without any unusual noise or vibration	
43	Prodigy	RTU-3	No alarms or issues on prodigy board, if present, note	
44	Prodigy	RTU-3	Compressor and condenser deactivate when set point is met and only the fans run	
45	Prodigy	RTU-4	Prodigy board in occupied mode	
46	Prodigy	RTU-4	Zone temperature & BMS setpoint match BMS values	
47	Prodigy	RTU-4	Unit operating without any unusual noise or vibration	
48	Prodigy	RTU-4	No alarms or issues on prodigy board, if present, note	
49	Prodigy	RTU-4	Compressor and condenser deactivate when set point is met and only the fans run	
50	Prodigy	RTU-5	Prodigy board in occupied mode	
51	Prodigy	RTU-5	Zone temperature & BMS setpoint match BMS values	
52	Prodigy	RTU-5	Unit operating without any unusual noise or vibration	
53	Prodigy	RTU-5	No alarms or issues on prodigy board, if present, note	
54	Prodigy	RTU-5	Compressor and condenser deactivate when set point is met and only the fans run	
55	Prodigy	RTU-6	Prodigy board in occupied mode	
56	Prodigy	RTU-6	Zone temperature & BMS setpoint match BMS values	
57	Prodigy	RTU-6	Unit operating without any unusual noise or vibration	
58	Prodigy	RTU-6	No alarms or issues on prodigy board, if present, note	
59	Prodigy	RTU-6	Compressor and condenser deactivate when set point is met and only the fans run	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - UNOCCUPIED COOLING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Have all units forced into unoccupied cooling via BMS. List any other misc. BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
1	BMS	RTU-1	Occupancy scheduler changed to unoccupied	
2	BMS	RTU-1	Unit change status to cooling	
3	BMS	RTU-2 (Munt.)	Occupancy scheduler changed to unoccupied	
4	BMS	RTU-2 (Munt.)	Unit change status to cooling	
5	BMS	RTU-3	Occupancy scheduler changed to unoccupied	
6	BMS	RTU-3	Unit change status to cooling	
7	BMS	RTU-4	Occupancy scheduler changed to unoccupied	
8	BMS	RTU-4	Unit change status to cooling	
9	BMS	RTU-5	Occupancy scheduler changed to unoccupied	
10	BMS	RTU-5	Unit change status to cooling	
11	BMS	RTU-6	Occupancy scheduler changed to unoccupied	
12	BMS	RTU-6	Unit change status to cooling	
13	Prodigy	RTU-1	Prodigy board in unoccupied mode	
14	Prodigy	RTU-1	Zone temperature & BMS setpoint matches BMS values	
15	Prodigy	RTU-1	Compressor and condenser de-energize and fan turns off when setpoint is met	
16	ALC	RTU-2 (Munt.)	ALC board in unoccupied mode	
17	ALC	RTU-2 (Munt.)	Zone temperature & BMS setpoint matches BMS values	
18	ALC	RTU-2 (Munt.)	Compressor and condenser de-energize and fan turns off when setpoint is met	
19	Prodigy	RTU-3	Prodigy board in unoccupied mode	
20	Prodigy	RTU-3	Zone temperature & BMS setpoint matches BMS values	
21	Prodigy	RTU-3	Compressor and condenser de-energize and fan turns off when setpoint is met	
22	Prodigy	RTU-4	Prodigy board in unoccupied mode	
23	Prodigy	RTU-4	Zone temperature & BMS setpoint matches BMS values	
24	Prodigy	RTU-4	Compressor and condenser de-energize and fan turns off when setpoint is met	
25	Prodigy	RTU-5	Prodigy board in unoccupied mode	
26	Prodigy	RTU-5	Zone temperature & BMS setpoint matches BMS values	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - UNOCCUPIED COOLING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Have all units forced into unoccupied cooling via BMS. List any other misc. BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
30	Prodigy	RTU-5	Compressor and condenser de-energize and fan turns off when setpoint is met	
31	Prodigy	RTU-6	Prodigy board in unoccupied mode	
32	Prodigy	RTU-6	Zone temperature & BMS setpoint matches BMS values	
33	Prodigy	RTU-6	Compressor and condenser de-energize and fan turns off when setpoint is met	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - DEHUMIDIFICATION

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Have all units forced into dehumidification via BMS. List any other misc. BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
1	BMS	RTU-1	BMS changes into dehumidification (dehum.)	
2	Prodigy	RTU-1	Prodigy board changed to dehum.	
3	N/A	RTU-1	Hot gas reheat engages	
4	N/A	RTU-1	Compressor engages	
5	BMS	RTU-2 (Munt.)	BMS Changes to Dehum.	
6	ALC	RTU-2 (Munt.)	The ALC controller changed to dehum.	
7	BMS	RTU-2 (Munt.)	Compressor engages	
8	BMS	AC-1	Zone temperature & BMS setpoint matches BMS values	
9	BMS	AC-1	Setpoints change on unit	
10	BMS	AC-1	Unit operating without any unusual noise or vibration	
11	BMS	AC-1	Test fail AC-1 to rotate to AC-2	
12	BMS	AC-1	Alarm sounds when temp in space is above 75F	
13	BMS	AC-2	Zone temperature & BMS setpoint matches BMS values	
14	BMS	AC-2	Setpoints change on unit	
15	BMS	AC-2	Unit operating without any unusual noise or vibration	
16	BMS	AC-2	Test fail AC-2 to rotate to AC-1	
17	BMS	AC-2	Leak detector pan operational	
18	BMS	AC-2	Alarm sounds when temp in space is above 75F	
19	BMS	AC-1,2	Leak detector floor operational and strobe sounds	
20	BMS	AC-1,2	Units confirmed to rotate every 2 weeks	
21	BMS	AC-3	Zone temperature & BMS setpoint matches BMS values	
22	BMS	AC-3	Setpoints change on unit	
23	BMS	AC-3	Unit operating without any unusual noise or vibration	
24	BMS	AC-3	Leak detector pan operational	
25	BMS	AC-3	Alarm sounds when temp in space is above 75F	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

ELECTRICAL - LIGHTING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Force the following lighting settings per the BMS. List any other misc. BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
1	N/A	BMS	LUX Light Sensor value on BMS:	
2	Unoccp'd	Store Closed	Set BMS 4 hours before opening, one light in vestibule on	
Set BMS 3 hours before opening, light level below 150 LUX				
3	Unoccp'd	Store Closed	Parking lights on	
4	Unoccp'd	Store Closed	Monument sign on	
5	Unoccp'd	Store Closed	Cart corral on	
6	Unoccp'd	Store Closed	Exterior building lights on	
7	Unoccp'd	Store Closed	One fixture in vestibule on	
Set BMS 3 hours before opening, light level above 200 LUX				
8	Unoccp'd	Store Closed	One fixture in vestibule on	
Set outside light level below 150 LUX				
9	Occupied	Store Closed	1/3 on: sales floor, bakery & fruit/veggie spot lights on	
10	Occupied	Store Closed	Blinds and light cases (wall refrigerated cases lights on and blinds open)	
11	Occupied	Store Closed	Parking lights on	
12	Occupied	Store Closed	Monument sign on	
13	Occupied	Store Closed	Cart corral on	
14	Occupied	Store Closed	Exterior building lights on	
15	Occupied	Store Closed	One fixture in vestibule on	
Set outside light level above 150 LUX				
16	Occupied	Store Closed	1/3 on: sales floor, bakery & fruit/veggie spot lights on	
17	Occupied	Store Closed	Blinds and light cases (wall refrigerated cases lights on and blinds open)	
18	Occupied	Store Closed	One fixture in vestibule on	
Set outside light level below 150 LUX				
19	Occupied	Open in 15 min.	Building sign on	
20	Occupied	Open in 15 min.	Parking lights on	
21	Occupied	Open in 15 min.	Sales floor, vestibule and checkout shelving lights on	
22	Occupied	Open in 15 min.	Freezers and fridges (Miami's, semi verticals, wall refrigerated cases lights on and blinds open)	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

ELECTRICAL - LIGHTING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Force the following lighting settings per the BMS. List any other misc. BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
23	Occupied	Open in 15 min.	Bakery spot light and shelving lights on	
24	Occupied	Open in 15 min.	Fruit and veggies spot lights on	
25	Occupied	Open in 15 min.	Monument sign on	
26	Occupied	Open in 15 min.	Cart corral on	
27	Occupied	Open in 15 min.	Exterior building lights on	
Set outside light level above 200 LUX				
28	Occupied	Open in 15 min.	Sales floor, vestibule and checkout shelving lights on	
29	Occupied	Open in 15 min.	Freezers and fridges (miami's, semi verticals, wall refrigerated cases lights on and blinds open)	
30	Occupied	Open in 15 min.	Bakery spot light and shelving lights on	
31	Occupied	Open in 15 min.	Fruit and veggies spot lights on	
Set outside light level below 150 LUX				
32	Occupied	15 min. after close	Building sign on	
33	Occupied	15 min. after close	Parking lights on	
34	Occupied	15 min. after close	1/3 lights - sales floor, bakery and fruit/veggie spot lights on	
35	Occupied	15 min. after close	Monument sign on	
36	Occupied	15 min. after close	Cart corral on	
37	Occupied	15 min. after close	Exterior building lights on	
38	Occupied	15 min. after close	Freezers and fridges (wall refrigerated cases lights on and blinds open)	
39	Occupied	15 min. after close	One fixture in vestibule on	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

ELECTRICAL - LIGHTING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Force the following lighting settings per the BMS. List any other misc. BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
Set outside light level above 200 LUX				
40	Occupied	15 min. after close	1/3 lights - sales floor, bakery and fruit/veggie spot lights	
41	Occupied	15 min. after close	Freezers, and fridges (miami's, semi verticals, wall refrigerated cases lights on and blinds open)	
42	Occupied	15 min. after close	One fixture in vestibule on	
Manager leaves and light level below 150 LUX				
43	Unoccp'd	Store Closed	Building sign on	
44	Unoccp'd	Store Closed	Parking lights on	
45	Unoccp'd	Store Closed	Cart corral on	
46	Unoccp'd	Store Closed	Exterior building lights on	
47	Unoccp'd	Store Closed	Monument sign on	
48	Unoccp'd	Store Closed	One fixture in vestibule on	
Simulate burglar events				
49	Unoccp'd	Burglar	All lights on sales floor and vestibule on	
50	Unoccp'd	Burglar	Parking lights on	
51	Unoccp'd	Burglar	Monument sign on	
52	Unoccp'd	Burglar	Cart corral lights on	
53	Unoccp'd	Burglar	Exterior building lights on	
54	Occupied	Burglar	Current operation of the lights is not affected	
Simulate night delivery - the following lights react accordingly				
55	Unoccp'd	Nite. Delivery	Back of the house on occupancy sensor turn on	
56	Unoccp'd	Nite. Delivery	Loading dock ramp lights on motion sensor turn on	
57	Unoccp'd	Nite. Delivery	One fixture in vestibule already on	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - EF TESTING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

Control all fans as necessary via BMS. List any other misc. BMS instructions here.

[illegible]

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - GENERATOR & BMS TESTING

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

List any other misc. or BMS instructions here.

[illegible]

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - TEMPERATURE SETPOINTS

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

The following temperatures are to be verified, and calibrated as necessary

Ref.#	Interface	Equipment	Measurement	Input
1	Occupied	RTU-1	Heat - 68 deg F	
2	Occupied	RTU-1	Cooling - 74 deg F	
3	Unoccp'd	RTU-1	Heat - 63 deg F	
4	Unoccp'd	RTU-1	Cooling - 75 deg F	
5	N/A	RTU-1	CO2 Setpoint at 50PPM minimum to 1950PPM maximum	
6	N/A	RTU-1	Relative Humidity 55%	
7	N/A	RTU-1	Building Pressure Sepoint 0.03" w.c.	
8	Occupied	RTU-2	Heat - 68 deg F	
9	Occupied	RTU-2	Cooling - 75 deg F	
10	Unoccp'd	RTU-2	Heat - 63 deg F	
11	Unoccp'd	RTU-2	Cooling - 78 deg F	
12	N/A	RTU-2	Relative Humidity 54%	
13	Occupied	RTU-3	Heat - 69 deg F	
14	Occupied	RTU-3	Cooling - 74 deg F	
15	Unoccp'd	RTU-3	Heat - 63 deg F	
16	Unoccp'd	RTU-3	Cooling - 75 deg F	
17	N/A	RTU-3	CO2 Setpoint at 700PPM to 1200PPM	
18	Occupied	RTU-4	Heat - 68 deg F	
19	Occupied	RTU-4	Cooling - 79 deg F	
20	Unoccp'd	RTU-4	Heat - 63 deg F	
21	Unoccp'd	RTU-4	Cooling - 84 deg F	
22	Occupied	RTU-5	Heat - 63 deg F	
23	Occupied	RTU-5	Cooling - 73 deg F	
24	Unoccp'd	RTU-5	Heat - 58 deg F	
25	Unoccp'd	RTU-5	Cooling - 76 deg F	
26	Occupied	RTU-6	Heat - 68 deg F	
27	Occupied	RTU-6	Cooling - 73 deg F	
28	Unoccp'd	RTU-6	Heat - 65 deg F	
29	Unoccp'd	RTU-6	Cooling - 79 deg F	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - TEMPERATURE SETPOINTS

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

The following temperatures are to be verified, and calibrated as necessary

Ref.#	Interface	Equipment	Measurement	Input
30	Occupied	AC-1	Cooling - 75 deg F	
31	Unoccp'd	AC-1	Cooling - 75 deg F	
32	Occupied	AC-2	Cooling - 75 deg F	
33	Unoccp'd	AC-2	Cooling - 75 deg F	
34	Occupied	AC-3	Cooling - 75 deg F	
35	Unoccp'd	AC-3	Cooling - 75 deg F	




Photo of the current BMS page




Photo of the current active alarms

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - UPS

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

The uninterruptible power source (UPS) settings are to be verified.

[illegible]

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

MECHANICAL - REFRIGERATION

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

List any other misc. or BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
Chiller/Vento/Miami				
1	N/A	Chiller	Bumper and kick plates have no gap (each cabinet)	
2	N/A	Chiller	Headpiece panels are installed neatly with no gap (each cabinet)	
3	N/A	Chiller	Refrigeration units aligned, perforations of the slide rails (see the back panel of refrigeration appliance) are in line	
4	N/A	Chiller	Display: temperature in range between 35 – 41°F) (thermometer positioned on the left side of the cabinet	
5	N/A	Chiller	Installation: Refrigeration base tub is clean, the drain is tested & operational and a drain filter present for each panel section of the appliance. No water on the floor in front of the cabinet (each bay/section)	
6	N/A	Chiller	Bumper installed by Lidl (each end-cabinet)	
7	N/A	Chiller	Installation: All corner pipework is to be covered (by the costumer) with a neatly installed pipe cover	
8	N/A	Chiller	Insulated pipework on top of the cabinets. Shut- off -valve on top of the last cabinet in cutomer direction	
9	N/A	Chiller	No Ice or Snow inside the cabinet (each cabinet)	
Piping from Refrigeration Appliances to Drycooler				
10	N/A	Piping	All wall breakthroughs for piping have been filled watertight or foamed/sealed watertight from inside & outside (plastering is responsibility of the client)	
11	N/A	Piping	All piping is insulated (no holes, tears or loose fittings evident)	
12	N/A	Piping	Exterior piping /glycol pipes/ All exterior glycol pipes are copper pipes and installed with insulation + aluminum cover	
13	N/A	Piping	Heat trace installed until wall breakthrough	
14	N/A	Piping	All insulation is applied until clamps and there are no breaks between insulation	
15	N/A	Piping	Installed with maximum of 2 meters (6.5 feet) between pipe clamps	
Pump Station and Drycooler - All Versions				
16	N/A	Drycooler	Fin coils are clean and undamaged	
17	N/A	Drycooler	All pipes are equipped with adhesive description labels in english, identified piping	
18	N/A	Drycooler	Drycooler base secured properly and installed on rubber pads + lifting points removed	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

Melink Corporation

Energy solutions for a brighter tomorrow

MECHANICAL - REFRIGERATION

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

List any other misc. or BMS instructions here.

Ref.#	Interface	Equipment	Measurement	Input
19	N/A	Drycooler	Installation floor mounted version: Installation site left clean, drycooler runs quietly. There are no unusual noises(for example rattles, squeaks)	
20	N/A	Drycooler	Air bleeders installed on drycoolers (2 on each)	
21	N/A	Drycooler	Outdoor single phase service connector installed on roof	
Equipment/System				
22	N/A	N/A	Installation sites orderly and clean, appliances cleaned	
23	N/A	N/A	Shut off valves are installed at the start of each glycol line. (bakery wall, back wall, freezer wall, cold rooms)	
24	N/A	N/A	System pressure test & leak check has been completed.	
25	N/A	N/A	XWEB is connected and reachable via the Lidl network in Connect+. No alarms are present in XWEB.	

Note to checker/tester:

Record any notes associated to an item marked "Fail" on the deficiency log tab. Record any recommendations in the notes/recommendations tab. Document the associated reference number and unit tag ID for each deficiency noted.

SIGNATURE - FUNCTIONAL CHECKLIST

PROJECT: Lidl Sample BMS Report

DATE: 4/21/2021

LOCATION: City, State

CHECKER/TESTER SIGNATURE:

Lidl Facilities Manager

Date

Signature

General Contractor

Date

Signature

Mechanical Contractor

Date

Signature

Electrical Contractor

Date

Signature

Plumbing Contractor

Date

Signature

Controls Contractor

Date

Signature

Melink Technician

Date

Signature

****All Deficiency Items have been Corrected**

Lidl Construction Manager

Date

Signature

FM HANDOVER I

Pre Acceptance HANDOVER CHECK LIST							
Store Name & Number:			Date of Visit:				
Participants:			Facilities Manager:				
Recipients (Regional Sr. FM, FM HQ, Regional Sr. CM, CM HQ, Regional HSM)			Construction Manager:				
#	Category	Pre Acceptance Checklist CON ==> FM	Complete (✓)	Incomplete (✓)	N/A (✓)	Comments	Expected date of completion
001 - Landscape							
1.01	Landscaping	All trash and rocks removed					
002 - Parking lot and Site externals							
2.01	Main parking lot	Parking lot is clean, clear, swept and ready for customer use.					
2.02	Parking lot lighting	Light heads – bulbs are working. (off during the day)					
2.03	Monument sign	Monument sign installed (lights working)					
2.04	Parking lot sidewalks	All external areas clean and litter free, contractor waste is removed.					
003 - Building externals (Customer facing)							
3.01	Store entrance area (external)	Knoxbox has been securly installed. Building key has been placed within knoxbox by the local fire department.					
3.02	Customer sidewalks	All external areas clean and litter free, contractor waste is removed.					
3.03	Curtain wall (exterior)	Lidl store logos are illuminate with BMS controls.					
3.04	Curtain wall (exterior)	Each glass panel is checked as clean, unmarked, free from cracks or staining.					
3.05	Gutters	Gutters are functioning. No damage to any edges.					
3.06	Doors	Main entrance: Dual opening automatic sliding doors working					
3.07	Doors	Doors allowing free access by motion sensor.					
3.08	Doors	Door locking hardware: Wall mounted card reader (furnished by security company), fail secure allowing entry by leaver (internally), master key override					
3.09	Doors	Exterior wall mounted light positioned above door.					
004 - Dumpster enclosure							
4.01	General	Bollards are free of damage					
005 - Loading docks (External)							
5.01	Dock leveler	Dock Leveler functioning correctly.					
5.02	Dock leveler	Buffer posts installed (included in dock leveler).					
5.03	Doors	Two (2) wall mounted exterior LED over loading dock and driver door. Lights on motion sensor.					
5.04	Other	Three (3) exterior wall mounted LED lights along sidewalk to driver door. Equally spaced. Installed at height. Lights on motion sensor.					
006 - Loading dock rooftop							
6.01	Access	Roof access ladder with fall protection cage, hinged security panel guard, locking clasp and padlock provided.					
007 - Main roof							
7.01	General	Visual inspection of single slope barrel pitch roof completed with membrane cover over main building. FMs & DMs should not climb up on the roof.					
7.02	General	No visible contractor waste or unused materials are left on the roof.					
008 - Building exterior (back of store)							
8.01	General	All external areas clean and litter free, contractor waste is removed.					
009 - Vestibule							
9.01	Floor	Polished concrete floor					
9.02	Floor	Floor is clean and ready for customer use. No unwanted marks, holes, paint splashes etc. are present.					
9.03	Floor	Perimeter caulking is neat and clean with no visible signs of gaps.					
9.04	Walls and doors	Accent wall painted.					
9.05	Walls and doors	Remaining walls painted					
9.06	Walls and doors	Rubber finishing border at wall base.					
9.07	Ceiling and Lighting	Circular LED pendulum lights installed.					
010 - Sales area							
10.01	Floor	Polished concrete floor without large cracks.					
10.02	Floor	Ram protection installed. Positioned to protect from pallet truck impact.					
10.03	Curtain wall (interior)	Windows and mullions clean and free from damage.					
10.04	Curtain wall (interior)	Sunshades and control switch are installed evenly without any visibility to cords.					
10.05	Cash Registers	Power supplies are provided for all checkouts.					
10.06	Lights	Lights are evenly placed above the cash registers.					
10.07	Walls and doors	Walls neatly painted throughout					
10.08	Walls and doors	Rubber finishing border at wall base throughout.					
10.09	Walls and doors	No steps, ledges, unevenness or defects in drywall finishes.					
10.10	Walls and doors	Accent wall painted.					
10.11	Walls and doors	Door frames are undamaged					
10.12	Walls and doors	Door locking hardware: Emergency push bar operation, (Position switch provided by security company).					
10.13	Ceiling and Lighting	All bulbs are illuminated (none are not working).					
10.14	Ceiling and Lighting	Track is straight and aligned in center of sales aisles.					
10.15	Power	Refrigeration island power poles installed with data, power and receptacles complete					
10.16	Walls and doors	Drywall has been added to cover the open gap between refrigeration in the back corner of the Sales Floor					
10.17	General	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.					
011 - Bakery							
11.01	Floor	Concrete floor in the baking preparation room. Clear slip resistant coating applied.					
11.02	Floor	Open site drains provided for bakery ovens, light commercial frame and cover provided.					
11.03	Floor	Ram protection for freezer					
11.04	Walls	Walls painted					
11.05	Walls	Rubber finishing wall base and stainless steel wall base installed.					
11.06	Equipment	Fire suppression system installed.					
11.07	Equipment	3 compartment sink installed.					
11.08	Equipment	Wall mounted hand sink with faucet.					
11.09	Equipment	Power and data supplies provided for 3 ovens.					
11.10	Equipment	Power for bug zapper (x2 locations - 3rd oven bay & near 3 compartment sink)					

11.11	General	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.					
012 - Restroom hallway							
12.01	Floor	Polished concrete floor.					
12.02	Floor	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.					
12.03	Floor	Clean, clear and ready for customer use.					
12.04	Walls and doors	Walls painted					
12.05	Walls and doors	Rubber finishing border at wall base.					
12.06	Walls and doors	Dual water fountain with surface mounting plate					
12.07	Ceiling and Lighting	Ceiling tiles are undamaged and clean no fingermarks on ceiling grid or tiles.					
12.08	Ceiling and Lighting	Recessed LED downlights.					
12.09	Ceiling and Lighting	Occupancy sensor installed.					
013 - Janitor's Closet							
13.01	Floor	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.					
13.02	Walls and doors	Walls painted					
13.03	Walls and doors	Rubber finishing border at wall base.					
13.04	Walls and doors	FRP is installed neatly around mop sink.					
13.05	Walls and doors	Janitor's closet door hardware is installed and properly functioning.					
13.06	Ceiling and Lighting	Recessed LED downlights neatly cut into the center of ceiling tile					
13.07	Fixtures and fittings	Shelving is securely fastened to wall. It has been evenly installed at the correct height.					
13.08	Fixtures and fittings	Mop sink is working correctly.					
13.09	Fixtures and fittings	Hot water supplied					
13.10	Walls and doors	Card reader for door access has been installed.					
014 - Unisex restroom							
14.01	Floor	Floor tiles clean, clear and ready for customer use. All surfaces clean.					
14.02	Floor	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.					
14.03	Walls and doors	Wall tiles, even, level, unmarked.					
14.04	Walls and doors	Door (internal) pull plate and mop plate, surface closer.					
14.05	Walls and doors	Door stop installed.					
14.06	Walls and doors	All surfaces are clean and area is ready for customer use.					
14.07	Walls and doors	Door 105 (women's restroom to hallway) opens and closes with ease. Hardware operates and the door stopper is installed.					
14.08	Ceiling and Lighting	Acoustic ceiling tile installed.					
14.09	Ceiling and Lighting	Ceiling tiles are undamaged and clean, no fingermarks on ceiling grid or tiles.					
14.10	Ceiling and Lighting	Recessed LED can downlights. Neatly cut into the center of ceiling tile.					
14.11	Fixtures and fittings	Wall mounted lavatory.					
14.12	Fixtures and fittings	Lavatory installed. Lavatory touchless flush valve working correctly.					
14.13	Fixtures and fittings	Side Wall, Rear Wall and Vertical Grab Bars firmly installed.					
14.14	Fixtures and fittings	Two (2) surface mounted multi roll toilet tissue dispenser.					
14.15	Fixtures and fittings	Wall mounted, pull down Baby Changing Station.					
14.17	Fixtures and fittings	One surface mounted sanitary trash bin in each stall.					
14.18	Fixtures and fittings	Sink unit securely fastened. Faucet: touchless AC powered, working correctly with hot water supply.					
14.19	Fixtures and fittings	Mirrors above wash hand basin installed.					
14.20	Fixtures and fittings	Hand dryer installed and working correctly.					
14.21	Fixtures and fittings	Test each toilet flush.					
015 - Cash office							
15.01	Floor	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.					
15.02	Walls and doors	Walls painted throughout.					
15.03	Walls and doors	Rubber finishing border at wall base.					
15.04	Walls and doors	Receptacles are installed for counter top and safe.					
15.05	Walls and doors	Door 106 (cash office to breakroom hallway) opens and closes with ease. Door is installed with door viewer (peep hole) for security. Hardware operates.					
15.06	Walls and doors	Card reader for door access has been installed.					
15.07	Ceiling and Lighting	Two (2) surface mounted lights functioning properly.					
15.08	Mechanical	Mechanical unit (Air Conditioning) is securely installed on the ceiling.					
016 - Managers office							
16.01	Floor	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.					
16.02	Walls and doors	Door 108 (manager's office to breakroom hallway) opens and closes with ease. Hardware operates.					
16.03	Walls and doors	Card reader has been installed.					
16.04	Walls, door and window	Walls painted.					
16.05	Walls, door and window	Rubber finishing border at wall base.					
16.06	Ceiling and Lighting	Recessed lights installed and functioning properly on motion sensor.					
017 - Employee break room							
17.01	Walls and doors	Walls painted throughout					
17.02	Walls and doors	Rubber finishing border at wall base.					
17.03	Walls and doors	Glass/plastic splash back at kitchen sink.					
17.04	Walls and doors	Haltotron I fire extinguisher on hanger and mounting block outside IT room door.					
17.05	Windows	Windows are fixed non-opening and finished.					
17.06	Windows	Clean, frame has no paint markings.					
17.07	Kitchen	Kitchen countertop is installed.					
17.08	Kitchen	Sink is fitted recessed finish with countertop.					
17.09	Kitchen	Pull down mixer faucet installed.					
17.10	Kitchen	Water temperature is sufficient.					
17.11	Kitchen	Filtered water dispenser is installed.					
17.12	Kitchen	High Gloss white kitchen cabinets units installed, doors and drawers functioning correctly.					
17.13	Kitchen	Combined refrigerator and freezer.					
17.14	Kitchen	Microwave installed					

17.15	Kitchen	Dishwasher installed.						
17.16	Kitchen	Garbage disposal functional.						
17.17	Kitchen	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.						
17.18	Training Area	Millwork has been installed without any damage.						
018 - IT room								
18.01	Floor	Concrete floor painted.						
18.02	Floor	Door stops installed.						
18.03	Floor	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.						
18.04	Walls and doors	Fire extinguisher on hanger and mounting block inside door.						
18.05	Walls and doors	Air Condition: Two mechanical units are provided with drip pan.						
18.06	Walls and doors	Door 107 opens and closes with ease. Door is installed with door viewer for security. Hardware operates.						
18.07	Walls and doors	Card reader for door access has been installed.						
18.08	Ceiling and Lighting	Lights operating						
019 - Cold Rooms								
19.01	General	Freezers installed anti-slip floors.						
19.02	General	Ram protection installed. Caulk has been provided on the top and bottom edges of the protection.						
19.03	General	Fire suppression and lights are sealed tight with no air gaps.						
19.04	General	Cold room finished floor with no gaps or cracks.						
19.05	General	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.						
020 - Scrubber station (cleaning corner)								
20.01	General	Drain gully with odor trap, clear, cleaned and running.						
20.02	General	Surface is clean and ready for use.						
20.03	General	Grating to concrete transition is flush.						
20.04	General	Mixing hose station for cleaning machine hot and cold connections.						
20.05	General	Three (3) waterproof electrical sockets are provided.						
20.06	General	Sink installed.						
20.07	General	Hot water supplied						
20.08	General	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.						
021 - Back of house (warehouse)								
21.01	Walls and doors	Walls painted throughout						
21.02	Walls and doors	Wall bumper is neat and securely fastened.						
21.03	Walls and doors	Caulking is provided at floor line.						
21.04	Security screen	Wire mesh security screen installed.						
21.05	Security screen	Ram protection is provided and securely fastened to floor.						
21.06	Security screen	All condensate pipes entering into open site drains are protected.						
21.07	Security screen	Handle turn lock mechanism provided.						
21.08	Floor	Concrete floor.						
21.09	Walls and doors	Walls painted throughout where needed						
21.10	Walls and doors	Wall bumper is neat and securely fastened.						
21.11	Walls and doors	Caulking is provided at bumper located at floor line.						
21.12	Walls and doors	Ram protection bollards installed for Sales Floor and Cold Room doors.						
21.13	Security screen	Wire mesh security screen installed						
21.14	Security screen	Ram protection is provided and securely fastened to floor.						
21.15	General	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.						
022 - Electrical room								
22.01	Floor	Concrete floor.						
22.02	Floor	Floor is clean, free of litter and contractor waste. Room tidy and clean, warning labels are applied.						
22.03	Floor	Mechanical equipment is installed.						
22.04	Walls and doors	Door 116 (electrical room to warehouse) opens and closes with ease. Hardware operates.						
22.05	Ceiling and Lighting	Lights installed and functioning.						
22.06	Other	Circuits are clearly labeled.						
22.07	Other	Fire alarm panel installed without damage and operational.						
023 - Sprinkler room								
23.01	General	Area is clean and tidy, no contractor waste is present.						
23.02	Walls and doors	Door opens and closes with ease. Hardware operates. (P2 stores have two doors)						
024 - Loading dock (internal)								
24.01	General	Concrete floor.						
24.02	General	Walls painted throughout where needed						
24.03	General	Wall bumper is neat and securely fastened.						
24.04	General	Caulking is provided at bumper located at floor line.						
24.05	General	Sectional delivery door installed.						
24.06	General	The door holds in open position and has a snap lock system.						
24.07	General	Locking and unlocking from the inside only.						
24.08	General	Impact protection bollards installed to protect overhead door rails.						
24.09	General	Dock leveler level with finished floor.						
24.10	General	Door opens and closes properly.						
24.11	General	Contractor waste removed. No unwanted marks, holes, paint splashes etc. are present.						
025 - Testing and Training								
25.01	Testing	Motion sensors; loading dock, warehouse, restrooms, employee area.						
25.02	Testing	Monument sign & building logo signs.						
25.03	Training	Sunshades are functioning and FM has been trained on full operation.						
25.04	Training	Emerson training on light operations; must be fully tested at time of handover with Commissioning Agent						
25.05	Training	Emerson training on mechanical & BMS operations; must be fully tested at time of handover with Commissioning Agent						
25.06	Training	Telaid training on security system.						
026 - Handover Documentation								
26.01	Handover Day	Completed 'GC Closeout Document' uploaded to ProjectMates: Documents -> Construction -> Handover; FM & DM have reviewed all areas of the document to confirm completion.						
26.02	Handover Day	GC has obtained Certificate of Occupancy, ADA sign off, Fire inspection copies are filed for our records.						
26.03	Handover Day	2 Phase checklists are all scanned and saved in ProjectMates: Documents -> Construction -> Handover						
26.04	Handover Day	Electronic copy of 'Closeout Documents' uploaded to ProjectMates.						
26.05	Handover Day	1 Hard copy of the 'Closeout Documents' provided.						
26.06	Handover Day	Manual Keys (quantity also must be confirmed & noted on this sheet).						
NEXT STEPS PREPARATION								
1	Date for Final Acceptance of all incomplete items from the Pre Acceptance check list							
2	List all items that will not be completed by the Final Acceptance rewalk with expected dates							
3	Expected date of Health Inspection							

4	Expected date of liquor inspection					
5	Expected date of power wash, window wash, and outside hand and machine sweeping (week of store opening)					
6	Notate all site/county specific requirements (CON/GC to FM)					
7	Handover Documents availability and notification in Projectmates (4 weeks after GO)					
8	Extra materials from the GC: are these items needed? The construction and facilities manager is to determine if these items are needed. If yes, coordination of shipment to RDC within 1 week organized by FM.				List materials and quantities: 1. 2. 3. 4.	
CM and						
Store 'conditionally' accepted by Facilities Management		Accept	Not Acceptable	Comments required if 'not acceptable' / anticipated readiness date:		
Facilities Manager Signature & Printed Name:		Date:				
Development Manager Signature & Printed Name:		Date:				
Final Acceptance & closeout book for handover of store:		Accept	Not Acceptable	Comments required if 'not acceptable' / anticipated readiness date:		
Facilities Manager Signature & Printed Name:		Date:				
Development Manager Signature & Printed Name:		Date:				

FM HANDOVER 2

Final Acceptance HANDOVER CHECK LIST							
Store Name & Number:				Date of Visit:			
Participants:				Facilities Manager:			
Recipients (Regional Sr. FM, FM HQ, Regional Sr. CM, CM HQ, Regional HSM)				Construction Manager:			
#	Category	Final Acceptance Checklist CON ==> FM	Complete (✓)	Incomplete (✓)	N/A (✓)	Comments	Expected date of completion
1	General	Open items from Pre Acceptance					
2	Systems	Commissioning (BMS testing, lighting test, function performance test, GLT, Electrical Coordination Document, Fire Panel Test, Xweb)					
3	Systems	Alarm/ Access control monitoring (arm/disarm building)					
4	Systems	CCTV (all cameras working)					
5	General	As Build uploaded to Project Mates, with FM notification					
6	General	Store Keys (amount)					
7	General	All doors/locks/fobs are operational					
8	General	Landscaping completed per local climate					
9	General	Site Specific Requirements (storm water, evac., mechanical specification)					
10	General	County Specific Requirements					
11	General	Generator Test					
12	General	Warrenty Infomation of the store					
13	General	Landloard vs FM Responsibilities (Snow removal, landscape, utilities, trades)					
Store accepted by Facilities Management			Accept	Not Acceptable	Comments required if 'not acceptable' / anticipated readiness date:		
Facilities Manager Signature & Printed Name:			Date:				
Development Manager Signature & Printed Name:			Date:				

FINAL COMPLETION CLOSEOUT DOCUMENT



FINAL ACCEPTANCE PROTOCOL

Store Number, Location

Contact Information

Region

AAA

Development Manager

First Last (###-###-####)

Facility Manager

First Last (###-###-####)

General Contractor

Name Corporation

Project Manager

First Last (###-###-####)

Designers of Record

General Planner

Name Corporation

Architect

First Last (###-###-####)

Mechanical Engineer

First Last (###-###-####)

Electrical Engineer

First Last (###-###-####)

Civil Engineer

Name Corporation

Civil Engineer

First Last (###-###-####)

AHJ

Local Building Inspector

First Last (###-###-####)

Fire Marshall

First Last (###-###-####)

Final Acceptance Protocol

Lidl Store

Address

1 Dates

Substantial completion date according to the GU contract:

Actual Substantial completion:

Final completion date according to the GU contract (with CfO):

Actual Final Completion:

Exceedance of Completion date:

Reasons for Exceedance:

[Date]
[Date]
[Date]
[Date]
[Days]
[Reasons]

2 Required certificates and inspections

Certificate of Occupancy:

Plumbing Final:

Electrical Final:

Refrigeration Final:

Mechanical Final:

Fire/Life Safety Final:

Zoning Final / ADA Sign-off:

Site/ Grading Final

Building Final:

*Add topic

Yes	No	Notes

Final Acceptance Protocol
Lidl Store ####
Address

3 Documents

As-builds completed:
 3rd Part Testing Reports without defects:
 Punch List completed and defects fixed:
 Checklists completed:
 All Submittals approved:
 Manufacturer's Manuals and Warranties handed over:
 Utilities under Owner's name (power, gas, water, etc.):
 Letters of Credit received:
 Final Lien Waiver:
 GC's warranty received:
 Keys handed over:

Yes	No	Notes

Necessary trainings for FM/Sales performed:

*Add topic

Yes	No	Notes

4 Financials

Item	Value
GC Contract	
Change Order # (if applicable)	
Liquidated Damages (if applicable)	
Quality defects credit (if applicable, not fixable)	
*Add topic	
Final Contract	

Notes:

.....

.....

.....

.....

Final Acceptance Protocol
Lidl Store ####
Address

5 Acceptance

Lidl US is **accepting** store without any outstanding visual defects:

Lidl US is **accepting** store with the outstanding visual defects:

*Add topic:

*Add topic:

Deadline	Retainage Value

Lidl US is **not accepting** store:

6 Warranty

General Contractor's warranty begins on:

[Date]

General Contractor's warranty ends on:

[Date]

Value of warranty:

[Value]

7 Final Clauses

- Lidl US reserves rights without any limitation to report defects after acceptance.
- Liquidated damages are being deducted from the contract value according to this acceptance protocol.
- It should be noted that the acceptance does not replace an official nor a statutory acceptance nor does it represent a quality inspection of technical equipment.
- Contractor agrees and acknowledges that despite this acceptance, protocol is not releasing him of any responsibility per contract documents.
- Lidl US is entitled to start its operations before the completion of outstanding topics.
- The Contractor is liable for the building until the completion of the outstanding topics.

Attachment 1 – Punchlist items

[Signature page follows]

Final Acceptance Protocol
Lidl Store ####
Address

.....
Location, date

.....
Location, date

.....
Lidl US

.....
Contractor

.....
Lidl US

.....
Contractor