

- ☐ Analytical
☒ Medical
☐ Testing Machine/Big Range
☐ Balance

TECHNICAL SERVICE REPORT

CUSTOMER NAME: UNIVERSITY OF CEBU MEDICAL CENTER ADDRESS: MADNAUE CITY, CEBU
SERVICE REQUESTED BY: BIOMED DEPARTMENT: RADIOLOGY
EQUIPMENT/MODEL: RADSPED FIT W/ CXDI SERIAL NO.: MP41EBA6A004

SERVICE CATEGORY

☐ WARRANTY ☒ CHECKUP/REPAIR ☐ PREVENTIVE MAINTENANCE ☐ INSTALLATION ☒ OTHERS DISMANTLING

COMPLAINT: COLUMN PROBLEM**ACTIONS TAKEN**

-BIOMED REPORTED PROBLEM AT COLUMN. THE METAL IN WHICH THE CARRIAGE ASSY PASSES THROUGH IS BENT
-VISITED SITE
-DISMANTLED X-RAY TUBE
-DISMANTLED COLLIMATOR
-DISMANTLED COLUMN
-DISMANTLED WIRING
-COORDINATED WITH ENGINEERING AND MAINTENANCE FOR COLUMN READJUSTMENT FOR THE MEANTIME TO TEMPORARILY USE MACHINE WHILE WAITING FOR PARTS
-CHECKED ALSO X-RAY TUBE; GASSY (WAITING FOR PARTS)
-ENDORSED TO DISMANTLED PARTS TO BIOMED

NOTE; RECOMMEND TO HAVE COLUMN REPAIRED IN MACHINE SHOP/ENGINEERING AND MAINTENANCE. AVOID USING COLUMN IF DEFECTIVE OR DAMAGED

REMARKS/RECOMMENDATIONS

UNIT IS NOT WORKING. COLUMN DISMANTLED, WILL COME BACK WHEN BENT PART IS FIXED FOR REINSTALLATION.

SUBMITTED ORIGINAL DOCUMENTS

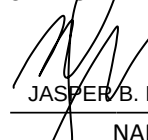
☐ STICKER ☐ CALIBRATION CERTIFICATE ☐ PM CERTIFICATE ☐ COMPLETION REPORT
☐ SYSTEM CHECK ☐ IQ DOCUMENTS ☐ OQ DOCUMENTS ☐ PM DOCUMENTS
☒ SERVICE REPORT ☐ CALIBRATION DATA (MEDICAL) ☐ INVOICE/BILLING ☐ DELIVERY RECEIPT

PARTS SUPPLIED/RECOMMENDED

ITEM NO.	PART NUMBER	DESCRIPTION	QTY	DELIVERY RECEIPT

DATE OF SERVICE	TIME STARTED	TIME FINISHED	BILLING STATEMENT
APRIL 30, 2026	9:30 AM	5:00 PM	SALES INVOICE
			PURCHASE ORDER

SERVED BY:


JASPER B. REDOBLE/MECO GENABE
NAME & SIGNATURE

ACKNOWLEDGED BY:


KENNETH S. LUCERO
NAME & SIGNATURE

CONTACT NO:**EMAIL ADD:**

WHITE: Customer Accounting

PINK: SPC Service Dept

GREEN: Customer End User

YELLOW: SPC Accounting