

- ☐ Analytical
☒ Medical
☐ Testing Machine/Big Range
☐ Balance

TECHNICAL SERVICE REPORT

CUSTOMER NAME: TANCHULING GENERAL HOSPITAL, INC ADDRESS: LEGAZPI CITY, ALBAY
SERVICE REQUESTED BY: _____ DEPARTMENT: X-RAY ROOM
EQUIPMENT/MODEL: RADSPEED FIT 32KW SERIAL NO.: MP41F0BDC005

SERVICE CATEGORY

☒ WARRANTY ☐ CHECKUP/REPAIR ☒ PREVENTIVE MAINTENANCE ☐ INSTALLATION ☐ OTHERS _____

COMPLAINT: PREVENTIVE MAINTENANCE OF RADSPEED FIT 32KW

ACTIONS TAKEN

1. CLEANED AND CHECKED MECHANICAL MOVEMENTS OF THE SYSTEM
2. RE-GREASED HIGH VOLTAGE CABLES, X-RAY TUBE AND HIGH VOLTAGE GENERATOR SIDES
3. PERFORMED TUBE CURRENT ADJUSTMENT OF SMALL AND LARGE FOCUS
4. COLLECTED EXPOSURE COUNT; 16604
5. PERFORMED RADIOGRAPHY EXPOSURE AND IMAGE ACQUISITION TESTS; GOOD
6. ATTACHED PMS AND CALIBRATION STICKERS ON THE SYSTEM
7. ENDORSED THE SYSTEM TO END-USER

NOTE: SYSTEM ENCOUNTERED POWER INTERRUPTION MULTIPLE TIMES AS PER END-USER, RECOMMENDED TO HAVE ONLINE UNINTERRUPTIBLE POWER SUPPLY WITH 30KVA POWER CAPACITY

REMARKS/RECOMMENDATIONS

1. DONE PREVENTIVE MAINTENANCE OF RADSPEED FIT 32KW
2. SYSTEM IS WORKING AND READY TO USE; RECOMMENDED TO HAVE ONLINE UPS DUE TO POWER INTERRUPTION

SUBMITTED ORIGINAL DOCUMENTS

☐ STICKER ☐ CALIBRATION CERTIFICATE ☐ PM CERTIFICATE ☐ COMPLETION REPORT
☐ SYSTEM CHECK ☐ IQ DOCUMENTS ☐ OQ DOCUMENTS ☐ PM DOCUMENTS
☒ SERVICE REPORT ☐ CALIBRATION DATA (MEDICAL) ☐ INVOICE/BILLING ☐ DELIVERY RECEIPT

PARTS SUPPLIED/RECOMMENDED

ITEM NO.	PART NUMBER	DESCRIPTION	QTY	DELIVERY RECEIPT

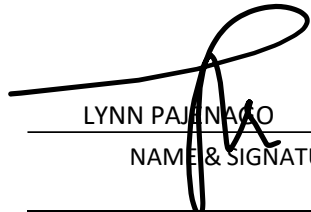
DATE OF SERVICE	TIME STARTED	TIME FINISHED
MAY 11, 2025	10AM	12NN

BILLING STATEMENT _____
SALES INVOICE _____
PURCHASE ORDER _____

SERVICED BY:

ACKNOWLEDGED BY:


ENGR. JOHN MICHAEL MARFIL
NAME & SIGNATURE


LYNN PAJUNAO
NAME & SIGNATURE

CONTACT NO: _____

EMAIL ADD: tanchulingradiology@gmail.com