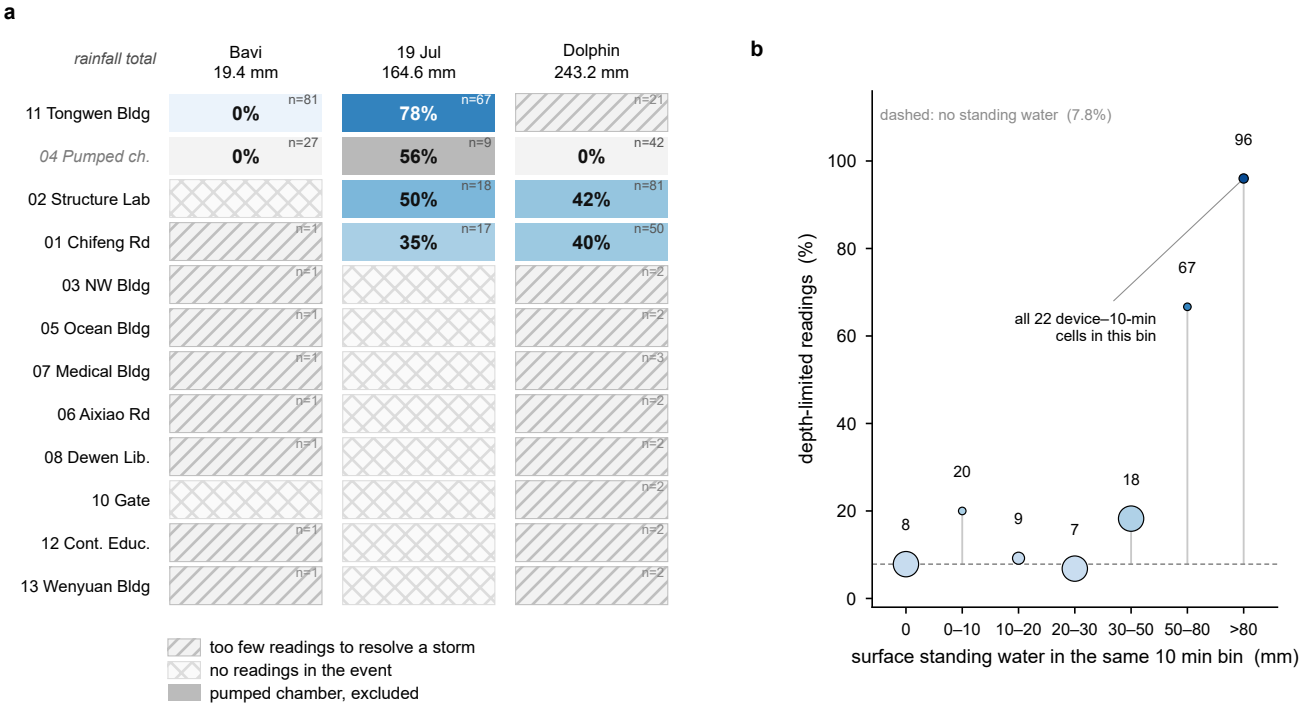

a
rainfall total
Bavi
19.4 mm
19 Jul
164.6 mm
Dolphin
243.2 mm
11 Tongwen Bldg
0%
n=81
78%
n=67
n=21
04 Pumped ch.
0%
n=27
56%
n=9
0%
n=42
02 Structure Lab
n=18
50%
n=81
42%
01 Chifeng Rd
n=1
35%
n=17
40%
n=50
03 NW Bldg
n=1
n=2
05 Ocean Bldg
n=1
n=2
07 Medical Bldg
n=1
n=3
06 Aixiao Rd
n=1
n=2
08 Dewen Lib.
n=1
n=2
10 Gate
n=2
12 Cont. Educ.
n=1
n=2
13 Wenyuan Bldg
n=1
n=2
too few readings to resolve a storm
no readings in the event
pumped chamber, excluded
b
dashed: no standing water (7.8%)
depth-limited readings (%)
100
80
60
40
20
0
96
67
all 22 device–10-min cells in this bin
20
18
8
9
7
0
0–10
10–20
20–30
30–50
50–80
>80
surface standing water in the same 10 min bin (mm)