

Fault Code: 225

Make-Up Valve Solenoid Circuit


 Printable Version

Overview


Codes	Reason	Effect
Fault Code: 225 PID(P): S85 SPN: 1266 FMI: 4 Lamp: Yellow SRT:	The Centinel™ make-up valve solenoid circuit is open or shorted. Less than 18.0 VDC detected at Centinel™ make-up valve solenoid supply pin 2 of the engine harness or resistance of the solenoid has dropped below 80 ohms.	ECM turns off the Centinel™ make-up valve supply voltage and the Centinel™ system is disabled.

©Cummins Inc

Centinel Make-Up
Valve Connector



Engine
Harness

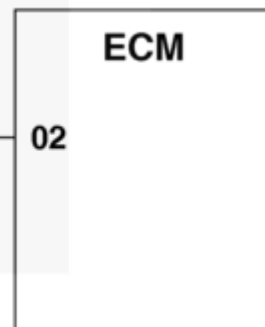

19400728

Make-Up Valve Solenoid Circuit

Circuit Description

The make-up valve solenoid controls the flow of oil within the oil control valve during the make-up cycle.

Component Location

The make-up valve solenoid is located on top of the oil control valve.

Refer to Troubleshooting Fault Code t05-225 (</qs3/pubsys2/xml/en/procedures/19/19-t05-225.html>)

Last Modified: 01-Mar-2011
