


+/- 27.74 Acre Boundary Survey
Sec. 13, T5N, R5W,
I.M., Grady Co. OK.

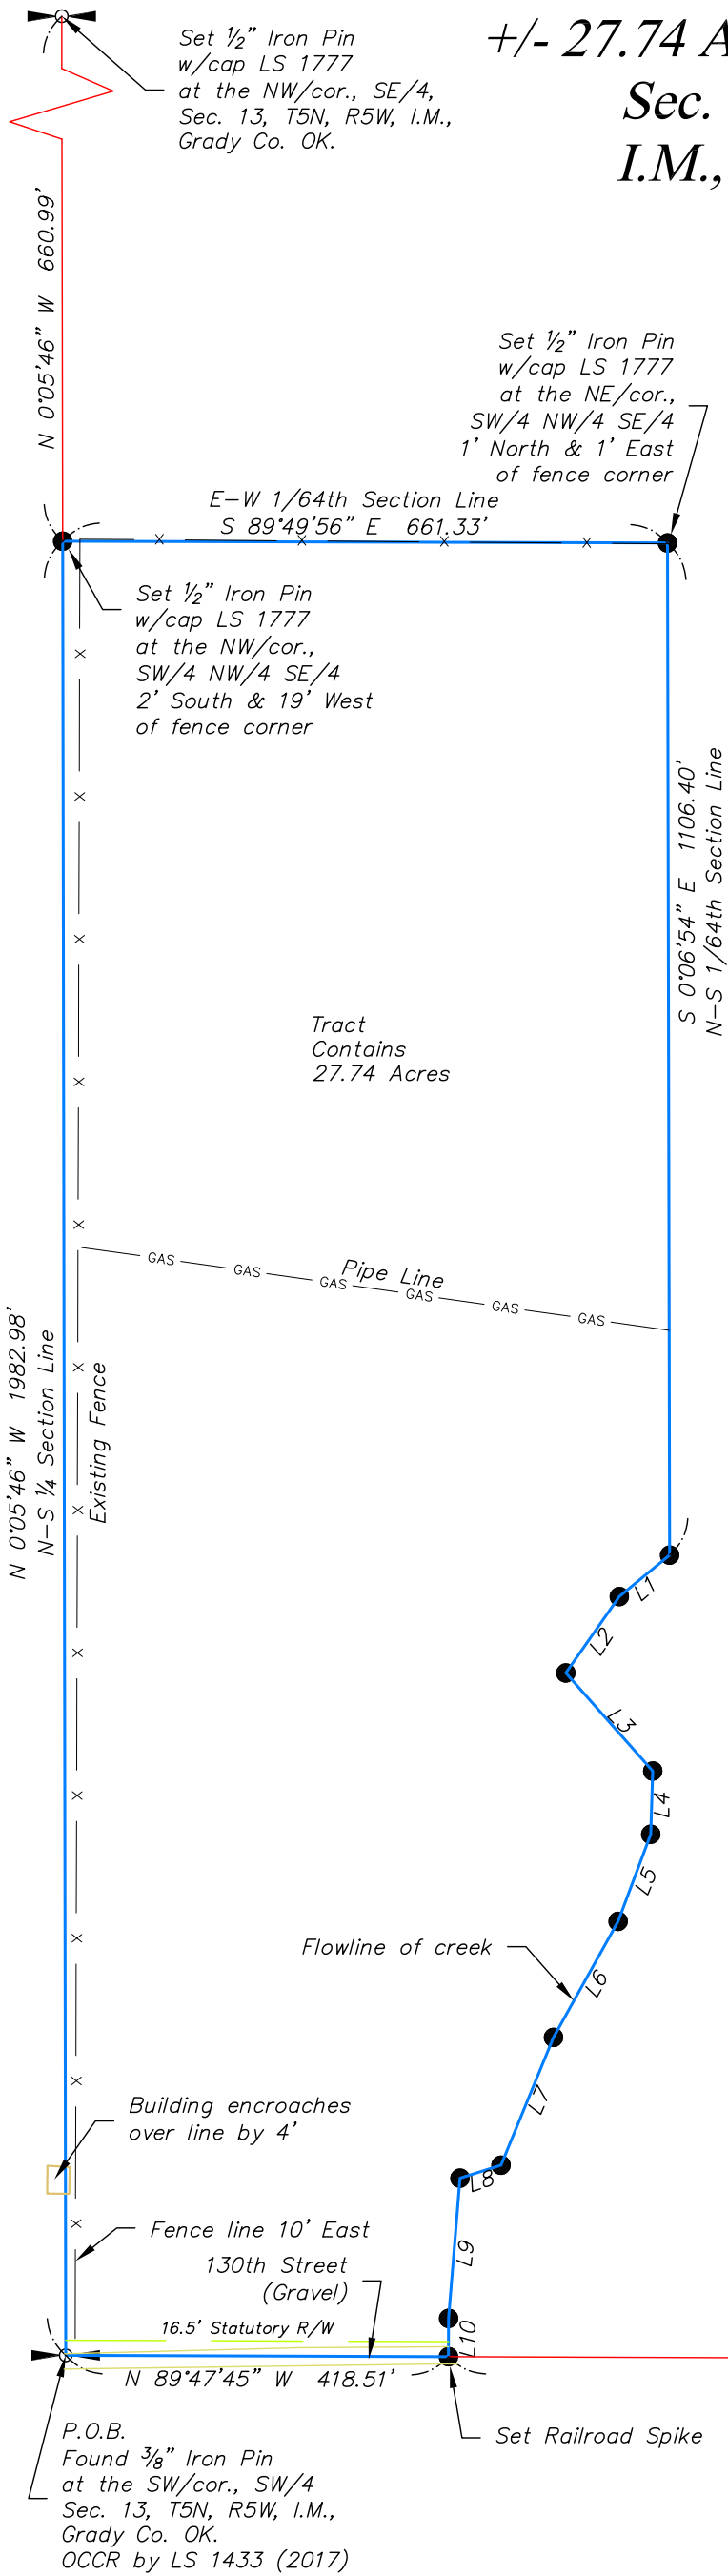

I, Clinton A. Carroll, A Licensed Professional Land Surveyor in the State of Oklahoma, do hereby certify that a careful survey has been made under my supervision of the above property described as follows:

27.74 Acre Tract Description:

A tract of land described as commencing at the Southwest corner of the Southeast Quarter of Section Thirteen (13), Township Five (5) North, Range Five (5) West, of the Indian Meridian in Grady County, Oklahoma;
Thence N 00°05'46" W, along the West line of said SE/4, a distance of 1982.98 feet, said point being the Northwest corner of the SW/4 NW/4 SE/4;
Thence S 89°49'56" E, along the North line of the SW/4 NW/4 SE/4, a distance of 661.33 feet, said point being the Northeast corner of the SW/4 NW/4 SE/4;
Thence S 00°06'54" E, along the East line of the SW/4 NW/4 SE/4, a distance of 1106.40 feet;
Thence S 50°30'58" W a distance of 71.22 feet;
Thence S 35°00'17" W a distance of 101.95 feet;
Thence S 41°34'25" E a distance of 143.32 feet;
Thence S 01°51'42" W a distance of 69.10 feet;
Thence S 20°31'11" W a distance of 101.67 feet;
Thence S 29°07'46" W a distance of 145.20 feet;
Thence S 22°20'34" W a distance of 151.02 feet;
Thence S 72°27'08" W a distance of 47.03 feet;
Thence S 04°38'45" W a distance of 153.75 feet;
Thence S 00°07'48" W a distance of 41.90 feet to a point on the South line of the SE/4;
Thence N 89°47'45" W, along the south line of said SE/4, a distance of 418.51 feet to the point of beginning.
Said tract contains 27.74 acres of land, more or less.



Bearings for this description are grid and based on the Oklahoma State plane Coordinate System of 1983 South Zone, holding N 00°05'46" W along the West line of the Southeast Quarter. This description was prepared on May 5, 2026 by Clinton A. Carroll, PLS 1777. Certificate of Authorization number 2706 expires June, 2026.

I further certify that this survey meets the Oklahoma Minimum Standards for the practice of land surveying and that there are no visible encroachments across the boundary lines other than those shown, and that the described property, as shown, is a true and accurate survey.

- Bearings and Distances are Grid and based on the Oklahoma South Coordinate System. (NAD83)
- All Angular and Distance Values SHOWN AS MEASURED on Survey Drawing unless otherwise noted
- Last Site Visit: April 30, 2026
- Set 1/2" Iron Pin with cap LS 1777 unless noted

L#	Distance	Bearing
L1	71.22'	S 50°30'58" W
L2	101.95'	S 35°00'17" W
L3	143.32'	S 41°34'25" E
L4	69.10'	S 01°51'42" W
L5	101.67'	S 20°31'11" W
L6	145.20'	S 29°07'46" W
L7	151.02'	S 22°20'34" W
L8	47.03'	S 72°27'08" W
L9	153.75'	S 04°38'45" W
L10	41.90'	S 00°07'48" W

Found Bent 80D Nail
at the SE/cor., SE/4
Sec. 13, T5N, R5W, I.M.,
Grady Co., OK.
OCCR by LS 1977 (2009)

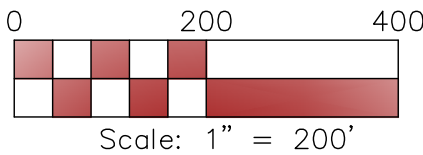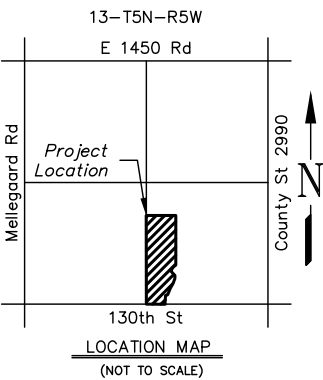

CARROLL SURVEYING & MAPPING

PO BOX 525
208 W. Choctaw St.
Marlow, OK 73055

Telephone: (580) 658-6405
Email: office@carrollsurveying.com
Certificate of Authortization# 2706